


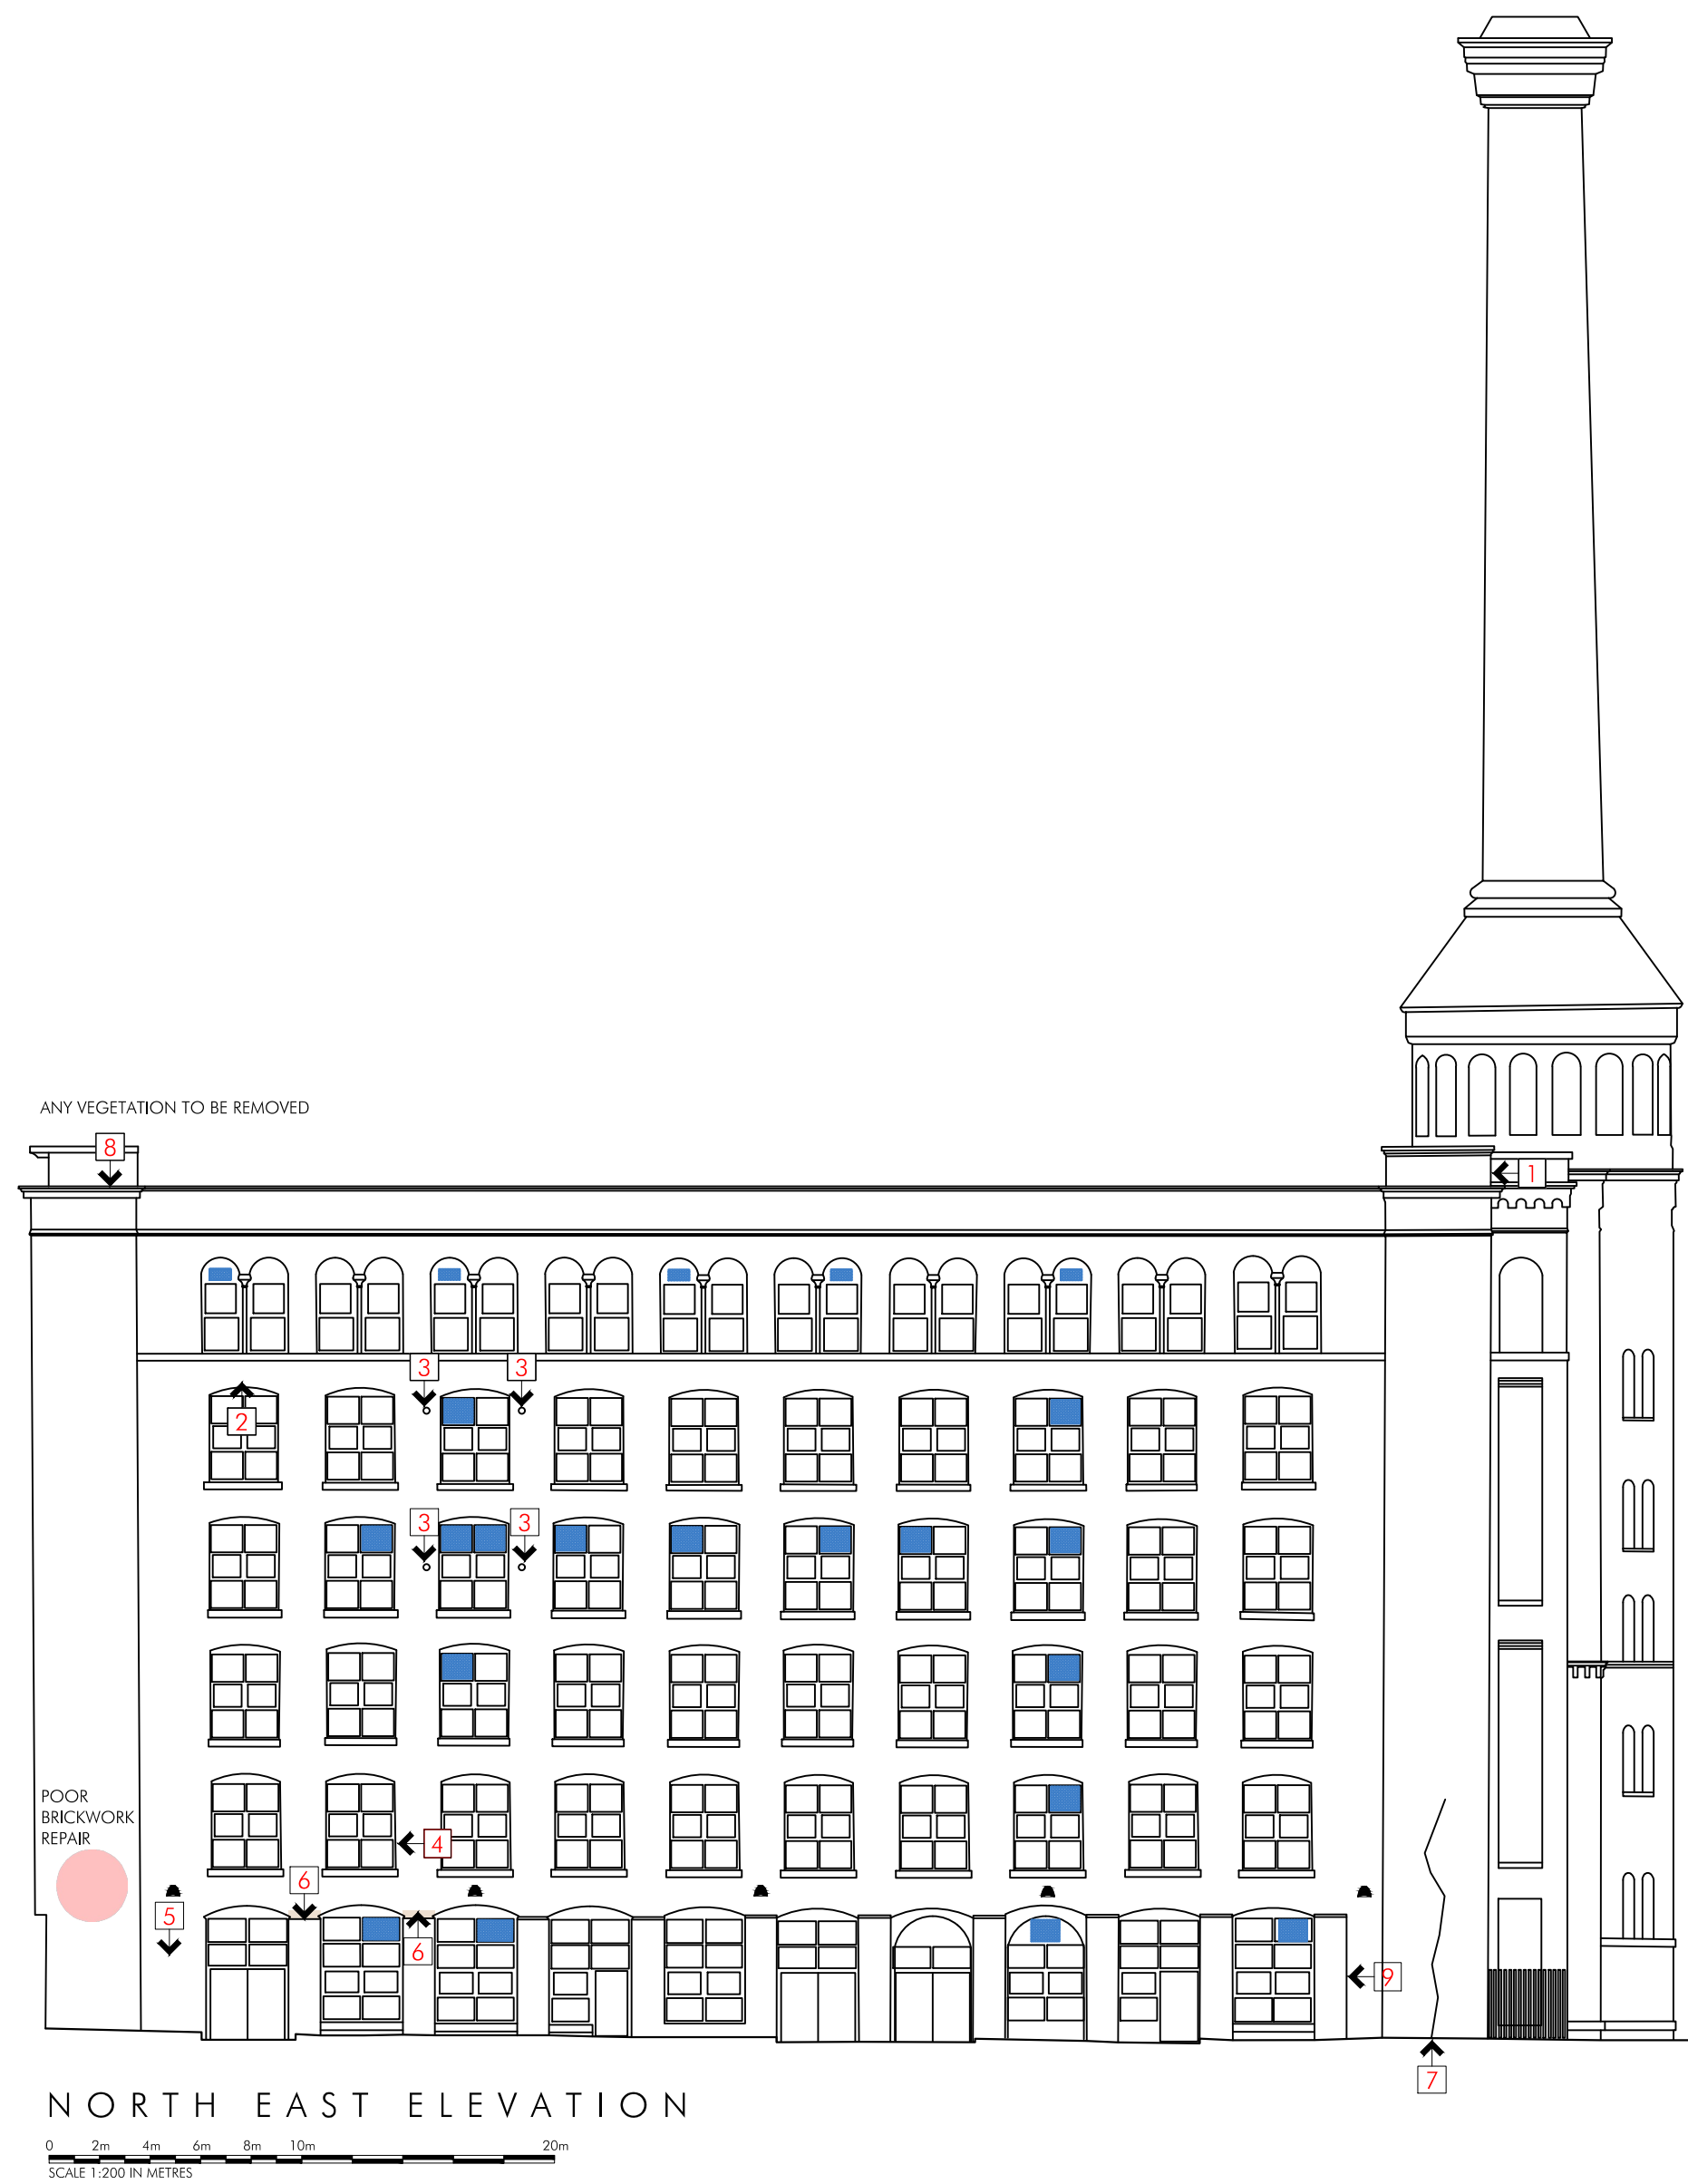


1. Damaged edge to string course. Stone repair required.



2. Damaged pointing above window head and widow cill to window above. Repointing required with mortar to match existing.




3. Existing metal stabilisation plates to be left in place.

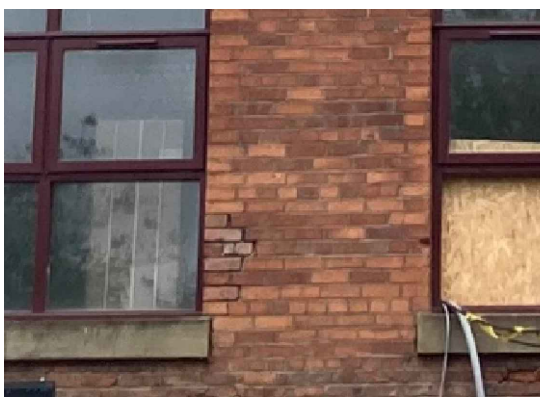


4. Loose brickwork to window reveal. Loose bricks to be rebbed in mortar to match existing.



5. Staining to brickwork. Brickwork to be cleaned with a steam cleaner. Brickwork to be repointed if necessary. Mortar to match existing.

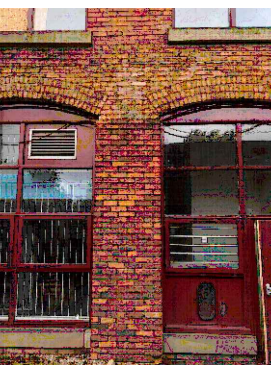

6. Cant bricks to top of brick piers missing. New cant bricks to match the existing cant bricks to the top of adjacent piers, are to be installed.

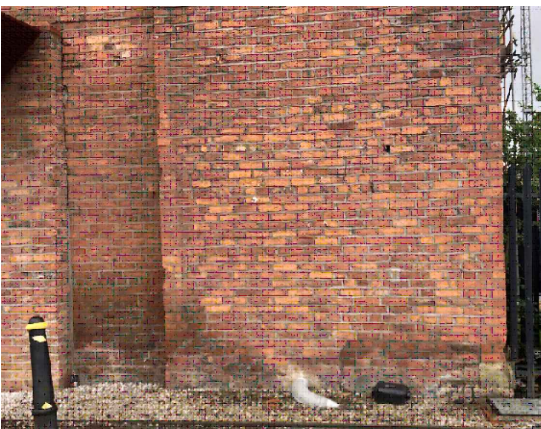

7. Cracking in brickwork. Assess condition of brickwork and mortar. Stabilise if necessary, replace cracked bricks repoint with mortar to match existing.



8. Damaged cornice. Stone repair required.



9. Crack between pier and main wall to be repaired with mortar to match existing.

LEGEND
▲ NEW THORN PIAZZA II LED LIGHT FITTING

NOTE: ONLY PHOTOGRAPH NUMBER 1 IS TAKEN FROM THE ORIGINAL APPROVED PLANNING APPLICATION. ALL OTHER PHOTOS WERE TAKEN DURING CONSTRUCTION ON 21/05/2021.

PLANNING ISSUE	DWG		REV C: UPDATED EXTERNAL LIGHTING POSITIONS	NOV 21	
	DWG		REV B: UPDATED FOLLOWING SITE VISIT WITH PLANNING OFFICER AND CONSERVATION OFFICER FROM MMC	JUNE 21	
	DWG		REV A: NOTE ADDED	MAY 21	
	DWG		DRAWN	APRIL 21	
	DRAWN		REVISION	DATE	
	PROJECT				
	MEDLOCK VICTORIA MILL MILES PLATTING				
	TITLE				
	NORTH EAST ELEVATION RECORD PHOTOGRAPHS AND REPAIRS REQUIRED				
	SCALE				
1:200 @ A1					
JOB No		DRAWING No		REV	
MED02		AP201		C	
 ALLISON PIKE ARCHITECTS & DESIGNERS 7 Buxton Road West, Disley, Stockport, Cheshire, SK12 2AE. Website: www.allisonpike.com Telephone: 01663 763000 Facsimile: 01663 766772 Email: studio@allisonpike.com © Allison Pike Partnership Limited.					