



- NOTES:**
- 1. REPAIR LOCATIONS TO BE INSPECTED BY THE STRUCTURAL ENGINEER FOLLOWING REMOVAL OF DECAYED MATERIAL AND BEFORE REPAIR.
 - 2. NOTIFY THE STRUCTURAL ENGINEER AS SOON AS POSSIBLE IF DECAY IS FOUND TO EXTEND BEYOND 40 - 50MM DEPTH IN LARGER TIMBER MEMBERS (c350mm X 350mm) OR TO MORE THAN 10% OF SECTION SIZE IN SMALLER MEMBERS (VALLEY BEAMS, RAFTERS ETC.)
 - 3. NEW TIMBER FILLETS REQUIRED TO BE OF MATCHING SPECIES AND APPEARANCE TO THE EXISTING TIMBER.
 - 4. FIX NEW TIMBER FILLETS WITH ROTAFIX STRUCTURAL ADHESIVE (OR EQUIVALENT AND APPROVED).

TYPICAL REPAIR FOR SUPERFICIAL TIMBER DECAY

conisbee
Consulting Structural Engineers
Consulting Civil Engineers

1-5 Offord St
London N1 1DH
Tel 020 7700 6666
Fax 020 7700 6686
design@conisbee.co.uk
www.conisbee.co.uk

Project
SCIENCE & INDUSTRY MUSEUM
1830 WAREHOUSE URW
Title
TYPICAL TIMBER SURFACE REPAIRS

C1 02.12.20 CONSTRUCTION ISSUE SW KC			
Rev	Date	Description	Drawn Check
Drawing Status		Project No	
CONSTRUCTION		180426	
Date	Drawn	Drawing No	
JUNE 2019	SW	S-4031	
Scale	Engineer	Revision	
NTS	SW	C1	