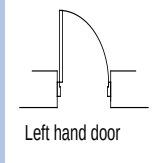
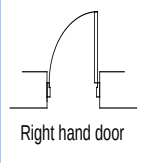


London Road Fire Station - Door Schedule																			ALLIED LONDON	15.03.2018		
Room / Door No.	Description	Door set Size mm (Approx.)	Door size mm (Approx.)	Frame Posts mm	Door Thickness mm	Original (O) or Modern door (M)	Single / Double / Multiple	Minimum single leaf clear opening width mm	Door closer	Pull Handle (P), Knob (K), Latch (L)	Push Plate (P) Kick Plate (K)	Locking mechanism	Latch mechanism	Security devices - bolts, chains	Existing Architrave	Vision panel / Glazing	Door vent	Existing Paint Scheme (s)	Left hand door Right hand door Comments <th>Recommendation Remediation Action 1. Restore Onsite 2. Offsite Specialist Input 3. Replace</th> <th>Allied London Phase 1A Requirements: (1) Remove Door & Remove Frame (2) Remove Door Only (3) Remove Frame Only</th>	Recommendation Remediation Action 1. Restore Onsite 2. Offsite Specialist Input 3. Replace	Allied London Phase 1A Requirements: (1) Remove Door & Remove Frame (2) Remove Door Only (3) Remove Frame Only	
Basement Floor																						
BD001	3 No. panelled square framed door in arch head frame.	980W x 2140H 2200A	860W x 2070H	100 x 75	45	O	S	810	N	K	N	Y	N	N	Y	N	N	Green Brown	Right Hand Door • Localised timber decay to bottom of door and frame posts • Vision panel currently boarded.	D - 2 F - 2		
BD002	2 No. pane fanlight frame only door missing.	980W x 2640H	760W x 2130H	100 x 75	45	O	S	710	N	K	N	Y	N	N	Y	Y	N	Green Green	Left Hand Door • Localised timber decay to bottom of frame posts • Replacement door required to match existing style •1 No. pane requires replacing to fanlight.	D - 3 F - 2	Remove Door Only	
BD003	18 No. pane flag frame with 6 No. pane / 2 No. panelled square framed door.	2460W x 2640H 1680F	760W x 2130H	100 x 75	45	O	S	710	N	K	N	Y	N	N	Y	Y	N	Green Green	Right Hand Door • Localised timber decay to bottom of door and frame posts •4 No. vented panes require replacing to flag frame.	D - 2 F - 2		
BD004	18 No. pane flag frame with 6 No. pane / 2 No. panelled square framed door.	2460W x 2640H 1680F	850W x 2030H	100 x 75	45	Missing	S	710	N	N	N	N	N	N	Y	Y	N	Green Grey	Left Hand Door • Localised timber decay to bottom of door and frame posts •4 No. vented panes require replacing to flag frame.	D - 2 F - 2		
BD005	32 No. pane combination / return frame with 6 No. pane / 2 No. panelled square framed door.	2450W x 2850H	910W x 2130H	75 x 75	40	O	S	865	N	Missing	N	Y	N	N	Y	Y	N	Green Brown	Left Hand Door • Severe timber decay to bottom of door and frame posts • Damage to door and frame posts.	D - 2 F - 2		
BD005A	Framed , ledged and battened door.	730W x 2080H	630W x 2020H	110 x 75	45	O	S	590	N	K	N	Y	N	N	Y	N	N	Brown Brown	Right Hand Door • Severe timber decay to bottom of door and frame posts.	D - 3 F - 3	Remove Door Remove Frame	
BD007	14 No. pane combination frame with 6 No. pane / 2 No. panelled square framed door.	1910W x 2850H	910W x 2130H	75 x 75	45	O	S	865	N	K	N	Y	N	N	Y	Y	N	Green Green	Right Hand Door • Severe timber decay to bottom of door and frame posts • 7 No. panes require replacing to combination frame.	D - 2 F - 2		
BD008	Arch head battened frame incorporating a framed , ledged and battened door.	1510W x 2370H	760W x 1830H	100 x 75	47	O	S	715	N	L	N	N	Y	N	Y	N	N	Green Green	Left Hand Door • Severe timber decay to bottom of door and frame posts.	D - 3 F - 3	Remove Door Remove Frame	
BD009	6 No. pane / 2 No. panelled square framed door in arch head frame.	980W x 2140H 2200A	850W x 2070H	100 x 75	45	O	S	810	N	L	N	Y	N	N	Y	Y	N	Green Green	Right Hand Door • Severe wear to door and frame posts •6 No. panes require replacing • Damage to door and closing post near lock area.	D - 2 F - 2		
BD010	4 No. panelled square framed door in arch head frame.	980W x 2140H 2200A	760W x 2000H	75 x 100	45	O	S	715	N	K	N	Y	N	N	Y	N	N	Green Grey	Left Hand Door • 3 No. hinges require replacing.	D - 1 F - 1		
BD013	Flush solid core door.	880W x 2140H	800W x 2050H	150 x 50	40	M	S	770	N	N	N	Y	N	N	Y	N	N	Brown Brown	Right Hand Door • Door and frame posts found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame	
BD014	Arch head frame only door missing.	1115W x 2140H 2200A	965W x 2060H	100 x 100	50	O	S	?	N	N	N	N	N	N	Y	N	N	White White	Left Hand Door • Replacement door required to match existing style.	D - 3 F - 1	Remove Door Only	
BD014A	1 No. pane / 2 No. panelled square framed door.	610W x 2070H	530W x 2000H	125 x 50	40	M	S	475	N	P	N	N	N	Y	N	N	N	White White	Left Hand Door • Door and frame posts found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame	
BD015	5 No. panelled square framed door.	?	?	?	?	O	S	?	N	Missing	N	Y	N	N	Y	N	N	Black ?	Right Hand Door •1 No. vertical panel requires replacing *note* Door painted with original signage stating 'No admittance'.	D - 2 F - 1		
BD016	6 No. pane / 2 No. panelled square framed door.	910W x 2140H 2200A	810W x 2020H	115 x 50	50	O	S	790	N	Missing	N	Missing	N	N	Y	Y	N	White White	Left Hand Door • Door badly damaged on closing stile and has 4 No. panes broken • Replace door as it is beyond economic repair.	D - 3 F - 1	Remove Door Only	
BD016A	3 No. panelled square framed door.	610W x 2060H	535W x 1970H	125 x 50	40	O	S	490	N	P	N	Y	N	Y	Y	N	N	White White	Left Hand Door • Severe timber decay to bottom of door and frame posts.	D - 3 F - 3	Remove Door Remove Frame	
BD017	Iron strong room door and frame set in original arch opening.	1410W x 2030H	850W x 2040H	75 x 50	20	M	S	810	N	N	N	Y	N	Y	N	N	N	Green Grey	Left Hand Door •note* Door frame has original manufacturers plate - Fredrick Fox Ltd - Central Iron Works - Bradford.	D - 2 F - 1		
BD018	2 No. pane fan light frame with flush solid core door.	890W x 2160H	760W x 1975H	75 x 50	45	M	S	710	N	N	N	N	N	Y	N	N	N	Blue White	Left Hand Door • Door and frame posts found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame	
BD018A	Modern internal door frame only.	820W x 2030H	760W x 2000H	100 x 50	45	M	S	?	N	N	N	N	N	Y	Y	N	N	White White	Left Hand Door • Frame posts found to be of no significance • Replacement door required.	D - 3 F - 3	Remove Door Remove Frame	
BD019	Flush solid core door.	820W x 2030H	760W x 2000H	100 x 50	45	M	S	700	N	P	N	Y	N	N	Y	N	N	White White	Left Hand Door • Door and frame posts found to be of no significance	D - 3 F - 3	Remove Door Remove Frame	
BD020	Flush solid core door.	820W x 2030H	760W x 2000H	100 x 50	45	M	S	700	N	Missing	N	Missing	N	N	Y	N	N	Hard Wood	Left Hand Door • Door and frame posts found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame	
BD021	Flush solid core door.	860W x 2030H	760W x 2000H	100 x 65	45	M	S	700	N	P	N	Y	N	N	Y	N	N	White White	Left Hand Door • Door and frame posts found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame	
BD021A	Flush solid core door.	ACM	ACM	ACM	ACM	O	S	?	N	?	?	?	?	?	?	?	?	?	ACM		?	
BD022	Flush hollow core door.	820W x 2030H	760W x 2000H	100 x 50	40	M	S	700	N	P	N	Y	N	N	Y	N	N	White White	Right Hand Door • Door and frame posts found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame	
BD022A	Flush hollow core door.	820W x 2030H	760W x 2000H	100 x 50	40	M	S	700	N	P	N	Y	N	N	Y	N	N	White White	Right Hand Door • Door and frame posts found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame	
BD023	Framed , ledged and battened door.	1010W x 2080H	885W x 2020H	100 x 75	45	O	S	830	N	N	N	Y	N	N	Y	N	N	Green Green	Left Hand Door • Door and frame posts found to be in good condition.	D - 1 F - 1		
BD023A	10 No. pane hardwood combination frame with 6 No. pane / 2 No. panelled square framed hardwood door.	1640W x 2460H 2600A	835W x 2020H	75 x 50	40	O	S	?	N	Missing	N	Y	N	N	Y	Y	N	Hard Wood	Left Hand Door • 3 No. panes require replacing.	D - 1 F - 1		

BD023B	29 No. pane hardwood combination / angled return frame with 6 No. pane / 2 No. panelled square framed hardwood door.	1890W x 2600H 860W x 2600H 690W x 2600H	760W x 2020H	100 x 100	40	O	S	?	N	Missing	N	Y	N	N	Y	Y	N	Hard Wood	Left Hand Door • Left hand side panel requires replacing • 4 No. panes require replacing.	D - 1 F - 2	
BD024	Framed , ledged and battened door.	900W x 2130H	810W x 2080H	100 x 60	36	O	S	770	N	Missing	N	Y	N	N	Y	N	N	Blue Brown Hard Wood	Right Hand Door • Salvaged utility door used in modern opening.	D - 3 F - 3	Remove Door Remove Frame
BD025	Flush hollow core door.	n/a	760W x 1980H	75 x 50	34	M	S	715	N	P	N	N	Missing	N	Y	N	N	Hard Wood	Left Hand Door • Door and frame posts found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
BD026	6 No. pane / 2 No. panelled square framed door in arch head frame.	1010W x 2140H	855W x 2060H	115 x 90	50	O	S	810	N	Missing	N	Y	N	Y	Y	Y	N	Green Green	Left Hand Door • Damage found the right hand side architrave.	D - 1 F - 1	
BD027	6 No. pane / 2 No. panelled square framed door in arch head frame.	940W x 2140H	800W x 2050H	115 x 90	45	M	S	740	N	K	N	Y	N	N	Y	Y	N	Green Green	Right Hand Door • Modern replacement door set within original frame.	D - 3 F - 1	Remove Door Only
BD028	Framed , ledged, braced and battened double doors.	1880W x 2200H	880W x 2125H	125 x 75	50	O	D	1160	N	N	N	Y	N	Y	N		N	Blue Blue	Double Doors • Utility doors found to be in poor condition with the left hand door closing stile being damaged and having missing section • Localised timber decay to bottom of door and frame posts.	D - 3 F - 3	
BD031	2 No. panelled square framed hardwood door.	970W x 2030H	805W x 1980H	125 x 90	45	O	S	760	N	K	N	Y	N	N	Y	N	N	Hard Wood	Left Hand Door • Severe timber decay to skirting boards next to bottom of door frame on the right hand side • Further investigation required • Tanking and dry rot eradication work required	D - 1 F - 2	
BD032	5 No. panelled square framed hardwood door.	890W x 2130H	810W x 2090H	75 x 50	40	O	S	760	N	K	N	Y	N	N	Y	N	N	Hard Wood	Right Hand Door • Severe timber decay to the skirting boards, plinth blocks, door frame post and architraves on the left hand side • Further investigation required • Dry rot eradication work required • Renewal of frame and rehanging of door required.	D - 1 F - 3	Remove Frame only
BD032A	5 No. panelled square framed hardwood door.	750W x 20750H	665W x 2025H	75 x 50	45	O	S	620	N	P	N	N	N	N	Y	Y	N	Hard Wood	Right Hand Door • Severe timber decay to the skirting boards, plinth blocks, door frame posts and architraves around frame • Further investigation required • Dry rot eradication work required • Renewal of frame and rehanging of door required	D - 1 F - 3	Remove Frame only
BD033	2 No. panelled square framed hardwood door.	970W x 2030H	805W x 1980H	125 x 90	45	O	S	760	N	K	N	Y	N	N	Y	N	N	Hard Wood	Right Hand Door • Door and frame posts found to be in good condition.	D - 1 F - 1	
BD034	5 No. panelled square framed hardwood door.	910W x 2060H	810W x 2010H	125 x 75	40	O	S	760	N	K	N	Y	N	Y	Y	N	N	Hard Wood	Left Hand Door • Severe timber decay to the skirting boards, plinth blocks, door frame posts and architraves around frame • Further investigation required • Dry rot eradication work required • Renewal of frame and rehanging of door required	D - 1 F - 3	Remove Frame only
BD034A	6 No. panelled square framed hardwood door.	980W x 2030H	850W x 1980H	100 x 75	32	O	S	810	N	p	N	Y	N	Y	N	N	N	Hard Wood	Right Hand Door • Severe timber decay to the skirting boards, plinth blocks, door frame posts and architraves around frame • Further investigation required • Dry rot eradication work required • Renewal of frame and rehanging of door required	D - 1 F - 3	Remove Frame only
BD035	5 No. panelled square framed hardwood door.	915W x 2180H	805W x 1980H	75 x 50	40	O	S	760	N	K	N	Y	N	N	Y	N	N	Hard Wood	Left Hand Door • Severe timber decay to the skirting boards, plinth blocks, door frame post and architraves on the right hand side • Further investigation required • Dry rot eradication work required • Renewal of frame and lining required.	D - 1 F - 3	Remove Frame only
BD036	1 No. circular pane / 3 No. panelled square framed hardwood double doors.	1410W x 2180H	650W x 2125H	125 x 50	45	O	D	1190	FM	p	N	N	N	N	Y	Y	N	Hard Wood	Dual Action Doors • Door and frame posts found to be in good condition • Service floor mounted door closers.	D - 2 F - 1	
BD036A	1 No. circular pane / 3 No. panelled square framed hardwood double doors.	1410W x 2180H	650W x 2125H	125 x 50	45	O	D	1190	FM	p	N	N	N	N	Y	Y	N	Hard Wood	Dual Action Doors • Door and frame posts found to be in good condition • Service floor mounted door closers.	D - 2 F - 1	
BD037	4 No. pane fanlight frame with 1 No pane / 2 No. panelled square framed door.	1365W x 2490H 2600A	610W x 2015H	115 x 75	50	O	D	1110	FM	p	N	Y	N	N	Y	Y	N	Hard Wood	Dual Action Doors • Door and frame posts found to be in good condition • Service floor mounted door closers.	D - 2 F - 1	
BD038	5 No. panelled square framed hardwood door.	1040W x 2180H	960W x 2130H	150 x 50	50	O	S	925	N	K	N	Y	N	N	Y	N	N	Hard Wood	Left Hand Door • Door and frame posts found to be in good condition.	D - 1 F - 1	
BD038A	Iron strong room door and frame.	1010W x 2000H	980W x 1945H	75 x 75 Angle Iron	70	O	S	845	N	N	N	Y	N	Y	N	N	N	Brown Brown	Right Hand Door • Strong room door and integral frame found to be in good condition.	D - 2 F - 1	
BD039	Battened fanlight frame with 2 No. pane / 2 No. panelled square framed door.	1900W x 2790H	835W x 1820H	100 x 50	35	O	D	810	N	K	N	Y	N	N	Y	Y	N	Grey Grey	Right Hand Door • Severe timber decay to bottom of doors, frame posts and battened fanlight frame • Full replacement required.	D - 3 F - 3	Remove Door Remove Frame
BD041	Shortened 2 No. panelled square framed door.	925W x 1475H	750W x 1420H	115 x 80	40	O	S	715	N	K	N	Y	N	Y	Y	N	N	Grey Grey	Right Hand Door • Door and frame posts found to be in good condition.	D - 1 F - 1	
BD043	4 No. pane / 2 No. panelled square framed door in arch head frame.	900W x 2260H	730W x 2155H	115 x 75	48	O	S	670	N	P	N	Y	N	N	Y	Y	Y	Hard wood Grey	Left Hand Door • Severe timber decay to bottom of door and frame posts • Full replacement required.	D - 3 F - 3	Remove Door Remove Frame
BD044	3 No. pane / 1 No. panelled square framed door.	675W x 2110H	590W x 2030H	115 x 50	45	O	S	?	N	P	N	Y	N	Y	Y	Y	N	Brown Brown	Right Hand Door • Door and frame posts found to be in good condition • 1 No. pane requires replacing	D - 1 F - 1	
BD045	3 No. pane / 1 No. panelled square framed door.	710W x 2080H	595W x 1985H	115 x 75	45	O	S	540	N	K	N	N	N	N	Y	Y	Y	Brown Brown	Right Hand Door • Door and frame posts found to be in good condition • 1 No. pane requires replacing	D - 1 F - 1	
BD046	Asbestos insulation board clad square framed door in arch head frame.	920W x 1980H 2040A	Asbestos insulation board	115 x 50	55	O	S	770	Y	N	N	N	N	N	Y	N	Y	Brown Brown	Left Hand Door • Door clad both sides in asbestos insulation board, to be removed as part of licenced removal works • Full replacement required.	D - 3 F - 1	Remove Door Only
BD047	Steel / Asbestos cement board boiler house door and frame.	745W x 1350H	580W x 1195H	75 x 75 Angle Iron	30	M	S	530	N	P	N	N	N	N	Y	N	N	Red Oxide	Left Hand Door • Door and frame angles found to be in good condition • Asbestos cement board to be encapsulated and future monitored as part of asbestos management regime.	D - 2 F - 1	
BD048	6 No. pane / 2 No. panelled square framed door in arch head frame.	910W x 2130H 2180A	830W x 2060H	150 x 50	45	O	S	775	N	K	N	Y	N	N	Y	Y	N	Brown White	Right Hand Door • Door and frame posts found to be in good condition.	D - 1 F - 1	
BD049	Iron safe / strong room door and frame.	1180W x 2120H	850W x 1920H	600 x 200	225	O	S	640	N	N	N	Y	N	Y	Y	N	N	Green Brown	Left Hand Door • Door and frame angles found to be in good condition • Door mechanism to be serviced by specialist lock and safe contractor.	D - 2 F - 2	
BD050	Iron safe / strong room inner barred door and frame.	Incorporated into the above	Incorporated into the above	600 x 200	20 dia. bar	O	S	640	N	N	N	Y	N	Y	Y	n/a	n/a	Brown	Left Hand Door • Barred door and frame angles found to be in good condition • Door mechanism to be serviced by specialist lock and safe contractor.	D - 2 F - 2	
BD051	1 No. pane ledged and battened door in arch head frame.	970W x 2040H 2110A	760W x 1905H	75 x 75	35	O	S	700	N	N	N	N	N	N	Y	Y	N	Green Brown	Right Hand Door • Door and frame posts found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
BD052	1 No. pane fan light frame with 4 No. panelled square framed door.	1070W x 2420H	970W x 2050H	80 x 50	35	O	S	920	N	K	N	Y	N	N	Y	N	N	Green Brown	Right Hand Door • Door and frame posts found to be in good condition • Fanlight currently boarded.	D - 1 F - 1	
BD052A	Framed, ledged and hardboarded door.	760W x 1860H	670W x 1805H	62 x 50	25	M	S	640	N	P	N	N	N	N	N	N	N	Brown Brown	Left Hand Door • Door and frame posts found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
BD053	5 No. panelled square framed door in arch head frame.	900W x 2140H 2190A	910W x 1810H	62 x 50	40	O	S	?	N	K	N	Y	N	Y	Y	N	N	Green Green	Left Hand Door • Door currently removed • Severe timber decay to bottom of door and frame posts • Full replacement required.	D - 3 F - 3	Remove Door Remove Frame
BD054	5 No. panelled square framed door fitted in timber studwork.	910W x 1950H	805W x 1895H	75 x 50	40	O	S	760	N	P	N	N	N	N	Y	Y	N	White White	Left Hand Door • Original door currently fitted into stud partition.	D - 3 F - 3	Remove Door Remove Frame

BD055	3 No. pane / 2 No. panelled square framed door.	830W x 2080H	750W x 1940H	100 x 50	42	O	S	730	N	Missing	N	Y	N	N	Y	Y	N	Green Green	Right Hand Door • Door and frame posts found to be damaged around lock area • Split and missing section of architrave	D - 1 F - 1	
BD056	Arch head frame only door missing.	900W x 2210H 2280A	Missing	100 x 75	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Left Hand Door • Door currently missing • Frame posts found to be in fair condition • Replacement door required.	D - 3 F - 1	
BD057	Opening in timber studwork only.	795W x 2010H	Missing	75 x 50	?	M	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Right Hand Door • Door and frame currently missing	D - 3 F - 3	
BD058	Flush hollow core door.	870W x 2040H	750W x 1980H	110 x 75	32	M	S	720	N	K	N	Y	N	N	N	N	N	Blue Blue	Right Hand Door • Door and frame posts found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
BD059	Framed, ledged, braced and battened door.	870W x 2040H	750W x 1980H	100 x 75	47	M	S	680	N	K	N	Y	N	N	N	N	N	Blue Blue	Left Hand Door • Modern utility door and frame posts found to be in good condition.	D - 1 F - 1	
BD060	32 No. pane combination frame with 2No. x 3 No. pane / battened square framed doors.	4020W x 2080H	840W x 2030H	90 x 75	45	O	S	785	N	Missing	N	N	N	N	N	Y	N	Blue Blue Blue	Left Hand Door • 1 No. pane requires replacing.	D - 1 F - 1	
BD060A	26 No. pane combination frame with 3 No pane / battened square framed door.	1980W x 2080H	830W x 2035H	90 x 60	45	O	S	780	Y	Missing	N	N	N	Y	N	Y	N	Blue Blue	Right Hand Door • Door and frame posts found to be in good condition.	D - 1 F - 1	
BD061	Framed, ledged and battened door.	1970W x 2090H	830W x 2035H	100 x 75	47	M	S	780	N	Y	N	Y	N	N	Y	N	N	Blue Blue	Left Hand Door • Modern utility door and frame posts found to be in good condition.	D - 1 F - 1	
BD062	Flush hollow core door.	900W x 2020H	840W x 1975H	80 x 40	45	M	S	775	N	P	N	Y	N	N	Y	N	N	Blue Blue Blue	Right Hand Door • Modern utility door and frame posts found to be in good condition.	D - 1 F - 1	
BD063	4 No. panelled square framed door.	830W x 2020H	760W x 1980H	80 x 40	33	M	S	720	N	P	N	N	Missing	N	Y	N	N	Blue Blue Blue	Left Hand Door • Door and frame posts found to be in poor condition.	D - 3 F - 3	Remove Door Remove Frame
BD064	22 No. pane combination frame with 2No. x 3 No panelled square framed double doors.	2415W x 2905H	525W x 2020H	70 x 100	43	O	D	1020	N	P	N	Missing	N	N	Y	N	N	Blue Blue Blue	Double Doors • Doors and frame posts found to be in good condition.	D - 1 F - 1	
BD065	4 No. pane / 2 No. panelled square framed door in arch head frame.	940W x 2035H 2100A	760W x 1970H	90 x 75	50	O	S	710	Y	K	N	Y	N	N	Y	Y	N	Blue Blue	Left Hand Door • Remove boarding covering glazing • Door and frame posts found to be in good condition.	D - 1 F - 1	
BD066	Flush solid core door.	890W x 2030H	Missing	115 x 35	45	M	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Dual Action Door • Door and frame posts found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
BD066A	Flush solid core door.	730W x 2000H	675W x 1970H	115 x 35	35	M	S	635	N	P	N	N	N	Y	Y	N	N	Blue Blue	Left Hand Door • Door and frame posts found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
BD066B	Flush solid core door.	730W x 2000H	675W x 1970H	115 x 35	35	M	S	635	N	P	N	N	N	Missing	Y	N	N	Blue Blue Blue	Left Hand Door • Door and frame posts found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
BD067	2 No. pane fanlight frame with 6 No. pane / 4 No. panelled square framed door.	1040W x 2070H	910W x 2120H	85 x 70	45	O	S	860	Y	Missing	N	Missing	N	N	Y	Y	N	Blue Blue Blue	Right Hand Door • Door and frame posts found to be damaged around lock area • 1 No. pane requires replacing.	D - 1 F - 1	
BD068	Flush solid core door.	890W x 2040H	810W x 2015H	115 x 35	45	M	S	775	N	N	Missing	N	N	N	Y	N	N	Blue Blue	Dual Action Door • Door and frame posts found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
BD068A	Framed, ledged and plywood door.	910W x 2160H	810W x 2080H	100 x 50	47	M	S	755	Y	Missing	N	Missing	N	N	N	N	N	Blue Blue Blue	Right Hand Door • Door and frame posts found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
BD069	Frame only door missing.	850W x 2030H	Missing	75 x 50	?	M	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Right Hand Door • Door currently missing • Frame posts found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
BD070	Framed, ledged and battened double doors.	n/a	780W x 1960H	75 x 50	45	M	D	910	N	N	N	N	N	N	N	N	N	Blue Blue	Double Doors • Original utility doors and frame posts found to be in poor condition.	D - 3 F - 3	Remove Door Remove Frame
BD070A	Solid hardwood timber plank door	1200W x 2270H	870W x 1945H	150 x 100	68	O	S	760	N	L	N	N	Y	N	N	N	N	Blue Black	Left Hand Door • Original utility door set within adapted frame with angle iron insert found to be in poor condition.	D - 1 F - 2	
BD070B	Frame only door missing.	850W x 2060H	Missing	95 x 40	?	M	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Right Hand Door • Door currently missing • Frame posts found to be of no significance.	D - 3 F - 3	Remove Frame only
BD071	Frame only door missing.	850W x 2060H	Missing	95 x 40	?	M	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Right Hand Door • Door currently missing • Frame posts found to be of no significance.	D - 3 F - 3	Remove Frame only
BD071A	1 No. panelled square framed hatch door.	800W x 750H	730W x 675H	75 x 50	40	M	S	710	N	P	N	N	N	Y	N	N	N	Black Black	Left Hand Door • Door and frame surround found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
BD071B	1 No. panelled square framed hatch door.	800W x 750H	730W x 675H	75 x 50	40	M	S	710	N	P	N	N	N	Y	N	N	N	Black Black Black	Right Hand Door • Door and frame surround found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
BD072	Flush hollow core door.	860W x 2060H	765W x 1980H	95 x 40	36	M	S	750	N	Missing	N	Y	N	N	N	N	N	Blue Blue	Right Hand Door • Door and frame posts found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
BD072A	1 No. panelled square framed hatch door.	800W x 750H	730W x 675H	75 x 50	40	M	S	710	N	P	N	N	N	Y	N	N	N	Black Black	Right Hand Door • Door and frame surround found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
BD072B	1 No. panelled square framed hatch door.	800W x 750H	730W x 675H	75 x 50	40	M	S	710	N	P	N	N	N	Y	N	N	N	Black Black	Left Hand Door • Door and frame surround found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
BD073	Flush hollow core door.	860W x 2060H	765W x 1980H	95 x 40	36	M	S	750	N	Missing	N	Y	N	N	N	N	N	Blue Blue	Right Hand Door • Door and frame posts found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
BD073A	1 No. panelled square framed hatch door.	800W x 750H	730W x 675H	75 x 50	40	M	S	710	N	P	N	N	N	Y	N	N	N	Black Black	Right Hand Door • Door and frame surround found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
BD074	Flush hollow core door.	860W x 2060H	765W x 1980H	95 x 40	36	M	S	750	N	K	N	Missing	N	N	N	N	N	Black Black	Right Hand Door • Door and frame posts found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
BD074A	Flush hollow core door.	860W x 2060H	765W x 1980H	95 x 40	36	M	S	750	N	K	N	Missing	N	N	N	N	N	Black Black Black	Left Hand Door • Door and frame posts found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
BD074B	Flush hollow core door.	860W x 2060H	765W x 1980H	95 x 40	36	M	S	750	N	Missing	N	Missing	N	N	N	N	N	Black Blue	Right Hand Door • Door and frame posts found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
BD074C	Frame only door missing.	915W x 2140H	Missing	200 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Left Hand Door • Door currently missing • Frame posts found to be of no significance.	D - 3 F - 3	Remove Frame only
BD075	Steel / Asbestos cement board boiler house door and frame.	780W x 1460H	680W x 1300H	?	?	M	S	?	N	P	N	Y	N	N	N	N	N	Silver Silver	Left Hand Door • Door and frame angles found to be in good condition • Asbestos cement board to be encapsulated and future monitored as part of asbestos management regime.	D - 1 F - 2	
BD076	Flush hollow core door.	860W x 2060H	765W x 1980H	95 x 40	36	M	S	750	N	Missing	N	Missing	N	N	N	N	N	Blue Blue	Left Hand Door • Door and frame posts found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
BD077	Solid hardwood timber plank door	950W x 2330H	810W x 2255H	100 x 75	42	O	S	770	Y	K	N	Y	N	Y	N	N	N	Hard Wood	Right Hand Door • Original utility door and frame posts found to be in fair condition.	D - 1 F - 1	
BD078	Ledged and battened door.	820W x 2030H	680W x 1955H	70 x 55	35	O	S	640	N	N	N	N	N	N	N	N	N	Soft Wood	Right Hand Door • Door and frame posts found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
Ground Floor																					
GFD001	Framed, ledged and battened door.	980W x 2190H	870W x 2115H	110 x 65	50	O	S	820	Y	K	N	Y	N	N	N	N	N	Green Blue	Right Hand Door • Original utility door and frame posts found to be in poor condition.	D - 3 F - 3	
GFD001A	22 No. pane dummy arch fanlight frame with 2 No. x 16 No pane / 6 No. panelled square framed bi-folding double doors.	2950W x 4650H	1370W x 2930H	140 x 100	50	O	D	2710	N	Missing	N	N	N	Y	Y	Y	N	Hard wood Grey	Double Doors • 1 No. bottom hinge require replacing • Reinststate 2 No. missing locking mechanisms / handles and 2 No. tower drop bolts • 20 No. panes requires replacing • Remove security boarding and crude steel restraints • Make good to glazed brickwork.	D - 2 F - 1	

GFD001B	22 No. pane dummy arch fan light frame with 2 No. x 16 No pane / 6 No. panelled square framed bi-folding double doors.	2950W x 4650H	1370W x 2930H	140 x 100	50	O	D	2710	N	Missing	N	Y	N	Y	Y	Y	N	Hard wood Grey	Double Doors • 3 No. hinges require replacing • Reinstall 3 No. missing locking mechanisms / handles and 2 No. tower drop bolts • 20 No. panes requires replacing • Remove security boarding and crude steel restraints • Make good to glazed brickwork.	D - 2 F - 1	
GFD001C	32 No. pane / 12 No. panelled square framed sliding door.	n/a	2910W x 2980H	n/a	55	O	S	2760	N	P	N	N	N	N	N	Y	N	Grey Grey	Sliding Door • Original utility sliding door found to be in fair condition • Minor damage found to closing stile and pull handle area • Clean out sliding channel and oil roller mechanism.	D - 2	
GFD001D	5 No. panelled square framed door in arch head frame.	1090W x 2220H 2290A	960W x 2160H	120 x 75	48	O	S	910	N	Missing	N	Missing	N	Y	Y	N	N	Hard Wood	Right Hand Door • Severe damage found to door closing stile • Door hinge frame post found to be loose • Left hand side architrave missing.	D - 1 F - 1	
GFD002	26 No. pane combination frame with 3 No. pane / 2 No. panelled square framed door.	2220W x 2790H	860W x 2045H	85 x 75	48	O	S	815	N	Missing	N	Missing	N	N	Y	Y	N	Green Red	Right Hand Door • Severe timber decay to the left hand side of door frame post and architrave • Further investigation required • Dry rot eradication work required • Renewal of frame post required.	D - 1 F - 1	
GFD003	Flush hollow core door.	900W x 2100H	835W x 2035H	115 x 40	45	M	S	800	N	P	N	Y	N	N	Y	N	N	Green Red	Right Hand Door • Door and frame posts found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
GFD004	7 No. pane combination frame with 4 No. panelled square framed door.	1730W x 2790H	760W x 1960H	65 x 40	35	O	S	740	N	K	N	Y	N	N	N	Y	N	Green Green	Left Hand Door • Original combination frame has been badly adapt and found to be beyond economic repair.	D - 3 F - 3	Remove Door Remove Frame
GFD005	Door frame only.	840W x 2070H	Missing	140 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Right Hand Door • Door currently missing • Frame posts found to be in good condition.	D - 3 F - 1	
GFD006	5 No. panelled square framed door.	915W x 2185H	810W x 2130H	75 x 50	50	O	S	780	N	Missing	N	Missing	N	Y	Y	N	N	Green Brown	Right Hand Door • Original door has had top corner cut off • Frame posts found to be in good condition.	D - 1 F - 1	
GFD007	3 No. pane / 2 No. panelled square framed door in arch head frame.	1060W x 2250H 2190A	960W x 2115H	150 x 50	45	O	S	900	N	Missing	N	Missing	N	Y	Y	N	N	Green Green	Left Hand Door • Original door adapted to take Georgian wired glazing • Frame posts found to be in good condition.	D - 1 F - 1	
GFD007A	6 No. pane fanlight frame with 3 No. pane / 2 No. panelled square framed door.	1045W x 2790H	935W x 2050H	85 x 75	48	O	S	900	N	Missing	N	Y	N	N	Y	Y	N	Green Green	Right Hand Door • Original door and frame posts found to be in good condition • Door found to have 3 No. different types of obscure glass.	D - 1 F - 1	
GFD007B	1 No. circular pane, solid hardwood timber plank door.	1080W x 2185H	1005W x 2125H	150 x 50	53	O	S	945	N	K	N	Y	N	N	Y	Y	N	Green Brown	Left Hand Door • Original door has had top corner cut off • 2 No. T&G planks missing • Frame posts found to be in good condition • 1 No. circular pane requires replacing along with its corresponding beads • Damage found to the lock / keeper area.	D - 2 F - 1	
GFD007C	1 No. circular pane, solid hardwood timber plank door.	1080W x 2185H	1005W x 2125H	150 x 50	53	O	S	945	N	K	N	Y	N	N	Y	Y	N	Green Green	Right Hand Door • Original door has had top corner cut off • Circular pane has been planked over.	D - 2 F - 1	
GFD007D	5 No. panelled square framed door.	890W x 2170H	810W x 2125H	75 x 75	50	O	S	760	N	Missing	N	Missing	N	N	Y	N	N	Brown Brown	Left Hand Door • Door found with damage to the closing stile.	D - 1 F - 1	
GFD007E	5 No. panelled square framed door.	940W x 2185H	835W x 2115H	75 x 75	48	O	S	785	N	Missing	N	Missing	N	N	Y	N	N	Brown Brown	Right Hand Door • Door and frame posts found to be in good condition.	D - 1 F - 1	
GFD007F	4 No. pane fanlight frame with 5 No. panelled square framed door.	915W x 3050H	835W x 2125H	165 x 50	48	O	S	800	N	Missing	N	Missing	N	N	Y	Y	N	Green Brown	Right Hand Door • Door found with damage to the closing stile lock area.	D - 1 F - 1	
GFD007G	4 No. pane fan light frame with 5 No. panelled square framed door.	1090W x 3100H	970W x 2125H	75 x 50	48	O	S	950	N	Missing	N	Missing	N	N	Y	Y	N	Green Green	Right Hand Door • Original door has been boarded over to provide extra security.	D - 1 F - 1	
GFD007H	4 No. pane fan light frame with 5 No. panelled square framed door.	1090W x 3100H	970W x 2125H	75 x 50	48	O	S	950	N	K	N	Y	N	N	Y	Y	N	Green Brown	Left Hand Door • Original door has been boarded over to provide extra security.	D - 1 F - 1	
GFD007(I)	Solid hardwood timber plank door in arch head frame.	940W x 2160H ????A (Duct)	805W x 2120H	75 x 75	47	O	S	735	N	K	N	Y	N	N	Y	N	N	Green Green	Right Hand Door • Door and frame posts found to be in good condition	D - 1 F - 1	
GFD007J	12 No. pane arch fanlight frame with 2 No. x 10 No panelled square framed double doors.	2045W x 3010H 3810A	910W x 2440H	115 x ?	?	O	D	?	N	Missing	N	Y	N	Y	Y	N	N	Hard wood Brown	Double Doors • Remove timber security device and make good minor damage.	D - 1 F - 1	
GFD007K	9 No. pane / 3 No. panelled square framed door.	1170W x 2340H 2420A	1015W x 2230H	?	?	O	D	?	N	K	N	Y	N	N	Y	N	N	Hard wood	Right Hand Door • Door and frame posts found to be in good condition • 1 No. panes require replacing • Remove security boarding and make good minor damage to door.	D - 1 F - 1	
GFD008	Split level countered 5 No. panelled square framed door.	915W x 2185H	805W x 2130H	75 x 75	47	O	S	735	N	Missing	N	Missing	N	N	Y	N	N	Green Brown	Right Hand Door • Door found with severe damage to the closing stile lock area and is beyond economic repair • Replacement door required.	D - 3 F - 1	Remove Door Only
GFD009	Door frame only.	940W x 2215H	Missing	150 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Right Hand Door • Severe timber decay to door frame and architraves around frame • Further investigation required • Dry rot eradication work required • Renewal of frame and door required.	D - 3 F - 3	Remove Frame Only
GFD010	Angle iron metal door frame only to cell.	810W x 1930H	Missing	70 x 70	56	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Right Hand Door • Cell door currently missing • Frame angles found to be in poor condition.	D - 3 F - 2	
GFD011	Angle iron metal door frame only to cell.	810W x 1930H	Missing	70 x 70	56	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Right Hand Door • Cell door currently missing • Frame angles found to be in poor condition.	D - 3 F - 2	
GFD012	Angle iron metal door frame only to cell.	810W x 1930H	Missing	70 x 70	56	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Right Hand Door • Cell door currently missing • Frame angles found to be in poor condition.	D - 3 F - 2	
GFD013	Angle iron metal door frame only to cell. (Steel clad timber door currently stored in cell)	810W x 1930H	700W x 1865H	70 x 70	56	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Right Hand Door • Cell door currently removed and in storage • Frame angles found to be in poor condition.	D - 2 F - 2	
GFD014	Angle iron metal door frame only to cell. (Steel clad timber door currently stored in cell)	810W x 1930H	700W x 1865H	70 x 70	56	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Right Hand Door • Cell door currently removed and in storage • Frame angles found to be in poor condition.	D - 2 F - 2	
GFD015	Angle iron metal door frame only to cell. (Steel clad timber door currently stored in cell)	810W x 1930H	700W x 1865H	70 x 70	56	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Right Hand Door • Cell door currently removed and in storage • Frame angles found to be in poor condition.	D - 2 F - 2	
GFD016	Angle iron metal door frame only to cell.	810W x 1930H	Missing	70 x 70	56	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Right Hand Door • Cell door currently missing • Frame angles found to be in poor condition.	D - 2 F - 2	
GFD017	14 No. pane arch fanlight frame with 2 No. x 24 No pane framed, ledged and battened bi-folding double doors.	3240W x 3780H 4590A	1495W x 3630H	150 x 125	50	O	D	2970	Y	Missing	N	Y	N	Y	Y	Y	N	Cream Grey	Bi - Folding Double Doors • Reinstall 4 No. missing locking mechanisms / handles and 2 No. tower drop bolts • 4 No. panes require replacing • Remove security boarding • Make good minor damage around door and frame.	D - 2 F - 1	
GFD018	1 No. pane fanlight frame with 1 No. pane / 1 No. panelled square framed doubled doors.	1400W x 2560H	635W x 2030H	85 x 50	45	M	D	1190	N	Y	N	Y	N	Y	Y	Y	N	L. Blue L. Blue	Double Doors • Insert doors and frame found to be of no significance • Original frame posts found to be in good condition.	D - 3 F - 3	Remove Door Remove Frame

GFD018A	Framed and battened double doors.	1520W x 1775H	720W x 1700H	75 x 75	60	O	D	1375	N	N	N	N	N	Y	N	N	N	Grey	Double Doors • Original utility doors and frame posts found to be in poor condition.	D - 3 F - 3	Remove Door Remove Frame	
GFD019	Flush hollow core double doors.	1175W x 2020H	525W x 1980H	110 x 75	45	M	D	1025	N	N	N	Missing	N	N	Y	N	N	Grey	Double Doors • 1 No. door currently missing • Door and frame posts found to be of no significance.	D - 3 F - 3	Remove Door (Only 1 remaining) Remove Frame	
GFD019A	9 No. pane arch tanlight frame with 2 No. pane / 1 No. panelled square framed double doors.	1540W x 3790H 4020A	675W x 2550H	95 x 110	45	M	D	1320	N	P	N	N	N	Y	Y	Y	N	Grey	Double Doors • Original frame found to be adapted and in poor condition with modern doors installed of no significance • 4 No. panes require replacing.	D - 3 F - 2		
GFD020	14 No. pane arch tanlight frame with 2 No. x 24 No pane framed, ledged and battened bi-folding double doors.	3240W x 3780H 4590A	1495W x 3630H	150 x 125	50	O	D	2970	N	P	N	N	N	Y	Y	Y	N	Cream Grey	Bi - Folding Double Doors • Remove temporary plywood framed door and reinstate original door that is currently in storage • Reinststate 4 No. missing locking mechanisms / handles and 2 No. tower drop bolts • 1 No. panes require replacing • Remove security boarding • Make good minor damage around door and frame.	D - 2 F - 1		
GFD021	3 No. panelled square framed door.	1130W x 2185H	990W x 2100H	125 x 75	55	O	S	890	N	K	N	Y	N	N	Y	N	N	Hard wood White	Left Hand Door • Remove timber over boarding and make good minor damage.	D - 1 F - 1		
GFD022	Framed , ledged and battened sliding door.	n/a	1220W x 2340H	n/a	54	O	S	1070	N	Y	N	N	N	Y	N	N	N	Grey Green	Sliding Door • Original utility sliding door found to be in fair condition • Minor damage found to closing stile and pull handle area • Clean out sliding channel and oil roller mechanism.	D - 2		
GFD022A	18 No. pane arch tanlight frame with 6 No. pane / framed, ledged and battened double doors.	2120W x 3790H 4210A	1010W x 2990H	125 x 75	56	O	D	1970	N	N	N	N	N	Y	Y	Y	N	Grey Green	Double Doors • Reinststate original door that is currently in storage • Reinststate 4 No. missing locking mechanisms / handles and 2 No. tower drop bolts • Reinststate missing section of external beading to the left hand side • 1 No. panes require replacing • Remove security boarding • Make good minor damage around door and frame	D - 2 F - 1		
GFD023	Square framed door over boarded in arch head frame.	935W x 2250H 2310A	800W x 2110H	75 x 65	40	O	S	750	N	P	N	Y	Y	N	Y	N	N	Red White	Left Hand Door • Remove timber over boarding and make good minor damage.	D - 1 F - 1		
GFD024	30 No. pane tanlight frame with 5 No. x 4 No. pane / 4 No. panelled square framed doors.	4310W x 3730H	795W x 2120H	75 x 50	35	O	M	745	N	N	N	Missing	N	Y	Y	Y	N	Cream Cream	Both Left and Right Hand Doors • Original combination frame has been adapt many times over the years and found to have 1 No. door missing completely • 2 No. panes require replacing.	D - 3 F - 1	Remove Door Only	
GFD025	Flush hollow core door fitted in timber studwork.	3230W x 3840H	810W x 2030H	75 x 50	45	M	S	770	N	N	N	Y	N	Y	N	N	N	White White	Right Hand Door • Door and frame posts found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame	
GFD026	Plywood double doors fitted in timber studwork.	3340W x 3470H 4270A	830W x 1990H	100 x 50	45	M	D	1640	N	N	N	N	N	Y	N	N	N	Natural Timber	Double Doors • Remove temporary plywood studwork frame / door and reinstate original doors that are currently in storage.	D - 2 F - 3		
GFD026A	Framed, ledged and battened sliding door.	n/a	2130W x 3700H	n/a	58	O	S	1950	N	P	N	N	Y	Y	N	N	N	Green Cream	Sliding Door • Original utility sliding door found to be in fair condition • Remove redundant pipework that currently goes through door and make good damage • Clean out sliding channel and oil roller mechanism	D - 2		
GFD026B	Framed , ledged and battened sliding double doors.	n/a	1315W x 3260H	n/a	58	O	D	2480	N	P	N	N	Y	Y	N	N	N	Green Grey	Double Sliding Doors • Original utility sliding doors found to be in fair condition • Damage found to closing stile and pull handle areas • Clean out sliding channel and oil roller mechanism	D - 2		
GFD026C	Flush hollow core door fitted in timber studwork.	870W x 2060H	760W x 1980H	75 x 50	45	M	S	?	Y	P	N	Y	N	Y	Y	N	N	Natural Timber	Right Hand Door • Door and frame posts found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame	
GFD027	Flush hollow core door	920W x 2110H	835W x 2035H	80 x 40	40	M	S	785	N	P	N	Y	N	N	Y	N	N	White Brown	Left Hand Door • Door and frame posts found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame	
GFD028	Flush hollow core door	920W x 2110H	835W x 2035H	80 x 40	40	M	S	785	N	P	N	Y	N	N	Y	N	N	White Brown	Left Hand Door • Door and frame posts found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame	
GFD029	4 No. pane / 2 No. panelled square framed door.	940W x 2200H	850W x 2140H	?	45	M	S	?	N	N	N	N	N	N	Y	Y	N	White White	Left Hand Door • Remove timber over boarding and make good minor damage.	D - 1 F - 1		
GFD029A	Opening currently boarded over	900W x 2070H	?	100 x 50	?	M	S	?	N	N	?	?	?	N	Y	?	?	?	?	• Remove timber over boarding from both sides of frame and make good minor damage • Further investigation required.	D - 1 F - 1	
GFD029B	5 No. panelled square framed door.	880W x 2070H	800W x 2010H	100 x 50	40	O	S	750	N	L	N	N	Y	Y	Y	N	N	Blue Green	Right Hand Door • Original door fitted into modern frame / studwork of no significance.	D - 1 F - 1		
GFD029C	5 No. panelled square framed door.	880W x 2070H	810W x 2010H	100 x 50	40	O	S	750	Y	L	N	N	Y	N	Y	N	N	Blue Brown	Left Hand Door • Original door fitted into modern frame / studwork of no significance.	D - 1 F - 1		
GFD029D	4 No. panelled square framed door.	815W x 2070H	740W x 1980H	100 x 50	37	O	S	710	N	P	N	Y	N	N	Y	N	N	Blue Brown	Right Hand Door • Original door fitted into modern frame / studwork of no significance. ***note*** Original door inscribed Food Store Room - No 27, BA School Lecture.	D - 1 F - 1		
GFD029E	9 No. pane / 3 No. panelled square framed door.	990W x 2150H	880W x 2110H	175 x 50	45	O	S	830	N	L	N	N	Y	Y	Y	Y	Y	Blue Blue	Right Hand Door • 2 No. red / acid etched panes require replacing • Door and frame posts found to be in good condition.	D - 2 F - 1		
GFD030	3 No. pane tanlight frame with 9 No. circular pane with red acid etched glass / 3 No. panelled square framed door.	1010W x 2625H	875W x 2065H	115 x 75	48	O	S	835	N	Missing	N	Missing	N	N	Y	Y	N	Blue White	Left Hand Door • Original door of significance found to be severely damaged to the closing stile lock area • Carry out sympathetic repair of closing stile • 1 No. red / acid etched pane requires replacing.	D - 2 F - 1		
GFD030A	3 No. pane tanlight frame with 9 No. circular pane with red acid etched glass / 3 No. panelled square framed door.	990W x 2625H	850W x 2065H	115 x 75	48	O	S	810	N	Missing	N	Missing	N	N	Y	Y	N	Blue White	Left Hand Door • Original door of significance found to be severely damaged to the closing stile lock area, 1 No. panel and the mid rail • Carry out sympathetic repairs to the closing stile, 1 No. panel and the mid rail	D - 2 F - 1		
GFD031	3 No. pane tanlight frame with 9 No. circular pane with red acid etched glass / 3 No. panelled square framed door.	1010W x 2625H	875W x 2065H	115 x 75	48	O	S	835	N	P	N	Y	N	N	Y	Y	N	Blue White	Right Hand Door • Original door of significance found to be severely damaged to the closing stile lock area • Carry out sympathetic repair of closing stile • 2 No. red / acid etched panes require replacing.	D - 2 F - 1		
GFD031A	5 No. panelled square framed door.	915W x 2090H	805W x 2015H	125 x 50	40	O	S	760	N	L	N	Y	Y	N	Y	N	N	White White	Left Hand Door • Door and frame posts found to be damaged to the closing stile lock / keeper area.	D - 1 F - 1		
GFD032	Door frame only.	965W x 2100H	Missing	125 x 50	48	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame posts found to be in good condition.	D - 3 F - 1		
GFD032A	4 No. pane tanlight frame with 2 No. x 6 No. semi circular pane / 1 No. panelled square framed double doors.	1420W x 2615H	635W x 2005H	125 x 75	48	O	D	1260	Y	P	N	Missing	N	N	Y	Y	N	Blue Blue	Dual Action Double Doors • Door and frame posts found to be in good condition • Service floor mounted door closers. ***note*** Floor spring plates Gibbon - London and Wolverhampton.	D - 2 F - 1		
GFD032B	8 No. pane hardwood combination frame only.	1760W x 2060H	835W x 2000H	90 x 60	40	M	S	?	Y	P	N	Missing	N	N	Y	Y	N	Hard wood	Right Hand Door • Stored door and combination frame found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame	
GFD032C	1 No. pane arch head fanlight frame with 3 No. panelled square framed hardwood double doors.	2090W x 2915H 3970A	980W x 2810H	125 x 75	53	O	D	1925	N	P+K	N	Y	N	Y	Y	Y	N	Hard wood Blue	Double Doors • Door and frame posts found to be in good condition.	D - 1 F - 1		
GFD032D	Door frame only.	830W x 2030H	Missing	100 x 50	34	M	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame posts found to be of no significance.	D - 3 F - 3	Remove Frame Only	
GFD032E	Flush hollow core door.	830W x 2010H	760W x 1970H	100 x 40	34	M	S	740	N	P	N	Y	N	N	Y	N	N	White White	Right Hand Door • Door and frame posts found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame	
GFD033	5 No. panelled square framed hardwood door.	760W x 2075H	680W x 2075H	150 x 50	40	O	S	635	N	K	N	Y	N	N	Y	N	N	Hard wood	Right Hand Door • Door currently in storage • Slight damaged to the hinge frame post.	D - 1 F - 1		

GFD034	9 No. circular pane with stained glass / 4 No. panelled square framed hardwood door.	965W x 2170H	880W x 2110H	225 x 50	48	O	S	850	N	P+K	N	Y	N	N	Y	Y	N	Hard wood Red	Right Hand Door • Door and frame posts found to be in good condition.	D - 1 F - 1	
GFD034A	9 No. circular pane with stained glass / 4 No. panelled square framed hardwood door.	965W x 2110H	880W x 2045H	125 x 50	48	O	S	850	N	P+K	N	Y	N	N	Y	Y	N	Hard wood Red	Right Hand Door • Door and frame posts found to be in good condition.	D - 1 F - 1	
GFD034B	9 No. circular pane with stained glass / 4 No. panelled square framed hardwood door.	965W x 2110H	880W x 2045H	125 x 50	48	O	S	850	N	P+K	N	Y	N	N	Y	Y	N	Red Red	Left Hand Door • Door and frame posts found to be in good condition.	D - 1 F - 1	
GFD034C	Arch head frame incorporating an arch 3 No. panelled square framed hardwood door.	1030W x 2010H 2240A	950W x 1955H 2135A	125 x 50	54	O	S	880	N	K	N	Y	N	Y	Y	N	N	Hard wood	Left Hand Door • Door and frame posts found to be in good condition • Replace decayed door drip mould.	D - 1 F - 1	
GFD035	6 No. Venetian arch pane with stained glass / 1 No. panelled square framed hardwood door.	1015W x 2180H	830W x 2110H	75 x 75	45	O	S	785	Y	P	N	Y	N	N	Y	Y	N	Hard wood Red	Right Hand Door • Door and frame posts found to be in good condition.	D - 1 F - 1	
GFD036	9 No. circular pane with stained glass / 3 No. panelled square framed hardwood door.	990W x 2210H	895W x 2145H	125 x 50	45	O	S	870	N	K	N	Y	N	N	Y	Y	N	Hard wood	Left Hand Door • Door and frame posts found to be in good condition.	D - 1 F - 1	
GFD036A	1 No. Venetian arch pane with stained glass / 2 No. panelled square framed hardwood double doors.	1420W x 2230H	640W x 2155H	100 x 75	45	O	D	1160	Y	Y	N	Y	N	N	Y	Y	N	Hard wood	Dual Action Doors • Door and frame posts found to be in good condition • Service floor mounted door closers.	D - 2 F - 1	
GFD036B	1 No. pane arch head fanlight frame with 3 No. panelled square framed hardwood double doors.	1980W x 2540H 3540A	950W x 2445H	125 x 50	54	O	D	1760	N	K	N	Y	N	Y	Y	N	N	Hard wood	Double Doors • Remove timber security device and make good minor damage • Door and frame posts found to be in good condition. ***note*** Original door inscribed with Coroners Court.	D - 1 F - 1	
GFD037	Flush hollow core door.	830W x 2020H	765W x 1975H	100 x 50	34	M	S	735	N	L	N	N	Y	N	Y	N	N	Hard wood	Left Hand Door • Door and frame posts found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
GFD037A	Flush hollow core door.	830W x 2020H	765W x 1975H	100 x 50	34	M	S	735	N	L	N	N	Y	N	Y	N	N	Hard wood	Left Hand Door • Door and frame posts found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
GFD037B	Boarded up arch head fanlight frame with modern insert frame incorporating a 12 No. panel solid core door	2010W x 2790H 3790A	810W x 2020H	135 x 75	45	M	S	810	N	Missing	N	Y	N	N	Y	N	N	Hard wood	Left Hand Door • Insert door and frame posts found to be severely damaged and of no significance • Original frame found to be in good condition.	D - 3 F - 2	
GFD038	Door frame only.	915W x 2080H	Missing	75 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Left Hand Door • Door missing completely • Timber decay to door frame and architraves around frame • Further investigation required • Dry rot eradication work required • Renewal of frame and replacement door required	D - 3 F - 2	
GFD038A	Sliding flush hollow core door.	n/a	835W x 2030H	n/a	35	M	S	740	N	P	N	N	N	Y	Ceramic Tile	N	N	Orange White	Sliding Door • Door and lining found to be of no significance • Timber decay to door linings and architraves around frame • Further investigation required • Dry rot eradication work required • Renewal of lining frame and replacement door required.	D - 3 F - 2	Remove Door Only
GFD038B	5 No. panelled square framed hardwood door.	1075W x 2170H	810W x 2040H	45 x 125	43	O	S	755	N	N	N	Y	N	N	Y	N	N	Blue Green	Right Hand Door • Door and panelled frame found to be in good condition.	D - 1 F - 1	
GFD038C	6 No. pane / 3 No. panelled square framed door.	1120W x 2210H	835W x 2135H	75 x 170	48	O	S	780	N	N	N	Y	N	Y	Y	Y	N	Blue Brown	Left Hand Door • Remove timber security boarding and make good minor damage • Original door of significance found to be damaged to the closing stile lock area	D - 1 F - 1	
GFD038D	3 No. panelled square framed hardwood door.	1015W x 2180H	1015W x 2180H	125 x 50	54	O	S	940	N	Missing	N	Y	N	Y	Y	N	N	Hard wood	Right Hand Door • Remove timber security device and make good minor damage • Door and frame found to be in good condition	D - 1 F - 1	
GFD038E	4 No. panelled square framed hardwood door.	915W x 2080H	810W x 2020H	75 x 50	45	O	S	765	N	Missing	N	Missing	N	N	Y	N	N	Blue Hard wood	Right Hand Door • Mid rail found to be severely damaged / missing • Left hand side architrave missing.	D - 2 F - 1	
GFD038F	Dual action double door frame only.	1525W x 2350H	Missing	125 x 75	?	O	D	1420	Y	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Hard wood	Dual Action Double Doors • Doors missing completely • Frame posts found to be in good condition • Ornatly carved Oak left hand side architrave missing and head architrave loose • Service floor mounted door closers. ***note*** Floor spring plates Gibbon - London and Wolverhampton.	D - 3 F - 2	
GFD039	2 No. pane, flush solid core door.	910W x 2120H	830W x 2035H	280 x 40	45	M	S	790	Y	N	P	N	N	N	Y	Y	N	Hard wood	Dual Action Door • Inclusive door and frame posts found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
GFD039A	Flush blockboard solid core double doors.	990W x 2150H	450W x 1960H	500 x 25	25	M	D	850	N	P	N	N	Y	N	Y	N	N	White White	Double Doors • Doors and lining frame found to be of no significance.	D - 1 F - 1	
GFD040	Door frame only (part of ornate oak combination frame)	1030W x 2440H	Missing	115 x 75	?	O	S	860	Missing	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Hard wood	Left Hand Door • Doors missing completely • Frame posts found to be in good condition • Ornatly carved Oak head and right hand side architrave missing.	D - 3 F - 2	
GFD040A	Door frame only (part of ornate oak combination frame)	1030W x 2440H	Missing	115 x 75	?	O	S	860	Missing	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Hard wood	Left Hand Door • Doors missing completely • Frame posts found to be in good condition	D - 3 F - 1	
GFD040B	Boarded up doorway with modern insert frame incorporating a flush solid core door	1500W x 2360H	760W x 2260H	175 x 75	45	O	S	?	Y	N	N	Missing	N	N	Y	N	N	Hard wood	Left Hand Door • Remove timber security boards • Insert door and frame found to be of no significance • Original frame posts found to be in good condition • Ornatly carved Oak left right hand side architrave missing.	D - 3 F - 2	Remove Door Only
GFD040C	Bricked up / over panelled doorway which originally formed part of a 26 No. arch head flag frame	1050W x 2515H	n/a	115 x 75	n/a	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	White White	Right Hand Door • Remove timber security board and open up door way entrance.	D - 3 F - 2	
GFD040D	2 No. panelled square framed hardwood door.	1010W x 2130H	915W x 2070H	? X 65	?	O	S	?	N	Missing	N	?	?	N	Y	N	N	Hard wood	• Doors missing completely • Door anf frame posts found to be in good condition • Ornatly carved Oak head and right hand side architrave found to be missing • Electric fuse box currently fitted to the face of the door	D - 2 F - 2	
GFD041	3 No. pane arch head fanlight frame with 3 No. panelled square framed hardwood double doors.	1955W x 3050H 4010A	930W x 2945H	125 x 50	?	O	D	1850	N	N	N	Y	N	Y	Y	Y	N	Hard wood	Double Doors • Remove timber security boards and make good minor damage • Door and frame found to be in good condition.	D - 1 F - 1	
GFD041A	5 No. slat pane square framed hardwood double doors.	1540W x 2270H	735W x 2240H	140 x 50	47	M	D	1330	Y	P+K	P	N	N	Y	Y	Y	N	Hard wood	Dual Action Double Doors • Damaged doors and frame found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
GFD042	1 No. vertical semi circular pane / 2 No. panelled square framed hardwood double doors.	1525W x 2370H	690W x 2270H	180 x 75	50	O	D	1370	Y	Missing	Missing	N	N	Y	Y	Y	N	Hard wood	Dual Action Double Doors • Doors and frame found to be in good condition • 1 No. semi-circular pane requires replacing • Original ornate Art Nouveau push plates / handles missing to both sides.	D - 2 F - 1	
GFD043	5 No. pane arch head flag frame adapted to fit modern 2xGG door.	1540W x 2220H 2880A	900W x 2140H	105 x 55	45	O	S	850	N	P+K	N	Y	N	Y	Y	Y	N	Stained Soft wood	Left Hand Door • 2xGG door found to be of no significance • Original flag frame has been crudely adapted to take modern door • Glazed leaded lights missing to the side and arched head • Remove electric cabling.	D - 3 F - 2	Remove Door Only

GFD043A	Flush hollow core door.	910W x 2130H 2200A	780W x 2035H	160 x 50	45	M	S	730	N	P	N	N	Y	Y	Y	N	N	Natural wood	Right Hand Door • Door of no significance and original frame found to be in good condition.	D - 3 F - 1	Remove Door Only
GFD044	1 No. panel / Louvred insert fitted within square framed door.	1025W x 2020H 2120A	900W x 2000H	?	?	O	S	?	N	N	N	Y	N	Y	Y	N	Y	Grey Grey	Right Hand Door • Door and frame found to be in good condition • 1 No. louvre requires replacing.	D - 2 F - 1	
GFD045	4 No. panelled square framed hardwood door.	940W x 2180H 2240A	810W x 2030H	150 x 75	48	O	S	760	Missing	Missing	N	Y	N	Y	Y	N	Y	Blue Hard wood	Left Hand Door • Damage to left hand side architrave.	D - 1 F - 1	
GFD045A	16 No. pane fanlight frame with 2 No. x 24 No pane framed, ledged and battened bi-folding double doors.	3260W x 4850H	1520W x 3660H	125 x 125	54	O	D	3110	N	Y	N	N	N	Y	Y	Y	N	Grey Grey	Bi - Folding Double Doors • Localised timber decay to bottom of doors and frame posts • Damage to door closing stiles • 1 No. bottom left hand side panel requires replacing • Reinstall 2 No. missing locking mechanisms / handles and refurbish 2 No. fixed mechanisms • 5 No. panes requires replacing • Remove security boarding and timber restraints.	D - 2 F - 1	
GFD045B	14 No. pane arch head fanlight frame with 2 No. x 24 No pane framed, ledged and battened bi-folding double doors.	3260W x 3850H 4500A	1520W x 3660H	125 x 125	54	O	D	3110	N	Y	N	N	N	Y	Y	Y	N	Grey Grey	Bi - Folding Double Doors • Localised timber decay to bottom of doors and frame posts • Damage to door closing stiles • 1 No. bottom left hand side panel requires replacing • Refurbish 4 No. fixed locking mechanisms / handles • Remove security boarding and timber restraints •	D - 2 F - 1	
GFD045C	14 No. pane arch head fanlight frame with 2 No. x 24 No pane framed, ledged and battened bi-folding double doors.	3260W x 3850H 4500A	1520W x 3660H	125 x 125	54	O	D	3110	N	Y	N	N	N	Y	Y	Y	N	Grey Grey	Bi - Folding Double Doors • Localised timber decay to bottom of doors and frame posts • Damage to door closing stiles • 1 No. bottom left hand side hinge requires replacing • Refurbish 4 No. fixed locking mechanisms / handles • 2 No. panes require replacing • Remove security boarding and timber restraints.	D - 2 F - 1	
GFD045D	14 No. pane arch head fanlight frame with 2 No. x 24 No pane framed, ledged and battened bi-folding double doors.	3260W x 3850H 4500A	1520W x 3660H	125 x 125	54	O	D	3110	N	Y	N	N	N	Y	Y	Y	N	Grey Grey	Bi - Folding Double Doors • Localised timber decay to bottom of doors and frame posts • Damage to door closing stiles • 1 No. bottom right hand side hinge requires attention • Refurbish 4 No. fixed locking mechanisms / handles • 6 No. panes require replacing • Remove security boarding and timber restraints.	D - 2 F - 1	
GFD045E	14 No. pane arch head fanlight frame with 2 No. x 24 No pane framed, ledged and battened bi-folding double doors.	3260W x 3850H 4500A	1520W x 3660H	125 x 125	54	O	D	3110	N	Y	N	N	N	Y	Y	Y	N	Grey Grey	Bi - Folding Double Doors • Localised timber decay to bottom of doors and frame posts • Damage to door closing stiles • 1 No. bottom right hand side panel requires attention • Reinstall 1 No. missing locking mechanisms / handles and refurbish 3 No. fixed mechanisms • 7 No. panes require replacing • Remove security boarding and timber restraints.	D - 2 F - 1	
GFD045F	14 No. pane arch head fanlight frame with 2 No. x 24 No pane framed, ledged and battened bi-folding double doors.	3260W x 3850H 4500A	1520W x 3660H	125 x 125	54	O	D	3110	N	Y	N	N	N	Y	Y	Y	N	Grey Grey	Bi - Folding Double Doors • Localised timber decay to bottom of doors and frame posts • Damage to door closing stiles • 1 No. bottom middle right hand side panel requires attention • 1 No. bottom right hand side hinge requires attention • Reinstall 2 No. missing locking mechanisms / handles and refurbish 2 No. fixed mechanisms • 9 No. panes require replacing • Remove security boarding and timber restraints.	D - 2 F - 1	
GFD045G	14 No. pane arch head fanlight frame with 2 No. x 24 No pane framed, ledged and battened bi-folding double doors.	3260W x 3850H 4500A	1520W x 3660H	125 x 125	54	O	D	3110	N	Y	N	N	N	Y	Y	Y	N	Grey Grey	Bi - Folding Double Doors • Localised timber decay to bottom of doors and frame posts • Damage to door closing stiles • Reinstall 1 No. missing locking mechanisms / handles and refurbish 3 No. fixed mechanisms • 3 No. panes require replacing • Left hand side architrave requires attention • Remove security boarding and timber restraints.	D - 2 F - 1	
GFD045H	14 No. pane dummy arch head fanlight frame with 2 No. x 24 No. pane / 2 No. panelled square framed hardwood bi-folding double doors.	3260W x 4620H	1520W x 3660H	125 x 125	54	O	D	3110	N	Y	N	N	N	Y	Y	Y	N	Grey Grey	Bi - Folding Double Doors • Minimal timber decay to bottom of doors and frame posts • Refurbish 2 No. fixed locking mechanisms / handles • 1 No. bottom right hand side panel is split and requires attention • Remove security boarding and crude steel restraints • Make good to glazed brickwork.	D - 2 F - 1	
GFD045(I)	14 No. pane dummy arch head fanlight frame with 2 No. x 24 No. pane / 2 No. panelled square framed hardwood bi-folding double doors.	3260W x 4620H	1520W x 3660H	125 x 125	54	O	D	3110	N	Y	N	N	N	Y	Y	Y	N	Grey Grey	Bi - Folding Double Doors • Minimal timber decay to bottom of doors and frame posts • Refurbish 2 No. fixed locking mechanisms / handles • 1 No. panes requires replacing • 1 No. right hand side bottom rail is split and requires attention • Remove security boarding and crude steel restraints • Make good to glazed brickwork.	D - 2 F - 1	
GFD045J	14 No. pane dummy arch head fanlight frame with 2 No. x 24 No. pane / 2 No. panelled square framed hardwood bi-folding double doors.	3260W x 3850H 4500A	1520W x 3660H	125 x 125	54	O	D	3110	N	Y	N	N	N	Y	Y	Y	N	Grey Grey	Bi - Folding Double Doors • Minimal timber decay to bottom of doors and frame posts • Reinstall 2 No. missing locking mechanisms / handles • 6 No. panes requires replacing • Remove security boarding and crude steel restraints • Make good to glazed brickwork.	D - 2 F - 1	
GFD045K	14 No. pane dummy arch head fanlight frame with 2 No. x 24 No. pane / 2 No. panelled square framed hardwood bi-folding double doors.	3260W x 4620H	1520W x 3660H	125 x 125	54	O	D	3110	N	Y	N	N	N	Y	Y	Y	N	Grey Grey	Bi - Folding Double Doors • Minimal timber decay to bottom of doors and frame posts • Reinstall 2 No. missing locking mechanisms / handles • Straighten and reinstall floor mounted brass quadrant track • 3 No. panes requires replacing • Remove security boarding and crude steel restraints • Make good to glazed brickwork.	D - 2 F - 1	
GFD045L	14 No. pane dummy arch head fanlight frame with 2 No. x 24 No. pane / 2 No. panelled square framed hardwood bi-folding double doors.	3260W x 4620H	1520W x 3660H	125 x 125	54	O	D	3110	N	Y	N	N	N	Y	Y	Y	N	Grey Grey	Bi - Folding Double Doors • Minimal timber decay to bottom of doors and frame posts • Reinstall 2 No. missing locking mechanisms / handles • 2 No. bottom middle panels are split and require attention • 3 No. panes requires replacing • Remove security boarding and crude steel restraints • Make good to glazed brickwork.	D - 2 F - 1	
GFD045M	14 No. pane dummy arch head fanlight frame with 2 No. x 24 No. pane / 2 No. panelled square framed hardwood bi-folding double doors.	3260W x 4620H	1520W x 3660H	125 x 125	54	O	D	3110	N	Y	N	N	N	Y	Y	Y	N	Grey Grey	Bi - Folding Double Doors • Minimal timber decay to bottom of doors and frame posts • 1 No. bottom middle right hand side panel requires attention • Refurbish 2 No. fixed locking mechanisms / handles • 3 No. panes requires replacing • Remove security boarding and crude steel restraints • Make good to glazed brickwork.	D - 2 F - 1	
GFD045N	14 No. pane dummy arch head fanlight frame with 2 No. x 24 No. pane / 2 No. panelled square framed hardwood bi-folding double doors.	3260W x 4620H	1520W x 3660H	125 x 125	54	O	D	3110	N	Y	N	N	N	Y	Y	Y	N	Grey Grey	Bi - Folding Double Doors • Minimal timber decay to bottom of doors and frame posts • Reinstall missing mid rail and associated glazing bars • Refurbish 2 No. fixed locking mechanisms / handles • Remove security boarding and crude steel restraints • Make good to glazed brickwork.	D - 2 F - 1	
GFD046	5 No. panelled square framed door.	910W x 2090H	810W x 2030H	75 x 50	47	O	S	765	N	K	N	Y	N	Y	Y	N	N	Blue Cream	Left Hand Door • Door and frame posts found to be in good condition • 1 No. side of door currently hardboarded over.	D - 1 F - 1	
GFD046A	1 No. pane / 4 No. panelled square framed door.	1000W x 2270H	745W x 960H	43 x 100 43 x 140 43 x 300	42	O	S	700	N	N	N	Y	N	Y	Y	Y	N	Blue Brown	Left Hand Door • Door and panelled frame found to be in fair condition • Remove temporary boarding • 1 No. pane requires replacing.	D - 1 F - 1	
GFD046B	2 No. pane combination frame with 3 No. panelled square framed door.	1690W x 2880H	730W x 2025H	75 x 50	45	M	S	700	N	N	N	Missing	N	N	Y	Y	N	Blue Brown	Left Hand Door • Damaged door and frame found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
GFD046C	9 No. pane / 3 No. panelled square framed hardwood door.	1140W x 2320H	1010W x 2250H	?	?	O	S	?	N	Missing	N	Y	N	Y	Y	N	N	Blue Hard wood	Left Hand Door • Remove timber security boards and make good minor damage • Door and frame posts found to be in good condition • 1 No. pane requires replacing.	D - 1 F - 1	

GFD047	42 No. pane combination frame with 2 No. x 2 No. pane / framed, ledged and battened hardwood doors.	3680W x 3870H	1075W x 2050H 760W x 1985H	75 x 75	45	O	M	800	Y	P	N	Y	N	N	Y	Y	N	Grey Grey	2 No. Left Hand Doors • Original combination frame has been adapt many times over the years, found to have 1 No. door permanently fixed the other is hanging of as a result of timber decay to the frame post • Further investigation required • Remove timber security boards and make good minor damage • 4 No. panes require replacing.	D - 2 F - 1	
GFD047A	Framed, ledged and battened double doors.	1295W x 1930H	610W x 1910H	235 x 50	50	O	D	1125	N	K	N	N	N	Y	Y	N	N	Grey Grey	Double Doors • Original utility doors and frame posts found to be in fair condition.	D - 1 F - 1	
GFD047B	32 No. paneled square framed hardwood sliding door.	n/a	2515W x 3100H	n/a	52	O	S	2460	N	P	N	N	N	Y	N	Y	N	Grey Grey Hard wood	Sliding Door • Original utility sliding door found to be in good condition • Localised timber decay to bottom of door • Remove timber security boards and make good minor damage • Clean out sliding channel and oil roller mechanism.	D - 2	
GFD048	5 No. panelled square framed hardwood door.	760W x 2075H	680W x 2030H	265 x 50	40	O	S	635	N	P	N	N	N	Y	Y	N	N	Hard wood	Left Hand Door • Door and frame found to be in good condition.	D - 1 F - 1	
GFD048A	5 No. panelled square framed hardwood door.	760W x 2075H	680W x 2030H	150 x 50	40	O	S	635	Y	K	N	Y	N	N	Y	N	N	Hard wood	Left Hand Door • Door and frame found to be in good condition.	D - 1 F - 1	
GFD049A	Flush solid core door.	830W x 2020H	760W x 1965H	100 x 50	45	M	S	700	Y	P	P	N	N	N	Y	N	N	White White	Left Hand Door • Door and frame found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
GFD049B	Flush hollow core door.	830W x 2020H	760W x 1965H	100 x 50	35	M	S	710	Y	P	P	N	N	N	Y	Y	N	White White	Right Hand Door • Door and frame found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
GFD049C	Flush hollow core door.	830W x 2020H	760W x 1970H	100 x 50	45	M	S	700	N	P	P	N	N	N	Y	N	N	White White	Left Hand Door • Door and frame found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
GFD049D	Flush hollow core door.	830W x 2020H	760W x 1980H	100 x 50	35	M	S	710	N	P	P	N	N	N	Y	N	N	White White	Right Hand Door • Door and frame found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
GFD050	Flush hollow core door.	830W x 2020H	760W x 1975H	100 x 50	45	M	S	700	Y	K	N	N	N	Y	Y	N	N	White White	Right Hand Door • Door and frame found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
GFD051	Flush hollow core door.	830W x 2020H	760W x 1980H	100 x 50	35	M	S	710	N	Y	P	N	N	N	Y	N	N	Grey Brown	Left Hand Door • Door and frame found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
GFD052	5 No. panelled square framed hardwood door.	840W x 2060H	755W x 2010H	115 x 50	42	O	S	705	Y	K	N	Y	N	Y	Y	N	N	Hard wood	Right Hand Door • Door found to be in good condition, left hand side frame post / architrave has swelled and is showing the first signs of timber decay • Further investigation required • Dry rot eradication work required likely as present in adjacent window frame and surround soffit.	D - 1 F - 2	
GFD052A	3 No. panelled square framed hardwood door.	940W x 2170H	860W x 2130H	75 x 50	45	O	S	810	N	K+P	N	Y	N	N	Y	N	N	Hard wood	Right Hand Door • Door and frame found to be in good condition • Door found to dropped and requires hinges oiling and refixing.	D - 1 F - 1	
First Floor																					
FFD001	5 No. panelled square framed door.	890W x 2070H	810W x 1985H	125 x 50	45	O	S	770	N	Missing	N	Missing	N	N	Y	N	N	Green Green	Right Hand Door • Door has had 30mm cut of the top of the door and been poorly refitted into original frame.	D - 3 F - 1	Remove Door Only
FFD002	Hardboard clad square framed door.	890W x 2070H	795W x 2000H	125 x 50	50	O	S	770	N	P	N	Missing	Y	N	Y	N	N	Green Pink	Left Hand Door • Door has had 30mm cut of the top of the door and been poorly refitted into original frame • Both sides of door have been clad in hardboard • 50mm x 50mm planted onto the side of the door • Top corner of the door has been cut off • Damage to right hand side architrave.	D - 3 F - 1	Remove Door Only
FFD003	Hardboard clad square framed door.	890W x 2070H	810W x 2000H	125 x 50	50	O	S	770	N	P	N	Y	Y	N	Y	N	N	Green Green	Right Hand Door • Door has had 30mm cut of the top of the door and been poorly refitted into original frame.	D - 3 F - 1	Remove Door Only
FFD004	Door frame only.	840W x 2070H	Missing	75 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Severe timber decay to the door frame post, head and architraves on the right hand side • Further investigation required • Dry rot eradication work required • Renewal of frame and door required.	D - 3 F - 3	Remove Door Remove Frame
FFD005	6 No. pane fanlight door frame only.	965W x 2795H	Missing	100 x 75	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Severe timber decay to the door fanlight frame • Further investigation required • Dry rot eradication work required • Renewal of frame and door required • Salvage 6 No. pane fanlight.	D - 3 F - 3	Remove Door Remove Frame
FFD006	Door frame only.	840W x 2070H	Missing	150 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Severe timber decay to the door frame post, head and architraves on the right hand side • Further investigation required • Dry rot eradication work required • Renewal of frame and door required.	D - 3 F - 3	Remove Door Remove Frame
FFD007	6 No. pane arch head combination door frame only.	1450W x 2450H 2565A	Missing	100 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Extensive damage to combination frame closing jamb • Remove timber security boards and make good minor damage • 3 No. panes require replacing.	D - 3 F - 2	Remove Door Only
FFD007A	Service duct double door frame only.	970W x 1070H	Missing	30 x 100	?	O	D	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Double Doors • Reinststate missing hardwood panel doors to service riser.	D - 3 F - 1	Remove Door Only
FFD007B	5 No. panelled square framed door in arch head frame.	1010W x 2130H 2210A	850W x 2100H	140 x 75	52	O	S	800	N	P	N	Y	N	N	Y	N	N	Green Green	Left Hand Door • Door has 1 No. side clad in hardboard • Damage to closing side frame post • Damage to left hand side architrave.	D - 1 F - 1	
FFD007C	6 No. pane arch head fanlight frame with 6 No. pane / 2 No. panelled square framed door.	940W x 2600H 2710A	830W x 2015H	115 x 50	48	O	S	770	N	P	N	Y	N	N	Y	N	N	Green Green	Left Hand Door • Both sides of door have been clad in hardboard • Door and frame found to be in fair condition with minor damage to both the door and frame • Remove timber security boards and make good minor damage • 2 No. pane requires replacing.	D - 1 F - 1	
FFD008	Door frame only.	910W x 2080H	Missing	75 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame post found with slight damage to the hinge areas.	D - 3 F - 1	
FFD009	Door frame only.	910W x 2080H	Missing	75 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame post found with slight damage to the top hinge area.	D - 3 F - 1	
FFD010	Door frame only.	910W x 2080H	Missing	75 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Timber decay to the door frame post, head and architraves on the right hand side • Further investigation required • Dry rot eradication work required • Renewal of frame and door required.	D - 3 F - 3	Remove Frame Only
FFD011	Door frame only.	910W x 2080H	Missing	125 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame posts found to be in good condition.	D - 3 F - 1	
FFD012	Door frame only.	910W x 2080H	Missing	75 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Timber decay to the door frame post, head and architraves on the right hand side • Further investigation required • Dry rot eradication work required • Renewal of frame and door required.	D - 3 F - 3	Remove Frame Only
FFD013	Door frame only.	910W x 2080H	Missing	125 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame posts found to be in good condition.	D - 3 F - 1	
FFD014	Door frame only.	910W x 2080H	Missing	125 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame post found with split and damage to hinge areas.	D - 3 F - 1	
FFD014A	8 No. pane fanlight frame with make ups and temporary flush hollow core door.	980W x 2660H	760W x 1945H	115 x 75	35	M	S	810	N	N	N	N	N	N	Y	Y	N	Natural Timber	Left Hand Door • Door of no significance and original frame found to be in poor condition and beyond economic repair • Salvage lights and renew fanlight frame and door.	D - 3 F - 2	
FFD015	Door frame only.	610W x 2060H	Missing	125 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame posts found to be in good condition.	D - 3 F - 1	
FFD016	Door frame only.	890W x 2060H	Missing	125 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame posts found with slight damage to the hinge and lock keeper areas.	D - 3 F - 1	

FFD017	Door frame only.	890W x 2060H	Missing	125 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame posts found with slight damage to the hinge and lock keeper areas.	D - 3 F - 1	
FFD017A	6 No. pane fanlight frame with make ups and temporary flush hollow core door.	980W x 2660H	760W x 1945H	115 x 75	35	M	S	810	N	N	N	N	N	N	Y	N	Y	Natural Timber	Left Hand Door • Door of no significance and original frame found to be in poor condition • Frame post found with damage to the lock keeper area.	D - 3 F - 2	
FFD018	Door frame only.	890W x 2060H	Missing	125 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame / posts found with slight damage to the hinge and head areas.	D - 3 F - 1	
FFD019	Door frame only.	890W x 2060H	Missing	125 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame posts found to be in good condition.	D - 3 F - 1	
FFD020	5 No. panelled square framed door.	890W x 2060H	810W x 2025H	125 x 50	40	O	S	785	N	K	N	Y	N	N	Y	N	N	Blue Mauve	Left Hand Door • Door found to be in good condition • Frame post found with damage to the lock keeper area.	D - 1 F - 1	
FFD021	Door frame only.	890W x 2060H	Missing	125 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame / posts found with slight damage to the hinge and head areas • Telecom wires fitted through the frame head.	D - 3 F - 1	
FFD022	5 No. panelled square framed door.	890W x 2060H	810W x 2025H	125 x 50	40	O	S	785	N	K	N	Y	N	N	Y	N	N	Mauve Mauve	Right Hand Door • Door found to be in good condition • Frame post found with slight damage to the lock keeper area • Telecom wires fitted through the frame head.	D - 1 F - 1	
FFD023	5 No. panelled square framed door.	890W x 2060H	810W x 2025H	125 x 50	40	O	S	785	N	K	N	Y	N	N	Y	N	N	White White	Right Hand Door • Door and frame found to be in good condition.	D - 1 F - 1	
FFD023A	6 No. pane fanlight frame with flush solid core door .	990W x 2790H	860W x 1985H	110 x 75	45	M	S	820	N	N	N	Y	N	N	Y	Y	N	Natural Timber	Right Hand Door • Door of no significance and original frame found to be in poor condition • Frame post found with damage to the lock keeper area • Telecom wires fitted through the frame head.	D - 3 F - 2	
FFD024	Flush hollow core door.	820W x 2025H	760W x 1980H	140 x 40	36	M	S	710	N	Y	N	N	Y	N	Y	N	N	White White	Left Hand Door • Door and frame found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
FFD025	5 No. panelled square framed door.	840W x 2060H	760W x 2025H	125 x 50	40	O	S	725	N	K	N	Y	N	Y	Y	N	N	White White	Right Hand Door • Door found to be in good condition • Frame post found with slight damage to the lock keeper area.	D - 1 F - 1	
FFD026	5 No. panelled square framed door.	890W x 2060H	810W x 2025H	125 x 50	40	O	S	785	Missing	K	N	Y	N	N	Y	N	N	Mauve Mauve	Left Hand Door • Door found to be in good condition • Frame post found with slight damage to the lock keeper area.	D - 1 F - 1	
FFD027	3 No. panelled square framed door.	610W x 2060H	530W x 2060H	125 x 50	40	O	S	495	N	K	N	Y	N	N	Y	N	N	Mauve Blue	Right Hand Door • Door and frame found to be in good condition.	D - 1 F - 1	
FFD028	Door frame only.	610W x 2060H	Missing	125 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame posts found with slight damage to the hinge and lock keeper areas.	D - 3 F - 1	
FFD029	Door frame only.	890W x 2060H	Missing	125 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame posts found to be in good condition.	D - 3 F - 1	
FFD030	5 No. panelled square framed door.	890W x 2075H	810W x 2025H	125 x 50	40	O	S	725	N	K	N	Y	N	N	Y	N	N	Mauve Mauve	Left Hand Door • Door found to be in good condition • Frame post found with slight damage to the lock keeper area.	D - 1 F - 1	
FFD030A	6 No. pane fanlight frame with flush solid core door .	900W x 2790H	800W x 1985H	110 x 75	45	M	S	820	N	N	N	Y	N	N	N	Y	N	Natural Timber	Left Hand Door • Severe timber decay to the door frame posts • Further investigation required • Dry rot eradication work required • Renewal of frame and door required.	D - 3 F - 3	
FFD031	3 No. panelled square framed door.	610W x 2040H	530W x 2000H	125 x 50	40	O	S	495	N	K	N	Y	N	N	Y	N	N	Green Blue	Right Hand Door • Door found to be in good condition • Slight damage found to right hand side architrave.	D - 1 F - 1	
FFD032	4 No. panelled square framed door fitted in stud wall.	n/a	760W x 1980H	100 x 75	36	O	S	?	N	Missing	N	Y	N	N	N	N	N	Mustard Tan	Left Hand Door • Door found to be in good condition set in redundant stud partition.	D - 3 F - 3	Remove Door Remove Frame
FFD033	Door frame only.	865W x 2045H	Missing	135 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame posts found to be in good condition • Slight damage found to architraves as a result of heavy traffic • Planted stop currently missing.	D - 3 F - 1	
FFD033A	Arcn head frame incorporating a pair of arched 6 No. pane / 1 No. panelled square framed double doors.	1450W x 2140H 2280A	650W x 2175H	145 x 100	45	O	D	1110	N	Missing	N	Y	N	N	Y	Y	N	Green Tan	Double Doors • Door found to be in good condition	D - 1 F - 1	
FFD034	1 No. pane / 3 No. panelled square framed door.	835W x 2010H	705W x 1960H	75 x 50	35	O	S	665	N	K	N	Y	N	N	Y	Y	N	Green Purple	Right Hand Door • Boarded / glazed door set in modern stud partition of no significance.	D - 3 F - 3	Remove Door Remove Frame
FFD035	1 No. pane / 3 No. panelled square framed door.	900W x 2070H	805W x 2010H	75 x 50	40	O	S	740	N	Missing	N	Y	N	N	Y	Y	N	Green Brown	Left Hand Door • Adapted door set in modern stud partition of no significance.	D - 3 F - 3	Remove Door Remove Frame
FFD036	5 No. panelled square framed door.	825W x 2020H	755W x 1985H	100 x 50	40	O	S	700	N	K	N	Y	N	Y	Y	N	N	Salmon Salmon	Right Hand Door • Door and frame found to be in good condition set in modern opening of no significance.	D - 1 F - 3	Remove Frame Only
FFD037	4 No. panelled square framed door.	815W x 2020H	755W x 1985H	100 x 50	35	O	S	700	N	Missing	N	Y	N	N	Y	N	N	Green Tan	Left Hand Door • Boarded / glazed door set in modern stud partition of no significance.	D - 3 F - 3	Remove Door Remove Frame
FFD038	Framed, ledged and battened door.	730W x 1950H	630W x 1950H	100 x 50	48	O	S	565	N	N	N	N	N	Y	Y	N	N	Green Tan	Right Hand Door • Utility door set in modern stud partition of no significance.	D - 3 F - 3	Remove Door Remove Frame
FFD039	6 No. pane / 1 No. battened panelled square framed door.	855W x 2105H	755W x 2055H	100 x 50	48	O	S	725	N	K	N	Y	N	N	Y	Y	N	Blue Tan	Left Hand Door • Glazed door set in modern stud partition of no significance.	D - 1 F - 3	Remove Frame Only
FFD040	3 No. pane / 2 No. panelled square framed door.	925W x 2095H	825W x 2045H	100 x 50	48	O	S	?	N	Missing	N	?	N	N	Y	Y	N	Orange Tan	Left Hand Door • Glazed door set in modern stud partition of no significance. • Door currently sealed up.	D - 1 F - 3	Remove Frame Only
FFD041	5 No. panelled square framed door in arch opening.	925W x 2125H 2170A	755W x 2015H	115 x 75	40	O	S	710	N	K	N	Y	N	N	Y	N	N	Blue Blue	Right Hand Door • Door found to be in good condition • Slight damage found to right hand side architrave • Telecom wires / cables fitted through the frame head.	D - 1 F - 1	
FFD043	5 No. panelled square framed door.	910W x 2060H	810W x 2010H	125 x 50	47	O	S	760	N	K	N	Y	N	N	Y	N	N	Brown White	Left Hand Door • Door found to be in good condition • 1 No. side of door has been clad in hardboard • Telecom wires / cables fitted to side of the frame.	D - 1 F - 1	
FFD044	5 No. panelled square framed door.	910W x 2060H	810W x 2020H	125 x 50	42	O	S	765	N	Missing	N	Y	N	N	Y	N	N	Brown Beige	Left Hand Door • Door found to be in good condition • Slight damage found to the frame head.	D - 1 F - 3	Remove Frame Only
FFD045	5 No. panelled square framed door.	860W x 2070H	760W x 2020H	125 x 50	42	O	S	740	N	P	N	N	Y	N	Y	N	N	Green Brown	Left Hand Door • Door found to be in good condition • Frame found to be of no significance.	D - 1 F - 3	Remove Frame Only
FFD046	5 No. panelled square framed door.	910W x 2070H	810W x 2020H	125 x 50	42	O	S	760	N	K	N	Y	N	N	Y	N	N	Brown Brown	Left Hand Door • Door found to be in good condition • Frame found with slight damage to the head, hinge and lock keeper area.	D - 1 F - 1	
FFD046A	Flush hollow core door.	760W x 2010H	680W x 1970H	150 x 40	45	M	S	650	N	P	N	N	Y	N	Y	N	N	Brown Brown	Left Hand Door • Door and frame found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
FFD046B	6 No. pane fanlight frame with 6 No. pane / 2 No. panelled square framed door.	1010W x 2070H	810W x 2020H	115 x 75	50	O	S	815	N	K	N	Y	N	Y	Y	Y	N	Green Brown	Right Hand Door • Door and frame found to be in poor condition • Frame post found with damage to the lock keeper area • 1 No. pane requires replacing.	D - 1 F - 1	
FFD047	5 No. panelled square framed door.	910W x 2060H	810W x 2010H	75 x 50	53	O	S	775	N	P	N	Y	N	N	Y	N	N	Brown Brown	Right Hand Door • Door and frame found to be in good condition • 1 No. side of door has been clad in hardboard • Telecom wires / cables fitted to side of the frame.	D - 1 F - 1	
FFD048	5 No. panelled square framed door.	910W x 2070H	810W x 2020H	125 x 50	42	O	S	740	N	P	N	Y	N	N	Y	N	N	Brown Brown	Left Hand Door • Door found to be in good condition • Damage found to architrave near top hinge • Frame has slight damage to edges as a result of heavy traffic.	D - 1 F - 1	
FFD049	Door frame only.	910W x 2070H	Missing	75 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing currently in storage • Frame found with slight damage to the hinge area.	D - 3 F - 1	
FFD050	3 No. panelled square framed door.	625W x 2080H	525W x 2030H	125 x 50	42	O	S	480	N	K	N	Y	N	Y	Y	N	N	Brown Brown	Right Hand Door • Door found to be in good condition • Frame found with slight damage to the closing jamb • Telecom wires / cables fitted to side of the frame	D - 1 F - 1	

FFD051	Door frame only.	910W x 2080H	Missing	125 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing currently in storage • Frame has slight damage to edges as a result of heavy traffic • Telecom wires / cables and bell fitted to side of the frame.	D - 3 F - 1	
FFD051A	Door frame only.	910W x 2080H	Missing	75 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing currently in storage • Frame has slight damage to edges as a result of heavy traffic • Telecom wires / cables fitted to side of the frame.	D - 3 F - 1	
FFD051B	Door frame only.	880W x 2050H	Missing	75 x 40	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing currently in storage • Frame found to be of no significance.	D - 3 F - 3	Remove Frame Only
FFD051C	6 No. pane fanlight frame with 6 No. pane / 2 No. panelled square framed door	1010W x 2060H	860W x 1990H	115 x 75	50	O	S	815	Y	K	N	Y	N	Y	Y	Y	N	Green Blue	Right Hand Door • Door and frame found to be in poor condition • Frame post found with damage to the lock keeper area.	D - 1 F - 1	
FFD052	Door frame only.	910W x 2080H	Missing	75 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame post found with damage to the lock keeper area • Telecom wires / cables fitted to side of the frame.	D - 3 F - 1	
FFD053	5 No. panelled square framed door	825W x 2080H	725W x 2015H	75 x 50	42	O	S	670	N	K	N	Y	N	N	Y	N	N	Orange Beige	Right Hand Door • Door found to be in good condition • Frame post found with damage to the lock keeper area.	D - 1 F - 1	
FFD054	5 No. panelled square framed door	860W x 2080H	760W x 2020H	125 x 50	40	O	S	710	N	K	N	Y	N	Y	Y	N	N	Brown Purple	Left Hand Door • Door found to be in good condition • Frame found to be of no significance.	D - 1 F - 1	
FFD055	Door frame only.	910W x 2060H	810W x 2010H	75 x 50	48	O	S	?	N	K	N	Y	N	N	Y	N	N	Brown White	Left Hand Door • Door and frame posts found to be in good condition • Telecom wires / cables fitted to side of the frame.	D - 1 F - 1	
FFD056	Door frame only.	910W x 2060H	Missing	75 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame post found with slight damage to the hinge area • Telecom wires / cables fitted to side of the frame.	D - 3 F - 1	
FFD057	3 No. pane fanlight frame with temporary plywood sheet door	990W x 2600H	840W x 2090H	125 x 75	n/a	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Severe timber decay to the door frame posts • Further investigation required • Dry rot eradication work required • Renewal of frame and door required • Salvage fanlight	D - 3 F - 3	
FFD057A	5 No. panelled square framed door	840W x 2030H	740W x 1980H	?	42	O	S	?	N	Missing	N	Missing	Y	Y	Y	N	N	Brown ?	Right Hand Door • Door and frame posts found to be in good condition.	D - 1 F - 1	
FFD057B	Flush hollow core door.	725W x 1970H	625W x 1920H	150 x 50	38	M	S	580	Y	K	K	Y	N	N	Y	N	N	Green Brown	Right Hand Door • Door and frame found to be of no significance • Severe timber decay to the left hand side door frame post • Further investigation required • Dry rot eradication work required • Renewal of frame and door required	D - 3 F - 3	Remove Door Remove Frame
FFD057C	Flush hollow core door.	725W x 1970H	625W x 1910H	115 x 50	38	M	S	580	N	N	N	N	N	Y	Y	N	N	Green Green	Right Hand Door • Door and frame found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
FFD058	Door frame only.	910W x 2080H	Missing	125 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame post found with slight damage to the hinge areas • Telecom wires / cables fitted to side of the frame.	D - 3 F - 1	
FFD059	Door frame only.	910W x 2080H	Missing	125 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame post found with damage to the lock keeper area • Telecom wires / cables fitted to side of the frame.	D - 3 F - 1	
FFD060	Door frame only.	910W x 2080H	Missing	75 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame post found with slight damage to the hinge areas • Telecom wires / cables fitted to side of the frame.	D - 3 F - 1	
FFD061	4 No. panelled square framed door.	910W x 2080H	810W x 2030H	75 x 50	50	O	S	760	N	Missing	Y	Missing	N	Y	Y	N	N	Blue Purple	Right Hand Door • Door found to be in good condition • Frame found with slight damage to the head area • Telecom wires / cables fitted to side of the frame • Remove timber security boards and make good minor damage	D - 1 F - 1	
FFD062	4 No. panelled square framed door.	900W x 2080H	750W x 2045H	42 x 75 42 x 100	42	O	S	690	N	Missing	N	N	N	Y	Y	N	N	Blue Blue	Right Hand Door • Door and frame posts found to be in good condition.	D - 1 F - 1	
FFD063	Door frame only.	910W x 2080H	Missing	125 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Telecom wires / cables fitted through the frame.	D - 3 F - 1	
FFD064	4 No. panelled square framed door.	810W x 1975H	710W x 1925H	85 x 50	35	O	S	670	N	K	N	N	Y	N	Y	N	N	Lemon Purple	Right Hand Door • Door and frame posts found to be in good condition.	D - 1 F - 1	
FFD065	Door frame only.	910W x 2080H	Missing	75 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Telecom wires / cables fitted through the frame.	D - 3 F - 1	
FFD066	Flush hollow core door.	840W x 2045H	760W x 1995H	100 x 50	45	M	S	710	N	P	N	Y	N	N	Y	N	N	Blue Beige n/a	Right Hand Door • Door and frame found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
FFD067	Door frame only.	910W x 2080H	Missing	175 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame post found with damage to the lock keeper area • Shelf and curtain rail fitted to top of the frame.	D - 3 F - 1	
FFD067A	Door frame only.	910W x 2080H	Missing	125 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame post found with slight damage to the lock keeper area • Loose head architrave to top of the frame • Telecom wires / cables fitted through the frame	D - 3 F - 1	
FFD067B	5 No. panelled square framed door.	860W x 2080H	760W x 2030H	125 x 50	45	O	S	710	N	K	N	Y	N	N	Y	N	N	Blue Cream	Right Hand Door • Door found to be in good condition • Frame post found with damage to the lock keeper area • Telecom wires / cables fitted through the frame.	D - 1 F - 1	
FFD068	Door frame only.	910W x 2080H	Missing	75 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame post found with slight damage to the lock keeper area • Telecom wires / cables fitted through the frame.	D - 3 F - 1	
FFD069	16 No. pane combination frame with hardboard clad 5 No. panelled square framed door	1550W x 2080H	780W x 2030H	?	?	O	S	?	N	Missing	N	Y	N	N	Y	N	N	Brown Blue	Left Hand Door • Door found to be in good condition • 1 No. side of door has been clad in hardboard • Frame post found with damage to the lock keeper area • 1 No. pane requires replacing.	D - 1 F - 1	
FFD070	6 No. pane / 3 No. panelled square framed door in arch opening	1010W x 2150H 2200A	885W x 2030H	125 x 50	50	O	S	?	N	Missing	N	Y	N	N	Y	N	N	Blue ?	Left Hand Door • Door found with severe damage to the stile lock area • Frame posts found to be in good condition.	D - 1 F - 1	
FFD071	Flush hollow core door.	840W x 2020H	760W x 1980H	125 x 50	45	M	S	700	N	P	N	Y	N	N	Y	N	N	Blue Blue	Right Hand Door • Door and frame found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
FFD071A	5 No. panelled bow framed hardwood pole door.	900Dia x 2070H	965W x 2020H	105 x 50	45	O	S	640	Y	Missing	N	Y	N	Missing	Y	N	N	Hard wood	Right Hand Door • Door found to be nailed shut • Door and frame found with slight damage to the stile lock / keeper area.	D - 1 F - 1	
FFD072	Flush hollow core door.	855W x 2020H	755W x 1970H	100 x 50	42	M	S	710	N	P	N	Y	N	N	Y	N	N	Green Brown	Right Hand Door • Door found to be of no significance • Frame posts found to be in good condition • Telecom wires / cables fitted through the frame.	D - 3 F - 1	Remove Door Only
FFD072A	6 No. pane fanlight frame with 6 No. pane / 2 No. panelled square framed door	1010W x 2060H	860W x 1990H	115 x 75	50	O	S	815	Y	Missing	N	Y	N	Y	Y	Y	N	Green Brown	Left Hand Door • Door and frame found to be in poor condition • Frame post found with damage to the lock keeper area • Telecom wires / cables fitted through the frame.	D - 1 F - 1	
FFD072B	Flush hollow core door.	935W x 2030H	835W x 1980H	125 x 50	45	M	S	780	N	P	N	Y	N	N	Y	N	N	Green Red n/a	Left Hand Door • Door found to be of no significance • Frame post found with slight damage to the lock keeper area.	D - 3 F - 3	Remove Door Remove Frame
FFD073	Door frame only.	935W x 2030H	835W x 1980H	100 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Dual Action Single Door • Door missing completely • Frame posts found to be in good condition.	D - 3 F - 1	
FFD074	Flush hollow core door.	855W x 2020H	755W x 1970H	100 x 50	42	M	S	710	N	Missing	N	Y	N	N	Y	N	N	Brown Brown	Right Hand Door • Door found to be of no significance • Frame posts found to be in good condition.	D - 3 F - 1	Remove Door Only
FFD074A	5 No. panelled bow framed hardwood pole door.	900Dia x 2070H	965W x 2020H	105 x 50	45	O	S	640	Y	Missing	N	Y	N	Missing	Y	N	N	Hard wood	Right Hand Door • Door and frame found to be in good condition • Door found to be nailed shut.	D - 1 F - 1	
FFD074B	Flush hollow core door.	800W x 2030H	700W x 1980H	100 x 50	45	M	S	650	N	N	N	N	N	Y	Y	N	N	Brown Brown	Right Hand Door • Door and modern stud partition of no significance.	D - 3 F - 3	Remove Door Remove Frame

FFD075	Flush hollow core door.	855W x 2020H	755W x 1970H	100 x 50	45	M	S	710	N	P	N	Y	N	N	Y	N	N	Brown Brown	Right Hand Door • Door and modern stud partition of no significance.	D - 3 F - 3	Remove Door Remove Frame
FFD075A	1No. pane fanlight frame with 6 No. pane / 2 No. panelled square framed door .	860W x 2540H	775W x 2030H	100 x 50	45	O	S	715	N	K	N	Y	N	N	Y	Y	N	Green Brown	Left Hand Door • Door and frame found to be in poor condition • Severe timber decay to the right hand side door frame post • Further investigation required • Dry rot eradication work required • Renewal of frame and door required.	D - 3 F - 3	
FFD075B	5 No. pane combination frame with flush hollow core door	910W x 2080H	810W x 2030H	75 x 50	45	M	S	?	N	P	N	Y	N	N	Y	N	N	Beige Brown	Right Hand Door • Door and modern stud partition of no significance.	D - 3 F - 3	Remove Door Remove Frame
FFD076	Dual action 1 No. pane flush hollow core door.	820W x 2005H	720W x 1955H	100 x 50	50	M	S	660	N	N	N	N	N	N	Y	Y	N	Beige Brown	Dual Action Single Door • Door found to be of no significance • Frame posts found to be in good condition.	D - 3 F - 1	Remove Door Only
FFD076A	5 No. panelled bow framed hardwood pole door.	900Dia x 2070H	965W x 2020H	105 x 50	45	O	S	640	N	Missing	N	Missing	N	Y	Y	N	N	Hard wood	Right Hand Door • Door and frame found to be in fair condition • Door found to be nailed shut • Door and frame found with slight damage to the stile lock / keeper area • Reinststate damaged bottom bow panel.	D - 2 F - 1	
FFD077	Flush hollow core door.	855W x 2030H	755W x 1980H	100 x 50	45	M	S	710	N	P	N	Y	N	N	Y	N	N	Beige White	Left Hand Door • Door and frame found to be of no significance • Severe timber decay to the right hand side door frame post • Further investigation required • Dry rot eradication work required • Renewal of frame and door required.	D - 3 F - 3	Remove Door Remove Frame
FFD078	Flush hollow core door.	855W x 2030H	755W x 1980H	100 x 50	45	M	S	710	N	Missing	N	Missing	N	N	Y	N	N	Brown Brown	Right Hand Door • Door found to be of no significance • Frame post found with slight damage to the lock keeper area • Telecom wires / cables fitted to side of the frame.	D - 3 F - 1	Remove Door Only
FFD079	Flush hollow core door.	855W x 2030H	755W x 1980H	100 x 50	45	M	S	710	N	P	N	Y	N	N	Y	N	N	Brown Brown	Right Hand Door • Door found to be of no significance • Frame post found with slight damage to the lock keeper area • Telecom wires / cables fitted to side of the frame.	D - 3 F - 1	Remove Door Only
FFD079A	1No. pane fanlight frame with 6 No. pane / 2 No. panelled square framed door .	1010W x 2060H	860W x 1990H	115 x 75	50	O	S	815	N	K	N	Y	N	N	Y	Y	N	Green Brown	Left Hand Door • Door and frame found to be in fair condition • Frame posts found with slight damage.	D - 1 F - 1	
FFD080	Flush hollow core door.	820W x 1970H	735W x 1920H	115 x 50	50	M	S	685	N	K	N	Y	N	N	Y	N	N	Brown Brown	Left Hand Door • Door found to be of no significance • Frame / post found with slight damage to the head and lock keeper area.	D - 3 F - 1	Remove Door Only
FFD081	Flush hollow core door.	870W x 2085H	785W x 2015H	115 x 50	50	M	S	725	N	K	N	Y	N	N	Y	N	N	Brown Brown	Right Hand Door • Door found to be in poor condition • 1 No. side of door has been clad in hardboard • Middle panel found to be split and beading missing • Frame found with slight damage to the head	D - 2 F - 1	
FFD082	Door frame only.	910W x 2080H	810W x 2030H	125 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame post found with slight damage to the lock keeper area.	D - 3 F - 1	
FFD083	Door frame with 75x50mm inserts only.	910W x 2080H	810W x 2030H	75 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame post found with slight damage to the hinge area.	D - 3 F - 1	
FFD083A	6 No. pane fanlight frame with 6 No. pane / 2 No. panelled square framed door	1010W x 2080H	860W x 2020H	115 x 75	50	O	S	815	N	K	N	Y	N	N	Y	Y	N	Green Green	Right Hand Door • Door and frame found to be in good condition.	D - 1 F - 1	
FFD083B	3 No. panelled square framed door.	630W x 2085H	530W x 2035H	150 x 50	40	O	S	490	N	K	N	Y	N	Y	Y	N	N	Green Green	Left Hand Door • Door and frame found to be in good condition.	D - 1 F - 1	
FFD084	5 No. panelled square framed door.	860W x 2070H	760W x 2020H	125 x 50	40	O	S	710	N	K	N	Y	N	Y	Y	N	N	Brown Blue	Right Hand Door • Door and frame found to be in good condition.	D - 1 F - 1	
FFD085	1 No. pane flush hollow core door.	840W x 2025H	760W x 1985H	100 x 50	45	M	S	715	N	Missing	N	N	Missing	N	Y	N	N	White White	Left Hand Door • Door and frame found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
FFD085A	5 No. panelled bow framed hardwood pole door.	900Dia x 2070H	965W x 2020H	105 x 50	45	O	S	640	N	Missing	N	Missing	N	Missing	Y	N	N	White	Right Hand Door • Door and frame found to be in fair condition • Door found to be nailed shut • Door found with damage to the stile lock area • Carry out sympathetic repair to door of significance.	D - 2 F - 1	
FFD085B	Door frame only.	860W x 2070H	Missing	100 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame found to be of no significance.	D - 3 F - 3	Remove Frame Only
FFD086	Flush hollow core door.	860W x 2025H	760W x 1975H	100 x 50	45	M	S	705	N	K	N	N	N	Missing	Y	N	N	Blue Blue	Right Hand Door • Door and frame found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
FFD087	Flush hollow core door.	910W x 2080H	810W x 2030H	?	?	M	S	?	N	Missing	N	Y	N	N	Y	N	N	Beige ?	Right Hand Door • Door and frame found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
FFD087A	5 No. panelled bow framed hardwood pole door.	900Dia x 2070H	965W x 2020H	105 x 50	45	O	S	640	N	Missing	N	Missing	N	Y	Y	N	N	Beige	Left Hand Door • Door and frame found to be in good condition • Door found to be nailed shut • Door found with slight damage to the closing stile • Carry out sympathetic repair to door of significance.	D - 2 F - 1	
FFD087B	Flush hollow core door.	910W x 2080H	810W x 2030H	?	?	M	S	?	N	P	N	Y	N	N	Y	N	N	Blue ?	Right Hand Door • Door and frame found to be of no significance.	D - 3 F - 3	
FFD088	Flush hollow core door.	910W x 2080H	810W x 2030H	75 x 50	45	M	S	750	N	Missing	N	Missing	N	N	Y	N	N	Green Beige	Left Hand Door • Door and frame found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
FFD088A	6 No. pane fanlight frame with 6 No. pane / 2 No. panelled square framed door	1010W x 2080H	860W x 2020H	115 x 75	40	O	S	815	N	K	N	Y	N	Y	Y	Y	N	Green Green	Right Hand Door • Door and frame found to be in good condition • Remove timber plywood strips and make good minor damage.	D - 1 F - 1	
FFD088B	Flush hollow core door.	910W x 2080H	810W x 2030H	75 x 50	45	M	S	750	N	P	N	Y	N	N	Y	N	N	Blue Green	Right Hand Door • Door and frame found to be of no significance • Frame post found with slight damage to the closing jamb.	D - 3 F - 1	Remove Door Only
FFD089	Flush hollow core door.	910W x 2080H	810W x 2030H	100 x 50	45	M	S	750	N	P	N	Missing	N	N	Y	N	N	Beige Beige	Left Hand Door • Door and frame found to be of no significance.	D - 3 F - 1	Remove Door Only
FFD090	Flush hollow core door.	910W x 2080H	810W x 2030H	100 x 50	45	M	S	750	N	P	N	Missing	N	N	Y	N	N	Beige Beige	Left Hand Door • Door and frame found to be of no significance.	D - 3 F - 1	Remove Door Only
FFD090A	Flush hollow core door.	910W x 2080H	810W x 2030H	125 x 50	45	M	S	750	N	K	N	Y	N	N	Y	N	N	Beige Beige	Right Hand Door • Door and frame found to be of no significance.	D - 3 F - 1	Remove Door Only
FFD090B	Flush hollow core door.	860W x 2025H	760W x 1975H	100 x 50	45	M	S	710	N	P	N	N	N	Missing	Y	N	N	Beige Beige	Left Hand Door • Door and frame found to be of no significance.	D - 3 F - 1	Remove Door Only
FFD090C	Door frame only.	910W x 2080H	810W x 2030H	150 x 50	?	M	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Missing	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame found to be of no significance.	D - 3 F - 1	
FFD090D	4 No. pane fanlight frame with 6 No. pane / 2 No. panelled square framed door	910W x 2080H	810W x 2030H	100 x 50	50	O	S	750	Y	Missing	N	Y	N	N	Y	Y	N	Blue Green	Right Hand Door • Door and frame found to be of no significance.	D - 1 F - 1	
FFD091	Dual action flush hollow core door.	910W x 2080H	810W x 2030H	110 x 50	45	M	S	795	N	N	Missing	N	N	N	Y	Y	N	Beige Blue	Dual Action Single Door • Door and frame found to be of no significance.	D - 3 F - 1	Remove Door Only
FFD091A	Flush hollow core door.	840W x 2020H	760W x 1975H	100 x 50	45	M	S	710	N	Missing	N	N	N	Missing	Y	N	N	Blue Blue	Right Hand Door • Door and frame found to be of no significance.	D - 3 F - 1	Remove Door Only
FFD091B	Flush hollow core door.	840W x 2020H	760W x 1975H	100 x 50	45	M	S	710	N	P	N	N	N	Missing	Y	N	N	Blue Blue	Left Hand Door • Door and frame found to be of no significance.	D - 3 F - 1	Remove Door Only
FFD091C	Door frame only.	840W x 2020H	Missing	100 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame found to be in good condition.	D - 3 F - 1	
FFD092	5 No. panelled square framed door.	910W x 2080H	810W x 2020H	75 x 50	40	O	S	760	N	Missing	N	Y	N	N	Y	N	N	Beige Beige	Right Hand Door • Door found to be in good condition • Frame posts / linings found with damage to both sides.	D - 1 F - 1	
FFD092A	5 No. panelled bow framed hardwood pole door.	900Dia x 2070H	965W x 2020H	105 x 50	45	O	S	640	N	Missing	N	Missing	N	Y	Y	N	N	Beige	Left Hand Door • Door found to be in good condition • Door found to be nailed shut • Frame / architrave found with slight damage to the head and closing jamb • Carry out sympathetic repair to door and frame of significance.	D - 2 F - 1	

FFD092B	5 No. panelled bow framed hardwood pole door.	900Dia x 2070H	965W x 2020H	105 x 50	45	O	S	640	Y	Missing	N	Missing	N	Y	Y	N	N	Beige	Left Hand Door • Door found with damage to the closing stile • Door found to be nailed shut • 1 No. bottom left hand side panel found to be cracked • Frame found to be in good	D - 2 F - 1	
FFD093	Flush hollow core door.	910W x 2080H	810W x 2020H	75 x 50	45	M	S	750	N	P	N	Y	N	N	Y	N	N	Beige Blue	Right Hand Door • Door found to be of no significance • Frame post found to be split near lock keeper • Architrave found to be loose	D - 3 F - 1	Remove Door Only
FFD093A	6 No. pane fanlight frame with 6 No. pane / 2 No. panelled square framed door	1010W x 2080H	860W x 2020H	115 x 75	50	O	S	800	N	K	N	Y	N	Y	Y	Y	N	Blue Green	Left Hand Door • Door found to be in poor condition with damage from fire training • Frame posts found to be in good condition • 1 No. pane requires replacing.	D - 3 F - 1	
FFD094	5 No. panelled square framed door.	750W x 2020H	650W x 1975H	125 x 50	40	O	S	600	N	N	N	N	N	Y	Y	N	N	Beige Beige	Right Hand Door • Door and frame found to be in good condition • Architrave plinth blocks found to be damaged.	D - 1 F - 1	
FFD095	5 No. panelled square framed door.	860W x 2025H	760W x 1975H	75 x 50	42	M	S	710	N	K	N	Y	N	N	Y	N	N	Beige Beige	Left Hand Door • Door found to be in good condition • Frame post found with slight damage to the lock keeper area • 1 No. pane requires replacing.	D - 1 F - 1	
FFD095A	5 No. panelled square framed door.	910W x 2080H	810W x 2020H	75 x 50	42	M	S	760	N	K	N	Y	N	N	Y	N	N	Blue Blue	Left Hand Door • Door found to be in good condition • Localised timber decay to frame head and left hand side post • Further investigation required • Renewal of frame required.	D - 1 F - 2	
FFD096	5 No. panelled square framed door.	910W x 2080H	810W x 2020H	115 x 50	42	O	S	760	N	Missing	N	Y	N	N	Y	N	N	Blue Blue	Right Hand Door • Door found to be in good condition • Severe timber decay to the door frame posts • Further investigation required • Dry rot eradication work required • Renewal of frame required	D - 1 F - 3	Remove Frame Only
FFD097	5 No. panelled square framed door.	860W x 2080H	760W x 2020H	115 x 50	42	O	S	760	N	Missing	N	Y	N	N	Y	N	N	Beige Beige	Left Hand Door • Door found to be in good condition • Severe timber decay to the door frame posts • Further investigation required • Dry rot eradication work required • Renewal of frame required	D - 1 F - 3	Remove Frame Only
FFD098	5 No. panelled square framed door.	910W x 2060H	810W x 2010H	125 x 50	40	O	S	770	N	Missing	N	Missing	N	N	Y	N	N	Green Green	Left Hand Door • Door found with top corner cut off • Frame post found with damage to the closing jamb lock keeper area.	D - 3 F - 1	Remove Door Only
FFD099	Door frame only.	910W x 2080H	Missing	125 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame / post found with slight damage to the head and closing jamb lock keeper area.	D - 3 F - 1	
FFD100	5 No. panelled square framed door.	910W x 2080H	810W x 2015H	125 x 50	40	O	S	760	N	Missing	N	Missing	N	N	Y	N	N	Green Green	Right Hand Door • Door found with top corner cut off • Frame post found with slight damage to the closing jamb lock keeper area • Telecom wires / cables fitted to side of the frame	D - 3 F - 1	Remove Door Only
FFD101	3 No. panelled square framed door.	625W x 2080H	525W x 2020H	125 x 50	40	O	S	480	N	Missing	N	Missing	N	N	Y	N	N	Green Salmon	Right Hand Door • Door found to be in good condition • Frame post found with slight damage to the closing jamb lock keeper area.	D - 1 F - 1	
FFD102	Door frame only.	860W x 2080H	Missing	125 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame posts found with slight damage to the hinge and closing jamb lock keeper area.	D - 3 F - 1	
FFD103	4 No. panelled square framed door	900W x 2080H	800W x 2030H	100 x 50	45	O	S	740	Y	K	N	Y	N	Y	Y	N	N	Tan Red	Left Hand Door • Door set in modern stud partition of no significance.	D - 3 F - 3	Remove Door Remove Frame
FFD104	6 No. pane / 3 No. panelled square framed door.	1040W x 2140H 2210A	960W x 2100H	75 x 50	48	O	S	910	Y	Missing	N	Y	N	N	Y	Y	N	Blue Blue	Left Hand Door • Door and frame found to be in good condition • 1 No. pane requires replacing • Architrave found to be missing to the closing jamb and head.	D - 1 F - 2	
FFD105	5 No. panelled square framed door.	785W x 2080H	685W x 2030H	115 x 50	42	O	S	630	N	P+K	N	Y	N	N	Y	N	N	Blue Cream	Right Hand Door • Door found to be in good condition • Frame post found with slight damage to the closing jamb lock keeper area.	D - 1 F - 1	
Second Floor																					
SFD001	5 No. panelled square framed door.	910W x 2060H	810W x 2010H	115 x 50	42	O	S	770	N	Missing	N	Y	N	N	Y	N	N	Grey Grey	Left Hand Door • Door found with top corner cut off • Bottom left hand panel / rail found to be split and beading missing • Frame found to be in good condition.	D - 3 F - 1	Remove Door Only
SFD002	Door frame only.	910W x 2060H	810W x 2010H	75 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame posts found with damage to the closing jamb lock keeper area • Architrave found to be loose to the head • Remove cable clips fitted to side of the frame.	D - 3 F - 1	
SFD003	Door frame only.	860W x 2060H	730W x 2020H	75 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame posts found with slight damage to the hinge areas • Splits to the lining found further investigation required • Conduit / cables fitted to head of the frame	D - 3 F - 2	
SFD004	Door frame only.	910W x 2070H	810W x 2020H	75 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame posts found with slight damage to the hinge and closing jamb lock keeper areas.	D - 3 F - 1	
SFD005	1No. pane fanlight frame with flush hollow core door.	840W x 2860H	760W x 1965H	100 x 50	40	M	S	710	N	P	N	N	Y	N	Y	Y	N	White White	Left Hand Door • Door and frame found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
SFD005A	6 No. pane fanlight frame with 6 No. pane / 2 No. panelled square framed door	1000W x 2780H	825W x 1930H	115 x 50	50	O	S	770	N	K	N	Y	N	N	Y	Y	N	Green White	Right Hand Door • Severe timber decay to the door fanlight frame • Further investigation required • Dry rot eradication work required • Renewal of frame and door required • Salvage 6 No. pane fanlight.	D - 3 F - 3	
SFD006	5 No. panelled square framed door.	910W x 2080H	810W x 2025H	75 x 50	42	O	S	880	N	Missing	N	Missing	N	N	Y	N	N	White White	Left Hand Door • Door found with top corner cut off • Frame found to be in good condition • Telecom wires / cables fitted through the frame.	D - 3 F - 1	Remove Door Only
SFD007	Door frame only.	910W x 2080H	810W x 2030H	125 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame post found with severe damage to the closing jamb • Frame post found with slight damage to the hinge areas.	D - 3 F - 3	Remove Frame Only
SFD008	5 No. panelled square framed door.	860W x 2080H	760W x 2030H	125 x 50	42	O	S	725	N	Missing	N	Missing	N	N	Y	N	N	White White	Right Hand Door • Door and frame found to be in good condition • 1 No. side of door has been clad in hardboard • Full set of architraves found to be missing to 1 No. side.	D - 1 F - 2	
SFD008A	Door frame only.	860W x 2080H	760W x 2030H	125 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	Right Hand Door • Door missing completely • Frame posts found with slight damage to the closing jamb lock keeper areas.	D - 3 F - 1	
SFD008B	6 No. pane combination frame only.	910W x 2080H	810W x 2030H	100 x 75	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	Left Hand Door • Door missing completely • Frame posts found to be in good condition.	D - 3 F - 1	
SFD009	Door frame only.	910W x 2080H	810W x 2030H	75 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	Right Hand Door • Door missing completely • Frame posts found with damage to the top hinge / architrave area.	D - 3 F - 1	
SFD010	5 No. panelled square framed door.	910W x 2080H	810W x 2030H	75 x 50	42	O	S	725	N	Missing	N	Missing	N	N	Y	N	N	White L. Blue	Left Hand Door • Door found to be in good condition • Frame post found with slight damage to the closing jamb lock keeper area • Conduit / cables fitted to head of the frame	D - 1 F - 1	
SFD011	5 No. panelled square framed door.	910W x 2080H	810W x 2030H	125 x 50	42	O	S	770	N	Missing	N	Missing	N	N	Y	N	N	Salmon L. Blue	Left Hand Door • Door found to be in good condition • Frame post found with slight damage to the closing jamb lock keeper area.	D - 1 F - 1	
SFD012	2 No. pane fanlight frame only.	910W x 2080H	810W x 2030H	100 x 75	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	Right Hand Door • Door missing completely • Frame posts found with severe damage to the bottom top hinge area.	D - 3 F - 3	Remove Frame Only
SFD013	5 No. panelled square framed door.	860W x 2080H	760W x 2030H	125 x 50	42	O	S	710	N	Missing	N	Missing	N	N	Y	N	N	White L. Blue	Right Hand Door • Door found to be in good condition • Frame post found with slight damage to the closing jamb lock keeper area.	D - 1 F - 1	

SFD014	5 No. panelled square framed door.	860W x 2080H	760W x 2030H	125 x 50	42	O	S	710	N	Missing	N	Missing	N	N	Y	N	N	Yellow L. Blue	Left Hand Door • Door found to be in good condition • Frame post found with slight damage to the closing jamb lock keeper area.	D - 1 F - 1	
SFD015	Door frame only.	910W x 2080H	810W x 2030H	125 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	Right Hand Door • Door missing completely • Frame posts found with slight damage to the hinge areas.	D - 3 F - 1		
SFD016	5 No. panelled square framed door.	910W x 2080H	810W x 2030H	125 x 50	42	O	S	760	N	Missing	N	Missing	N	N	Y	N	N	White L. Blue	Left Hand Door • Door and frame found to be in good condition • Telecom wires / cables fitted through the frame.	D - 1 F - 1	
SFD017	Door frame only.	910W x 2080H	810W x 2030H	125 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	Left Hand Door • Door missing completely • Frame posts found to be in good condition.	D - 3 F - 1		
SFD018	Door frame only.	910W x 2080H	810W x 2030H	125 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	Left Hand Door • Door missing completely • Frame posts found with slight damage to the closing jamb lock keeper areas • Cables and pipework fitted to side of the frame.	D - 3 F - 1		
SFD019	6 No. pane fanlight frame with 6 No. pane / 2 No. panelled square framed door	1010W x 2080H	860W x 2030H	115 x 75	50	O	S	810	N	Missing	N	Missing	N	N	Y	N	N	White Cream	Right Hand Door • Severe damage found to the door and frame • Renewal of frame and door required • Salvage 6 No. pane fanlight.	D - 3 F - 3	
SFD020	Over boarded 5 No. panelled square framed door.	910W x 2080H	810W x 2030H	125 x 50	46	O	S	770	N	P	N	Y	N	N	Y	N	N	White White	Right Hand Door • Door and frame found to be in good condition • 1 No. side of door has been clad in hardboard.	D - 1 F - 1	
SFD021	Flush hollow core door.	840W x 2015H	760W x 1975H	140 x 40	35	M	S	715	N	P	N	N	Y	N	Y	Y	N	White White	Left Hand Door • Door and frame found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
SFD022	Flush hollow core door.	840W x 2015H	760W x 1975H	125 x 40	35	M	S	725	N	P	N	N	Y	N	Y	Y	N	White White	Left Hand Door • Door and frame found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
SFD023	5 No. panelled square framed door.	910W x 2080H	810W x 2030H	125 x 50	42	O	S	770	N	K	N	Y	N	N	Y	N	N	Green Grey	Left Hand Door • Door found to be in good condition Frame post found with slight damage to the closing jamb lock keeper area • Telecom wires / cables fitted to the frame.	D - 1 F - 1	
SFD024	5 No. panelled square framed door.	910W x 2080H	810W x 2030H	125 x 50	42	O	S	770	N	K	N	Y	N	N	Y	N	N	Green Lime	Left Hand Door • Door found to be in good condition • Frame post found with damage to the closing jamb lock keeper area.	D - 1 F - 1	
SFD025	3 No. panelled square framed door.	830W x 2000H	730W x 1950H	125 x 50	42	O	S	480	N	K	N	Y	N	N	Y	N	N	Green Green	Left Hand Door • Door and frame found to be damage to the bottom hinge area.	D - 1 F - 1	
SFD025A	Flush hollow core door.	690W x 2080H	610W x 1990H	75 x 40	35	M	S	565	N	N	N	N	N	N	Y	N	N	Green Green	Left Hand Door • Door and frame found to be of no significance • Severe timber decay to the door frame posts • Further investigation required • Dry rot eradication work required • ~~Renewal of frame and door required~~	D - 3 F - 3	Remove Door Remove Frame
SFD025B	Flush hollow core door.	690W x 2080H	610W x 1990H	75 x 40	35	M	S	565	N	N	N	N	N	N	Y	N	N	Green Green	Left Hand Door • Door and frame found to be of no significance • Severe timber decay to the right hand side door frame post • Further investigation required • Dry rot eradication work required • ~~Renewal of frame and door required~~	D - 3 F - 3	Remove Door Remove Frame
SFD026	5 No. panelled square framed door.	910W x 2080H	810W x 2030H	125 x 50	42	O	S	770	N	K	N	Y	N	N	Y	N	N	Green Orange	Left Hand Door • Door found to be in good condition • Frame post found with slight damage to the closing jamb lock keeper area.	D - 1 F - 1	
SFD027	5 No. panelled square framed door.	910W x 2080H	810W x 2030H	125 x 50	42	O	S	770	N	K	N	Y	N	N	Y	N	N	Green Brown	Left Hand Door • Door found to be in good condition • Frame post found with slight damage to the closing jamb lock keeper area.	D - 1 F - 1	
SFD028	5 No. panelled square framed door.	910W x 2080H	810W x 2030H	125 x 50	42	O	S	770	N	K	N	Y	N	N	Y	N	N	Green Red	Right Hand Door • Door found to be in good condition • Frame post found with slight damage to the closing jamb lock keeper area.	D - 1 F - 1	
SFD029	5 No. panelled square framed door.	910W x 2080H	810W x 2030H	125 x 50	42	O	S	770	N	P	N	N	Y	N	Y	N	N	Green Brown	Right Hand Door • Door found to be in good condition • Frame post found with slight damage to the hinge and closing jamb lock keeper areas • Telecom wires / cables fitted to the frame	D - 1 F - 1	
SFD030	6 No. pane fanlight frame with insert and flush hollow core door	1010W x 2080H	860W x 2030H 765W x 1985H	115 x 75	45	M	S	810	N	N	N	N	N	N	Y	N	N	Natural Timber	Left Hand Door • Door found to be of no significance • Severe timber decay to the fanlight frame • Further investigation required • Dry rot eradication work required • ~~Renewal of frame and door required~~	D - 3 F - 3	
SFD031	Door frame only.	840W x 1990H	760W x 1950H	110 x 40	?	M	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame posts found with slight damage to the closing jamb lock keeper areas.	D - 3 F - 1	
SFD031A	6 No. pane fanlight frame with 6 No. pane / 2 No. panelled square framed door	970W x 2770H	810W x 2030H	115 x 75	50	M	S	?	N	Missing	N	Missing	N	N	Y	Y	N	Green Blue	Right Hand Door• Door found to be in poor condition • Frame posts found to be in good condition.	D - 1 F - 1	
SFD032	Flush hollow core door. (Over boarded one side)	840W x 2020H	755W x 1980H	110 x 40	39	M	S	720	N	N	N	Y	N	Y	Y	N	N	Blue Blue	Right Hand Door • Door and frame found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
SFD033	Door frame only.	890W x 1970H	810W x 1930H	150 x 40	?	M	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame post found with slight damage to the hinge and closing jamb lock keeper areas.	D - 3 F - 1	
SFD034	Flush hollow core door.	825W x 2060H	745W x 2020H	175 x 40	35	M	S	690	Y	P	N	N	N	N	Y	N	N	Green Purple	Left Hand Door • Door and frame found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
SFD035	Flush hollow core door.	825W x 2035H	745W x 1995H	175 x 40	35	M	S	690	N	P	N	N	N	N	Y	N	N	Blue Purple	Right Hand Door • Door and frame found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
SFD035A	Plywood clad box frame incorporating a 10 No. pane square framed door and a flush hollow core door.	1575W x 2025H	810W x 1980H	75 x 75	45	M	D	1520	N	N	N	Missing	N	N	N	Y	N	Green Blue	Double Doors • Door and frame found to be of no significance.	D - 3 F - 3	
SFD036	1 No. pane flush hollow core double doors.	1360W x 2030H	610W x 1955H	110 x 50	50	M	D	1110	N	N	K	N	N	N	N	Y	N	Blue Blue	Dual Action Double Doors • Door and frame found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
SFD037	1 No. pane flush hollow core double doors.	1195W x 2000H	570W x 1960H	100 x 40	36	M	D	1160	N	Missing	N	Y	N	N	N	Y	N	Blue Blue	Double Doors • Door and frame found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
SFD038	4 No. panelled square framed double doors over clad with hardboard	1180W x 2050H	535W x 2000H	125 x 50	54	M	D	940	N	N	N	N	N	N	N	N	N	Blue Blue	Dual Action Double Doors • Door and frame found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
SFD038A	1 No. pane fanlight frame with 1 No. pane / 1 No. panelled square framed door	985W x 2730H	870W x 1970H	110 x 65	?	M	S	?	Y	Y	N	Y	N	N	N	Y	N	Green Blue	Right Hand Door • Door and frame found to be of no significance.	D - 3 F - 3	
SFD039	5 No. panelled square framed door.	910W x 2080H	810W x 2030H	75 x 50	42	O	S	770	N	Missing	N	Missing	N	N	Y	N	N	Blue Blue	Left Hand Door • Door found to be in good condition • Frame found to be of no significance.	D - 1 F - 3	Remove Frame Only
SFD040	1 No. pane flush hollow core door.	860W x 2035H	760W x 1985H	100 x 50	36	M	D	710	N	Missing	N	Missing	N	N	Y	Y	N	Blue Blue	Left Hand Door • Door and frame found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame

SFD040A	Flush hollow core door.	730W x 1910H	650W x 1830H	125 x 40	40	M	S	600	N	Y	N	N	Y	Y	Y	N	N	Blue Blue	Left Hand Door • Door and frame found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
SFD040B	Flush hollow core door.	730W x 1910H	650W x 1830H	125 x 40	40	M	S	600	N	Y	N	N	Y	Y	Y	N	N	Blue Blue	Left Hand Door • Door and frame found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
SFD041	5 No. panelled square framed door.	910W x 2080H	810W x 2030H	125 x 50	42	O	S	770	N	Missing	N	Y	N	N	Y	N	N	Blue Blue	Right Hand Door • Door and frame found to be in good condition.	D - 1 F - 1	
SFD042	1 No. pane fanlight frame with 1 No. pane flush hollow core door.	1025W x 2880H	925W x 1980H	100 x 50	45	M	S	?	N	Missing	N	Missing	N	N	N	Y	N	Blue Blue	Right Hand Door • Door and frame found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
SFD042A	Flush hollow core door.	700W x 2070H	600W x 1910H	100 x 50	40	M	S	555	N	Y	N	N	Y	Y	Y	N	N	Blue Blue	Right Hand Door • Door and frame found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
SFD042B	Flush hollow core door.	700W x 2070H	600W x 1910H	100 x 50	40	M	S	555	N	Y	N	N	Y	Y	Y	N	N	Blue Blue	Left Hand Door • Door and frame found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
SFD042C	Door frame only.	830W x 2075H	730W x 2025H	75 x 50	?	M	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame post found with slight damage to the hinge areas.	D - 3 F - 1	
SFD043	Door frame only.	910W x 2080H	810W x 2030H	125 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame post found with slight damage to the hinge and closing jamb lock keeper areas • Telecom wires / cables fitted through the frame	D - 3 F - 1	
SFD044	Door frame only.	860W x 2080H	760W x 2030H	125 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame post found with slight damage to the closing jamb lock keeper area.	D - 3 F - 1	
SFD045	Remnants of 5 No. panelled square framed door.	910W x 2080H	810W x 2030H	125 x 50	42	O	S	760	N	Missing	N	Y	N	N	Y	N	N	White Yellow	Left Hand Door • Only remnants of door remain • Frame post found with slight damage to the hinge areas.	D - 3 F - 1	Remove Door Only
SFD046	6 No. pane fanlight frame with 6 No. pane / 2 No. panelled square framed door.	1010W x 2080H	860W x 2030H	115 x 75	50	O	S	800	N	Missing	N	Missing	N	N	Y	Y	N	White Burgundy	Right Hand Door • Door severely damaged to the closing stile lock area • Frame posts found with slight damage.	D - 3 F - 1	
SFD046A	5 No. panelled square framed door.	840W x 2080H	740W x 2030H	75 x 50	42	O	S	700	N	Missing	N	Missing	N	N	Y	N	N	Blue Yellow	Left Hand Door • Door damaged beyond economic repair • Frame found with damage to the head / architrave area	D - 3 F - 1	Remove Door Only
SFD047	5 No. panelled square framed door.	910W x 2080H	810W x 2030H	125 x 50	42	O	S	760	N	Missing	N	Missing	N	N	Y	N	N	White White	Right Hand Door • Door damaged beyond economic repair • Frame post found with slight damage to the closing jamb lock keeper area • Telecom wires / cables fitted through the frame	D - 3 F - 1	Remove Door Only
SFD048	5 No. panelled square framed door.	910W x 2080H	810W x 2030H	125 x 50	42	O	S	760	N	Missing	N	Missing	N	N	Y	N	N	White White	Right Hand Door • Door damaged beyond economic repair • Frame post found with slight damage to the closing jamb lock keeper area.	D - 3 F - 1	Remove Door Only
SFD049	5 No. panelled square framed door.	910W x 2080H	810W x 2030H	125 x 50	42	O	S	760	N	Missing	N	Missing	N	N	Y	N	N	White Purple	Right Hand Door • Door damaged beyond economic repair • Frame posts found to be in good condition.	D - 3 F - 1	Remove Door Only
SFD050	5 No. panelled square framed door.	910W x 2080H	810W x 2030H	125 x 50	42	O	S	760	N	Missing	Missing	Missing	N	N	Y	N	N	White White	Left Hand Door • Door and frame found to be in good condition • Telecom wires / cables fitted to the frame.	D - 1 F - 1	
SFD051	5 No. panelled square framed door.	910W x 2080H	810W x 2030H	125 x 50	42	O	S	760	N	Missing	N	Missing	N	N	Y	N	N	White White	Left Hand Door • Door found to be in good condition • Frame post found with slight damage to the closing jamb lock keeper area.	D - 1 F - 1	
SFD052	5 No. panelled square framed door.	825W x 2070H	745W x 2030H	115 x 50	42	O	S	700	N	Missing	N	Missing	N	N	Y	N	N	White White	Left Hand Door • Door found to be in good condition • Frame found to be of no significance.	D - 1 F - 3	Remove Frame Only
SFD053	Door frame only.	910W x 2080H	Missing	125 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame / posts found with slight damage all around.	D - 3 F - 1	Remove Door Only
SFD054	Door frame only.	730W x 2020H	Missing	125 x 50	?	M	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame found to be of no significance.	D - 3 F - 3	Remove Frame Only
SFD054A	6 No. pane fanlight frame with 6 No. pane / 2 No. panelled square framed door.	1010W x 2080H	860W x 2030H	115 x 75	50	O	S	800	N	Missing	P	Missing	N	Y	Y	Y	N	Mustard Burgundy	Right Hand Door • Door found to be severely damaged beyond economic repair • Frame closing jamb is severely damaged and requires renewal • Renewal of door required.	D - 3 F - 3	
SFD055	Door frame only.	910W x 2080H	810W x 2030H	75 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame post found with slight damage to the hinge areas.	D - 3 F - 1	
SFD056	5 No. panelled square framed door.	910W x 2080H	810W x 2030H	125 x 50	42	O	S	770	N	Missing	N	Missing	N	N	Y	N	N	Blue White	Left Hand Door • Door and frame found to be in good condition.	D - 1 F - 1	
SFD057	5 No. panelled square framed door.	910W x 2080H	810W x 2030H	75 x 50	42	O	S	770	N	Missing	N	Missing	N	N	Y	N	N	Blue Yellow	Left Hand Door • Door found to be in good condition • Frame post found with slight damage to the closing jamb lock keeper area.	D - 1 F - 1	
SFD058	5 No. panelled square framed door.	910W x 2080H	810W x 2030H	125 x 50	42	O	S	770	N	Missing	N	Missing	N	N	Y	N	N	Blue White	Left Hand Door • Door found to be in good condition • Frame found with slight damage to the head area.	D - 1 F - 1	
SFD059	5 No. panelled square framed door.	845W x 2070H	745W x 2030H	125 x 50	42	O	S	700	N	Missing	N	Missing	N	N	Y	N	N	Blue Cream	Right Hand Door • Door and frame found to be in good condition.	D - 1 F - 1	
SFD060	6 No. pane fanlight frame with 6 No. pane / 2 No. panelled square framed door.	1010W x 2080H	860W x 2030H	115 x 75	50	O	S	800	N	Missing	P	Missing	N	Y	Y	Y	N	Yellow Cream	Right Hand Door • Door found to be severely damaged beyond economic repair • Frame post found with slight damage to the closing jamb lock keeper area • Renewal of door required.	D - 3 F - 1	
SFD061	5 No. panelled square framed door.	910W x 2080H	810W x 2030H	75 x 50	42	O	S	770	N	Missing	N	Missing	N	N	Y	N	N	Orange White	Left Hand Door • Door found to be in good condition • Architrave found to be loose to the left hand side • Telecom wires / cables fitted through the frame.	D - 1 F - 1	
SFD062	5 No. panelled square framed door.	910W x 2080H	810W x 2030H	75 x 50	42	O	S	770	N	Missing	N	Missing	N	N	Y	N	N	White White	Left Hand Door • Door and frame found to be in good condition.	D - 1 F - 1	
SFD063	5 No. panelled square framed door.	910W x 2080H	810W x 2030H	75 x 50	42	O	S	770	N	K	N	Y	N	N	Y	N	N	White White	Left Hand Door • Door found to be in good condition • Frame post found with slight damage to the closing jamb lock keeper area • Telecom wires / cables fitted to the frame.	D - 1 F - 1	
SFD064	5 No. panelled square framed door.	840W x 2080H	710W x 2005H	75 x 50	42	O	S	670	N	Missing	N	Missing	N	N	Y	N	N	White Lime	Right Hand Door • Door found to be in good condition, originally left hand fitted now planted onto the face of the lining • Frame found with slight damage around the architraves	D - 1 F - 1	
SFD065	5 No. panelled square framed door.	860W x 2080H	760W x 2030H	125 x 50	42	O	S	710	N	K	N	N	Y	N	Y	N	N	White White	Left Hand Door • Door found to be in good condition • Frame found with slight damage to the closing jamb architraves.	D - 1 F - 1	

SFD065A	1 No. panelled square framed door with battened infill, set within an arch opening	915W x 1910H 1960A	805W x 1870H	125 x 50	50	O	S	?	N	K	N	N	N	Y	Y	N	N	Green Green	Right Hand Door • Door found to have slight damage to the closing stile • Frame found with slight damage to the head • Localised timber decay to bottom of door and frame posts.	D - 1 F - 1	
SFD066	5 No. panelled square framed door.	845W x 2080H	745W x 2030H	125 x 50	42	O	S	700	N	K	N	Y	N	N	Y	N	N	Brown Turquoise	Left Hand Door • Door found to be in good condition • Frame post found with slight damage to the closing jamb lock keeper area.	D - 1 F - 1	
SFD066A	Door frame only.	860W x 2080H	760W x 2030H	115 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame posts found with slight damage to the hinge and closing jamb lock keeper areas.	D - 3 F - 1	
SFD066B	5 No. panelled square framed door.	830W x 2080H	730W x 2030H	125 x 50	42	O	S	680	N	K	N	Y	N	Y	Y	N	N	Brown Grey	Right Hand Door • Door found to be in good condition • Frame post found with slight damage to the closing jamb lock keeper area.	D - 1 F - 1	
SFD066C	3 No. pane fanlight frame with 6 No. pane / 2 No. panelled square framed door	965W x 2150H	815W x 2075H	115 x 75	50	O	S	?	N	Missing	N	Missing	N	Y	Y	Y	N	Brown Cream	Right Hand Door • Door found to be severely damaged beyond economic repair • Severe timber decay to the fanlight frame • Further investigation required • Dry rot eradication work required • Salvage fanlight and reuse • Renewal of frame and door required.	D - 3 F - 3	
SFD067	Door frame only.	910W x 2080H	810W x 2030H	75 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame posts found with slight damage to the closing jamb lock keeper area • Frame found with distortion to the head architraves • Telecom wires / cables fitted to the frame	D - 1 F - 1	
SFD068	Door frame only.	910W x 2080H	810W x 2030H	125 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame posts found with severe damage to the top hinge / architrave and closing jamb lock keeper areas • Telecom wires / cables fitted through the frame	D - 1 F - 1	
SFD069	Door frame only. (Boarded up to one side)	860W x 2080H	760W x 2030H	100 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame posts found with slight damage to the closing jamb lock keeper area • Remove timber security board and make good minor damage	D - 3 F - 1	
SFD070	Door frame only.	910W x 2080H	810W x 2030H	125 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame found with damage to the head • Frame posts found with slight damage to the hinge and closing jamb lock keeper areas • Telecom wires / cables fitted through the frame	D - 3 F - 1	
SFD071	1 No. pane / panel fanlight frame only.	940W x 2250H	840W x 1985H	100 x 50	?	M	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame found to be of no significance.	D - 3 F - 3	Remove Frame Only
SFD071A	Door frame only.	910W x 2080H	810W x 2030H	75 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame / posts found with slight damage to the head, hinge and closing jamb lock keeper areas • Telecom wires / cables fitted to the frame	D - 3 F - 1	
SFD072	Door frame only.	910W x 2080H	810W x 2030H	125 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame post found with slight damage to the closing jamb lock keeper area • Telecom wires / cables fitted to the frame.	D - 3 F - 1	
SFD073	Door frame only.	910W x 2080H	810W x 2030H	125 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame post found with slight damage to the closing jamb lock keeper area • Telecom wires / cables fitted through the frame.	D - 3 F - 1	
SFD074	Door frame only.	920W x 2070H	840W x 2030H	150 x 40	?	M	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame found to be in good condition • Telecom wires / cables fitted through the frame.	D - 3 F - 1	
SFD075	Door frame only.	910W x 2080H	810W x 2030H	125 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame posts found with slight damage to the hinge and closing jamb lock keeper areas • Telecom wires / cables fitted through the frame	D - 3 F - 1	
SFD075A	Door frame only.	860W x 2080H	760W x 2030H	125 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame posts found with grind damage to the hinge areas and slight damage closing jamb lock keeper area • Telecom wires / cables fitted to the frame	D - 3 F - 1	
SFD075B	Door frame only.	890W x 2065H	810W x 2025H	100 x 50	?	M	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame found to be of no significance.	D - 3 F - 3	Remove Frame Only
SFD076	5 No. panelled square framed door.	835W x 2050H	735W x 2000H	125 x 50	42	O	S	690	N	K	N	Y	N	N	Y	N	N	Brown Cream	Right Hand Door • Door found to be in good condition, originally left handed opening inwards • Frame post found with slight damage to the closing jamb lock keeper area.	D - 1 F - 1	
SFD077	5 No. panelled square framed door.	860W x 2060H	760W x 2010H	125 x 50	42	O	S	710	Y	Missing	N	Y	Y	N	Y	N	N	Brown Green	Left Hand Door • Door found to be in good condition • Frame found with slight damage to the left hand side architrave.	D - 1 F - 1	
SFD078	5 No. panelled square framed door.	910W x 2080H	810W x 2030H	75 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame posts found with damage to the hinge and closing jamb lock keeper areas • Telecom wires / cables fitted through the frame.	D - 3 F - 1	
SFD079	5 No. panelled square framed door.	910W x 2080H	810W x 2030H	125 x 50	42	O	S	770	Missing	Missing	N	Y	N	N	Y	N	N	Brown Brown	Left Hand Door • Door found to be in good condition • Frame posts found to be damaged / badly split with slight damage to the closing jamb lock keeper area • Telecom wires / cables fitted to the frame	D - 1 F - 1	
SFD080	1 No. pane fanlight frame with flush hollow core door.	840W x 2025H	760W x 1985H	100 x 75	45	M	S	710	N	Missing	N	Missing	N	N	Y	Y	N	Blue Brown	Right Hand Door • Door and frame found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
SFD080A	1 No. pane fanlight frame with flush hollow core door.	840W x 2025H	760W x 1985H	100 x 75	45	M	S	710	Y	Missing	N	Missing	N	N	Y	Y	N	Blue Brown	Left Hand Door • Door and frame found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
SFD081	5 No. panelled square framed door.	780W x 2080H	680W x 2030H	?	42	O	S	?	N	Missing	N	Y	N	N	Y	N	N	Brown ?	Right Hand Door • Door found to be in good condition • Frame posts found with slight damage to the closing jamb lock keeper area • Door found to be currently locked / no keys	D - 1 F - 1	
SFD082	Door frame only.	920W x 2030H	840W x 1990H	150 x 40	?	M	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame posts found with grind damage to the hinge areas • Frame currently fitted with a 'Beanco A' 'Over Head Door Check and Spring' - Pat 621457 /47	D - 3 F - 1	
SFD083	1 No. pane fanlight frame only.	750W x 1990H 940W x 2320H	670W x 1950H	85 x 40	?	M	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame found to be of no significance.	D - 3 F - 3	Remove Frame Only
SFD083A	16 No. pane combination frame only.	860W x 2100H	780W x 2060H	100 x 75	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame post found with damage to the top hinge area • 1 No. side of frame has been clad in hardboard. • Remove boarding and make good minor damage • 1 No. pane requires replanning	D - 3 F - 2	
SFD083B	6 No. pane / 3 No. panelled square framed door in arch opening	970W x 2140H 2200A	895W x 2130H	140 x 50	50	O	S	840	N	K	N	Y	N	Y	Y	Y	N	Blue Blue	Left Hand Door • Door found to be severely damaged beyond economic repair • Frame found to be in good condition.	D - 3 F - 1	Remove Door Only
SFD084	Door frame only.	910W x 2080H	810W x 2030H	115 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame post found with damage / split to the hinge areas • Frame post found with slight damage to the closing jamb lock keeper area • Architrave found to be missing to the left hand side	D - 3 F - 2	
SFD084A	5 No. panelled bow framed hardwood pole door.	900Dia x 2070H	965W x 2020H	105 x 50	45	O	S	640	N	Missing	N	Missing	N	Missing	Y	N	N	Beige	Right Hand Door • Door found to be in fair condition • Door found to be nailed shut • Door panel to the bottom left hand side is split • Bowed frame, architrave, vertical boarding and cornice found with severe damage to the head • Carry out sympathetic repair to door and frame of significance.	D - 2 F - 2	
SFD085	5 No. panelled square framed door.	860W x 2080H	760W x 2030H	115 x 50	42	O	S	715	N	K	N	Y	N	N	Y	N	N	Orange Red	Right Hand Door • Door found to be in good condition • Frame posts found with slight damage to the hinge and closing jamb lock keeper areas.	D - 1 F - 1	
SFD085A	6 No. pane fanlight frame with 6 No. pane / 2 No. panelled square framed door	1010W x 2080H	860W x 2030H	115 x 75	50	O	S	800	N	Missing	N	Missing	N	Y	Y	Y	N	Grey Green	Right Hand Door • Door found to be severely damaged beyond economic repair • Frame posts found with slight damage to the closing jamb lock keeper area • Renewal of door required.	D - 3 F - 1	

SFD086	Door frame only.	840W x 2020H	760W x 1980H	133 x 50	?	M	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame found to be of no significance.	D - 3 F - 3	
SFD087	Door frame only.	910W x 2080H	810W x 2030H	75 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame posts found with damage to the hinge and closing jamb lock keeper areas.	D - 3 F - 1	
SFD087A	Door frame only.	860W x 2080H	760W x 2030H	125 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame posts found with slight damage to the hinge and closing jamb lock keeper areas.	D - 3 F - 1	
SFD087B	5 No. panelled bow framed hardwood pole door.	900Dia x 2070H	965W x 2020H	105 x 50	45	O	S	640	N	Missing	N	Missing	N	Missing	Y	N	N	Brown	Right Hand Door • Door found to be in fair condition • Door found to be nailed shut • Door / frame post found with slight damage to the closing jamb lock keeper area • Carry out sympathetic repair to door and frame of significance	D - 1 F - 1	
SFD088	Door frame only.	630W x 2080H	530W x 2030H	150 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame posts found with slight damage to the hinge and closing jamb lock keeper areas.	D - 3 F - 1	
SFD088A	6 No. pane fanlight frame with 6 No. pane / 2 No. panelled square framed door	1010W x 2080H	860W x 2030H	115 x 75	50	O	S	800	N	Missing	N	Missing	N	Y	Y	Y	N	Grey Yellow	Right Hand Door • Door found to be severely damaged beyond economic repair • Severe timber decay to the fanlight frame on the left hand side • Further investigation required • Dry rot eradication work required • Salvage fanlight and reuse • Renewal of frame and door required	D - 3 F - 3	
SFD089	Door frame only.	860W x 2080H	760W x 2030H	125 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame posts found with slight damage to the hinge and closing jamb lock keeper areas.	D - 3 F - 1	
SFD090	Door frame only.	890W x 2070H	810W x 2030H	100 x 40	?	M	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame found to be of no significance.	D - 3 F - 3	Remove Frame Only
SFD091	Door frame only.	910W x 2080H	810W x 2030H	75 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame / posts and lining found with slight damage to the head, hinge and closing jamb lock keeper areas.	D - 3 F - 1	
SFD091A	6 No. pane fanlight frame with 6 No. pane / 2 No. panelled square framed door	1010W x 2080H	860W x 2030H	115 x 75	50	O	S	800	N	Missing	N	Missing	N	Y	Y	Y	N	Blue Yellow	Left Hand Door • Door found to be severely damaged beyond economic repair • Localised timber decay to the head of the fanlight frame • Further investigation required • Removal of water ingress required • Renewal of door required.	D - 3 F - 1	
SFD092	Door frame only.	910W x 2080H	810W x 2030H	125 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame post found with slight damage to the closing jamb lock keeper area • Telecom wires / cables fitted through the frame.	D - 3 F - 1	
SFD092A	5 No. panelled bow framed hardwood pole door.	900Dia x 2070H	965W x 2020H	105 x 50	45	O	S	640	N	Missing	N	Missing	N	Missing	Missing	N	N	Blue	Right Hand Door • Door found to be in fair condition • Door found to be nailed shut • Door panel to the bottom left hand side is missing • Door / frame found with slight damage to the closing jamb lock keeper area • Full set of bowed architrave are missing • Carry out reinstatement and sympathetic repairs to door and frame of significance.	D - 2 F - 2	
SFD093	5 No. panelled square framed door.	910W x 2080H	810W x 2030H	125 x 50	42	O	S	760	N	Missing	N	Y	N	N	Y	N	N	Orange Yellow	Right Hand Door • Door and frame found to be in good condition • Door found to be missing its bottom hinge.	D - 1 F - 1	
SFD096	Door frame only.	910W x 2080H	810W x 2030H	125 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame post found with slight damage to the hinge areas • Telecom wires / cables fitted to the frame.	D - 3 F - 1	
SFD097	Door frame only.	910W x 2080H	810W x 2030H	125 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame / post found with slight damage to the head and hinge areas.	D - 3 F - 1	
SFD098	Door frame only.	910W x 2080H	810W x 2030H	125 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame post found with slight damage to the hinge areas • Architraves found to be loose to the head and left hand side • Telecom wires / cables fitted to the frame	D - 3 F - 1	
SFD098A	5 No. panelled bow framed hardwood pole door.	900Dia x 2070H	965W x 2020H	105 x 50	45	O	S	640	N	Missing	N	Missing	N	Y	Missing	N	N	White	Right Hand Door • Door found to be in fair condition • Door found to be nailed shut • Door panel to the bottom right hand side is missing • Door / frame found with slight damage to the hinge and closing jamb lock keeper areas • Door hinges found to be missing • Full set of bowed architrave are missing • Carry out reinstatement and sympathetic repairs to door and frame of significance.	D - 2 F - 2	
SFD099	Door frame only.	910W x 2080H	810W x 2030H	75 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame / post found with slight damage to the head and hinge areas.	D - 3 F - 1	
SFD099A	6 No. pane fanlight frame only.	1010W x 2080H	860W x 2030H	115 x 75	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	Y	n/a	n/a	Right Hand Door • Door missing completely • Frame post found with slight damage to the closing jamb lock keeper area.	D - 3 F - 1	
SFD100	5 No. panelled square framed door.	860W x 2080H	760W x 2030H	125 x 50	42	O	S	715	N	Missing	N	Y	N	Y	Y	N	N	White White	Right Hand Door • Door and frame found to be in good condition • Frame post found with slight damage to the closing jamb lock keeper area • Telecom wires / cables fitted to head of the frame	D - 1 F - 1	
SFD101	Door frame only.	860W x 2080H	760W x 2030H	125 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Hinge side frame post, architrave and plinth block found with severe damage • Frame post found with slight damage to the closing jamb lock keeper area • New hinge side frame post required	D - 3 F - 2	
SFD102	5 No. panelled square framed door.	910W x 2080H	810W x 2030H	75 x 50	42	O	S	760	N	Missing	N	Y	N	N	Y	N	N	White Orange	Left Hand Door • Door found to be severely damaged beyond economic repair • Frame post found with slight damage to the closing jamb lock keeper area • Architrave found to be split to the right hand side • Telecom wires / cables fitted to the frame.	D - 3 F - 1	
SFD103	Door frame only.	910W x 2080H	810W x 2030H	125 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Hinge side frame post found with severe damage • New hinge side frame post required.	D - 3 F - 2	
SFD103A	5 No. panelled bow framed hardwood pole door.	900Dia x 2070H	965W x 2020H	105 x 50	45	O	S	640	N	Missing	N	Missing	N	Y	Missing	N	N	Brown	Left Hand Door • Door found to be in good condition • Door found to be nailed shut • Door now hung up side down • Door / frame found with slight damage to the hinge and closing jamb lock keeper areas • Door hinges found to be missing • Full set of bowed architrave are missing • Carry out reinstatement and sympathetic repairs to door and frame of significance.	D - 2 F - 2	
SFD104	Door frame only.	1020W x 2030H 2090A	860W x 1980H	150 x 75	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame found with damage to the hinge and closing jamb areas • Telecom wires / cable conduit fitted through the frame.	D - 3 F - 1	
SFD105	5 No. panelled square framed door.	910W x 2080H	810W x 2030H	125 x 50	42	O	S	770	N	Missing	N	Y	N	N	Y	N	N	White White	Right Hand Door • Door found to be in good condition • Frame found with slight damage to the closing jamb lock keeper area and the corners where telecom wires / cables were once fitted to the frame	D - 1 F - 1	
SFD106	6 No. pane fanlight frame with 6 No. pane / 2 No. panelled square framed door	1010W x 2080H	860W x 2030H	115 x 75	50	O	S	800	N	Missing	N	Missing	N	Y	Y	Y	N	Beige Yellow	Left Hand Door • Door found to be severely damaged beyond economic repair • Frame / post found with slight damage to the head and closing jamb lock keeper areas • Renewal of door required.	D - 3 F - 1	
SFD107	Door frame only.	910W x 2080H	810W x 2030H	125 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame post found with slight damage to the hinge areas.	D - 3 F - 1	
SFD109	5 No. panelled square framed door.	910W x 2080H	810W x 2030H	125 x 50	42	O	S	770	N	Missing	N	Y	N	N	Y	N	N	White White	Left Hand Door • Door found to be in good condition • Frame post found with slight damage to the closing jamb lock keeper area • Telecom wires / cables fitted to the frame.	D - 1 F - 1	
SFD110	5 No. panelled square framed door.	910W x 2080H	810W x 2030H	125 x 50	42	O	S	770	N	Missing	N	Y	N	N	Y	N	N	White White	Left Hand Door • Door and frame found to be in good condition • Door found to be fitted with a padded board to 1 No. side.	D - 1 F - 1	

SFD110A	Bow framed hardwood pole door only.	900Dia x 2070H	965W x 2020H	105 x 50	45	O	S	640	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Architrave and plinth block missing to the left hand side • Carry out reinstatement of door, architrave and plinth block of significance.	D - 3 F - 2	
SFD111	Door frame only.	910W x 2080H	810W x 2030H	125 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door and frame found to be in good condition • Telecom wires / cables fitted to the frame.	D - 1 F - 1	
SFD112	5 No. panelled square framed door.	910W x 2080H	810W x 2030H	75 x 50	42	O	S	760	N	Missing	N	Missing	N	N	Y	N	N	White White	Right Hand Door • Door found to be severely damaged beyond economic repair • Frame post and lining found with damage to the closing jamb lock keeper / architrave area • ~~Renewal of door required~~	D - 3 F - 1	Remove Door Only
SFD113	5 No. panelled square framed door.	860W x 2080H	760W x 2030H	125 x 50	42	O	S	710	N	Missing	N	Missing	N	Y	Y	N	N	White White	Right Hand Door • Door found to be in good condition • Door found to be fitted with a padded board to 1 No. side • Frame / posts found with slight damage to the head, hinges and closing jamb lock keeper areas • Telecom wires / cables fitted to the frame.	D - 1 F - 1	
SFD114	6 No. pane fanlight frame with 6 No. pane / 2 No. panelled square framed door	1010W x 2080H	860W x 2030H	115 x 75	50	O	S	800	N	Missing	N	Missing	N	Y	Y	Y	N	White Yellow	Right Hand Door • Door found to be severely damaged beyond economic repair • Severe timber decay to the fanlight frame • Further investigation required • Dry rot eradication work required • Salvage fanlight and reuse • Renewal of frame and door required.	D - 3 F - 3	
SFD116	Door frame only.	910W x 2080H	810W x 2030H	125 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame found to be in good condition.	D - 3 F - 1	
SFD117	Door frame only.	860W x 2080H	760W x 2030H	125 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame posts found with slight damage to the hinge and closing jamb lock keeper areas.	D - 3 F - 1	
SFD118	Door frame only.	860W x 2080H	760W x 2030H	75 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame found to be in good condition.	D - 3 F - 1	
SFD118A	6 No. pane fanlight frame with 6 No. pane / 2 No. panelled square framed door	1010W x 2080H	860W x 2030H	115 x 75	45	M	S	800	N	N	N	Y	N	N	Y	Y	N	White White	Left Hand Door • Door found to be of no significance • Frame closing jamb found with severe damage to the closing jamb lock keeper area • Architrave to the head and left hand side found to be missing • New closing jamb and architraves required.	D - 3 F - 2	
SFD119	Door frame only.	910W x 2080H	810W x 2030H	125 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame posts found with slight damage to the hinge areas.	D - 3 F - 1	
SFD119A	Door frame only. (Previously leading to second officers pole)	860W x 2080H	760W x 2030H	75 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame / posts found with slight damage to the head, hinge and closing jamb lock keeper areas • Full set of architrave are missing • New architraves required	D - 3 F - 2	
SFD120	Door frame only.	910W x 2080H	810W x 2030H	125 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame / posts found with slight damage to the head, hinge and closing jamb lock keeper areas	D - 3 F - 1	
SFD121	5 No. panelled square framed door.	910W x 2080H	810W x 2030H	75 x 50	42	O	S	800	N	K	N	Y	N	N	Y	N	N	Brown Brown	Right Hand Door • Door found to be in good condition • Architrave plinth block removed to the left hand side • Severe timber decay to skirting boards in vicinity • Further investigation required • Dry rot eradication work required • Renewal of frame possibly.	D - 1 F - 2	
SFD122	Door frame only.	910W x 2080H	810W x 2030H	285 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Severe timber decay throughout the frame • Further investigation required • Dry rot eradication work required • Renewal of frame and door required.	D - 3 F - 3	Remove Frame Only
SFD123	Door frame only.	910W x 2080H	810W x 2030H	125 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Severe timber decay throughout the frame • Further investigation required • Dry rot eradication work required • Renewal of frame and door required	D - 3 F - 3	Remove Frame Only
SFD124	Door frame only.	860W x 2080H	760W x 2030H	125 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Severe timber decay throughout the frame • Further investigation required • Dry rot eradication work required • Renewal of frame and door required	D - 3 F - 3	Remove Frame Only
SFD125	Flush hollow core door.	910W x 2080H	810W x 1985H	125 x 50	45	M	S	750	N	Missing	N	N	N	N	Y	N	N	White White	Right Hand Door • Door found to be of no significance, originally left hand hung • Frame posts found with slight damage to the hinge and closing jamb lock keeper areas • Telecom wires / cables fitted through the frame	D - 3 F - 1	Remove Door Only
SFD126	Door frame only.	910W x 2080H	810W x 2030H	125 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame post found with slight damage to the closing jamb lock keeper area • Replace damaged architrave to the closing jamb.	D - 3 F - 1	
SFD127	Arch opening only.	1020W x 2030H 2090A	n/a	n/a	n/a	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Right Hand Door • Door and frame missing completely • Renewal of frame and door required.	D - 3 F - 3	
SFD128	5 No. panelled square framed door.	910W x 2080H	810W x 2030H	125 x 50	42	O	S	800	N	Missing	N	Missing	N	N	Y	N	N	White Purple	Left Hand Door • Door found with top corner cut off • Door found to be originally right hand hung • Frame post found with damage to the top hinge area.	D - 3 F - 1	Remove Door Only
SFD129	Door frame only.	840W x 2025H	760W x 1985H	115 x 40	?	M	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame found to be of no significance.	D - 3 F - 3	Remove Frame Only
SFD129A	3 No. pane fanlight frame with 1 No. pane / 2 No. panelled square framed door	990W x 2440H	840W x 2015H	115 x 75	50	O	S	?	N	K	N	Y	N	N	Y	Y	N	Green Blue	Right Hand Door • Door and frame found to be in fair condition • Remove timber security boards and make good minor damage • 1 No. pane requires replacing.	D - 1 F - 1	
SFD130	5 No. panelled square framed door.	860W x 2080H	760W x 2030H	125 x 50	42	O	S	?	N	Missing	N	Y	N	Y	Y	N	N	White Yellow	Left Hand Door • Door and frame found to be in good condition • 1 No. side of door currently hardboarded over.	D - 1 F - 1	
Third Floor																					
TFD001	Door frame only in arch opening.	1010W x 2060H 2120A	880W x 2020H	110 x 75	?	M	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame post found with slight damage to the closing jamb lock keeper area.	D - 3 F - 1	
TFD001A	Double door frame only.	1210W x 1865H	560W x 1820H	100 x 50	?	M	D	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Double Doors • Doors missing completely • Frame found to be of no significance.	D - 3 F - 3	Remove Frame Only
TFD001B	1 No. circular pane flush hollow core door.	910W x 2080H	810W x 2030H	100 x 50	45	M	S	760	N	N	N	Missing	N	N	Y	Y	N	Green Orange	Right Hand Door • Door and frame found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
TFD002	Door frame only.	910W x 2080H	810W x 2030H	115 x 50	45	M	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame found to be of no significance.	D - 3 F - 3	Remove Frame Only
TFD003	1 No. circular pane flush hollow core double doors in arch opening.	1300W x 1880H 1940A	580W x 1810H	110 x 75	48	M	D	1060	N	Missing	K	N	N	N	Y	Y	N	Orange Orange	Dual Action Double Doors • Doors and frame found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
TFD003A	4 No. pane fanlight frame with 6 No. pane / 2 No. panelled square framed door	1080W x 2070H	935W x 2000H	110 x 75	48	O	S	890	N	P	K	Missing	N	Y	Y	Y	N	Green Green	Dual Action Single Door • Door found to be in fair condition • Frame post found with slight damage to the closing jamb lock keeper area • 5 No. panes require replacing.	D - 1 F - 1	
TFD004	Door frame only.	910W x 2080H	810W x 2030H	100 x 50	48	M	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame found to be of no significance.	D - 3 F - 3	Remove Frame Only

TFD005	Door frame only.	925W x 2125H	785W x 2050H	115 x 75	?	M	D	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame found to be of no significance.	D - 3 F - 3	Remove Frame Only
TFD006	1 No. circular pane flush hollow core door.	910W x 2080H	810W x 2030H	90 x 65	45	M	S	780	N	P	N	Missing	N	N	Y	Y	N	Green L. Blue	Left Hand Door • Door and frame found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
TFD007	Door frame only.	910W x 2080H	810W x 2030H	90 x 65	45	M	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame found to be of no significance.	D - 3 F - 3	Remove Frame Only
TFD008	1 No. circular pane flush hollow core door.	910W x 2080H	810W x 2030H	90 x 65	45	M	S	780	N	Missing	N	Missing	N	N	Y	Y	N	Green L. Blue	Left Hand Door • Door and frame found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
TFD009	1 No. circular pane flush hollow core door.	910W x 2080H	810W x 2030H	90 x 65	45	M	S	780	N	Missing	N	Missing	N	N	Y	Y	N	Green Blue	Right Hand Door • Door and frame found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
TFD010	Door frame only.	910W x 2080H	810W x 2030H	90 x 65	?	M	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame found to be of no significance.	D - 3 F - 3	Remove Frame Only
TFD010A	Door frame only.	810W x 2080H	710W x 2030H	90 x 65	?	M	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame found to be of no significance.	D - 3 F - 3	Remove Frame Only
TFD011	Door frame only.	910W x 2080H	810W x 2030H	90 x 65	?	M	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame found to be of no significance.	D - 3 F - 3	Remove Frame Only
TFD012	1 No. circular pane flush hollow core door.	910W x 2080H	810W x 2030H	90 x 65	45	M	S	780	N	Missing	N	Missing	N	N	Y	Y	N	Green L. Blue	Left Hand Door • Door and frame found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
TFD013	1 No. circular pane flush hollow core door.	910W x 2080H	810W x 2030H	90 x 65	45	M	S	780	N	Missing	N	Y	N	N	Y	Y	N	Green Green	Right Hand Door • Door and frame found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
TFD014	8 No. pane fanlight frame only in arch opening (Currently boarded up)	1120W x 2080H ????A	810W x 2030H	100 x 75	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Strip out make up sections to reveal original frame • Renewal of door required • Remove timber security boards and make good minor damage	D - 3 F - 1	
TFD015	Door frame only.	910W x 2080H	810W x 2030H	90 x 65	?	M	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame found to be of no significance.	D - 3 F - 3	Remove Frame Only
TFD015A	1 No. circular pane flush hollow core split door.	910W x 2080H	810W x 2030H	90 x 65	45	M	S	780	N	N	N	N	N	Y	Y	Y	N	Green L. Blue	Right Hand Door • Door and frame found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
TFD016	Door frame only.	910W x 2080H	810W x 2030H	90 x 65	?	M	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame found to be of no significance.	D - 3 F - 3	Remove Frame Only
TFD016A	Door frame only.	810W x 2080H	710W x 2030H	90 x 65	?	M	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame found to be of no significance.	D - 3 F - 3	Remove Frame Only
TFD016B	Flush hollow core door.	810W x 2030H	705W x 1980H	100 x 75	45	M	S	650	N	Missing	N	N	N	Y	Y	N	N	L. Blue L. Blue	Right Hand Door • Door and frame found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
TFD016C	Flush hollow core door.	795W x 2030H	695W x 1980H	90 x 65	45	M	S	645	N	P	N	N	N	Y	Y	N	N	L. Blue L. Blue	Right Hand Door • Door and frame found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
TFD017	Door frame only.	910W x 2080H	810W x 2030H	90 x 65	?	M	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame found to be of no significance.	D - 3 F - 3	Remove Frame Only
TFD017A	Flush hollow core door.	800W x 2020H	700W x 1970H	90 x 65	45	M	S	645	N	P	N	N	N	Y	Y	N	N	L. Blue L. Blue	Left Hand Door • Door and frame found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
TFD018	1 No. circular pane flush hollow core split door.	910W x 2080H	810W x 2030H	90 x 65	45	M	S	780	N	P	N	Missing	N	N	Y	Y	N	Green Green	Right Hand Door • Door and frame found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
TFD019	Door frame only.	910W x 2080H	810W x 2030H	90 x 65	?	M	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame found to be of no significance.	D - 3 F - 3	Remove Frame Only
TFD020	1 No. circular pane flush hollow core split door.	910W x 2080H	810W x 2030H	90 x 65	45	M	S	780	N	Missing	N	Missing	N	N	Y	Y	N	Green Green	Right Hand Door • Door and frame found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
TFD021	1 No. circular pane flush hollow core split door.	910W x 2080H	810W x 2030H	90 x 65	45	M	S	780	N	P	N	Missing	N	N	Y	Y	N	Green Green	Left Hand Door • Door and frame found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
TFD022	1 No. circular pane flush hollow core split door.	910W x 2080H	810W x 2030H	90 x 65	45	M	S	780	N	Missing	N	Y	N	N	Y	Y	N	Green White	Left Hand Door • Door and frame found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
TFD023	1 No. circular pane flush hollow core split door.	910W x 2080H	810W x 2030H	90 x 65	45	M	S	780	N	Missing	N	Y	N	N	Y	Y	N	Green L. Blue	Right Hand Door • Door and frame found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
TFD024	1 No. circular pane flush hollow core split door.	910W x 2080H	810W x 2030H	90 x 65	45	M	S	780	N	Missing	N	Y	N	N	Y	Y	N	Green Green	Right Hand Door • Door and frame found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
TFD025	1 No. circular pane flush hollow core split door.	910W x 2080H	810W x 2030H	90 x 65	45	M	S	780	N	Missing	N	Y	N	N	Y	Y	N	Green Green	Left Hand Door • Door and frame found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
TFD026	1 No. circular pane flush hollow core split door.	1010W x 2145H	880W x 2060H	115 x 65	45	M	S	835	N	Missing	K	N	N	N	Y	Y	N	Green Green	Dual Action Single Door • Door and frame found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
TFD026A	4 No. pane fanlight frame with 3 No. pane / 1 No. panelled square framed door	1320W x 2195H	590W x 2130H	115 x 65	45	O	D	1100	N	Missing	N	Missing	N	N	Y	Y	N	Green Green	Double Doors • Doors found to be of no significance • Frame found to have been adapted to accommodate modern doors size heights • Localised timber decay to bottom of frame posts.	D - 3 F - 1	
TFD026B	Flush solid blockboard double doors to modern pole.	1190W x 2050H	530W x 2010H	110 x 75 110 x 40	45	M	D	950	N	Missing	N	Y	N	N	Y	N	N	Green Green	Double Doors • Door and frame found to be of no significance • 1 No. door missing and security boarded up.	D - 3 F - 3	Remove Door Remove Frame
TFD027	1 No. circular pane flush hollow core split door.	1010W x 2145H	880W x 2060H	115 x 65	45	M	S	835	N	P	K	Y	N	N	Y	Y	N	Green Brown	Dual Action Single Door • Door and frame found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
TFD027A	Flush hollow core door.	805W x 2080H	705W x 2015H	90 x 65	45	M	S	660	N	P	N	Y	N	N	Y	N	Y	Green Mauve	Right Hand Door • Door and frame found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
TFD028	Door frame only.	805W x 2080H	680W x 2015H	90 x 65	?	M	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame found to be of no significance.	D - 3 F - 3	Remove Frame Only

TFD028A	Door frame only.	910W x 2080H	810W x 2030H	90 x 65	45	M	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame found to be of no significance.	D - 3 F - 3	Remove Frame Only
TFD028B	Flush hollow core door.	860W x 2025H	695W x 1960H	90 x 65	45	M	S	650	N	Missing	N	N	N	N	Y	N	N	L. Blue L. Blue	Left Hand Door • Door and frame found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
TFD028C	Flush hollow core door.	860W x 2025H	705W x 1960H	90 x 75	45	M	S	650	N	P	N	N	N	N	Y	N	N	L. Blue L. Blue	Right Hand Door • Door and frame found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
TFD028D	Flush hollow core door.	860W x 2025H	710W x 1960H	90 x 75	45	M	S	650	N	P	N	N	N	Y	Y	N	N	L. Blue L. Blue	Right Hand Door • Door and frame found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
TFD028E	Flush hollow core door.	860W x 2025H	705W x 1960H	90 x 65	45	M	S	650	N	Missing	N	N	N	Y	Y	N	N	L. Blue L. Blue	Left Hand Door • Door and frame found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
TFD029	1 No. circular pane flush hollow core split door.	920W x 2080H	820W x 2030H	90 x 65	45	M	S	755	N	P	N	Missing	Y	N	Y	Y	N	Brown Brown	Left Hand Door • Door and frame found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
TFD029A	4 No. panelled square framed door.	910W x 2050H	760W x 1975H	75 x 75	35	M	S	710	N	Missing	N	Missing	N	N	Y	N	N	Mauve Mauve	Left Hand Door • Door and frame found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
TFD029B	3 No. pane fanlight frame with 1 No. pane / 1 No. panelled square framed double doors	1290W x 2615H	590W x 2005H	110 x 75	45	O	S	1060	N	Missing	N	Missing	N	Y	Missing	Y	N	Mauve Green	Double Doors • Doors found to be of no significance • Localised timber decay to bottom of frame posts • 1 No. pane requires replacing.	D - 3 F - 1	
TFD030	Flush hollow core door.	830W x 2040H	750W x 1960H	120 x 50	45	M	S	710	N	N	N	N	N	Missing	Y	N	N	Brown Brown	Left Hand Door • Door and frame found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
TFD030A	Flush hollow core door. (over boarded with hardboard)	840W x 2015H	760W x 1975H	120 x 50	46	M	S	710	N	P	P+K	Missing	N	N	Y	N	N	Brown Brown	Right Hand Door • Door and frame found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame
TFD031	22 No. pane arch head combination frame with 3 No. pane / 1 No. panelled square framed double doors.	2210W x 2260H 3390A	630W x 2220H	110 x 75	45	O	S	1140	N	N	N	Missing	N	N	Y	Y	N	Green Green	Double Doors • Doors found to be of no significance • Localised timber decay to bottom of frame posts, bottom rails and panels • Renew decayed timbers to the base of the combination frame • 1 No. pane requires security film • Remove timber security boards and make good minor damage.	D - 3 F - 2	
TFD033	Door frame only.	910W x 2080H	810W x 2030H	120 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame / posts found with slight damage to the head, hinge and closing jamb lock keeper areas.	D - 3 F - 1	
TFD034	Door frame only.	910W x 2080H	810W x 2030H	75 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame posts and linings found with slight damage to the hinge and closing jamb lock keeper areas • Damage found to the lining and plinth blocks • Architrave found missing to the head and right hand side • New architraves required.	D - 3 F - 2	
TFD035	Door frame only.	900W x 2080H	800W x 2030H	75 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Severe timber decay to the right hand side the frame • Further investigation required • Dry rot eradication work required • Renewal of frame and door required.	D - 3 F - 3	Remove Frame Only
TFD035A	Door frame only.	790W x 2080H	690W x 2030H	75 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame linings found with splits to both sides • Further investigation required • Possible dry rot eradication work required • Possible renewal of frame and new door required.	D - 3 F - 3	Remove Frame Only
TFD035B	6 No. pane fanlight frame with 6 No. pane / 3 No. panelled square framed door	1010W x 2750H	860W x 2020H	110 x 75	45	M	S	825	N	N	N	Y	N	N	Y	Y	N	White White	Right Hand Door • Door found to be of no significance • Localised timber decay to bottom of frame posts • Frame / posts found with damage to the head and closing jamb lock keeper areas.	D - 3 F - 1	
TFD036	Door frame only.	860W x 2080H	760W x 2030H	75 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame posts found with slight damage to the hinge and closing jamb lock keeper areas.	D - 3 F - 1	
TFD037	Door frame only.	910W x 2080H	810W x 2030H	120 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame posts found with slight damage to the hinge and closing jamb lock keeper areas.	D - 3 F - 1	
TFD038	Door frame only.	910W x 2080H	810W x 2030H	120 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame post found with severe damage to the hinge area • Hinge jamb requires replacement.	D - 3 F - 1	
TFD039	Door frame only.	860W x 2080H	760W x 2030H	115 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame post found with damage to the hinge area • Frame post found with damage to the closing jamb lock keeper areas and architraves	D - 3 F - 1	
TFD040	Door frame only.	910W x 2080H	810W x 2030H	120 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame / post found with damage to the head and closing jamb lock keeper areas and architraves.	D - 3 F - 1	
TFD041	1 No. pane fanlight frame with 6 No. pane / 3 No. panelled square framed door	1010W x 2750H	860W x 2020H	110 x 75	45	M	S	825	N	N	N	Y	N	N	Y	Y	N	White White	Left Hand Door • Door found to be of no significance • 6 No. pane fanlight casement found to be missing • Localised timber decay to bottom of frame posts • Frame / post found with damage to the head and closing jamb lock keeper areas.	D - 3 F - 1	
TFD042	Door frame only.	910W x 2080H	810W x 2030H	120 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame found to be in good condition.	D - 3 F - 1	
TFD043	Door frame only.	840W x 2080H	740W x 2030H	75 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame posts found with slight damage to the hinge and closing jamb lock keeper areas.	D - 3 F - 1	
TFD044	Door frame only.	910W x 2080H	810W x 2030H	120 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame / posts found with damage to the head, closing jamb lock keeper areas and corresponding architraves.	D - 3 F - 1	
TFD045	Door frame only.	910W x 2080H	810W x 2030H	120 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame post found with severe damage to the hinge area • Hinge jamb requires replacement • Frame post found with damage to the closing jamb lock keeper area	D - 3 F - 2	
TFD046	Door frame only.	910W x 2080H	810W x 2030H	120 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame post found with slight damage to the hinge areas.	D - 3 F - 1	
TFD047	Door frame only.	910W x 2080H	810W x 2030H	120 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame post found with severe damage to the lock keeper area • Closing jamb and corresponding architrave requires replacement • Frame / posts found with slight damage as a result of heavy traffic.	D - 3 F - 2	
TFD048	Door frame only. (modern)	860W x 2080H	760W x 2030H	100 x 50	?	M	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame found to be of no significance.	D - 3 F - 3	Remove Frame Only
TFD049	Door frame only.	910W x 2080H	810W x 2030H	120 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame found to be of no significance.	D - 3 F - 3	Remove Frame Only
TFD050	Door frame only. (modern)	790W x 2080H	690W x 2030H	100 x 50	?	M	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame found to be of no significance.	D - 3 F - 3	Remove Frame Only

TFD050A	6 No. pane fanlight frame with 6 No. pane / 3 No. panelled square framed door.	1010W x 2750H	860W x 2020H	110 x 75	45	M	S	825	N	N	N	Y	N	N	Y	Y	N	White White	Right Hand Door • Doors found to be of no significance • Localised timber decay to bottom of frame posts • Frame / posts found with damage to the head, hinge and closing jamb lock keeper areas.	D - 3 F - 1	
TFD051	Door frame only.	910W x 2080H	810W x 2030H	75 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame posts found with damage to the hinge and closing jamb lock keeper areas • Architraves found to be loose on the right hand side.	D - 3 F - 1	
TFD052	Door frame only.	910W x 2080H	810W x 2030H	120 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame post found with slight damage to the lock keeper area and around the architraves as a result of heavy traffic.	D - 3 F - 1	
TFD053	Door frame only.	910W x 2080H	810W x 2030H	75 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame post found with severe damage to the bottom hinge area and corresponding architrave • Hinge jamb and architrave requires replacement	D - 3 F - 2	
TFD054	Door frame only.	845W x 2080H	745W x 2030H	120 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame post found with damage to the hinge areas • Telecom wires / cables fitted through the frame.	D - 3 F - 1	
TFD055	Door frame only.	910W x 2080H	810W x 2030H	120 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame post found with damage to the hinge areas.	D - 3 F - 1	
TFD056	6 No. pane fanlight frame with 6 No. pane / 3 No. panelled square framed door.	1010W x 2750H	860W x 2020H	110 x 75	45	M	S	825	N	N	N	Y	N	N	Y	Y	N	White White	Right Hand Door • Doors found to be of no significance • Localised timber decay / spelches to bottom of frame posts • Frame / posts found with slight damage to the head, hinge and closing jamb lock keeper areas.	D - 3 F - 1	
TFD057	Door frame only.	910W x 2080H	810W x 2030H	75 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame post found with severe damage to the hinge area • Hinge jamb requires replacement • Frame post found with slight damage to the closing jamb lock keeper area	D - 3 F - 2	
TFD058	Door frame only.	910W x 2080H	810W x 2030H	75 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame post found with severe damage to the hinge areas and corresponding architrave • Hinge jamb and architrave requires replacement	D - 3 F - 2	
TFD059	Door frame only.	845W x 2080H	745W x 2030H	75 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Lining and architrave found with slight damage.	D - 3 F - 1	
TFD060	Door frame only.	910W x 2080H	810W x 2030H	75 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame posts found with slight damage to the hinge and closing jamb lock keeper areas • Lining and architrave found with slight damage	D - 3 F - 1	
TFD061	Door frame only.	860W x 2080H	760W x 2030H	120 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame / posts found with slight damage to the head, hinge and closing jamb lock keeper areas and corresponding architraves.	D - 3 F - 1	
TFD061A	Framed , ledged and battened door.	915W x 1910H 1960A	805W x 1870H	125 x 50	50	O	S	?	N	K	N	N	N	Y	Y	N	N	Green Green	Right Hand Door • Door and frame found to be in poor condition • Complete renewal of door and frame required.	D - 3 F - 3	
TFD062	Door frame only.	910W x 2080H	810W x 2030H	120 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Severe timber decay to the left hand side plinth block / architrave / frame post • Further investigation required • Dry rot eradication work required • Renewal of infected timber items required • Frame post found slight damage to the closing jamb lock keeper area	D - 3 F - 3	Remove Frame Only
TFD063	Door frame only.	910W x 2080H	810W x 2030H	75 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Severe timber decay to the linings • Further investigation required • Dry rot eradication work required • Head architraves sections found to be missing to both sides • Renewal of frame, linings and head architraves required.	D - 3 F - 3	Remove Frame Only
TFD064	Door frame only.	860W x 2080H	760W x 2030H	120 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Severe timber decay to the right hand side frame post • Further investigation required • Dry rot eradication work required • Renewal of right hand side frame post required • Frame post found with slight damage to the closing jamb lock keeper areas	D - 3 F - 3	Remove Frame Only
TFD065	Door frame only.	910W x 2080H	810W x 2030H	120 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame post found with slight damage to the hinge areas.	D - 3 F - 1	
TFD065A	3 No. pane fanlight frame with temporary plywood framed door	1010W x 2750H	860W x 2020H	115 x 75	n/a	M	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Severe timber decay to the fanlight frame • Further investigation required • Dry rot eradication work required • Salvage fanlight and reuse • Renewal of frame and door required	D - 3 F - 3	
TFD066	Door frame only.	910W x 2080H	810W x 2030H	75 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Severe timber decay to the linings • Further investigation required • Dry rot eradication work required • Renewal of frame / linings required • Frame / post found with slight damage to the head and closing jamb lock keeper areas	D - 3 F - 3	Remove Frame Only
TFD066A	Door frame only.	860W x 2080H	760W x 2030H	120 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame post found with severe damage to the hinge area • Hinge jamb requires replacement • Frame post found with slight damage to the hinge areas • Renew right hand side plinth block	D - 3 F - 2	
TFD066B	Door frame only.	630W x 2080H	530W x 2030H	120 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame post found with severe damage to the closing jamb lock keeper area • Closing jamb requires replacement.	D - 3 F - 2	
TFD067	Door frame only.	910W x 2080H	810W x 2030H	75 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame / post found with slight damage to the head, hinge and closing jamb lock keeper areas.	D - 3 F - 1	
TFD068	Door frame only.	910W x 2080H	810W x 2030H	120 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame / post found with slight damage to the head and closing jamb lock keeper areas.	D - 3 F - 1	
TFD069	Door frame only.	910W x 2080H	810W x 2030H	120 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame post found with slight damage to the hinge areas and corresponding architraves.	D - 3 F - 1	
TFD069A	7 No. pane flag frame with missing sliding door.	730W x 2020H	Missing	120 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Sliding Door • Door missing completely • Frame found to be of no significance.	D - 3 F - 3	Remove Frame Only
TFD070	Door frame only.	860W x 2080H	760W x 2030H	120 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame post found with damage to the hinge areas • Architrave found to be missing to the right hand side • Glue, cramp and pin splits within the frame post	D - 3 F - 2	
TFD071	Door frame only.	910W x 2080H	810W x 2030H	120 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame / post found with slight damage to the hinge and closing jamb lock keeper areas and corresponding architraves.	D - 3 F - 1	
TFD071A	Door frame only.	910W x 2080H	810W x 2030H	120 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Architraves found with slight damage.	D - 3 F - 1	
TFD072	3 No. pane combination frame with 6 No. pane / 2 No. panelled square framed door in arch opening.	1590W x 2110H 2190A	860W x 2090H	115 x 75	50	O	S	810	N	Missing	N	Missing	N	N	Y	Y	N	Green Salmon	Right Hand Door • Door found to be in poor condition and beyond economic repair • Localised timber decay to bottom of frame posts / bottom rail • Renew decayed timbers to the base of the combination frame • Frame post found with slight damage to the closing jamb lock keeper area • Renew door.	D - 3 F - 2	
TFD073	Door frame only.	860W x 2080H	760W x 2030H	120 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame post found with slight damage to the closing jamb lock keeper areas and corresponding architraves.	D - 3 F - 1	
TFD074	Flush hollow core door.	935W x 2030H	835W x 1980H	100 x 50	48	M	S	810	N	P	N	Y	N	N	Y	N	N	Brown Brown	Left Hand Door • Door and frame found to be of no significance.	D - 3 F - 3	Remove Door Remove Frame

TFD075	Door frame only.	910W x 2080H	810W x 2030H	120 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame post found with slight damage to the closing jamb lock keeper area.	D - 3 F - 1	
TFD075A	Door frame only.	910W x 2080H	810W x 2030H	120 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame post found with damage to the hinge areas • Head architrave found to be loose • Glue, cramp and pin splits within the frame post.	D - 3 F - 1	
TFD076	Door frame only.	910W x 2080H	810W x 2030H	120 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame post found with damage to the hinge areas • Frame post found with slight damage to the closing jamb lock keeper areas and corresponding architraves • Glue, cramp and pin splits within the frame post.	D - 3 F - 1	
TFD076A	Door frame only.	630W x 2080H	530W x 2030H	120 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame post found with slight damage to the closing jamb lock keeper areas and corresponding architraves.	D - 3 F - 1	
TFD077	Door frame only.	910W x 2080H	810W x 2030H	120 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame post found with damage to the closing jamb lock keeper area • Glue, cramp and pin splits within the frame post.	D - 3 F - 1	
TFD077A	Door frame only in arch opening.	1010W x 2155H 2205A	895W x 2140H	135 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame / post found with slight damage to the head, hinge and closing jamb lock keeper areas.	D - 3 F - 1	
TFD078	Door frame only.	910W x 2080H	810W x 2030H	120 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame post found with severe damage to the top hinge area and corresponding architrave • Hinge jamb and architrave requires replacement • Frame / post found with slight damage to the head and closing jamb lock keeper areas.	D - 3 F - 2	
TFD079	Door frame only.	860W x 2080H	760W x 2030H	120 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame posts found with slight damage to the hinge and closing jamb lock keeper areas • Architrave and plinth block to the right hand side found to be severely damaged • Renew damaged architrave and plinth block.	D - 3 F - 2	
TFD080	6 No. pane fanlight frame with 6 No. pane / 3 No. panelled square framed door in arch opening	1010W x 2700H 2750A	860W x 2020H	115 x 75	45	M	S	840	N	N	N	Y	N	N	Y	Y	N	White White	Right Hand Door • Doors found to be of no significance • Localised timber decay to the bottom of frame posts • Frame post found with severe damage to the closing jamb lock keeper area • Renew closing jamb section of frame.	D - 3 F - 2	
TFD080A	1 No. panelled square framed door with battened infill, set within an arch opening	635W x 1995H 2045A	545W x 1920H	100 x 50	?	O	S	?	N	K	N	Y	N	Y	Y	N	N	Grey Grey	Left Hand Door • Door found to be in poor condition and beyond economic repair • Localised timber decay to bottom of frame posts • Renew door.	D - 3 F - 2	
TFD081	Door frame only.	910W x 2080H	810W x 2030H	120 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Architraves found with slight damage around the frame as a result of heavy traffic.	D - 3 F - 1	
TFD082	Door frame only.	860W x 2080H	760W x 2030H	120 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame / posts found with slight damage to the head, hinge and closing jamb lock keeper areas • Architrave found to be loose to the right hand side.	D - 3 F - 1	
TFD083	Door frame only.	910W x 2080H	810W x 2030H	120 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame / post found with severe damage to the hinge areas • Hinge jamb requires replacement • Frame / post found with slight damage to the head and closing jamb lock keeper areas.	D - 3 F - 2	
TFD084	Door frame only.	910W x 2080H	810W x 2030H	120 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame / post found with slight damage to the head and closing jamb lock keeper areas.	D - 3 F - 1	
TFD085	Door frame only.	910W x 2080H	810W x 2030H	120 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame posts found with slight damage to the hinge areas.	D - 3 F - 1	
TFD086	Door frame only.	910W x 2080H	810W x 2030H	120 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame found with slight damage to the head area.	D - 3 F - 1	
TFD087	Door frame only.	910W x 2080H	810W x 2030H	120 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame / post found with slight damage to the head and closing jamb lock keeper areas.	D - 3 F - 1	
TFD088	Door frame only.	860W x 2080H	760W x 2030H	120 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame post found with slight damage to the closing jamb lock keeper area.	D - 3 F - 1	
TFD089	5 No. panelled square framed door.	910W x 2080H	810W x 2030H	75 x 50	50	O	S	760	N	Missing	N	Missing	N	N	Y	Y	N	White White	Left Hand Door • 1 No. side of door has been clad in hardboard • Top corner of the door has been cut off • Right hand side architrave and plinth block found to be loose • Frame / posts found with slight damage to the head, hinge and closing jamb lock keeper areas.	D - 3 F - 1	Remove Door Only
TFD089A	6 No. pane fanlight frame with 6 No. pane / 3 No. panelled square framed door in arch opening	1010W x 2700H 2750A	860W x 2030H	115 x 75	45	O	S	840	N	Missing	N	Missing	N	N	Y	Y	N	White Beige	Right Hand Door • Door found to be severely damaged beyond economic repair • Severe timber decay to the fanlight frame • Further investigation required • Dry rot eradication work required • Salvage fanlight and reuse • Renewal of frame and door required.	D - 3 F - 3	
TFD090	Door frame only.	860W x 2080H	760W x 2030H	120 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Missing	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame posts found with slight damage to the hinge and closing jamb lock keeper areas • Architraves and plinth blocks found to be missing to both sides • Reinstall missing architraves and plinth blocks.	D - 3 F - 2	
TFD091	Door frame only.	910W x 2080H	810W x 2030H	120 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Missing	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame post found with severe damage to the hinge areas • Hinge jamb requires replacement • Frame / post found with slight damage to the head and closing jamb lock keeper areas.	D - 3 F - 2	
TFD092	6 No. pane fanlight frame with 6 No. pane / 2 No. panelled square framed door in arch opening	1010W x 2700H 2750A	870W x 2030H	115 x 75	45	M	S	840	N	N	N	Y	N	N	Y	Y	N	White White	Left Hand Door • Door found to be of no significance • Localised timber decay to the fanlight frame posts • Further investigation required • Frame joints opening up as a result of structural movement • Salvage fanlight and reuse • Renewal of frame and door required.	D - 3 F - 3	
TFD093	Door frame only.	910W x 2080H	810W x 2030H	120 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Missing	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame post found with severe damage to the hinge areas • Hinge jamb requires replacement • Full set of architraves and plinth blocks found to be missing to opening side and left hand side architrave missing to the closing side • Reinstall missing architraves and plinth blocks.	D - 3 F - 2	
TFD094	Door frame only.	910W x 2080H	810W x 2030H	120 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Missing	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame found to be in good condition • Architraves and plinth blocks found to be missing to both sides • Reinstall missing architraves and plinth blocks.	D - 3 F - 2	
TFD095	Door frame only.	910W x 2080H	810W x 2030H	285 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Missing	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame post found with split damage to the hinge areas • Glue, cramp and pin splits within the frame post • Frame posts found with slight damage to the hinge and closing jamb lock keeper area.	D - 3 F - 1	
TFD096	Opening only door frame missing completely.	Missing	Missing	285 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Missing	n/a	n/a	n/a	Right Hand Door • Door and frame missing completely • Reinstall full door and frame set.	D - 3 F - 3	
TFD097	Door frame only.	910W x 2080H	810W x 2030H	120 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame posts found with slight damage to the hinge and closing jamb lock keeper area.	D - 3 F - 1	
TFD098	Door frame only.	910W x 2080H	810W x 2030H	120 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame posts found with slight damage to the hinge and closing jamb lock keeper areas.	D - 3 F - 1	
TFD099	Door frame only.	910W x 2080H	810W x 2030H	120 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame post found with severe damage to the hinge areas • Hinge jamb requires replacement • Frame post found with slight damage to the closing jamb lock keeper area.	D - 3 F - 2	

TFD100	6 No. pane fanlight frame with 6 No. pane / 3 No. panelled square framed door in arch opening	1010W x 2700H 2750A	860W x 2030H	115 x 75	45	M	S	840	N	N	N	Missing	N	N	Y	Y	N	White White	Right Hand Door • Door found to be of no significance • Localised timber decay to the fanlight frame posts • Further investigation required • Frame joints opening up as a result of structural movement • Salvage fanlight and reuse • Renewal of frame and door required.	D - 3 F - 3	
TFD101	Door frame only.	860W x 2080H	760W x 2030H	120 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame post found with severe damage to the hinge areas • Hinge jamb requires replacement • Architrave found to be damaged to the left hand side • Renew damaged section of architrave	D - 3 F - 2	
TFD102	Door frame only.	860W x 2080H	760W x 2030H	120 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Architrave found to be damaged around the frame as a result of heavy traffic.	D - 3 F - 1	
TFD103	Opening only door frame missing completely.	Missing	Missing	285 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Missing	n/a	n/a	n/a	Left Hand Door • Door and frame missing completely • Reinststate full door and frame set.	D - 3 F - 3	
TFD104	Door frame only.	910W x 2080H	810W x 2030H	120 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame posts found with slight damage to the hinge and closing jamb lock keeper areas.	D - 3 F - 1	
TFD105	Door frame only.	910W x 2080H	810W x 2030H	120 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame post found with severe damage to the hinge areas • Hinge jamb requires replacement • Frame / post found with slight damage to the head and closing jamb lock keeper areas • Full set of architraves and plinth blocks found to be missing to the opening side • Reinststate missing architraves and plinth blocks.	D - 3 F - 2	
TFD106	6 No. pane fanlight frame with 6 No. pane / 3 No. panelled square framed door in arch opening	1010W x 2700H 2750A	860W x 2030H	115 x 75	45	O	S	840	N	Missing	N	Y	N	N	Y	Y	N	Yellow White	Left Hand Door • Door found to be severely damaged beyond economic repair • Localised timber decay to the fanlight frame posts • Further investigation required • Frame joints opening up as a result of structural movement • Salvage fanlight and reuse • Renewal of frame and door required.	D - 3 F - 3	
TFD107	Door frame only.	910W x 2080H	810W x 2030H	120 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame post found with severe damage to the hinge areas • Hinge jamb requires replacement • Frame found with slight damage to the head area • Full set of architraves and plinth blocks found to be missing to the opening side • Reinststate missing architraves and plinth blocks	D - 3 F - 2	
TFD108	Door frame only.	910W x 2080H	810W x 2030H	120 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame post found with slight damage to the hinge areas • Full set of architraves and plinth blocks found to be missing to the opening side • Reinststate missing architraves and plinth blocks	D - 3 F - 2	
TFD110	Door frame only.	910W x 2080H	810W x 2030H	120 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Missing	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame post found with severe damage to the hinge areas • Hinge jamb requires replacement • Full set of architraves and plinth blocks found to be missing to both sides • Reinststate missing architraves and plinth blocks.	D - 3 F - 2	
TFD111	Door frame only.	910W x 2080H	810W x 2030H	120 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Missing	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame post found with severe damage to the hinge areas • Hinge jamb requires replacement • Frame posts found with slight damage to the closing jamb lock keeper area • Full set of architraves and plinth blocks found to be missing to both sides • Reinststate missing architraves and plinth blocks.	D - 3 F - 2	
TFD112	Opening only door frame missing completely.	Missing	Missing	285 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Missing	n/a	n/a	n/a	Left Hand Door • Door and frame missing completely • Reinststate full door and frame set.	D - 3 F - 3	
TFD113	Door frame only.	860W x 2080H	760W x 2030H	120 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Missing	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame post found with severe damage to the hinge areas • Hinge jamb requires replacement • Frame posts found with slight damage to the closing jamb lock keeper area • Full set of architraves and plinth blocks found to be missing to both sides • Reinststate missing architraves and plinth blocks.	D - 3 F - 2	
TFD114	6 No. pane fanlight frame with 6 No. pane / 3 No. panelled square framed door in arch opening	1010W x 2700H 2750A	860W x 2030H	115 x 75	45	M	S	840	N	N	N	Missing	N	N	Y	Y	N	White White	Right Hand Door • Door found to be of no significance • Localised timber decay to the fanlight frame posts • Further investigation required • Frame joints opening up as a result of structural movement • Salvage fanlight and reuse • Renewal of frame and door required.	D - 3 F - 3	
TFD116	6 No. pane fanlight frame with 6 No. pane / 3 No. panelled square framed door in arch opening	1010W x 2700H 2750A	860W x 2030H	115 x 75	45	M	S	840	N	N	N	Y	N	N	Y	Y	N	White White	Right Hand Door • Door found to be of no significance • Localised timber decay to the fanlight frame posts • Further investigation required • Frame joints opening up as a result of structural movement • Salvage fanlight and reuse • Renewal of frame and door required.	D - 3 F - 3	
TFD117	Door frame only.	860W x 2080H	760W x 2030H	120 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Missing	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame post found with severe damage to the hinge areas • Hinge jamb requires replacement • Frame posts found with slight damage to the closing jamb lock keeper area • Full set of architraves and plinth blocks found to be missing to both sides • Reinststate missing architraves and plinth blocks.	D - 3 F - 2	
TFD118	Door frame only.	910W x 2080H	810W x 2030H	120 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Missing	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame post found with severe damage to the hinge areas • Hinge jamb requires replacement • Frame posts found with slight damage to the closing jamb lock keeper area • Full set of architraves and plinth blocks found to be closing side • Reinststate missing architraves and plinth blocks.	D - 3 F - 2	
TFD119	Door frame only.	910W x 2080H	810W x 2030H	120 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Missing	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame post found with severe damage to the hinge areas • Hinge jamb requires replacement • Frame posts found with slight damage to the closing jamb lock keeper area • Full set of architraves and plinth blocks found to be missing to both sides • Reinststate missing architraves and plinth blocks.	D - 3 F - 2	
TFD120	Opening only door frame missing completely.	Missing	Missing	285 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Missing	n/a	n/a	n/a	Right Hand Door • Door and frame missing completely • Reinststate full door and frame set.	D - 3 F - 3	
TFD121	Door frame only.	910W x 2080H	810W x 2030H	120 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Missing	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame post found with slight damage to the closing jamb lock keeper area • Full set of architraves and plinth blocks found to be missing to both sides • Reinststate missing architraves and plinth blocks	D - 3 F - 2	
TFD122	Door frame only.	910W x 2080H	810W x 2030H	120 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame post found with slight damage to the hinge areas.	D - 3 F - 1	
TFD123	Door frame only.	910W x 2080H	810W x 2030H	120 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Frame post found with slight damage to the closing jamb lock keeper area • Architraves found to be severely damaged to the left hand side • Reinststate damaged architrave	D - 3 F - 2	
TFD124	Door frame only.	910W x 2080H	810W x 2030H	120 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame found to be in good condition *** softwood timber architraves fitted to 1 No. side of frame***	D - 3 F - 2	
TFD125	Door frame only.	910W x 2080H	810W x 2030H	120 x 50	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Left Hand Door • Door missing completely • Severe timber decay to frame posts • Further investigation required • Remove temporary inserted framework / visqueen sheeting • Renewal of frame and door required	D - 3 F - 3	Remove Frame Only
TFD126	Opening only door frame missing completely.	Missing	Missing	100 x 50	?	M	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Missing	n/a	n/a	n/a	Right Hand Door • Door missing completely • Frame found to be of no significance.	D - 3 F - 3	Remove Frame Only
TFD127	Door frame currently boarded over in arch opening	760W x 1860H 1910A	?	?	?	O	S	n/a	n/a	n/a	n/a	n/a	n/a	n/a	Y	n/a	n/a	n/a	Right Hand Door • Remove security boarding • Make good minor damage around door and frame • Further investigation required.	D - 1 F - 1	

