

Notes

- Various areas of concrete fill to redundant fittings. These do not appear to be causing harm to surrounding fabric. Leave but observe.
- Signage to be removed and fabric beneath made good to match existing.
- Consider stone indent - however, extent of erosion given age is not extensive.
- Replacement air grill to match elsewhere.
- Timber frames - clean off peeling finish.
- Cleaned off adhered material/adhesive
- Large piece of stone missing behind - indent only required if water ingress locally.

Repairs

- AtMB - Repair -Remove biological growth
- AtMB - Repair -Replace brick
- AtMB - Repair -Repointing
- AtMB - Repair -Stone indent or sacrificial mortar fill
- AtMB - Repair -Stone indent repair
- AtMB - Repair -Remove loose hard mortar with brush
- AtMB - Repair -Clean to remove guano deposits
- AtMB - Repair -Cracked brick. Mortar fill.
- AtMB - Repair -Mortar fill redundant fixing hole
- AtMB - Repairs -Clean off graffiti paint
- AtMB - Repair - Descale
- AtMB - Repair -Structural repair to S.E. details

REV | NOTE | DRN/CHK

Mosley Street


Proposed Elevation - Princess Street - Repairs

PROJECT REF. 1995
DRWG NO. P(223)
REVISION
SCALE 1:100 @ A3
DATE 1st May 24
DRAWN HW

SK sketch E Existing P proposed T tender C construction FI final issue

+44 161 236 0051
ARCHITECT@ATELIERMB.CO.UK

ATELIER.MB

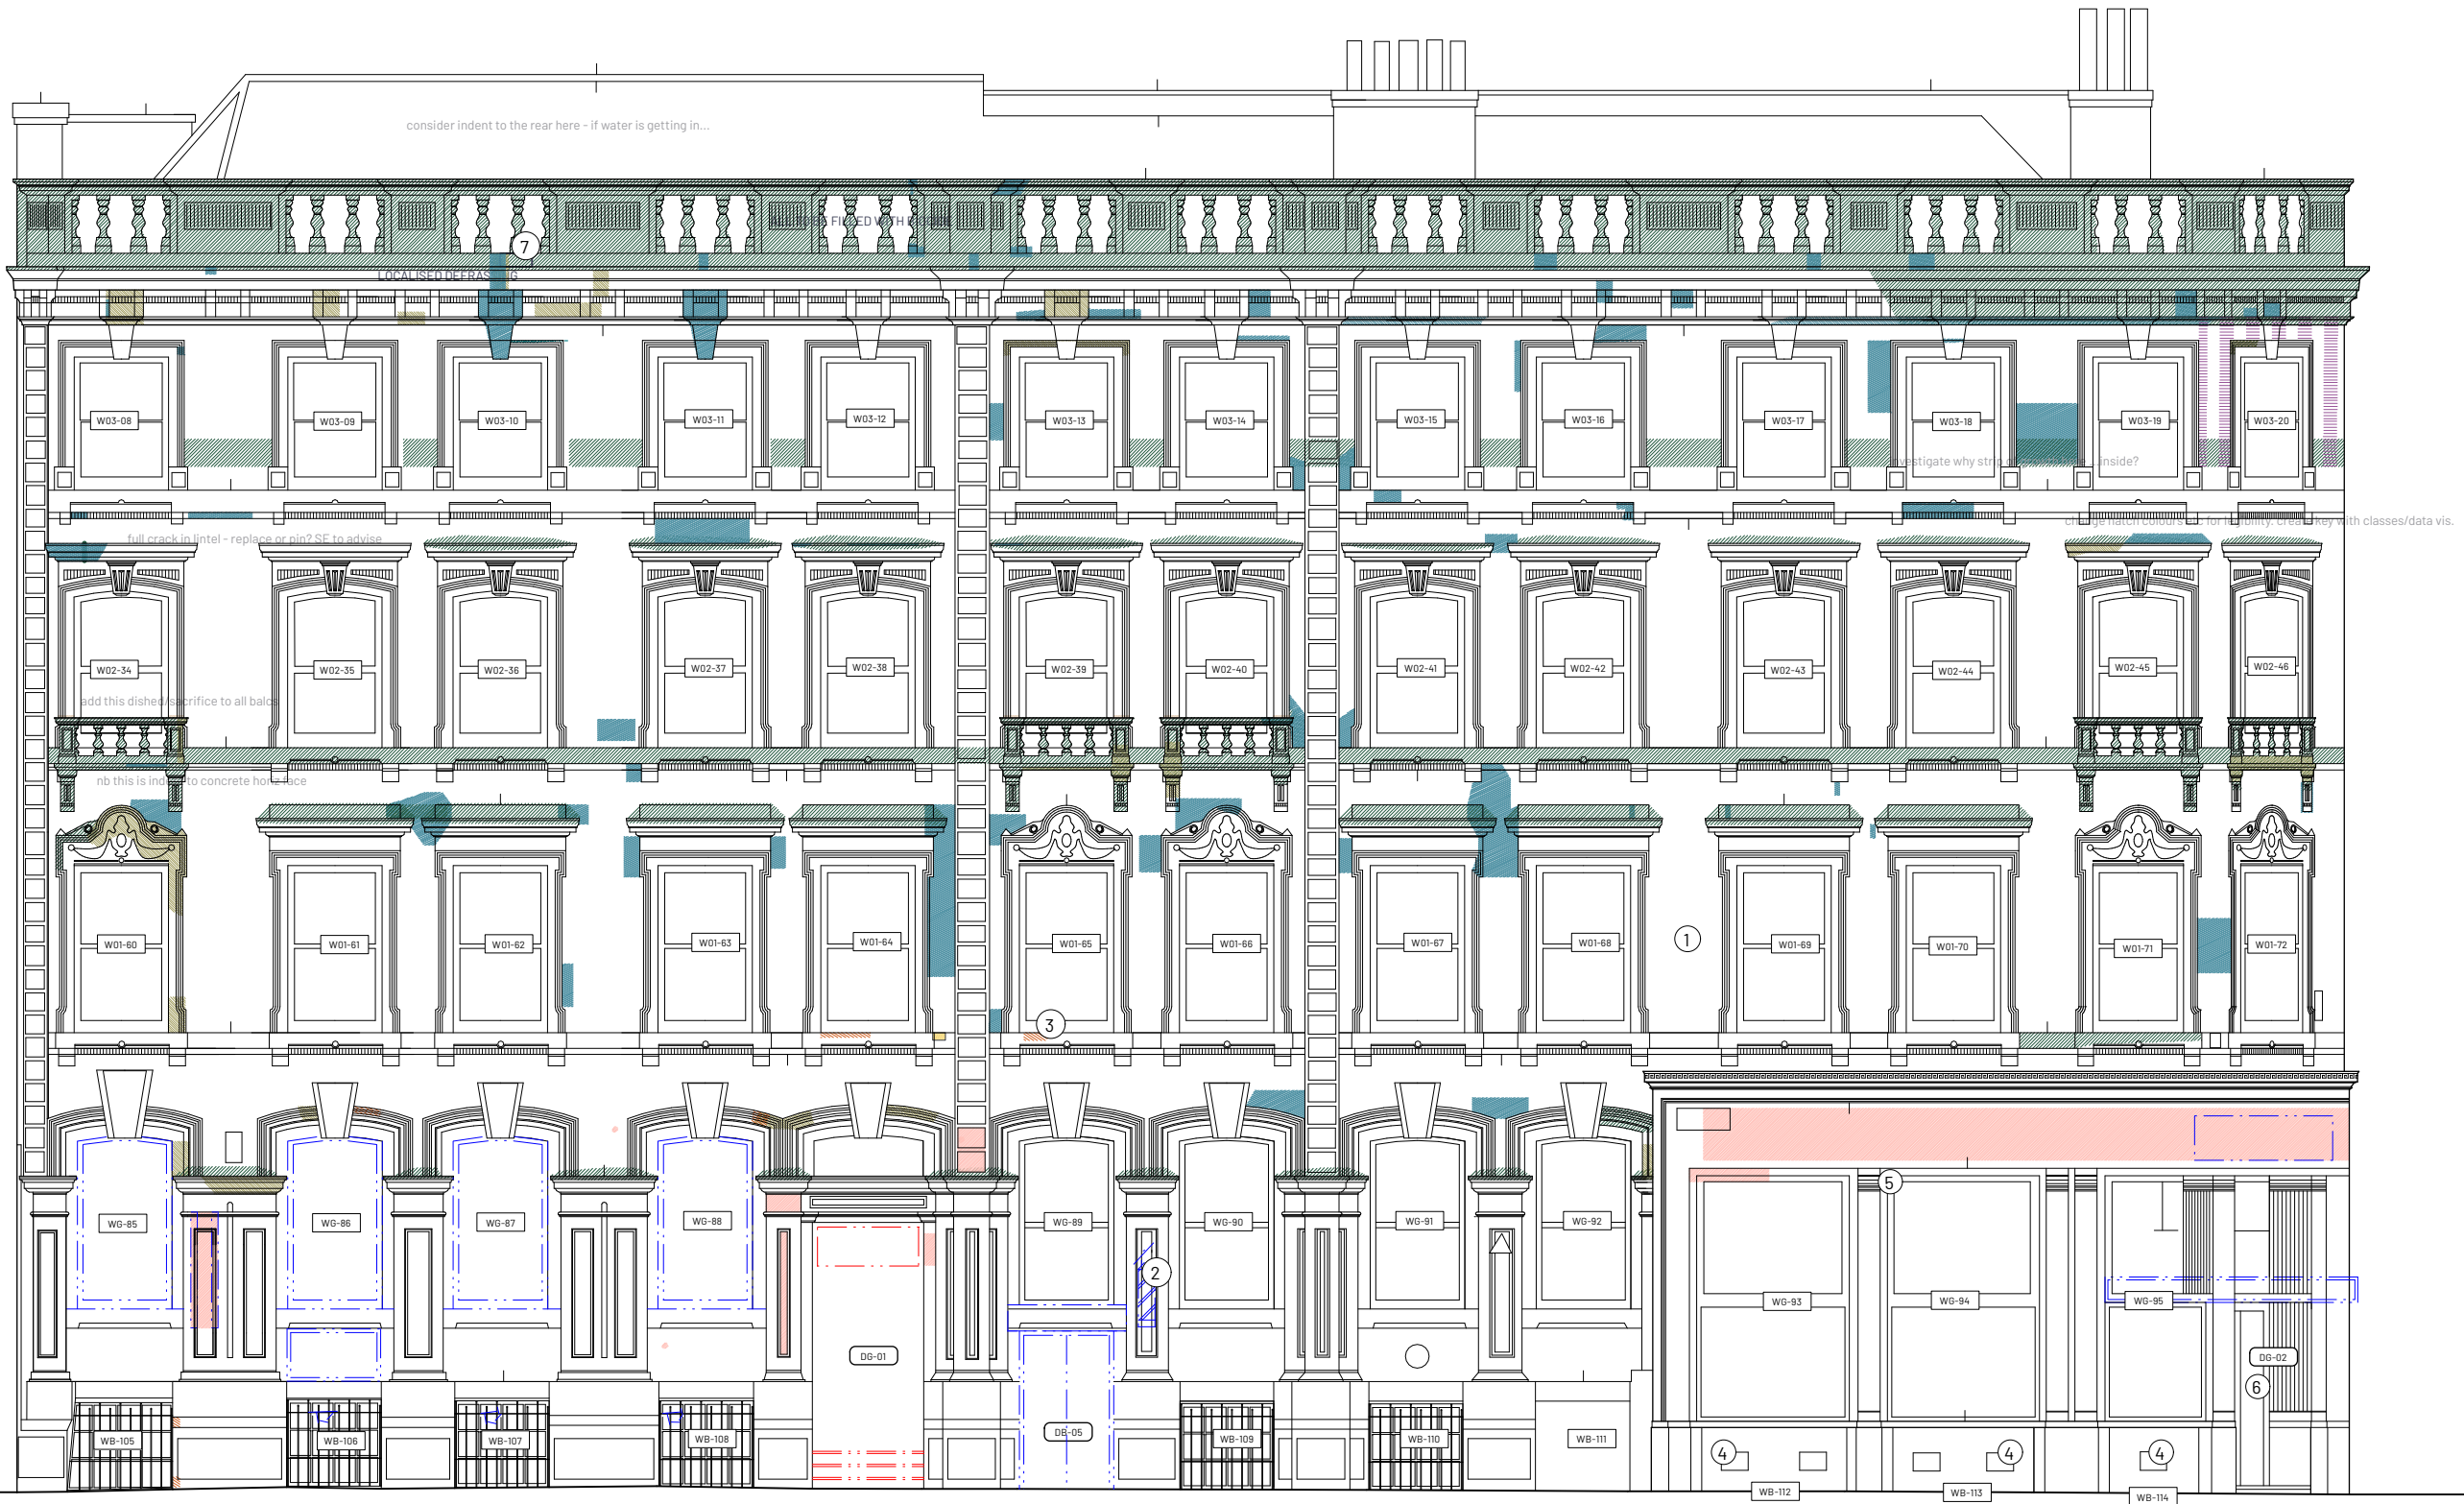

0 1 2 3 4 5m

1:100 @ A3