

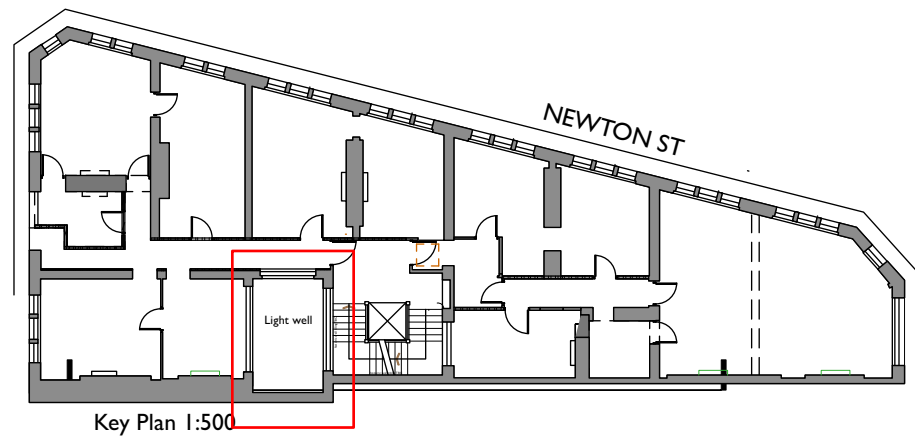


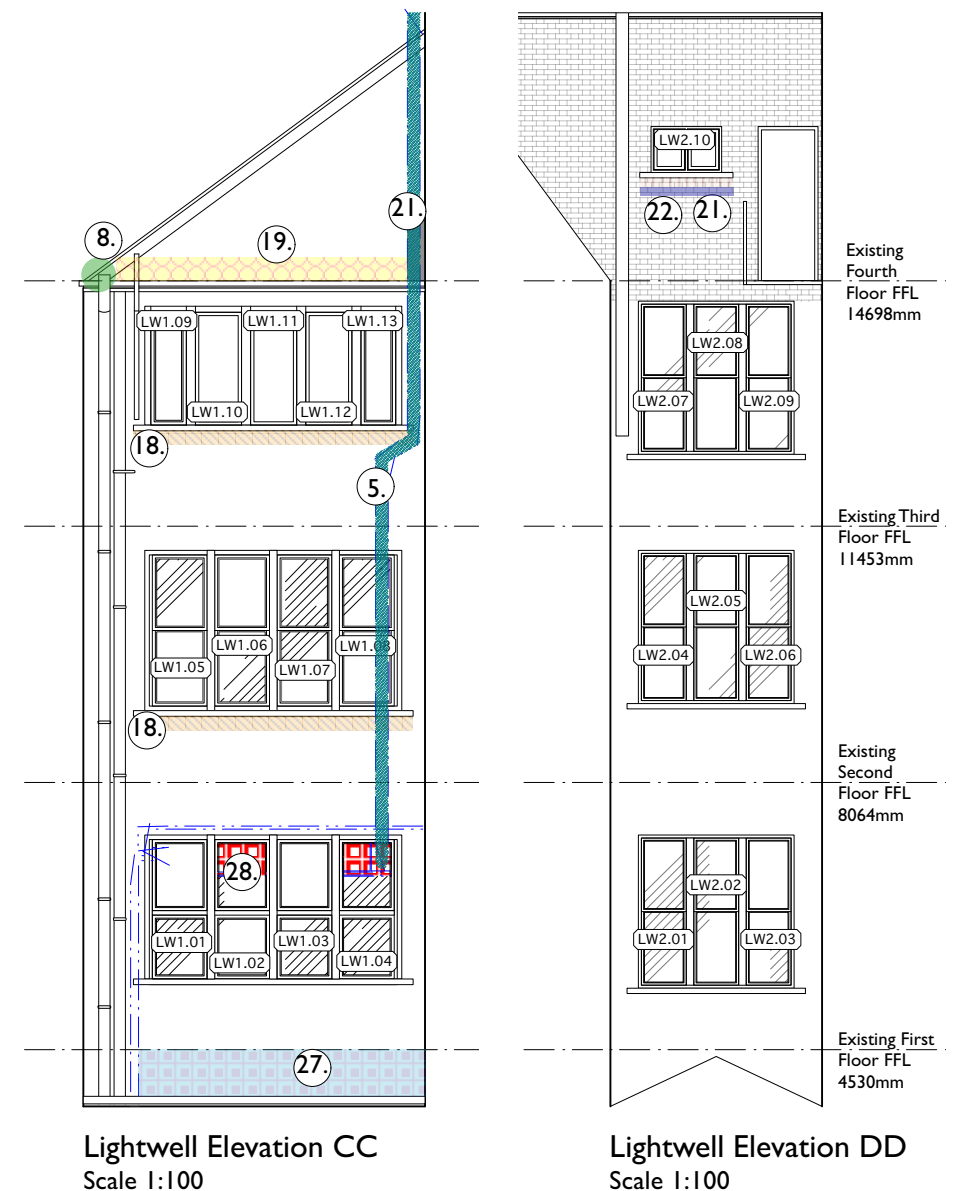

- 1 Sandstone erosion - close inspection required.
- 2 Holes left by redundant fixings - mortar fill in accordance with specification.
- 3 Gaps in brickwork. Close inspection required to inform replacement with matching material.
- 4 Missing pointing between frieze panels. Reinstall in accordance with specification.
- 5 Redundant plant equipment carefully remove and make good fabric in accordance with specification.
- 6 Eroded sandstone coping. Close inspection required. Replacement matching stone inserts may be required to prevent further deterioration.
- 7 Rusting lintels Clean off and repaint in accordance with specification.
- 8 Biological growth to be removed from roof level.
- 9 Coping water staining. May require repointing. Close inspection required.
- 10 Previous repairs to sandstone. Poorly matched aesthetic and presumed composition, but no evidence repairs are causing damage to surrounding historic fabric. Add to building maintenance plan for regular monitoring.
- 11 Biological growth to stone to be cleaned in accordance with specification.
- 12 Water staining may be caused by missing pointing. Close inspection required to inform repair strategy.
- 13 Signs of cracking. Further inspection required on site.
- 14 Redundant cables/lights/alarm box. Carefully remove
- 15 Residue from former sign to be cleaned off sandstone. Method pending site trials.
- 16 Existing timber to be carefully removed from brickwork

- 17 Clean off atmospheric dirt from glazed tiles
- 18 Redecorate cill
- 19 Clean-out gutters
- 20 Missing slate to be investigated once high level access provided
- 21 Repair and redecorate timber window frame and rotten cill
- 22 Clean concrete cill
- 23 Reinstall missing pointing
- 24 Inspect felt roof
- 25 Loose board and flashing to be repaired
- 26 inspect stone cill. Possible damage causing biological growth and staining to wall
- 27 Paint flanking and signs of damp further inspection required
- 28 Reinstall original sash configuration

Allow for the renewal of gutters and rainwater outlet to roof

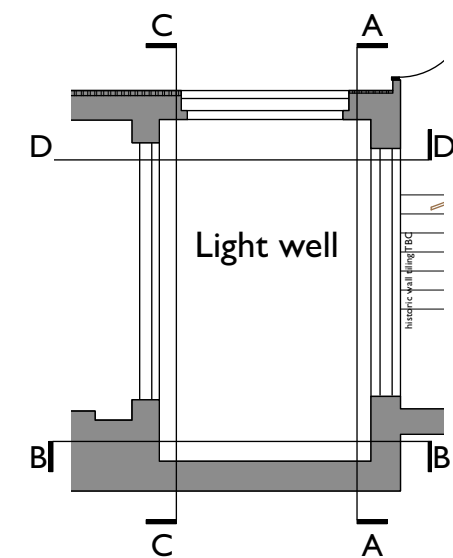

COPYRIGHT OF ATELIER MB LTD
DO NOT SCALE FROM THIS DRAWING
DIMENSIONS TO BE CHECKED ON SITE

Note: These elevations are indicative and not based on a full measured survey

Existing
Proposed

Note: Floor Levels are Approximate

Flashings to be renewed as required

Rev Note DRN CHK

St Margarets Chambers
For Charlotte Street Estates

Lightwell Elevations - Proposed Repairs and Conditions 2/2

scheme 1907
drwg no. **P(237)**
revision

scale 1:100 @ A3
date first drawn February 2022
drawn RG

SK sketch E existing P proposed T tender C construction FI final issue

www.ateliermb.co.uk
t. 0161 236 0051
e. architect@ateliermb.co.uk