


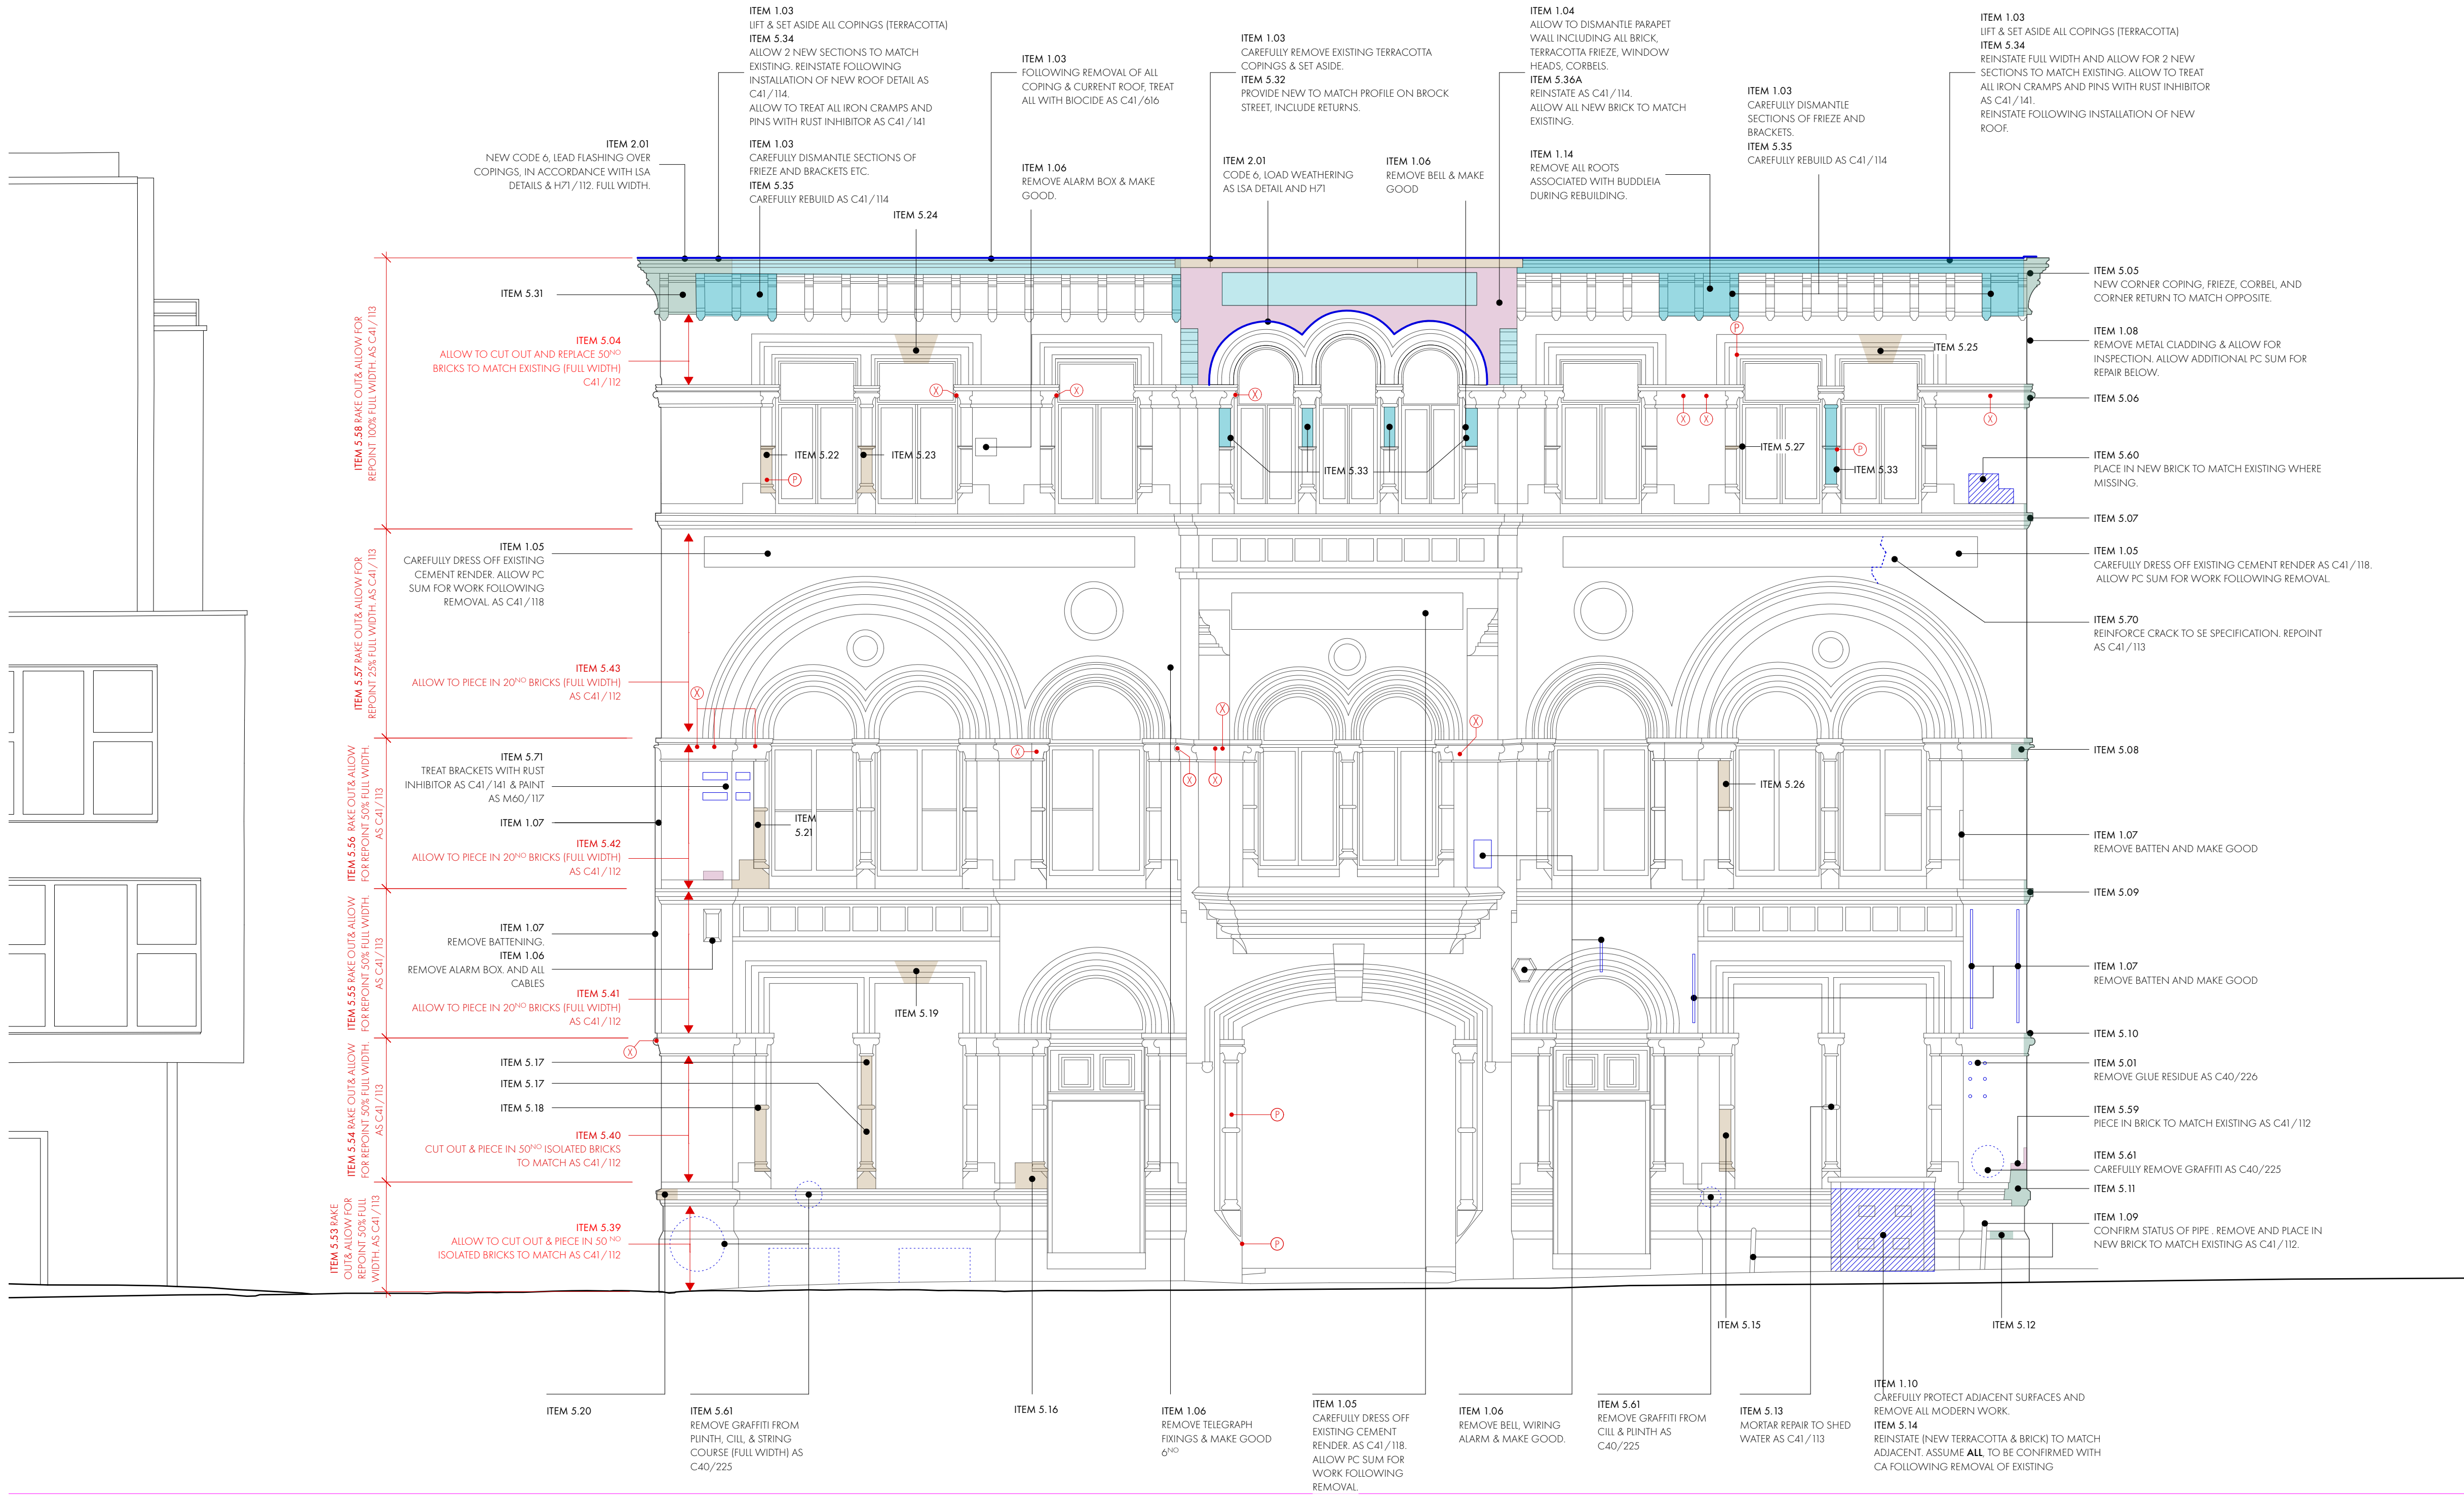

REVISION	DATE	DESCRIPTION

- CAREFULLY DISMANTLE TERRACOTTA COPING TO CORNICE, INSPECT & ALLOW TO REBUILD, ALLOW PC SUM FOR RENEWAL AND REPAIRS AS STATED. AS C41 /114.
- CAREFULLY DISMANTLE/ REMOVE EXISTING TERRACOTTA. (WHERE APPLICABLE) PROVIDE NEW TO MATCH EXISTING. (OR AS STATED) AS C41 /115
- CAREFULLY DISMANTLE, ALLOW TO REBUILD BRICKWORK/ ALLOW FOR RENEWAL AS STATED C41 /112.
- TERRACOTTA MISSING. PREPARE AND PROVIDE NEW SECTION AS C41 /121 (I WILL REQUIRE PATTERN)
- ITEM 2.01
NEW CODE 6 LEAD FLASHING/ WEATHERING AS H71 /112
- ITEM 5.02
CAREFULLY REMOVE PIN CRACKED TERRACOTTA (SUBJECT TO SITE TRIAL) AS C41 /119 & REINSTATE.
- ITEM 5.03
MISSING ACANTHUS LEAF DETAIL (SINGLE) REMOVE EXISTING PIN (IRON). PROVIDE NEW TERRACOTTA DETAIL AND RE ADD USING STAINLESS DOWEL AS C41 /120.
- ITEM 1.15
REMOVE **ALL** METAL GRILLES & METAL ROLLER SHUTTER, & MAKE GOOD. ALLOW ADDITIONAL PC SUM FOR REPAIR FOLLOWING REMOVAL.
- ITEM 5.04
CAREFULLY REMOVE PIN CRACKED TERRACOTTA (SUBJECT TO SITE TRIAL) AS C41 /119 & REINSTATE.