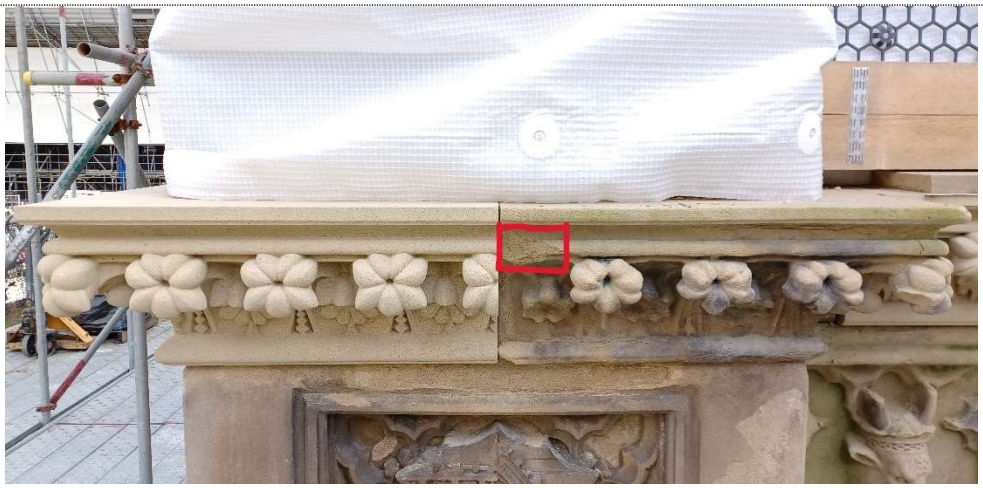
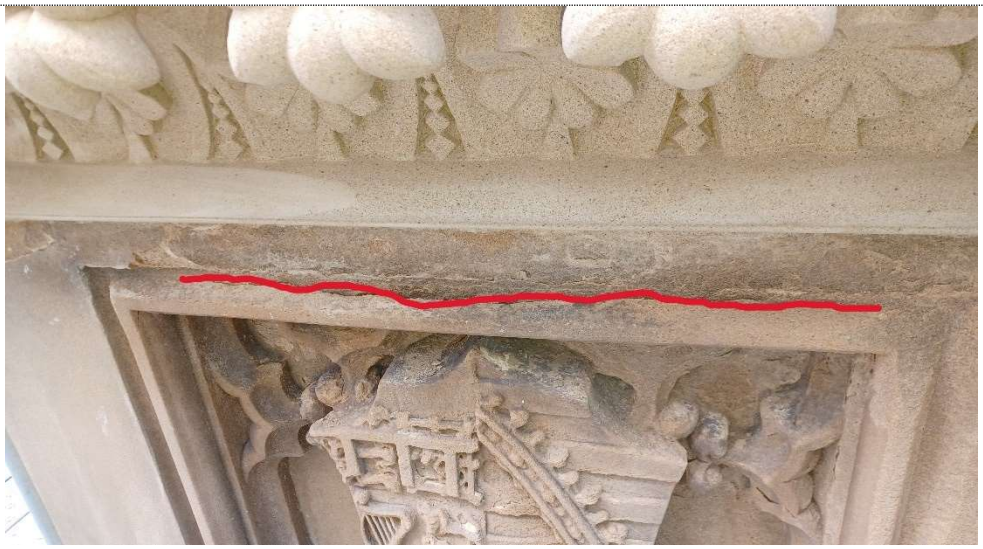
SITE RECORD SHEET

PURCELL

Aconex Ref: OTH-PUR-TH-ZZ-SRS-A-0717	**Date:** 31/10/2024
Document Title: Albert Memorial – Works to Plinth	**Revision:** 01
Visit By: Jamie Coath, Andrew Bailey (Purcell)	**Status: -** For Construction
Attended: See below sections	**Attachments:** Photos embedded where applicable

No	Item/Room	Comments	Action
		Following site review on 22.10.24, a series of works were identified at plinth level as follows:	
1.1	Albert Memorial – West Elevation	 A mortar repair is required to make good the upper moulding of the cornice where damage has occurred during site works. This will ensure the stonework below is properly weathered. Repair to be colour matched to the stone.	
1.2	Albert Memorial – South Elevation (west shield)	 The upper roll to the shield is at risk of detaching and being lost. It is believed that the cleaning of this area (as a result of the significant repairs undertaken above) has led to this damage. The fissure is to be filled with lime grout and then weathered with lime mortar to ensure the detail is preserved.	

Checklist:

Active Work/ Upcoming Work
Progress Against Programme
Quality of Work/ Defective Work
Any change from contract work to note
RFI answered

Clerk of Works items to note
Review with JC or other
Materials on Site/ Storage/ Quality
Heritage Surgery notes
Samples Approved/ Rejected

Number of People Working on Site
Site Safety Issues
Test Certificates/ RAMS reviewed
Aconex uploaded (check off once uploaded)

1.3	Albert Memorial – South Elevation (east shield)	 The upper roll to the shield is at risk of detaching and being lost. It is believed that the cleaning of this area (as a result of the significant repairs undertaken above) has led to this damage. The fissure is to be filled with lime grout and then weathered with lime mortar to ensure the detail is preserved.	