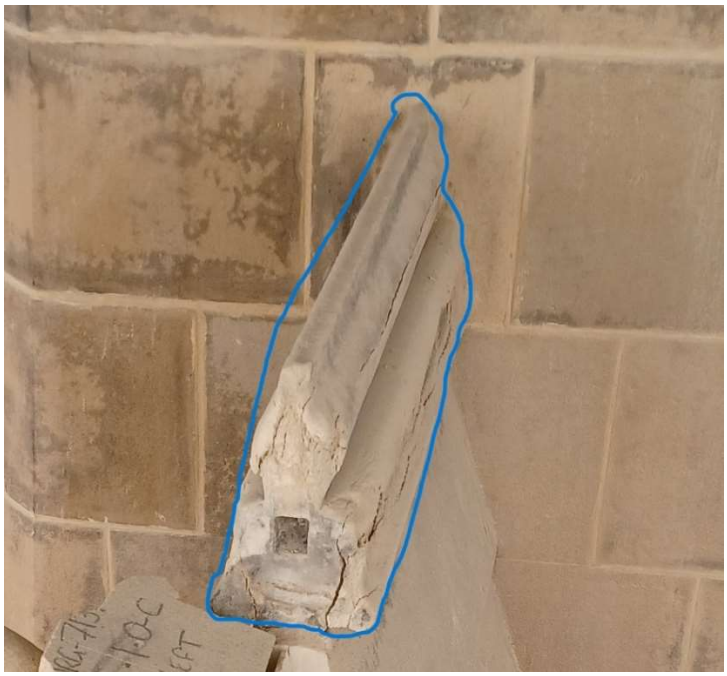
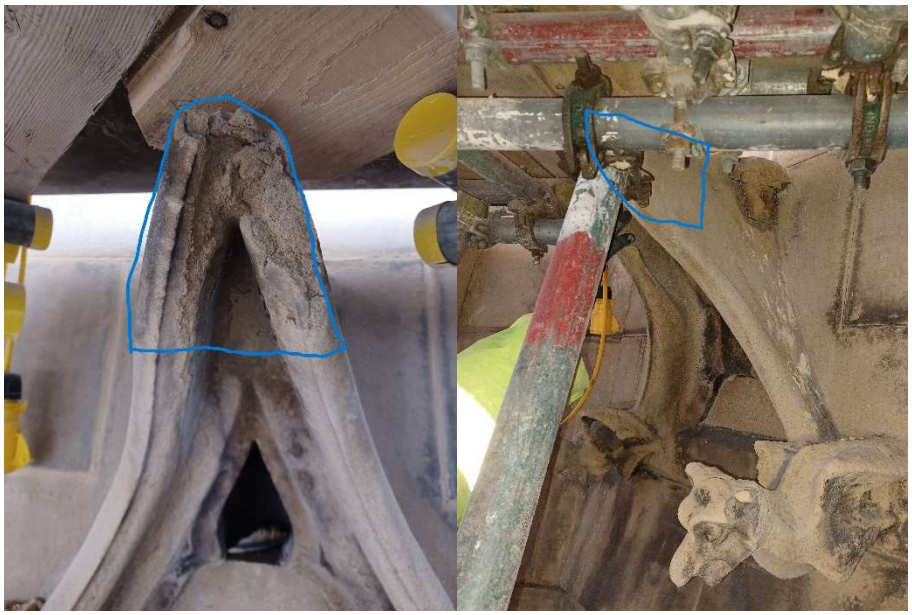
SITE RECORD SHEET



PURCELL

Aconex Ref: OTH-PUR-TH-ZZ-SRS-A-0601	**Date:** 24/04/2024
Document Title: Albert Memorial – Confirmation of High Level Repairs	**Revision:** -
Visit By: Jamie Coath, Andrew Bailey (Purcell)	**Status: -** For Information
Attended: See below sections	**Attachments:** Photos embedded where applicable

No	Item/Room	Comments	Action
		Following site review on 04.04.24, a number of high level repairs have been identified as being required.	
1.1	Albert Memorial – South Gable	Coping stone to gable on south elevation. Stone badly fractured. Full replacement recommended. 	
1.2	Albert Memorial – South East roof gablet	Considerable damage to end of small gablet. 1nr. carved indent repair required to end of ridge to match intact detail on North East roof gablet (two views of same gablet shown below) 	

Checklist:

Active Work/ Upcoming Work
Progress Against Programme
Quality of Work/ Defective Work
Any change from contract work to note
RFI answered
Clerk of Works items to note
Review with JC or other
Materials on Site/ Storage/ Quality
Heritage Surgery notes
Samples Approved/ Rejected
Number of People Working on Site
Site Safety Issues
Test Certificates/ RAMS reviewed
Aconex uploaded (check off once uploaded)

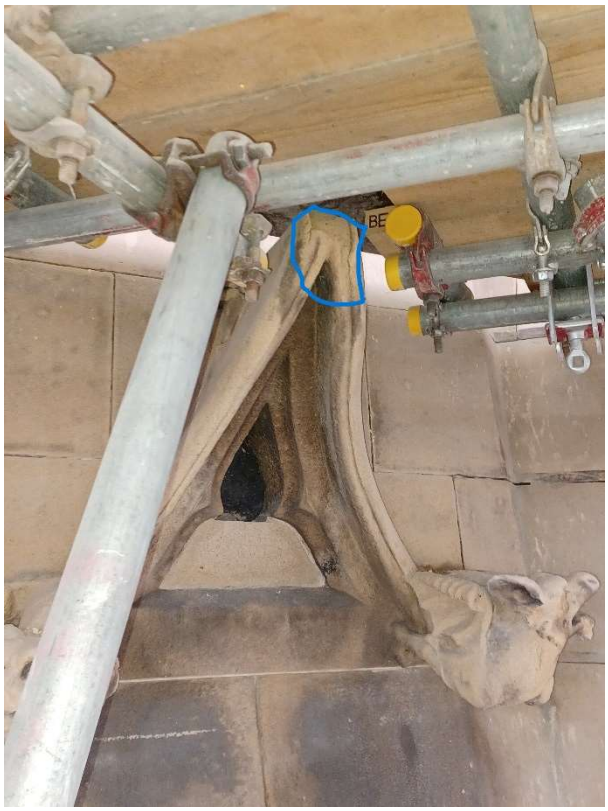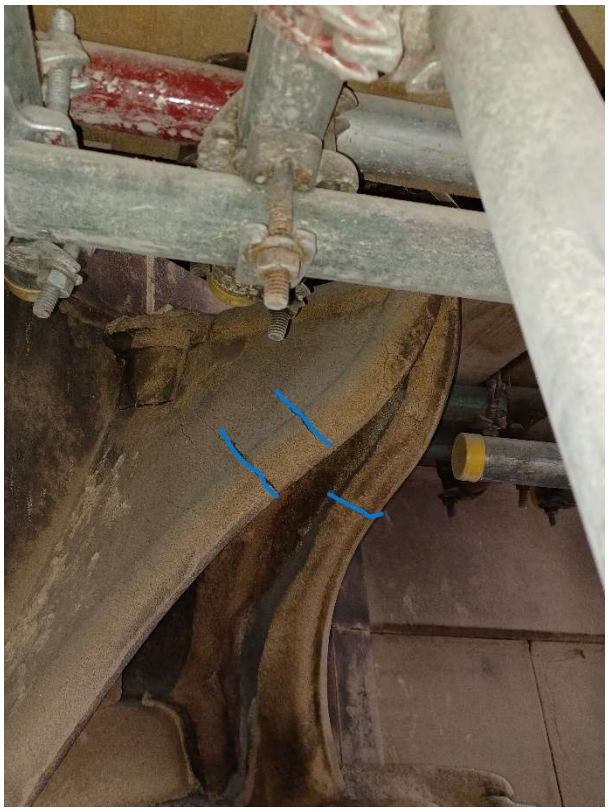1.3	Albert Memorial – North West roof gablet	Crumbly/ delaminating stone noted to end of ridge of small gable. Defrass loose material. 	
1.4	Albert Memorial – South West roof gablet	Fissures noted to small gablet. 'V' joint each split and point with lime mortar. 	

1.5	Albert Memorial – South West roof gablet	Considerable damage/ loss of wing tips of projecting griffin. Carved indent repair required to **both** wing tips. 