



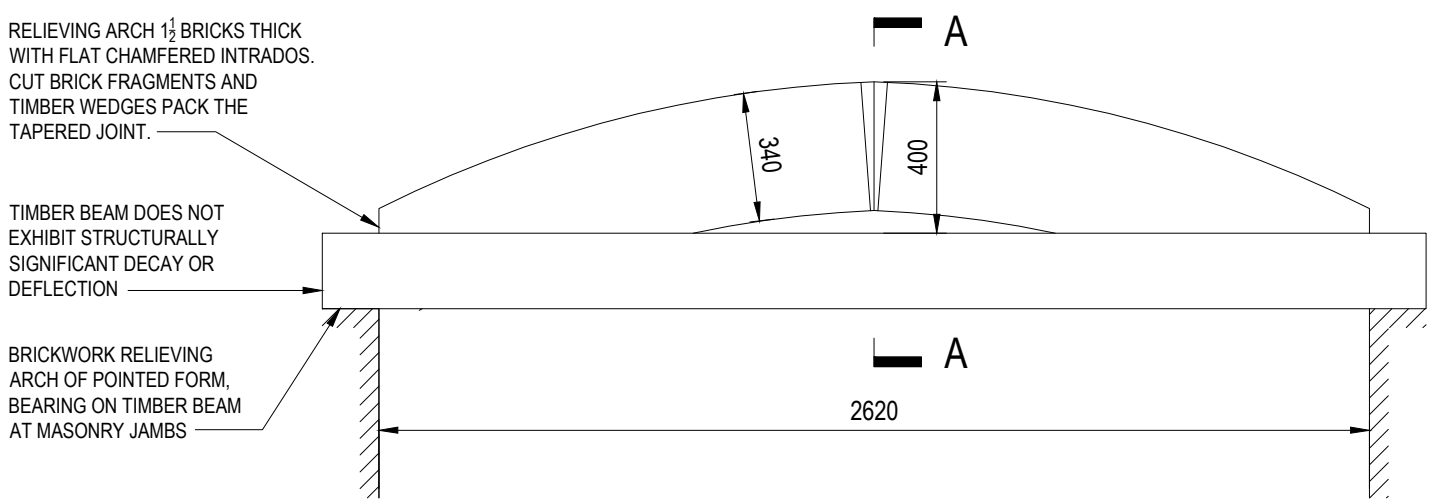

DETAIL 01: ELEVATION ON OPENING TO BAY WINDOW
(APPROX. 1:10)

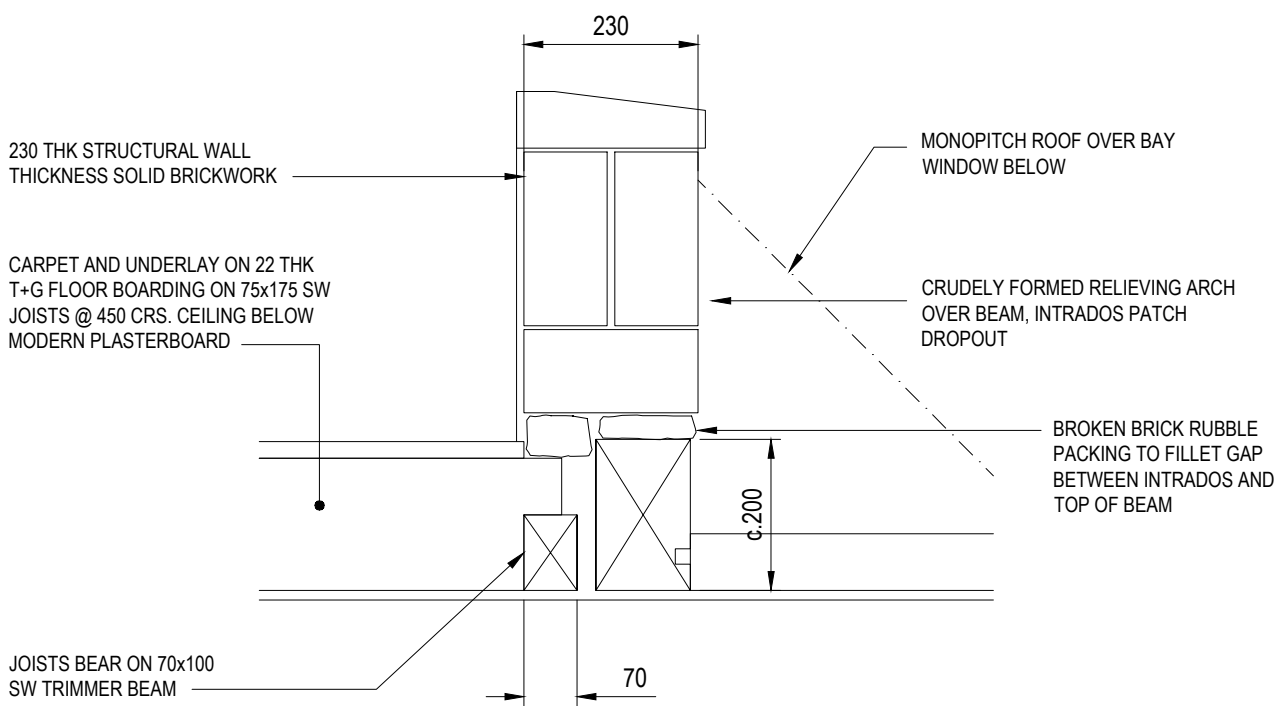

DETAIL 02: SECTION A-A THROUGH OPENING TO BAY WINDOW
(APPROX. 1:5)



IMAGE 01: EXTERNAL ELEVATION ON STRUCTURAL OPENING TO BAY WINDOW. NOTE THE SIGNIFICANT DOWNWARD CRANK OF FIRST FLOOR WINDOW OPENINGS, DOWNWARD TRANSLATION OF CENTRAL PIER OF MASONRY



IMAGE 03: VIEW OF RIGHT-HAND BEARING (AS VIEWED EXTERNALLY. SEE IMAGE 01) SHOWING TIMBER WEDGES AND CUT BRICK PACKERS TO AWKWARD TAPERED END OF RELIEVING ARCH. NOTE LOOSE CHARACTER OF CUT BRICK UNITS AS ARCH SLIDES ALONG BEAM.



IMAGE 02: EXTERNAL VIEW OF RELIEVING ARCH OVER TIMBER BEAM SHOWING AWKWARD FLAT CHAMFER OF INTRADOS. DROP-OUT OF INTRADOS AND PACKING UNITS BELOW CROWN.



IMAGE 04: VIEW OF LEFT-HAND BEARING (AS VIEWED EXTERNALLY. SEE IMAGE 01) SHOWING TIMBER WEDGES AND CUT BRICK PACKERS TO AWKWARD TAPERED END OF RELIEVING ARCH, SIMILAR TO OPPOSITE BEARING (IMAGE 03). TIMBER BEAM APPEARS IN SOUND TIMBER CONDITION.