




- 01 existing timber window, internal architraves, and cill repaired and painted
02 existing dado rail repaired as required and painted
03 existing skirting repaired as required and painted
04 existing painted plaster wall repaired as required and painted
05 existing painted plaster ceiling repaired as required and painted
06 new plasterboard ceiling concealing existing ceiling with possible cornice above
07 existing chipboard raised floor retained with new carpet and underlay
08 new p.p.c clear double glazed secondary glazing unit
09 existing skirtings re-located following removal of chipboard raised floor
10 all existing cornices to be retained, repaired and painted
11 new independent waterproof and insulated wall with painted plasterboard lining
12 existing stone slab retained and over-boarded with plywood
13 new painted skirtings to match existing
14 new beam required for structural integrity
15 insulation with painted plaster finish fixed to existing timber ceiling
16 new concrete steps and floor slab
17 exposed concrete ceiling to underside of new floor
18 new exposed screed floor finish to retail unit
19 existing floor tiles and skirtings retained and repaired as necessary
20 new p.p.c doors and associated glazing with louvred over-panel
21 new grc wall cladding and soffit
22 existing slate roof repaired as required
23 new lead flashing between existing slate roof and new facade

- 24 new brickwork facade in stretcher bond with flush pointing
25 new painted plasterboard wall lining
26 new painted plasterboard ceiling
27 existing timber door painted and clad externally with grc panel
28 existing retained facade restored, made good and painted
29 existing cornice restored, made good and painted
30 new painted skirting
31 new carpet or vinyl floor covering over existing
32 new double glazed conservation skylight
33 existing timber window, internal architraves, and cill repaired and painted, opalescent vinyl added to glass
34 new grc cornice
35 new ppc windows with clear glass and micro-louvre at head

section B-B

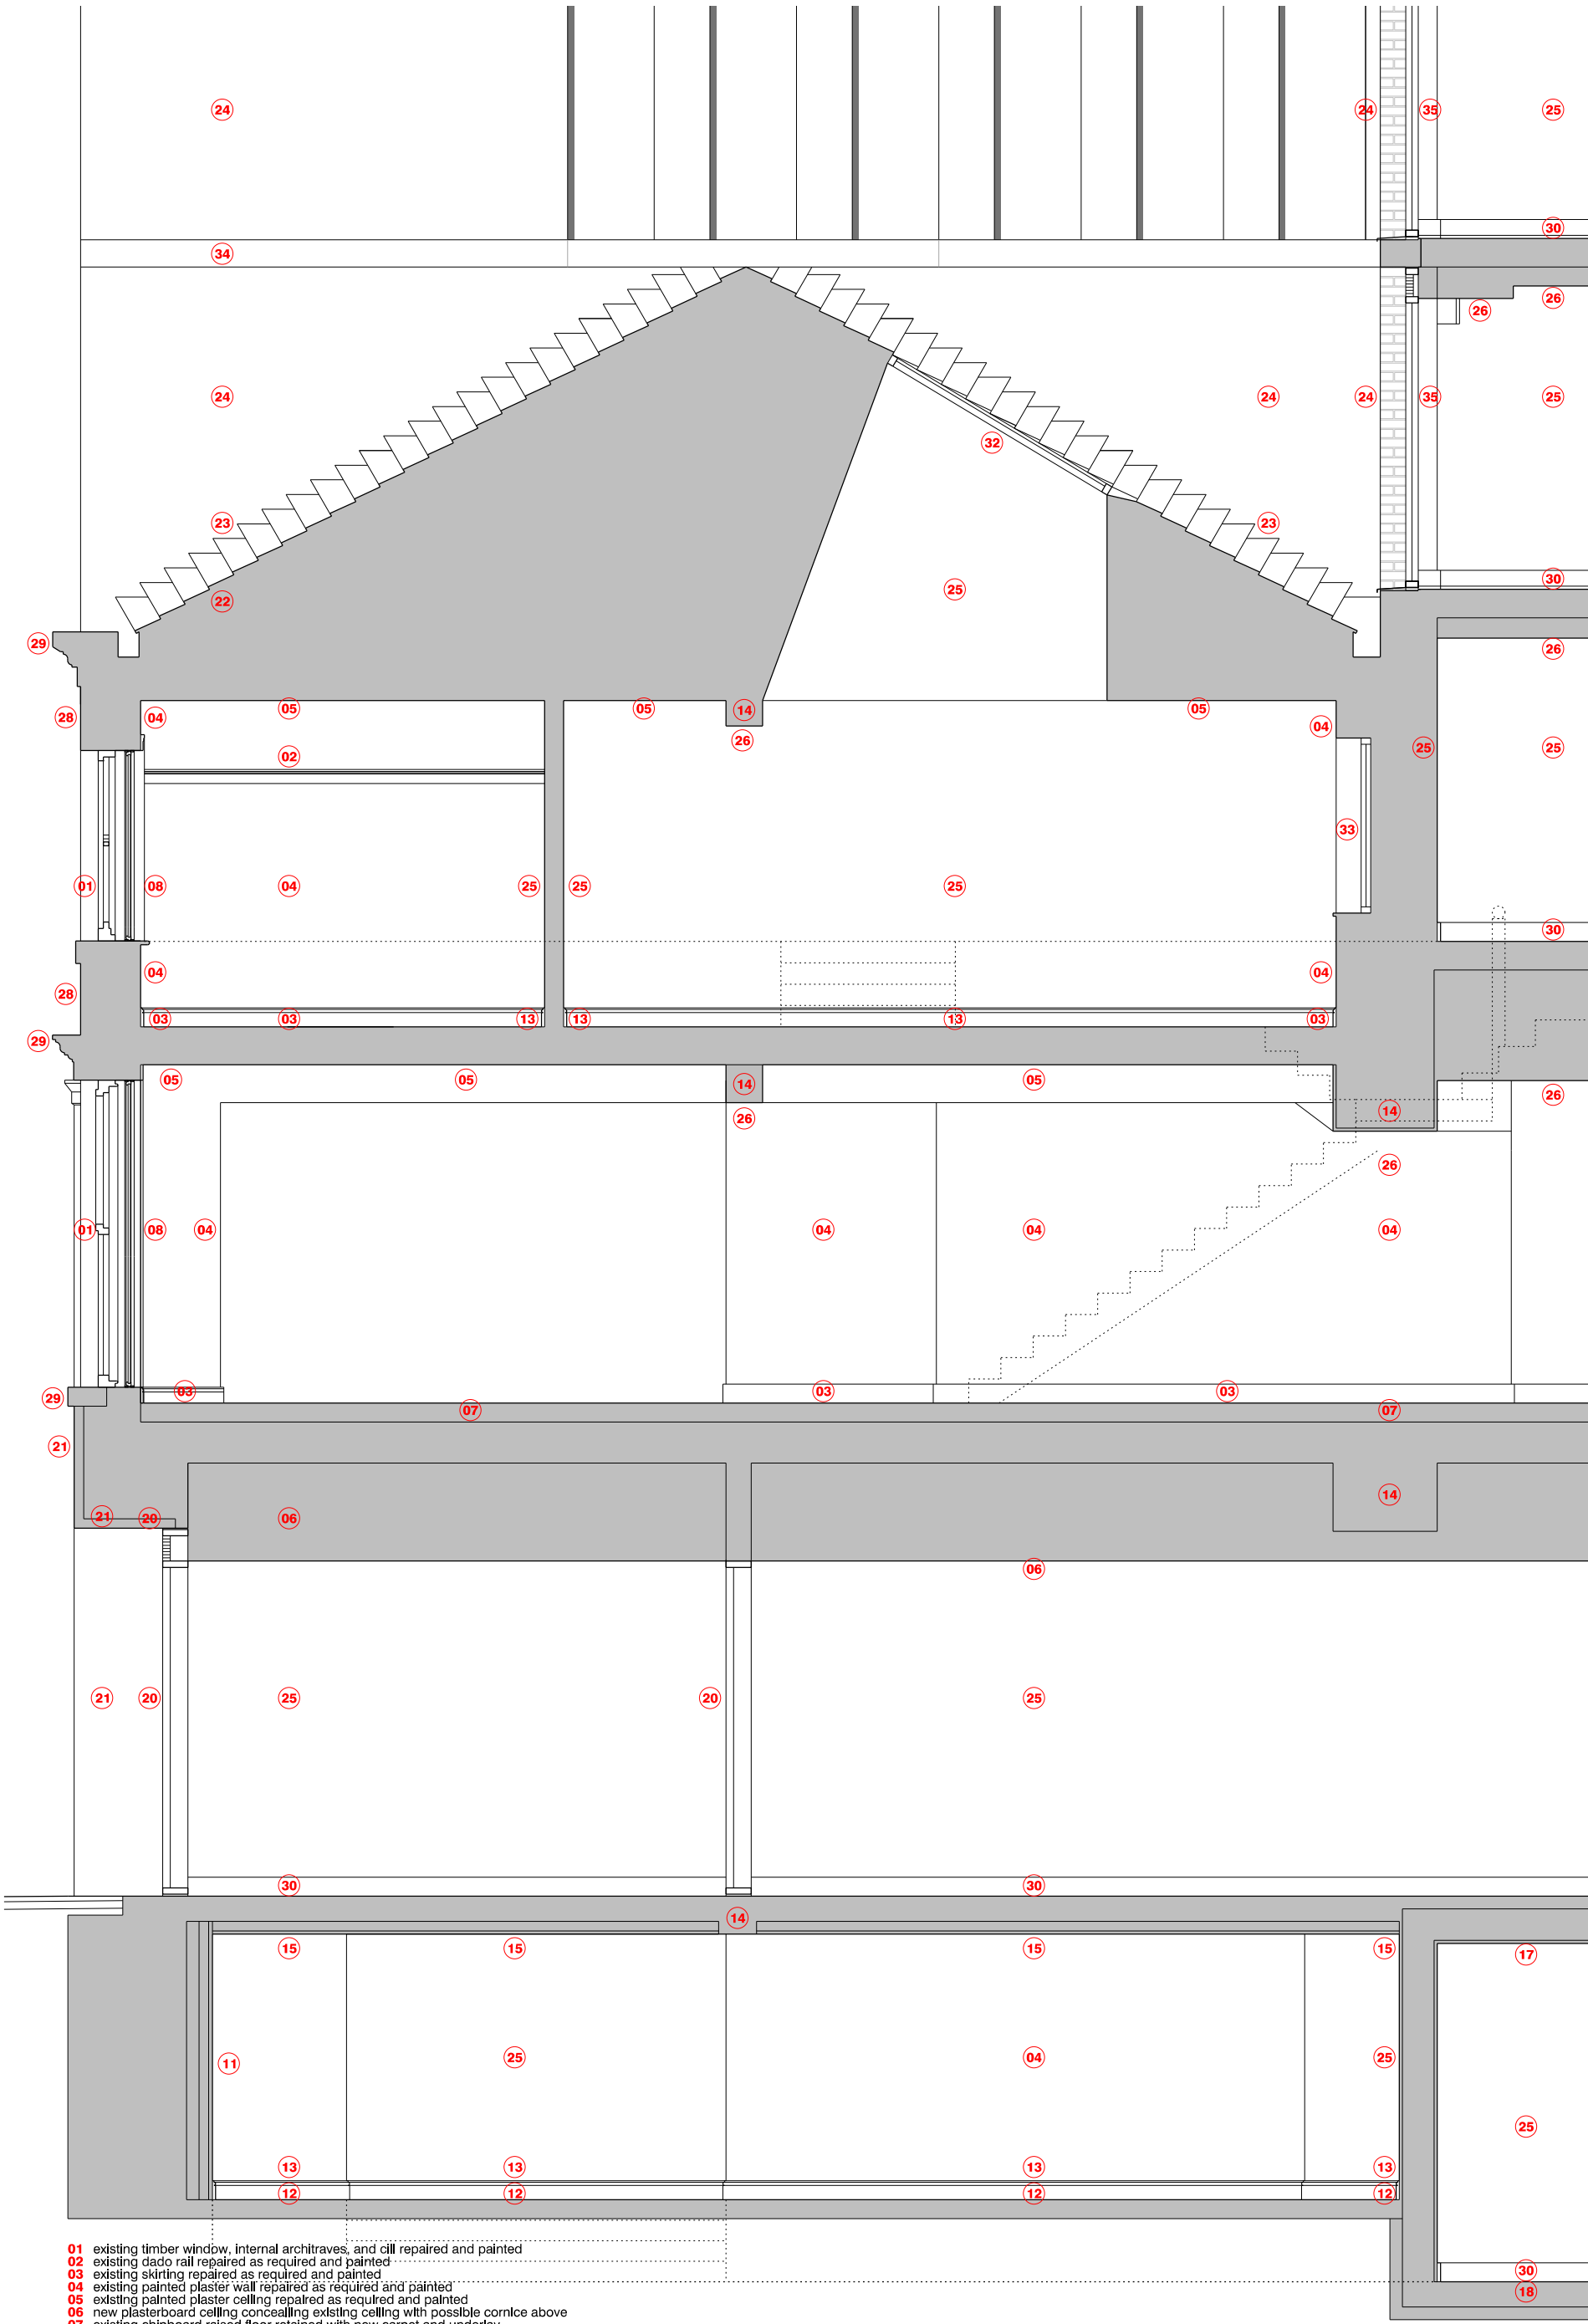