


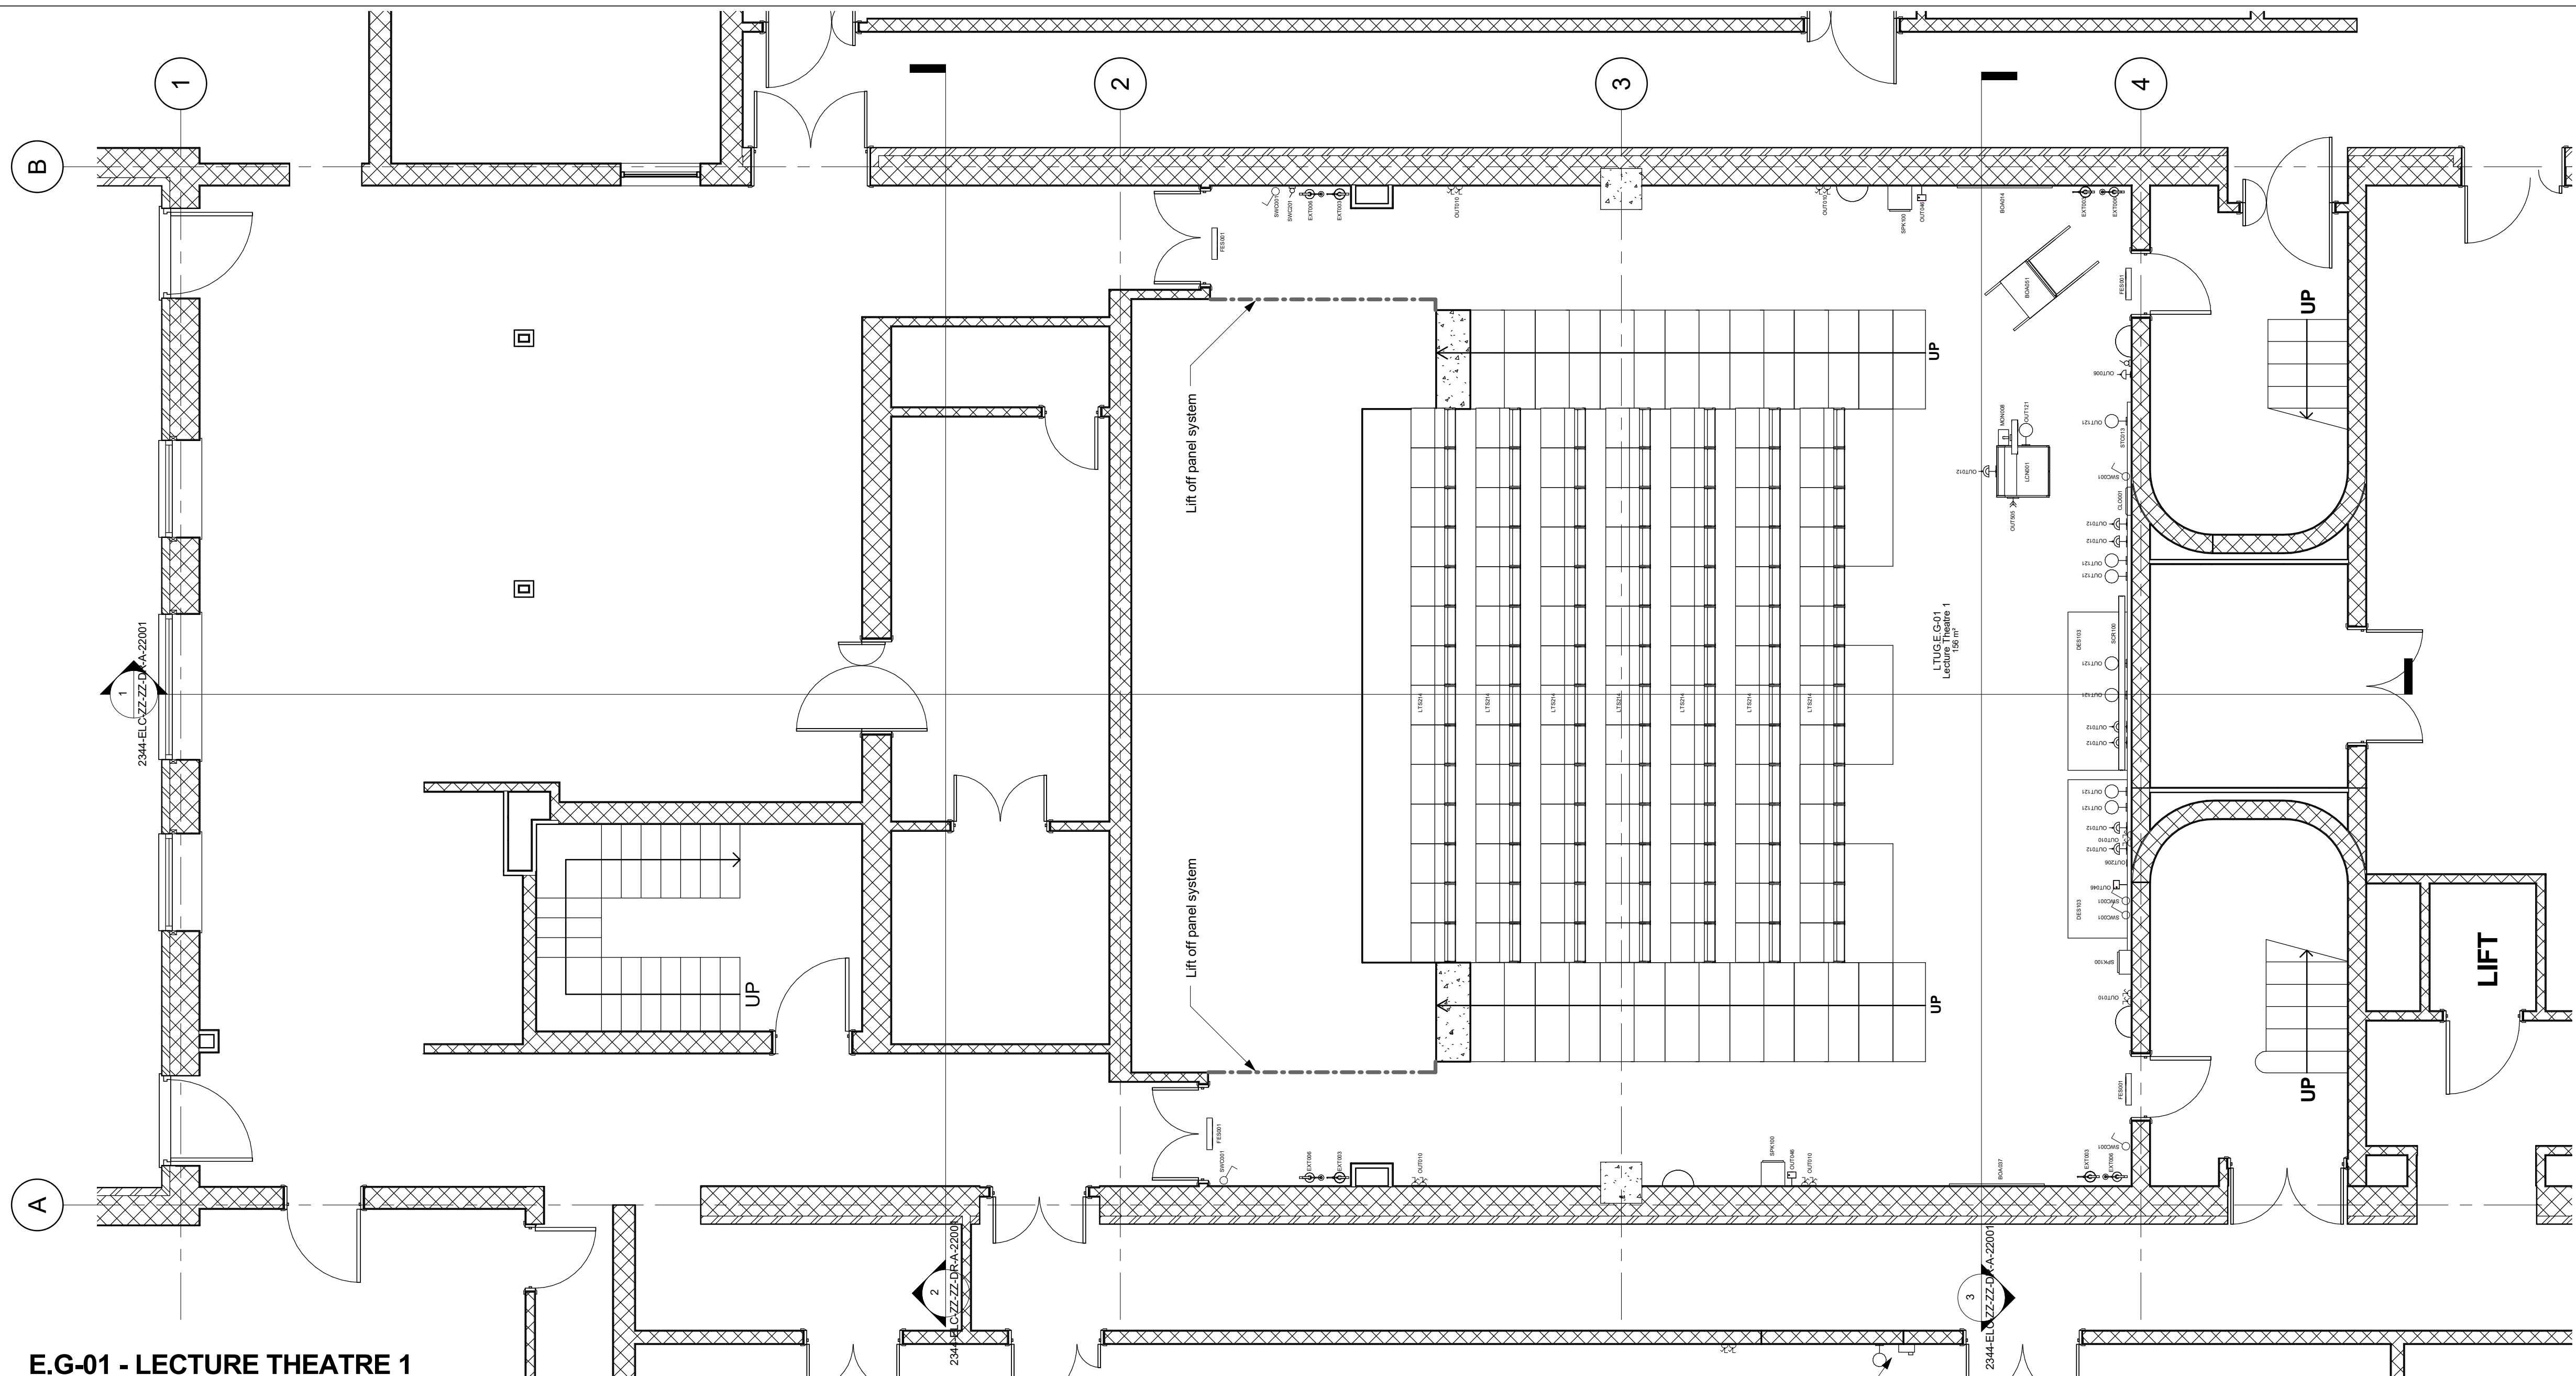

E.G-01 - LECTURE THEATRE 1

Equipment Schedule			
Qty	Grp	ADB No	Description
4	A	EXT003	EXTINGUISHER, portable cylinder, foam, wall mounted
4	A	EXT006	EXTINGUISHER portable cylinder, carbon dioxide-gas, wall mounted
[E] 4	A	FES001	SIGNAGE, fire exit, illuminated, wall mounted
[E] 7	A	LTS214	CHAIR, lecturer, with writing shelf, 14 modules
[E] 2	A	OUT010	SOCKET outlet switched 13amp double, wall mounted
[E] 7	A	OUT012	SOCKET outlet switched 13amp double, trunking mounted
[E] 4	A	OUT046	CONNECTION UNIT unswitched 13amp, flex outlet
[E] 1	A	OUT206	SOCKET outlet television aerial, single, wall mounted
[E] 1	A	OUT505	OUTLET, TV link, RGB, HDMI, USB connections
[E] 1	A	STC013	SERVICE TRUNKING, electrical power/data, length to suit
[E] 4	A	SWC001	SWITCH, light, wall mounted
[E] 2	A	SWC201	SWITCH, key test, wall mounted
[E] 1	B	BOA014	BOARD, display/notice, wall mounted, 1200x600
[E] 1	B	BOA037	BOARD, marker, whiteboard, dry-wipe, with pen holder, wall mounted, 1200x900
[E] 1	B	CLO001	CLOCK battery, wall mounted, including bracket
[E] 1	B	SCR100	SCREEN, projector, wall mounted, electric, 16:9 ratio, widescreen, 3980x2240
[E] 1	D	BOA051	BOARD, flip chart, adjustable height, freestanding
[E] 2	D	DES103	DESK, 715 x1800 x600
[E] 1	D	LCN001	LECTURN, Mobile, lockable
[E] 1	D	MON008	MONITOR, computer
[E] 3	D	SPK100	Speaker - Wall Mounted

CONDITION SURVEY

LECTURE THEATRE 1

- **Walls:** Areas of patching require making good, general marks, column edges damaged, wallpaper, evidence of damp/water penetration
- **Floor:** Carpet, heavily stained
- **Skirtings:** Good condition, timber, painted/varnished
- **Seating:** Fabric stained, damaged and missing seats (retractable portion performance not checked)
- **Balustrades:** Good condition
- **Acoustic Panelling:** Poor condition, heavily stained (acoustic performance unknown)
- **Vinyl Flooring:** (Control Room), Reasonable, joints not welded
- **Worktops:** (Control Room), Poor condition, holes in laminate, chipped laminate, stained
- **Blinds:** Poor condition, broken/damaged slats
- **Projection Screens:** Good condition
- **Ceilings:** Poor condition of plasterboard ceiling in control room, other (plasterboard ceilings in good condition, raked metal plank ceiling tiles require reseating)
- **Doors:** Painted doors, generally in good condition, existing double doors not DDA compliant, smoke/intumescent seals not continuous over lock/hinges, upper level doors no smoke seals to fire doors
- **Lecturn:** Good condition


CORRIDORS & LOBBY

- Suspended ceiling tiles marked and stained
- Vinyl flooring stained but generally intact

SCOPE OF WORKS - LECTURE THEATRE 1

- Strip out existing lecture theatre seating (retractable structure remains)
- Strip out existing FF&E
- Remove existing carpet finish to retractable structure and floors
- Remove existing acoustic boards from rear wall and separating wall to Lecture Theatre 2
- Remove existing lecturn and AV equipment
- Remove existing data point and telephone from mess room and store telephoe for re-fixing

Remove existing data/telephone outlet.
Remove wall mounted telephone and
store for relocating onto new partition

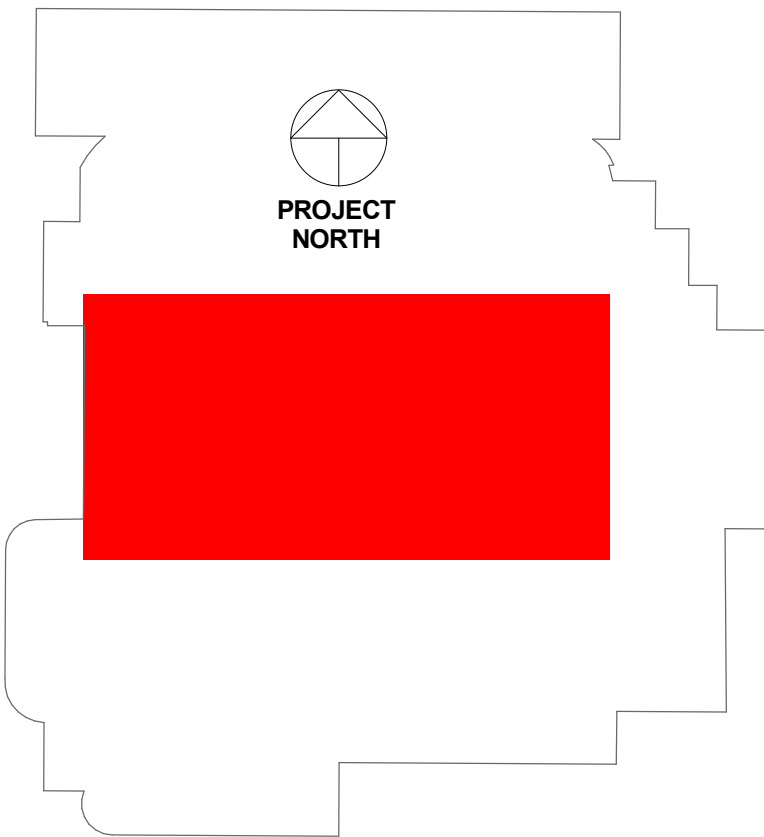

Revision Schedule		
Rev	Revision Description	Date
A	Updated to Stage 3	04/08/20
B	Revised as per Engie comments	23/09/20



NICORNA
Architecture

W: www.nicorna.co.uk E: arch@nicorna.co.uk T: 01457 337320

DO NOT SCALE

STATUS

STAGE 3

PROJECT

LECTURE THEATRES 1 + 2 -
EDUCATION NORTH

TITLE

EXISTING GF LOADED LAYOUTS

CLIENT

ENGIE

DRAWN BY

J CARRICK

CHECKED BY

-

DATE

08/09/17

SCALE (@ A1)

As indicated

FILE NO.

17008

PROJECT NO.

2344

DRAWING NUMBER

2344-ELC-ZZ-ZZ-DR-A-70001

STATUS

S4

REV

B