



2.2.1



2.2.2



2.2.3



2.2.5



2.2.6



2.2.9



2.2.10




2.2.13

2.2.4



2.2.7

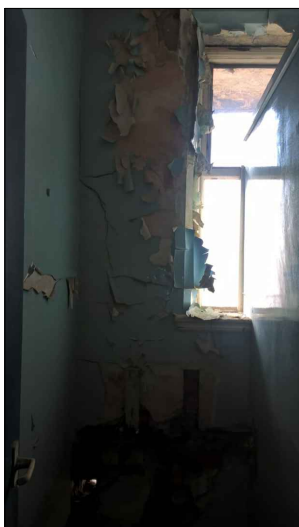

2.2.8



2.2.11



2.2.12



2.2.14



2.2.16



2.2.21




2.2.19



2.2.18



FOR CONTINUATION REFER TO DRG 10-02-01

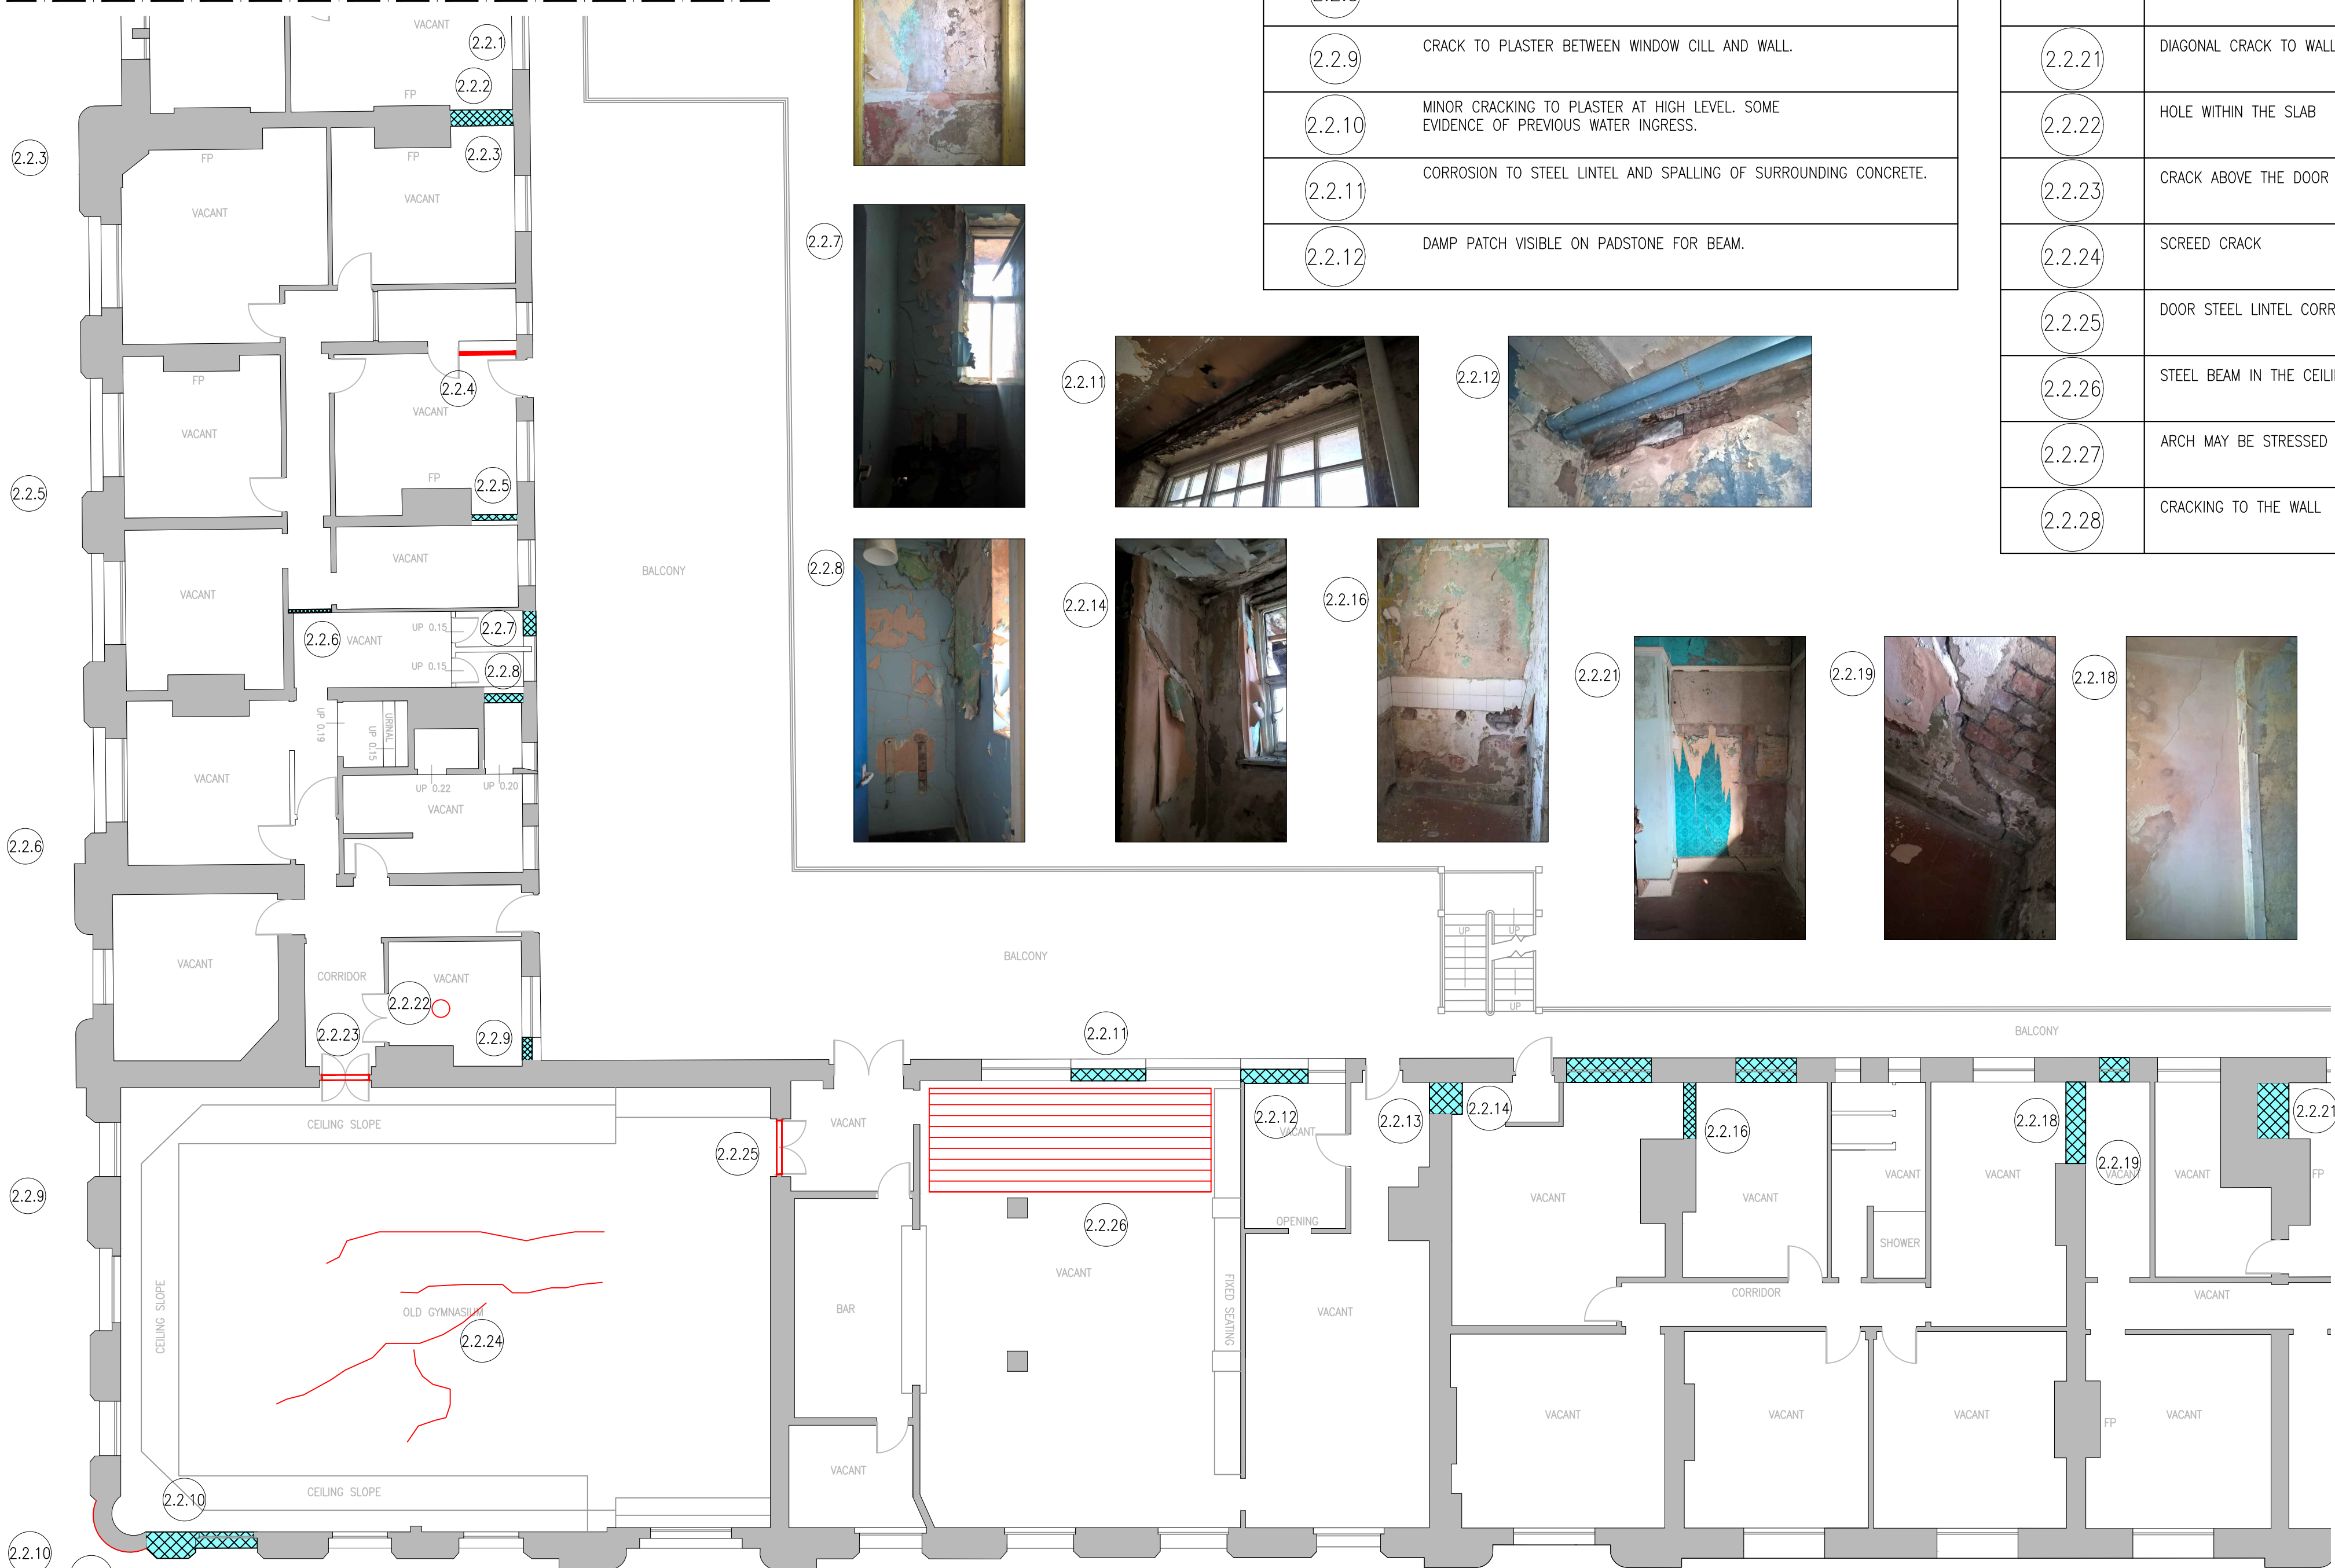


PLAN ON EXISTING SECOND FLOOR
SCALE 1:100

REF	OBSERVATION
2.2.1	CRACK TO PLASTER BETWEEN WINDOW CILL AND WALL.
2.2.2	DIAGONAL CRACK TO WALL EVIDENT TO BOTH SIDES.
2.2.3	DIAGONAL CRACK TO WALL EVIDENT TO BOTH SIDES.
2.2.4	DIAGONAL CRACK TO WALL EVIDENT TO BOTH SIDES.
2.2.5	DIAGONAL CRACK TO WALL EVIDENT TO BOTH SIDES.
2.2.6	STRAIGHT LINE CRACK TO PARTITION WALL
2.2.7	BRICKWORK HAS BEEN BROKEN OUT TO INSTALL TOILETS
2.2.8	DIAGONAL CRACK TO WALL EVIDENT TO BOTH SIDES.
2.2.9	CRACK TO PLASTER BETWEEN WINDOW CILL AND WALL.
2.2.10	MINOR CRACKING TO PLASTER AT HIGH LEVEL. SOME EVIDENCE OF PREVIOUS WATER INGRESS.
2.2.11	CORROSION TO STEEL LINTEL AND SPALLING OF SURROUNDING CONCRETE.
2.2.12	DAMP PATCH VISIBLE ON PADSTONE FOR BEAM.

REF	OBSERVATION
2.2.13	DIAGONAL CRACK TO WALL EVIDENT TO BOTH SIDES
2.2.14	DIAGONAL CRACK TO WALL EVIDENT TO BOTH SIDES.
2.2.16	DIAGONAL CRACK TO WALL EVIDENT TO BOTH SIDES.
2.2.18	DIAGONAL CRACK TO WALL EVIDENT TO BOTH SIDES.
2.2.19	DIAGONAL CRACK TO WALL EVIDENT TO BOTH SIDES.
2.2.21	DIAGONAL CRACK TO WALL EVIDENT TO ONE SIDE ONLY.
2.2.22	HOLE WITHIN THE SLAB
2.2.23	CRACK ABOVE THE DOOR LINTEL
2.2.24	SCREED CRACK
2.2.25	DOOR STEEL LINTEL CORRODED
2.2.26	STEEL BEAM IN THE CEILING NEEDS PAINTING
2.2.27	ARCH MAY BE STRESSED
2.2.28	CRACKING TO THE WALL

NOTES:

1. THIS DRAWING IS TO BE READ IN CONJUNCTION WITH ALL RELEVANT ARCHITECTS AND ENGINEERS DRAWINGS AND SPECIFICATIONS.
2. DO NOT SCALE THIS DRAWING.
3. ALL DIMENSIONS ARE IN MILLIMETRES UNLESS NOTED OTHERWISE.
4. DRAWING TO BE READ IN CONJUNCTION WITH DETAILED VISUAL SURVEY REPORT BY CURTINS CONSULTING.

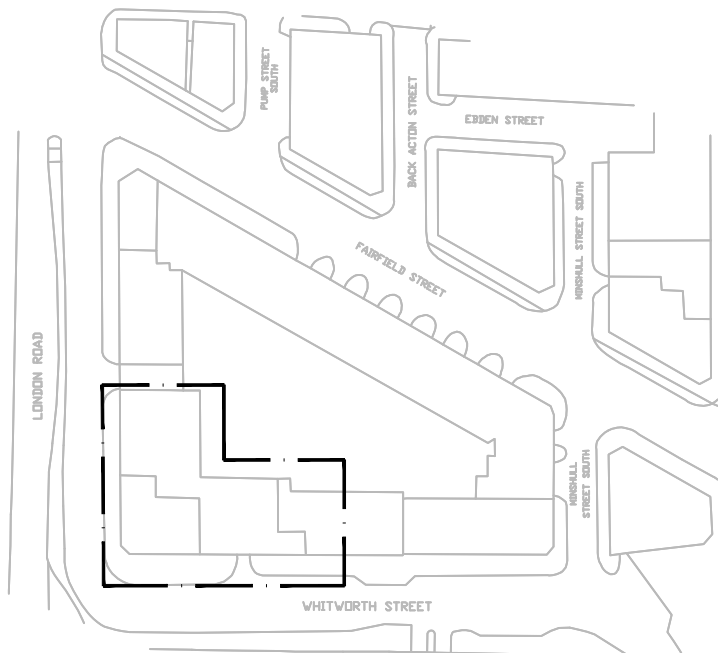

KEY
SCALE 1:1500

V01	INITIAL ISSUE	21/01/20	PC	DS
Rev:	Description:	Date:	By:	Chkd:



Curtins Consulting Ltd.
Merchant Exchange, 17-19 Whitworth Street West, M1 5WG
t: 0161 236 2394
e: manchester@curtins.com
www.curtins.com

Structures • Civils • Environmental • Infrastructure • Transport Planning • Sustainability • Expert Advisory Services
Birmingham • Bristol • Cardiff • Douglas • Edinburgh • Kentish • Leeds • Liverpool • London • Manchester • Nottingham

Status:	INFORMATION
---------	-------------

Project:	LONDON ROAD FIRE STATION
----------	--------------------------

Drg Title:	SECOND FLOOR OBSERVATIONS SHEET 2 OF 3
------------	---

Scale:	Size:	First Issue:	Drawn:	Checked:
AS SHOWN	A1	05.04.16	CH	PB

Drg No:	Rev:
060270 / 10-02-02	V01