



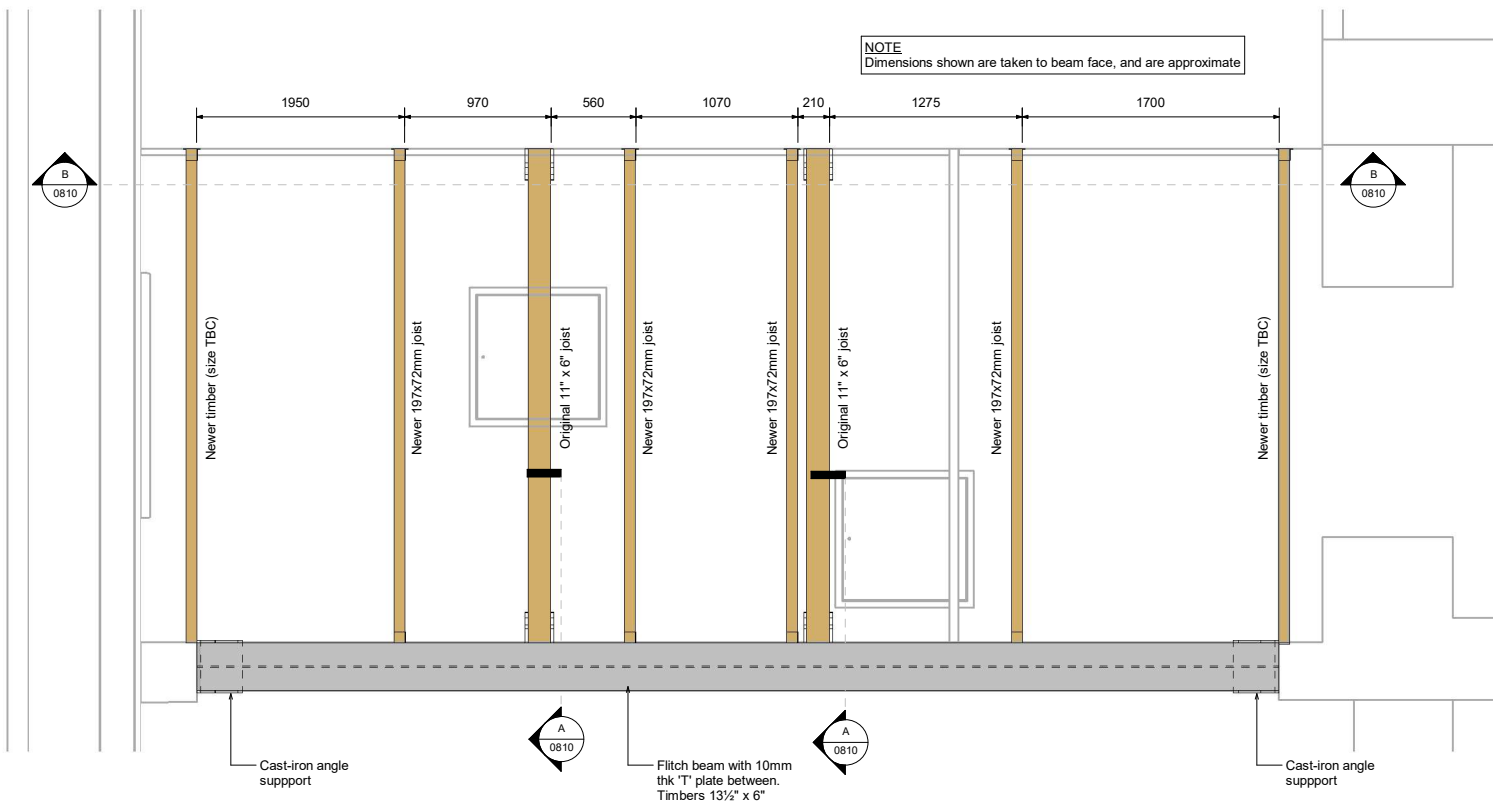


GROUND FLOOR G.A. 43.820m

1 : 25

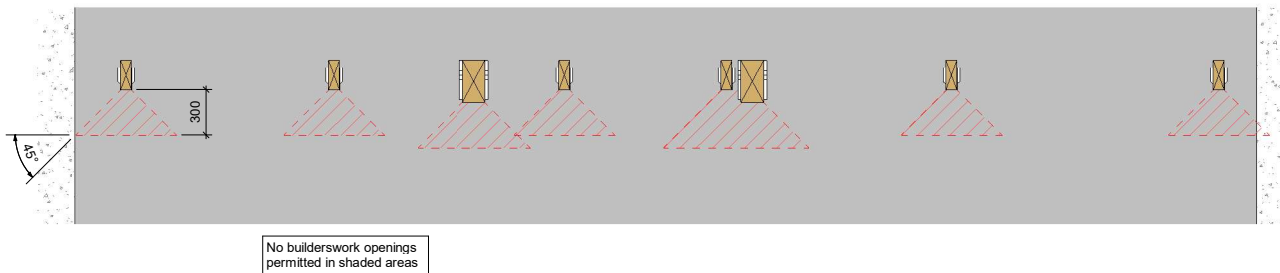

BUILDERSWORK ELEVATION B


1 : 25

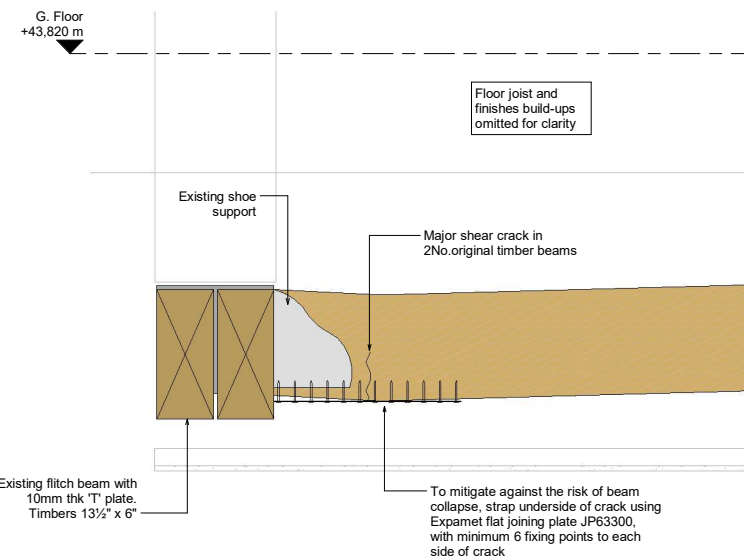

SECTION A


1 : 10

NOTE
This proposed fixing detail to be agreed by conservation officer due to listed status

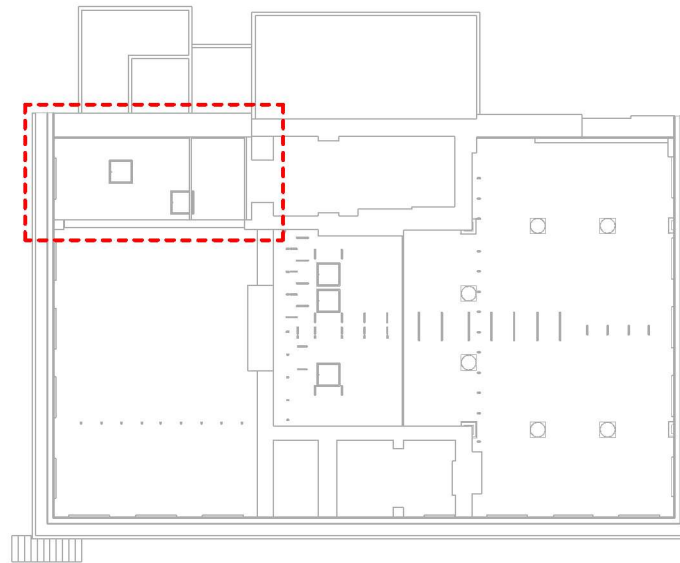


KEY PLAN

N.T.S.

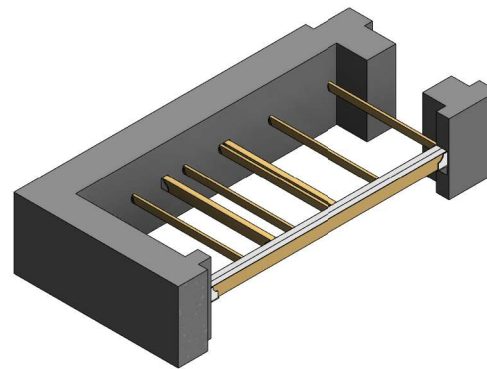

ISO VIEW 1

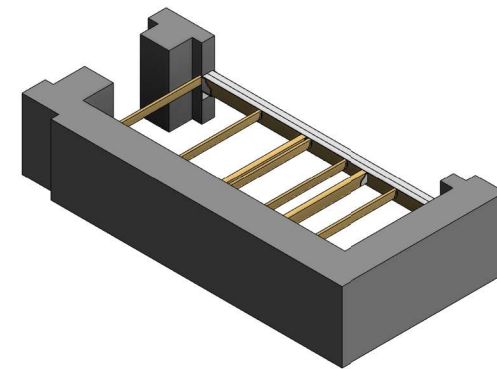

ISO VIEW 2



IMAGE SHOWING CRACKED ORIGINAL TIMBERS (2No.)

NOTES:

- Do not scale from this drawing.
- This drawing is copyright and is sent to you in confidence. It must not be copied, used or disclosed, in whole or in part, to third parties without written permission. It remains the property of Booth King Partnership Ltd. (BKPL) and must be returned on request.
- This drawing is to be read in conjunction with all relevant contractual documents.
- Anyone using this drawing must be aware of their legal duties under the CDM Regulations 2015, refer to the HSE website for further information. BKPL are not Principal Designers.
- All dimensions shown on this drawing are in millimeters unless noted otherwise.
- If the Contractor consider that they do not have sufficient information to safely complete the works detailed on this drawing, they should contact the Engineer.
- This document uses revision codes in accordance with ISO EN 19650:
P, Preliminary (non-contractual) - review, comment or approval.
C, Contractual - Approved for stage completion.
- This document uses status codes in accordance with ISO EN 19650:
Work in progress:
S0 - WIP
Shared (non-contractual):
S1 - Coordination, S2 - Information, S3 - Review, S4 & S5 - Approval.
Published (contractual):
A1, An, etc. (where "n" relates to the project stage)
- This document uses project stages in accordance with the IStructE Structural Plan of Work 2020:
2 - Concept, 3 - Coordination, 4 - Technical Design, 4.5 - Production Design, 5 - Construction, 6 - Handover
- Only documents with a revision code C# (where 'n' relates to a revision number) and status code A4 or A5 are suitable for construction. Any deviations to that which is on site is not the liability of BKPL.



NOTE
Any existing or proposed services must not be fixed to cracked old timber beams. Any fixings to be removed and reconnected to newer joists

CONSTRUCTION

REV.	DATE	REVISION DETAILS	CHECKER	INITIALS
C01	07.02.25	Updated following receipt of design team and site comments. Issued for construction	MS	
P01	03.12.24	First issue to suit new WPO8 design	MS	
CURRENT DRAWING REVISION CHECKED BY				
CURRENT DRAWING REVISION APPROVED BY				
DRAWING STATUS:		PROJECT STAGE:		
S3		STAGE 4		

boothking
PARTNERSHIP LIMITED

CONSULTING CIVIL & STRUCTURAL ENGINEERS
www.booth-king.co.uk office@booth-king.co.uk
RAMSBOTTOM MANCHESTER EDINBURGH
Tel: 01706 822 022 Tel: 0161 694 7087 Tel: 0131 229 1547

PROJECT:

Manchester Art Gallery

TITLE:

WP08 Ceiling Repair Detail

SCALE (A1)	AUTHOR	DATE	REVISION	BKPL No.
As indicated	MS	DEC '24	C01	14794

DRAWING REF:

MAG-BKP-08-B1-DR-S-40-0810