



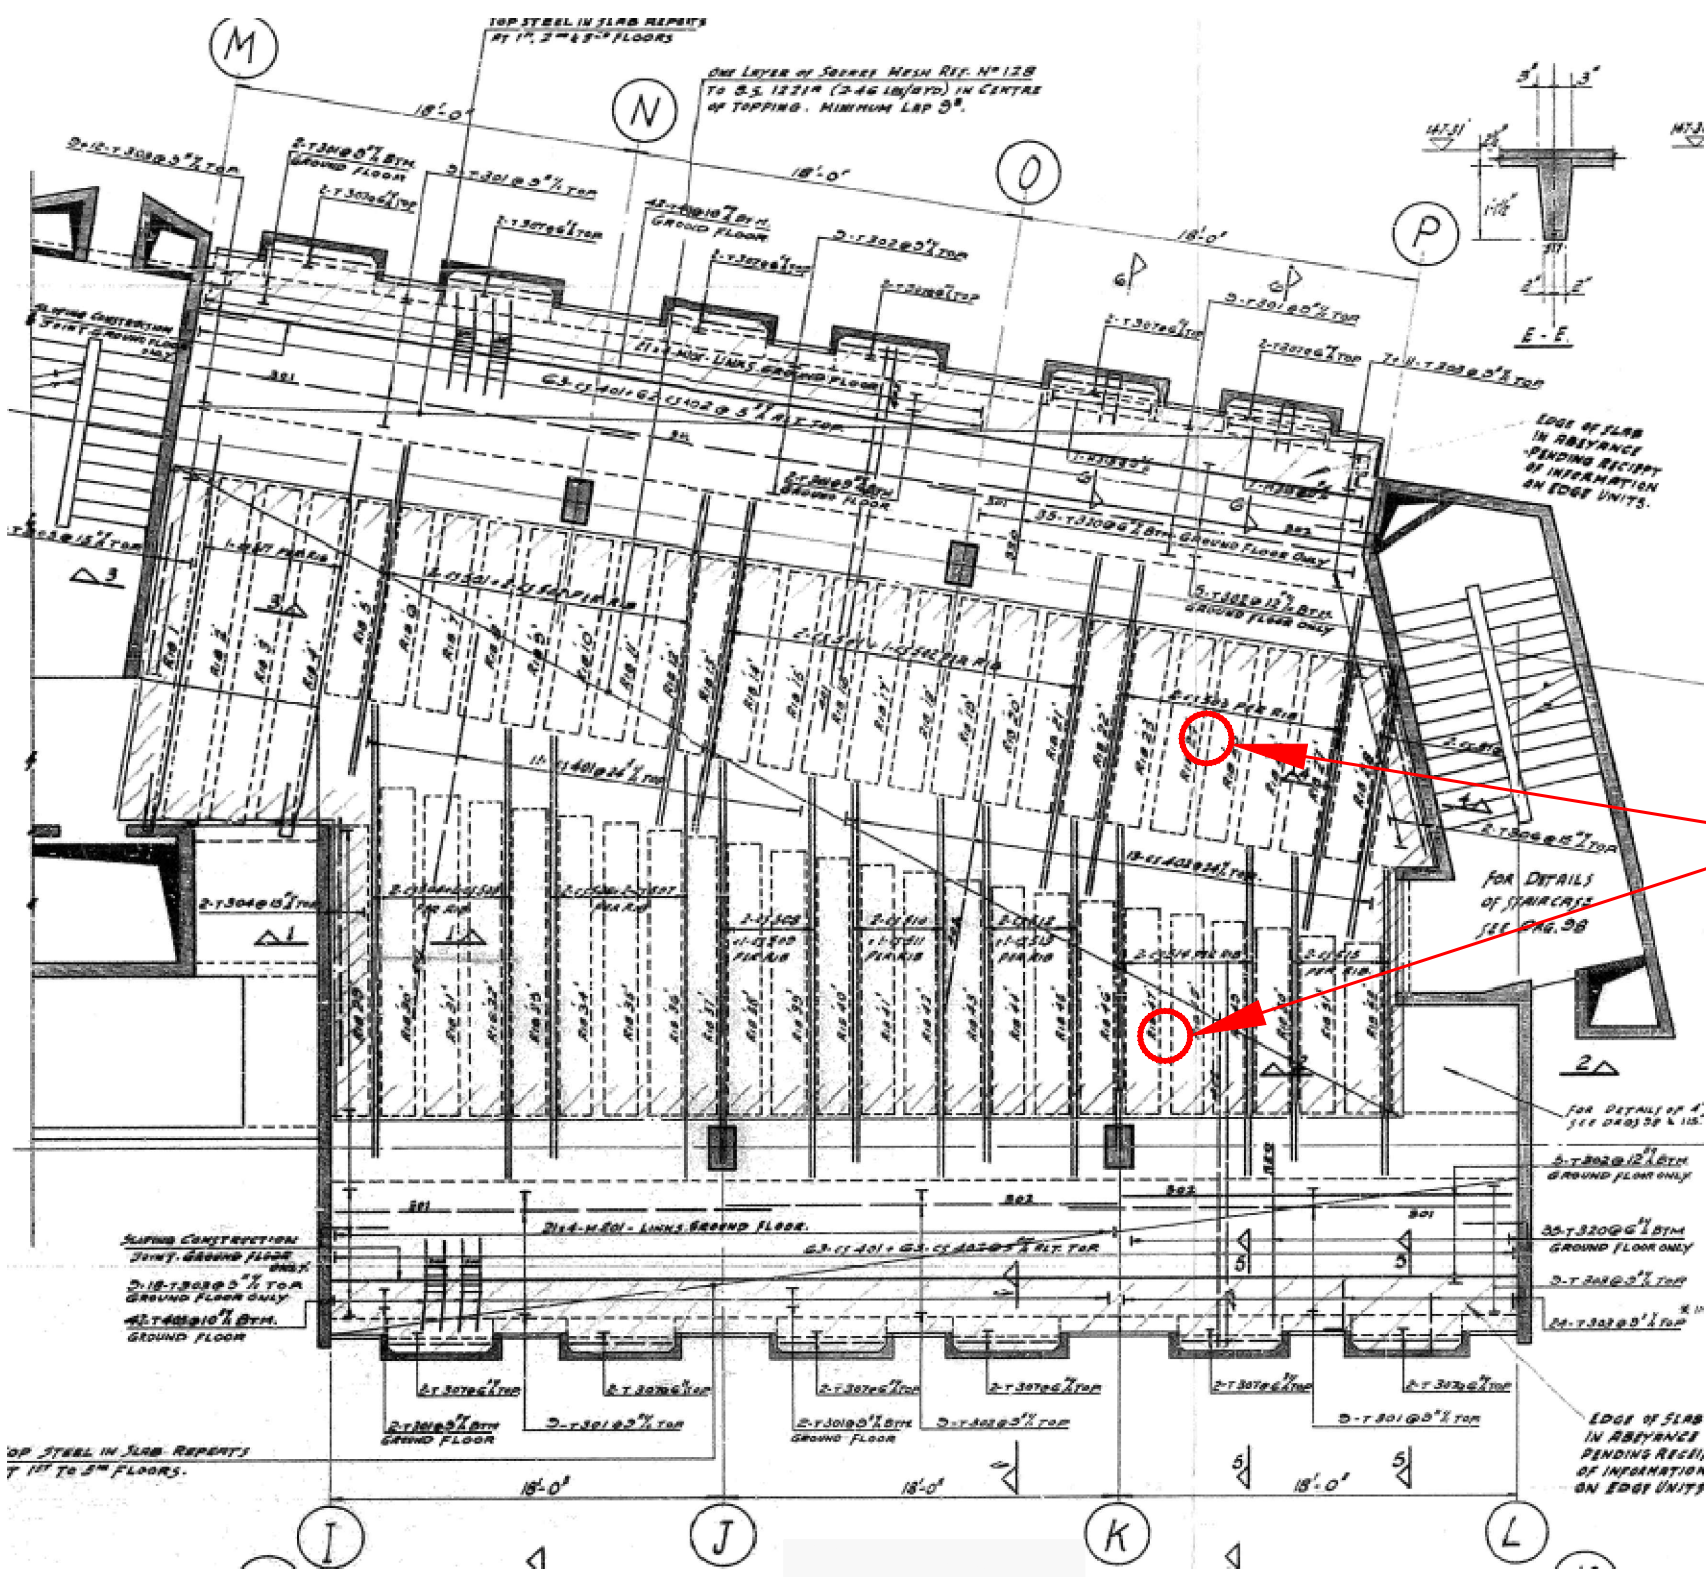


Marsden Street Block.

Rib Investigation Locations at Underside of Roof and Underside of 4th Floor.
2 Locations at Both Levels.

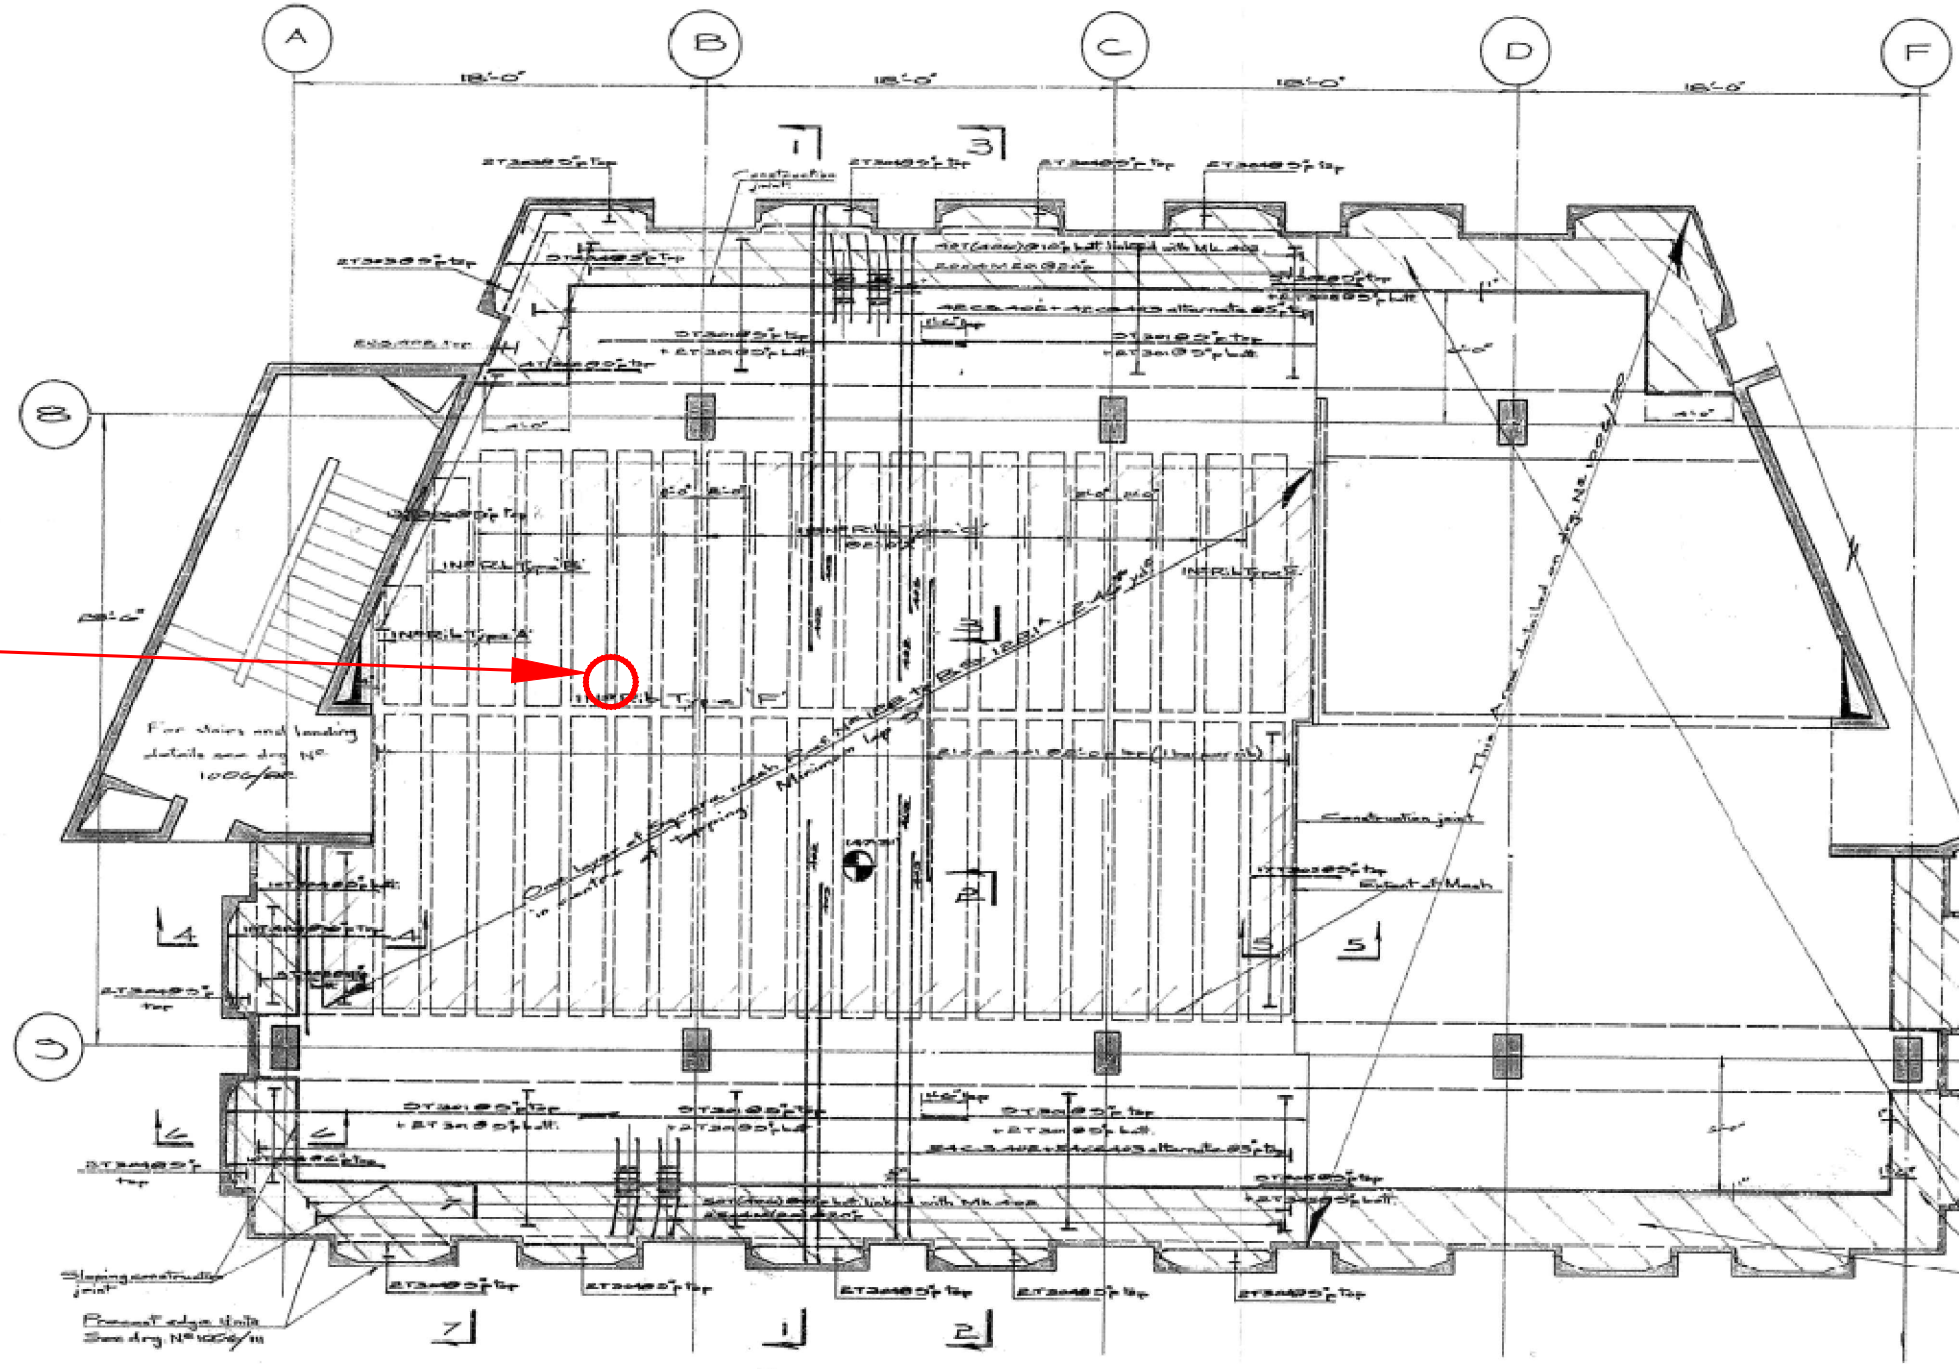

King Street Block.

Rib Investigation Location at Underside of Roof and Underside of 4th Floor.
One Location at Both Levels.

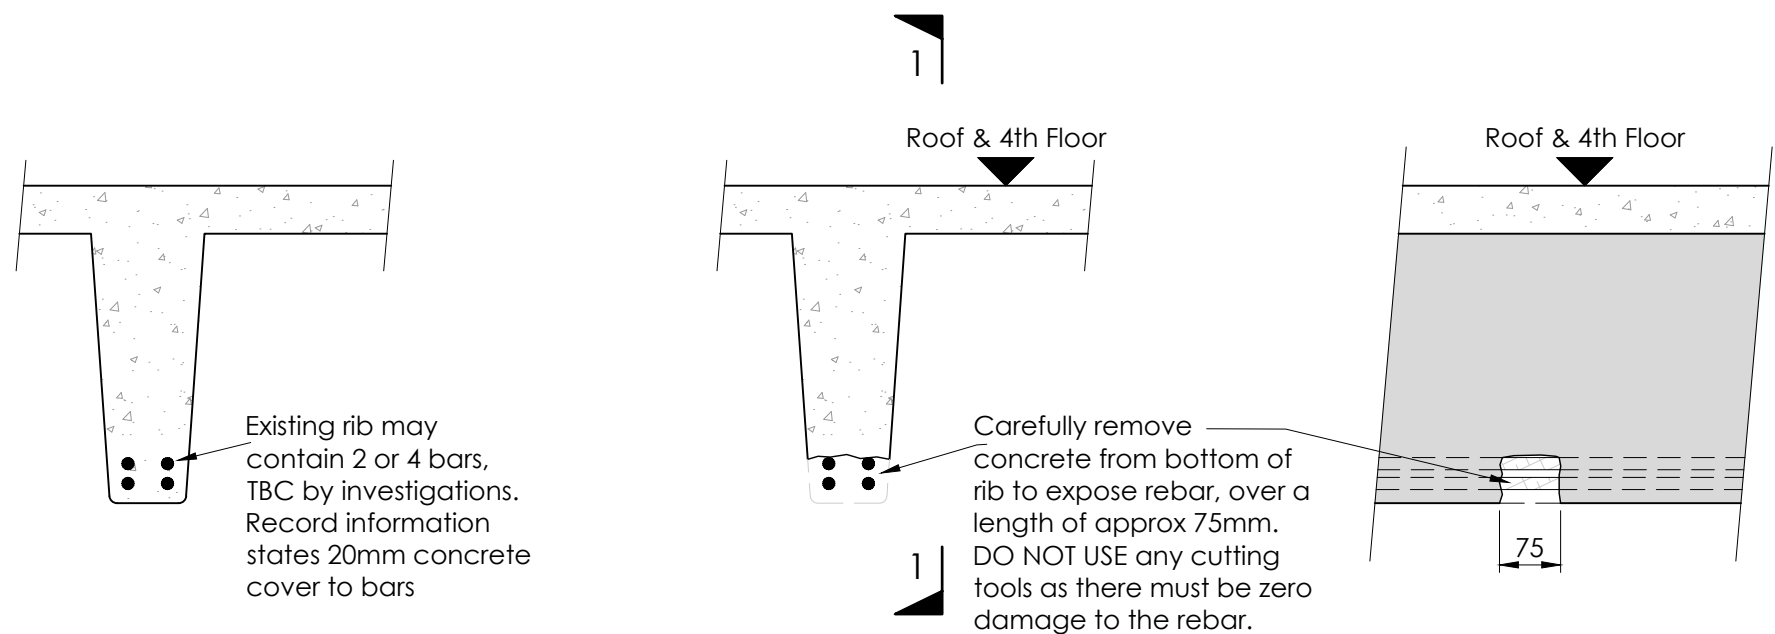

Sequence of Works

- Carefully remove concrete from bottom of rib to expose rebar, over a length of approx 75mm.
- DO NOT USE any cutting tools as there must be zero damage to the rebar.
- Contact DW Consulting to inspect exposed rebar and rib.
- Following inspections fully repair & replace removed area with Fosroc Rendoc H8 concrete repair mortar, installed fully in accordance with Fosroc specification.

Anticipated Rib Details
1:10 at A1

Rib Rebar Investigation Works
1:10 at A1

Section / Elevation 1-1
1:10 at A1

Note:- Rib exposure must be at EXACTLY the same position on plan at both levels being investigated to ensure a 'like-for-like' comparison of the rebar at both levels. The ribs at both levels must be carefully inspected prior to carrying out any works to ensure that the same position can be investigated at both levels.

GENERAL NOTES

Do not scale this drawing.
Contractor to check all dimensions and report all errors and omissions to the Engineer.

Rev	Detail	By	Auth	Date
Revisions				
				
Marland House Marland Road Sole, M33 3AQ Tel: 0161 969 4144 www.dwlip.com				
Hornbeam House Hornbeam Park Hornbeam Road Hamogate, HG2 8QT Tel: 01423 855930				
Client bruntwood works				
Project Pall Mall Manchester Refurbishment Works				
Drawing Title Floor Investigation Works Marsden St & King St Blocks Roof & 4th Floor Levels				
Drawing Status investigations				
Project No.	PM-DWC-XX-	Discipline	DR-S	Drawing No.
Scale	as noted	Sheet Size	A1	Revision
Date	Feb'22	Drawn	Checked	Auth