


General Notes

All timber sash windows on First Second and Third floors to be prepared and repainted externally. All external sealant to be replaced.
Stone dentil and cornice to be inspected following water damage and areas of delamination to be repaired

Repairs Notes

- Existing cementitious slates and sarking to be replaced with breathable sarking and natural slates. All roof penetration seals and flashing to be renewed.
- Delaminated stone to be patch repaired
- Existing vertical slates to be removed and replaced with natural slate. Flashings at abutment with pitched roofs with be replaced with Code 4 lead flashing.
- Existing hip tiles to be replaced with lead roll hip with soakers
- Patch stone repair where decorative rose is missing

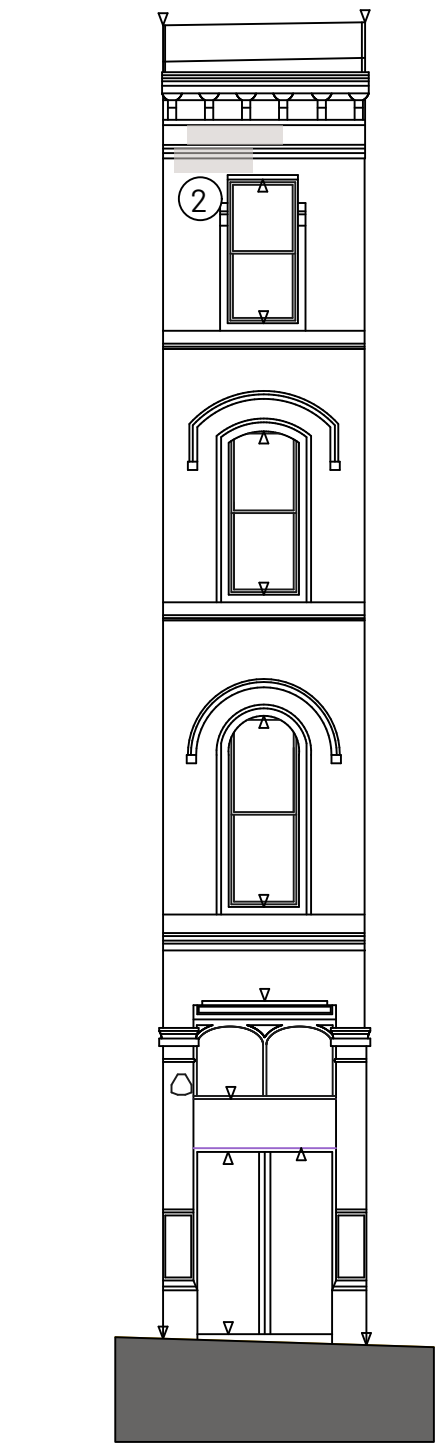

2

Corner Elevation

Scale: 1:100

Deansgate, King Street



1


Elevation 4

Scale: 1:100

Deansgate



1:100 @A3

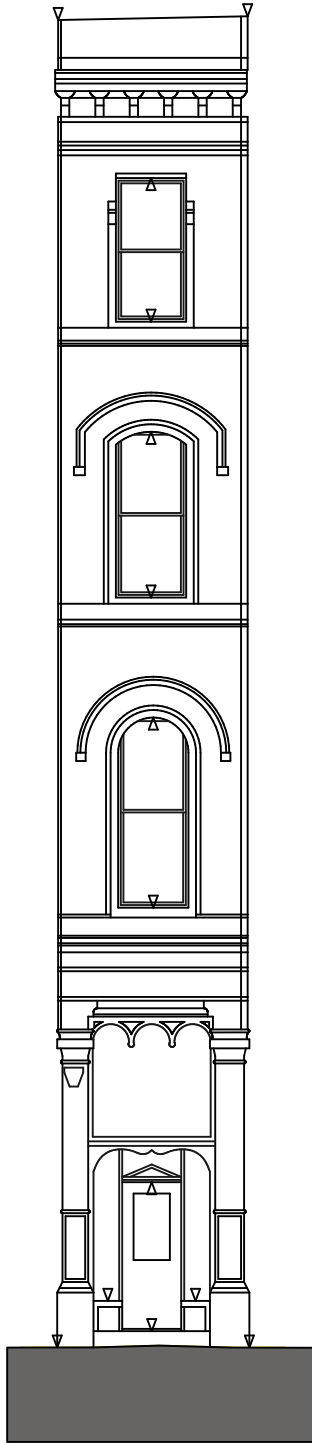

3

Corner Elevation

Scale: 1:100

Deansgate, South King Street

REV	NOTE	DRN	CHK
-----	------	-----	-----

King Street Chambers
Manchester
Roof Repairs

Elevation 4

PROJECT REF.	2050
DRWG NO.	P(203)
REVISION	
SCALE	1:100 @ A3
DATE 1st	June 24
DRAWN	PL

SK sketch E existing P proposed T tender C construction FI final issue

+44 161 236 0051
ARCHITECT@ATELIERMB.CO.UK

ATELIER.MB