



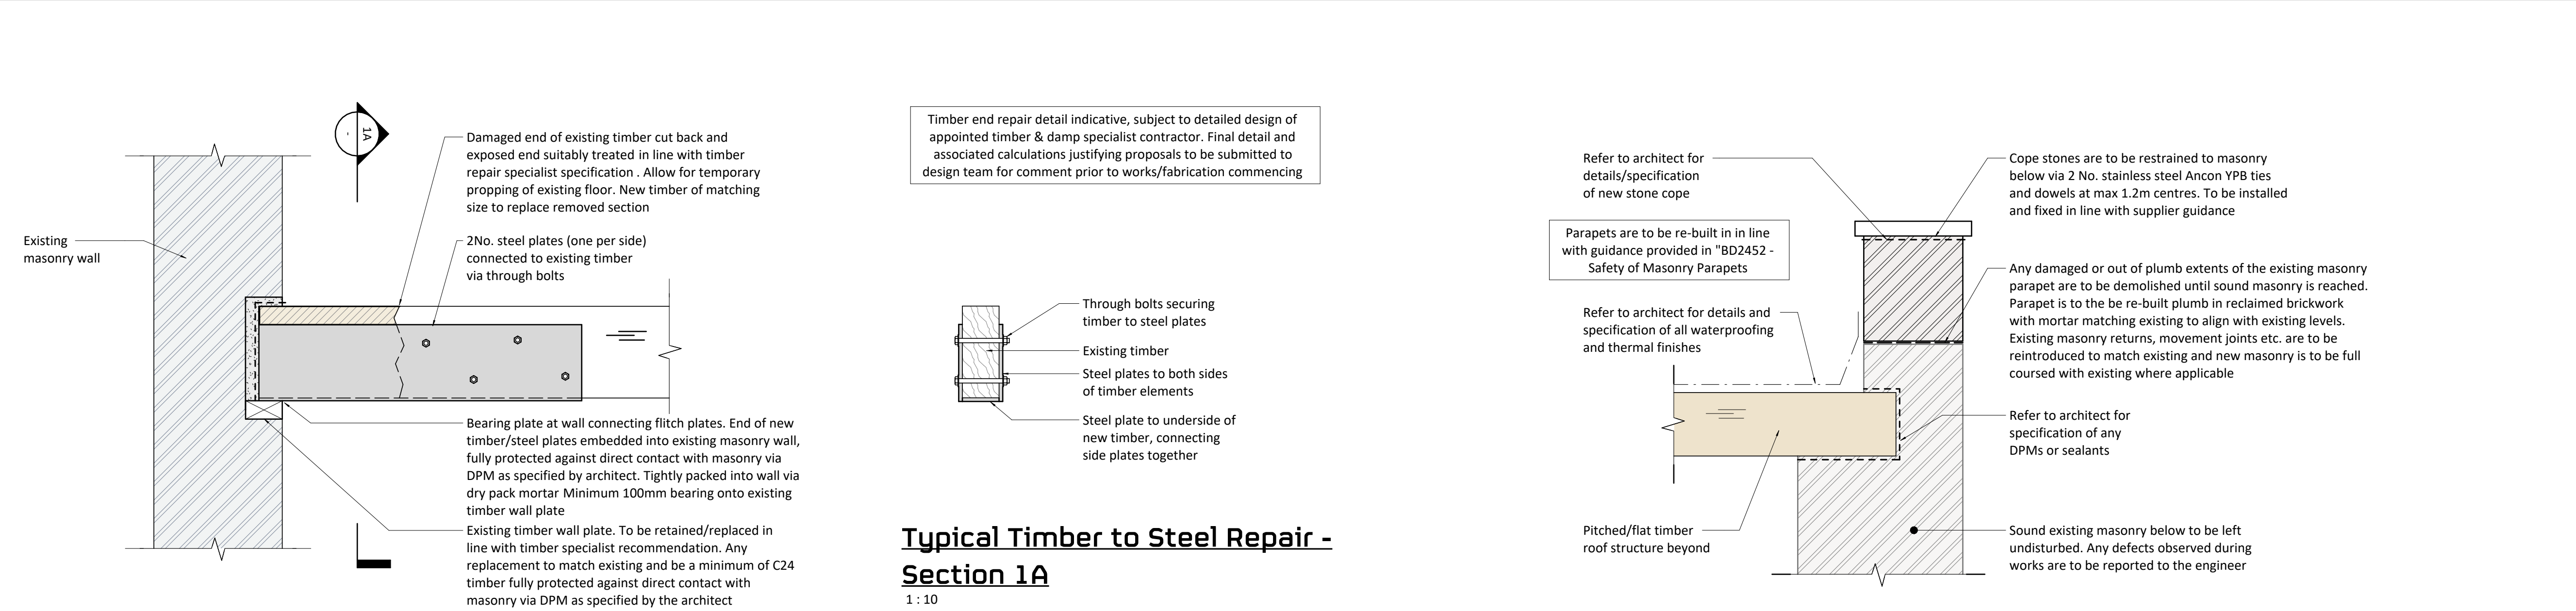

### Typical Timber to Steel Repair - Elevation

1 : 10

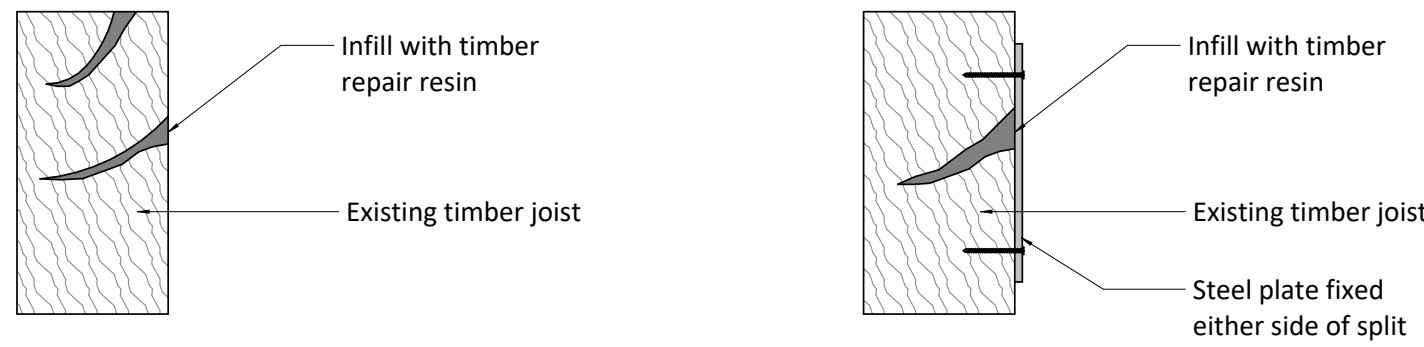


Typical Repair Detail to Splits

Typical Repair large / Continuous Splits in Beams

### Typical Timber Joist Repair Details

1 : 10

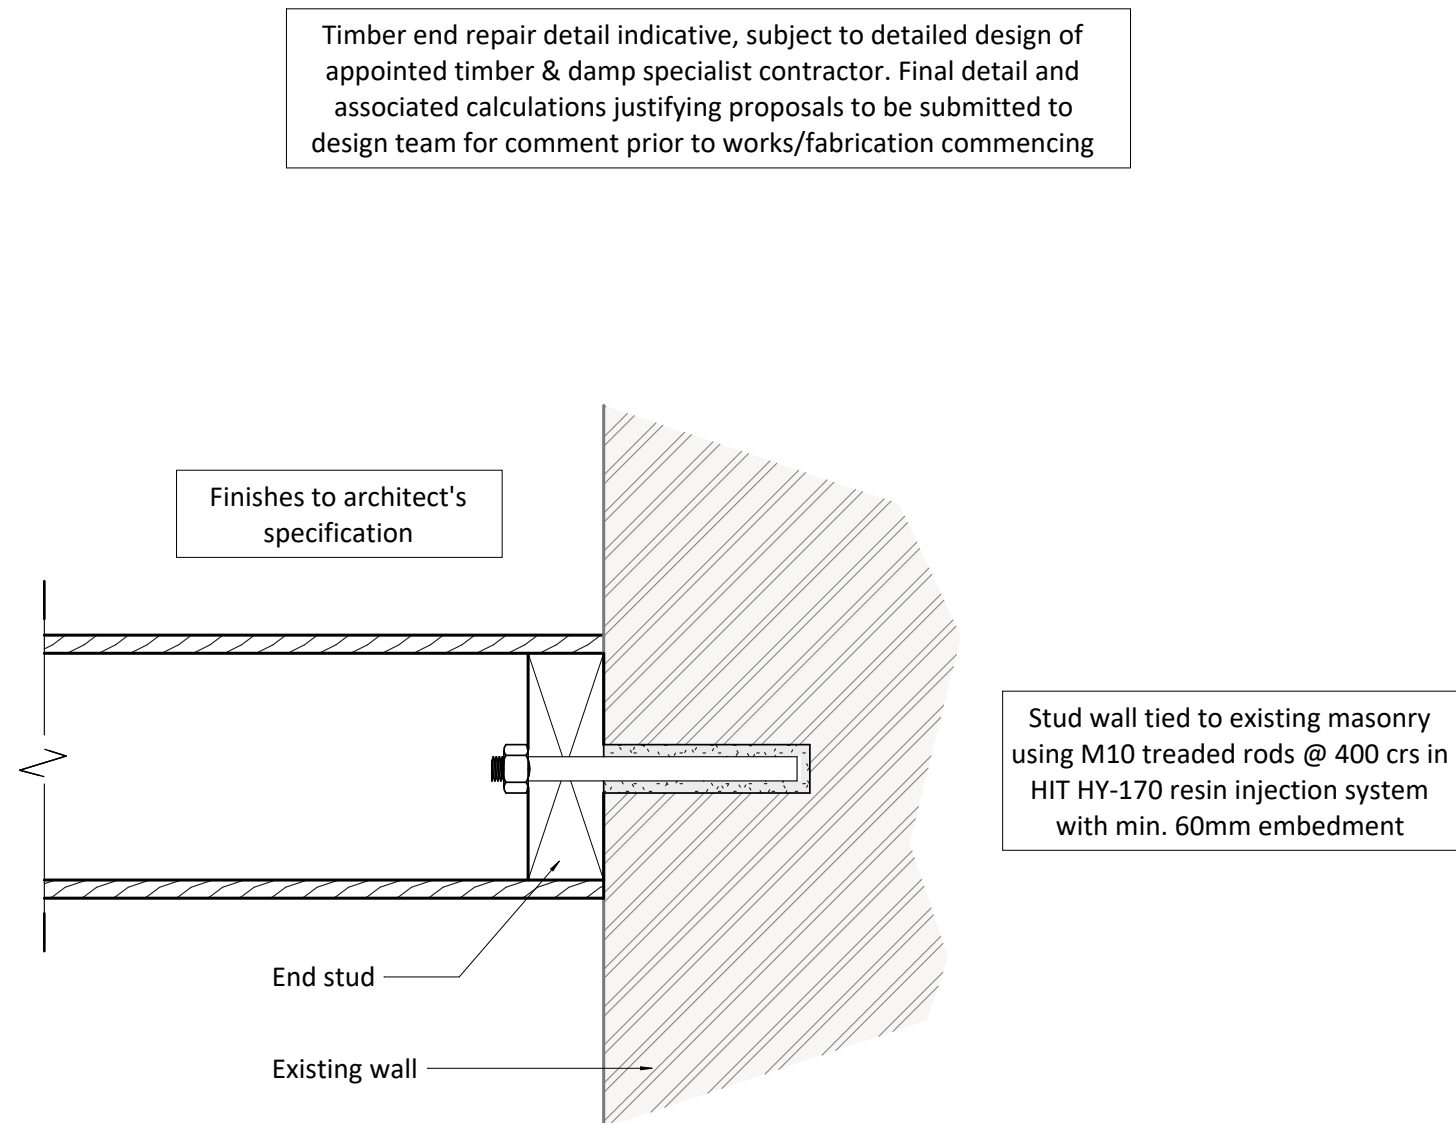


### Typical Plan on Typical Internal Stud Partition Wall Starter Detail

1 : 5

### Typical Timber to Steel Repair - Section 1A

1 : 10


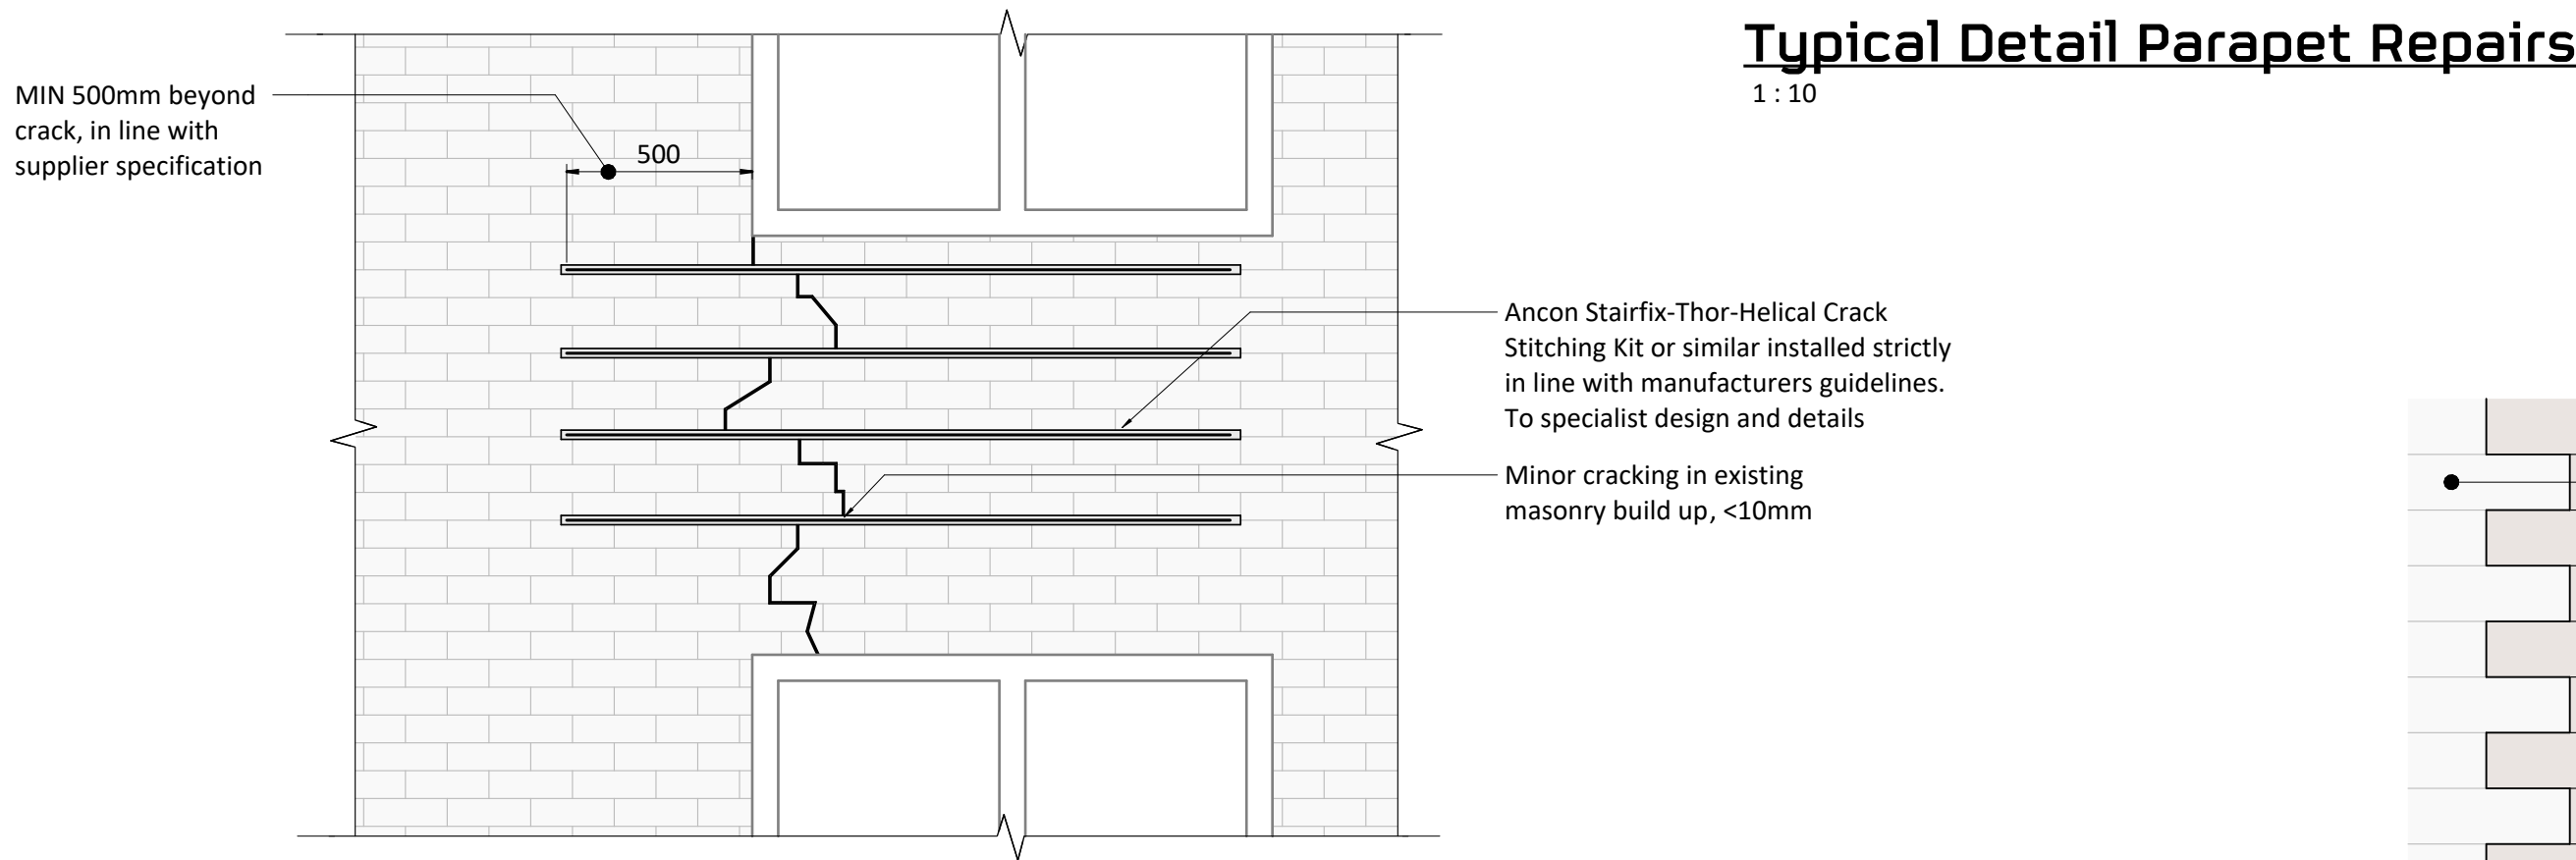


### Typical Masonry Crack Stitching Remedial Detail

1 : 20


### Typical Detail Parapet Repairs

1 : 10

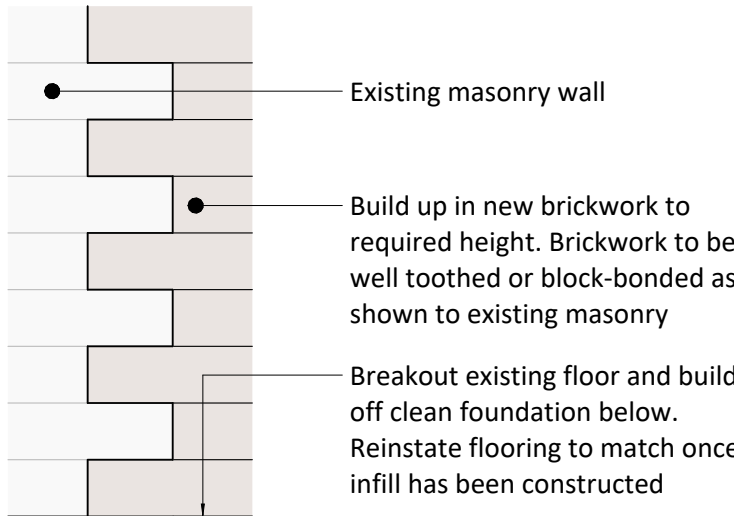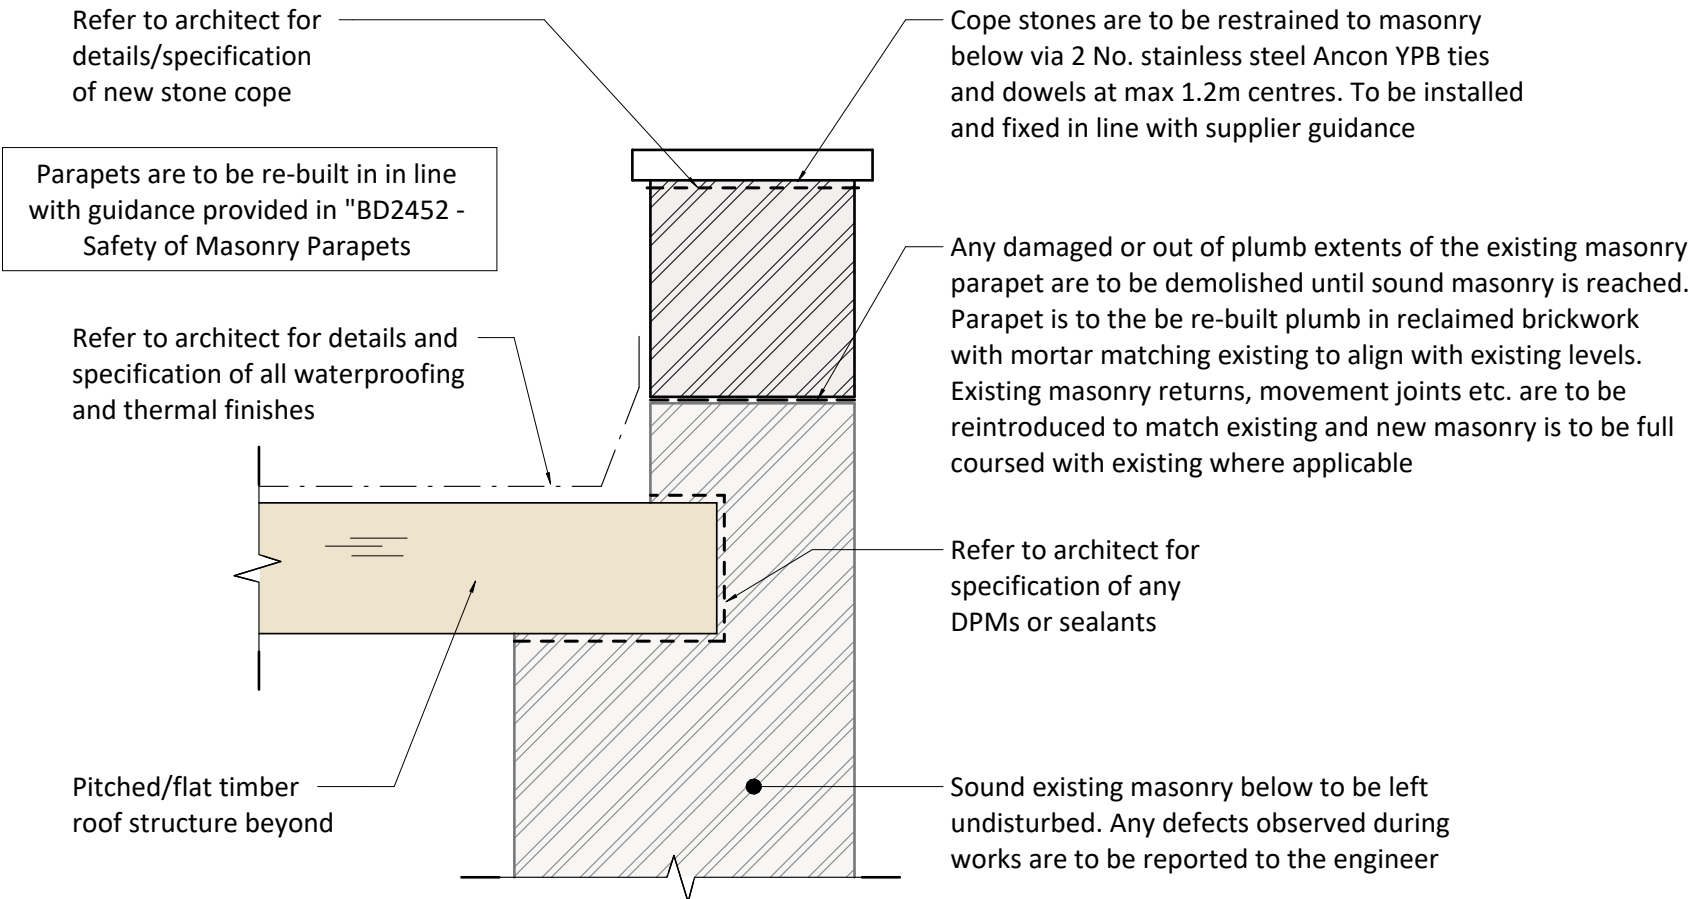

### Typical Masonry Wall Bonding Detail

1 : 10

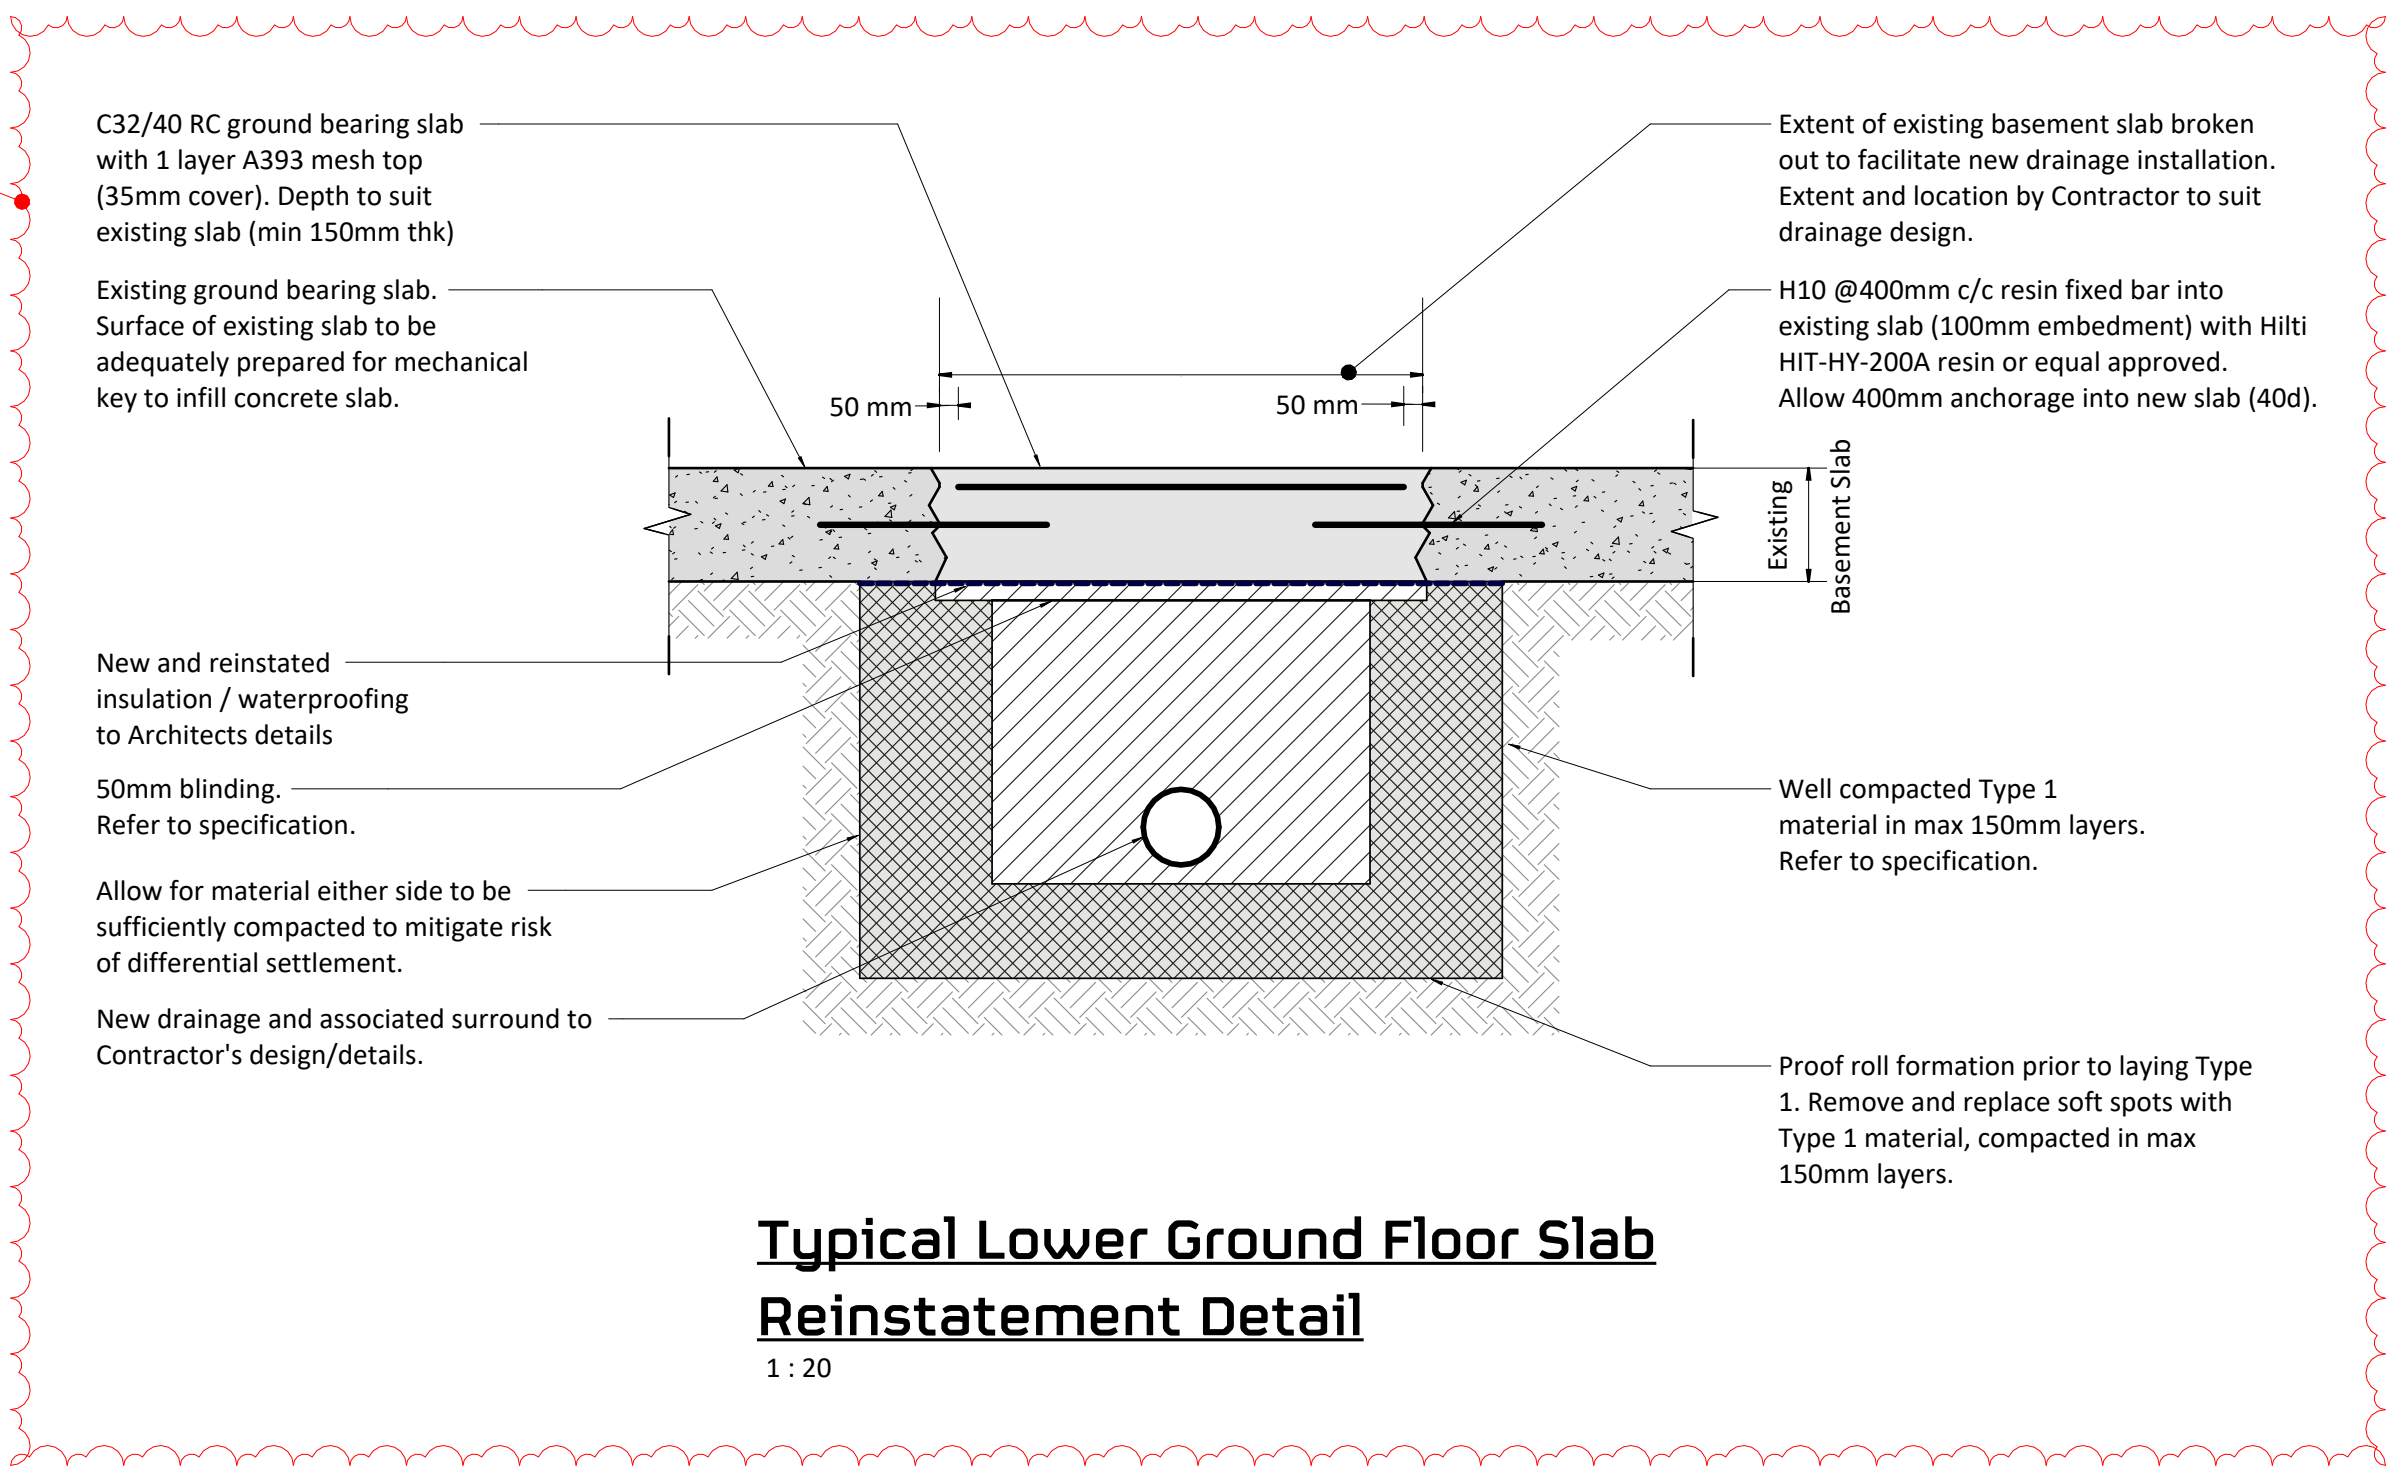

### Typical Lower Ground Floor Slab Reinstatement Detail

1 : 20

|     |          |     |     |                     |  |
|-----|----------|-----|-----|---------------------|--|
|     |          |     |     |                     |  |
|     |          |     |     |                     |  |
|     |          |     |     |                     |  |
|     |          |     |     |                     |  |
|     |          |     |     |                     |  |
|     |          |     |     |                     |  |
|     |          |     |     |                     |  |
|     |          |     |     |                     |  |
| P2  | 01.12.23 | JMD | SD  | Draft Stage 4 Issue |  |
| P1  | 24.04.23 | JMD | SD  | Stage 3 Issue       |  |
| Rev | Date     | By  | Eng | Amendment           |  |

**HEYNE TILLET STEEL** STRUCTURAL & CIVIL ENGINEERS  
<http://hts.uk.com/>

Job Name  
**Neptune Mill**  
**Manchester, M1 2WQ**

Drawing Title  
**Proposed Typical Details - Sheet 1**

Purpose of Issue **Stage 4** Scale at A1 **As indicated**

Drg No **2909-HTS-XX-XX-DR-S-2300**

HTS Job No **2909** Suitability Rev **P2**