

CCTV Report



Project

1133 Rochdale Road,
Manchester, M9 8DS

Survey Date

21/07/2022

Client

James Campbell Associates LTD

Surveyor

Paul Ireson

Job Number

43437CCTV-01

Issue Date

04/08/2022

Checked by

Rob Nicolson

Revision - Issue Date

High Pressure Jetting & Resurvey

Maintenance Visits

Following the initial investigations completed on site we would recommend a quarterly re-survey of the drainage network in order to monitor the ongoing pipework condition.

System Maintenance Survey:

Quarterly Assessment of Existing Defects Due – 00/00/00

Annual Full System Re-survey Due – 00/00/0000

High Pressure Jetting Required:

(5% - 30%) -

(35 % - 60%) -

(65% - 95%) -



Project-information

Project name:
Rochdale Road

Contract number:
43437

Contact:
Martin Ashworth

Date:
02/08/2022

Client **James Campbell Associates Ltd**
 Contact: **Martin Ashworth**
 Position: **Senior Architectural Technician**
 Road **Campbell House, 173 Rochdale Road**
 Town **Firgrove, Rochdale**
 County **Lancashire**
 Telephone: **01706354888**
 Fax:
 Mobile: **07817623183**
 E-Mail: **martin@jamescampbellassociates.co.uk**

Site **1133 Rochdale Road**
 Contact:
 Position:
 Road **1133 Rochdale Road**
 Town **Manchester**
 County **Lancashire**
 Telephone:
 Fax:
 Mobile:
 E-Mail:

Contractor **Survey Solutions**
 Contact: **Paul Ireson**
 Position: **Surveyor**
 Road **6 Farrington Way**
 Town **Eastwood, NG16 3BF**
 County **Nottingham**
 Telephone: **01773714733**
 Fax:
 Mobile:
 E-Mail: **Utilities@survey-solutions.co.uk**



Inspection report

Date: 02/08/2022	Job N°: 20469	Weather: Showers	Operator: PI	section number: 1	PLR: X
Present:	Vehicle:	Camera: Crawler	Preset:	Cleaned: No	Grade:

Road: Rochdale Road	Division:	start MH: MH1 A
Place: Rochdale Road	District:	end MH:
Location:	Tape No.:	Total length: 18.1 m

Purpose:	Shape/Size: Circular dia 525 mm
Use: Surface water	Material: Brick Culvert Pipe length:
Catchment:	Lining:
	Category:

Comment:
Location details:

1:150	position	code	observation	counter	photo	grade
	0.00	MH	Manhole Remark: MH1 A	00:00:00		(Constr) 0
	0.00	ST	Start of Survey	00:00:00		(Misc) 0
	0.20	WL	Water level, 10 % height/diameter	00:00:00		(Serv) 0
	0.20	S1 DES	Debris silt, 25 % cross-sectional area loss, Start	00:00:00	4_4a	(Serv) 1
	2.35	GP	General Condition photograph	00:00:00	1_5a	(Misc) 0
	4.26	C1 DES	Debris silt, 35 % cross-sectional area loss, Changed	00:00:00	1_6a	(Serv) 1
	5.00	C1 DES	Debris silt, 40 % cross-sectional area loss, Changed	00:00:00	1_7a	(Serv) 1
	6.00	C1 DES	Debris silt, 45 % cross-sectional area loss, Changed	00:00:00	1_8a	(Serv) 1
	8.00	LL	Line of Sewer deviates left	00:00:00		(Serv) 0
	8.30	GP	General Condition photograph	00:00:00	1_10a	(Misc) 0
	11.66	GP	General Condition photograph	00:00:00	11_11a	(Misc) 0
	15.35	F1 DES	Debris silt, 50 % cross-sectional area loss, Finish	00:00:00		(Serv) 1
	18.00	GO	General Observation, Remark: Obstruction.	00:00:00	13_13a	(Misc) 0
	18.10	DE	Debris, 95 % cross-sectional area loss	00:00:00	14_14a	(Serv) 1
	18.10	SA	Survey abandoned, Remark: Unable to survey beyond blockage.	00:00:00		(Misc) 0

Structural Defects	Constructional Features
Service Defects	Miscellaneous Features

Inspection photos

Place: Rochdale Road	Road: Rochdale Road	Date: 02/08/2022	section number: 1	PLR: X
--------------------------------	-------------------------------	----------------------------	-----------------------------	------------------



Photo: 4_4a, 00:00:00
0.2m, Debris silt, 25 % cross-sectional area loss, Start



Photo: 1_5a, 00:00:00
2.35m, General Condition photograph



Photo: 1_6a, 00:00:00
4.26m, Debris silt, 35 % cross-sectional area loss, Changed

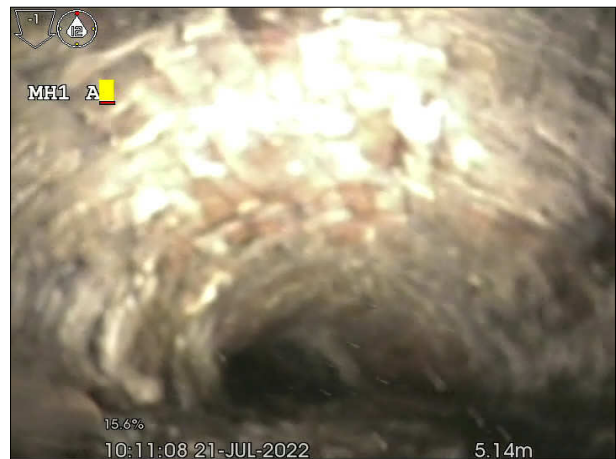


Photo: 1_7a, 00:00:00
5m, Debris silt, 40 % cross-sectional area loss, Changed

Inspection photos

Place: Rochdale Road	Road: Rochdale Road	Date: 02/08/2022	section number: 1	PLR: X
--------------------------------	-------------------------------	----------------------------	-----------------------------	------------------



Photo: 1_8a, 00:00:00
6m, Debris silt, 45 % cross-sectional area loss, Changed

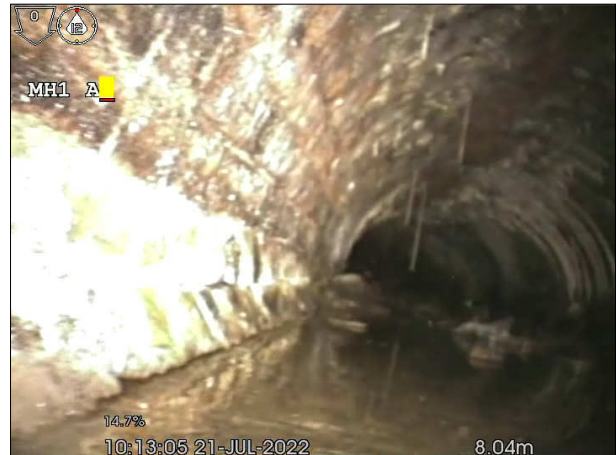


Photo: 1_10a, 00:00:00
8.3m, General Condition photograph

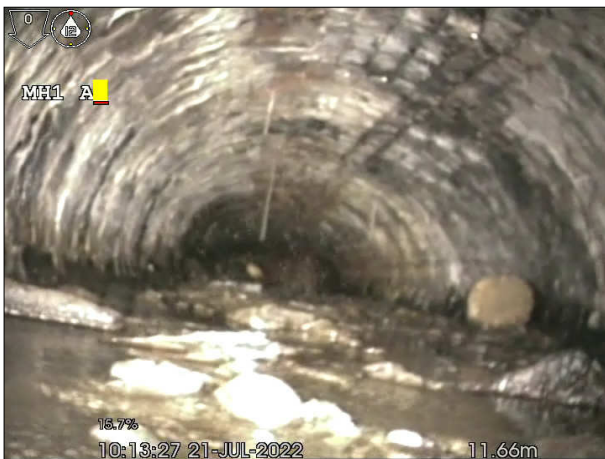


Photo: 11_11a, 00:00:00
11.66m, General Condition photograph



Photo: 13_13a, 00:00:00
18m, General Observation, Remark: Obstruction.

Inspection photosPlace:
Rochdale RoadRoad:
Rochdale RoadDate:
02/08/2022section number:
1PLR:
X

Photo: 14_14a, 00:00:00
18.1m, Debris, 95 % cross-sectional area loss



Survey Solutions
Eastwood, NG16 3BF
Nottingham
Tel: 01773714733, Fax:


Inspection report

Date: 02/08/2022	Job N°: 20469	Weather: Showers	Operator: PI	section number: 2	PLR: MH1 X X
Present:	Vehicle:	Camera: Crawler	Preset:	Cleaned: No	Grade:

Road: Rochdale Road	Division:	start MH: MH1 X
Place: Rochdale Road	District:	end MH:
Location:	Tape No.:	Total length: 12.95 m

Purpose:	Shape/Size: Circular dia 525 mm
Use: Surface water	Material: Concrete Pipe length:
Catchment:	Lining:
	Category:

Comment:
Location details:

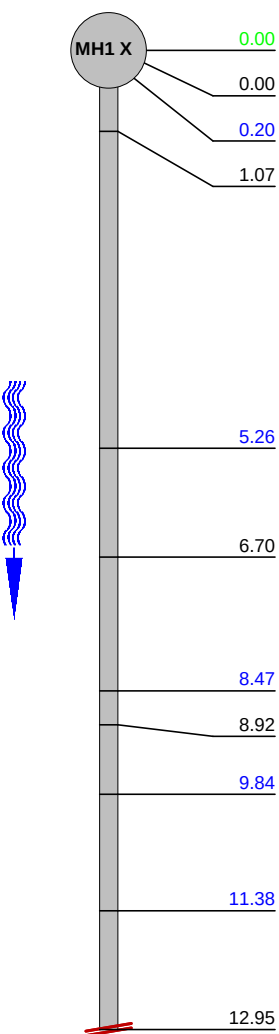1:100	position	code	observation	counter	photo	grade
	<u>0.00</u>	MH	Manhole Remark: MH1 X	00:00:00		(Constr) 0
	<u>0.00</u>	ST	Start of Survey	00:00:00		(Misc) 0
	<u>0.20</u>	WL	Water level, 25 % height/diameter	00:00:00		(Serv) 0
	<u>1.07</u>	GP	General Condition photograph	00:00:00	2_4a	(Misc) 0
	<u>5.26</u>	WL	Water level, 30 % height/diameter	00:00:00		(Serv) 0
	<u>6.70</u>	GP	General Condition photograph	00:00:00	2_6a	(Misc) 0
	<u>8.47</u>	WL	Water level, 40 % height/diameter	00:00:00		(Serv) 0
	<u>8.92</u>	GP	General Condition photograph	00:00:00	24_8a	(Misc) 0
	<u>9.84</u>	DES	Debris silt, 40 % cross-sectional area loss	00:00:00	25_9a	(Serv) 1
	<u>11.38</u>	WL	Water level, 60 % height/diameter	00:00:00		(Serv) 0
	<u>12.95</u>	SA	Survey abandoned, Remark: Unable to survey beyond blockage.	00:00:00	27_11a	(Misc) 0

Structural Defects	Constructional Features
Service Defects	Miscellaneous Features

Inspection photosPlace:
Rochdale RoadRoad:
Rochdale RoadDate:
02/08/2022section number:
2PLR:
MH1 X X

Photo: 2_4a, 00:00:00
1.07m, General Condition photograph



Photo: 2_6a, 00:00:00
6.7m, General Condition photograph

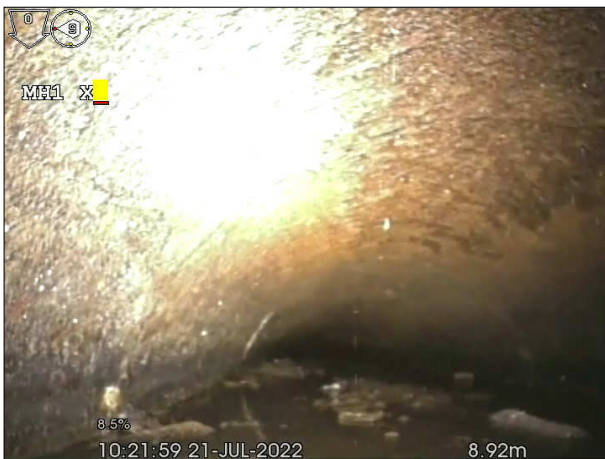


Photo: 24_8a, 00:00:00
8.92m, General Condition photograph



Photo: 25_9a, 00:00:00
9.84m, Debris silt, 40 % cross-sectional area loss

Inspection photosPlace:
Rochdale RoadRoad:
Rochdale RoadDate:
02/08/2022section number:
2PLR:
MH1 X X

Photo: 27_11a, 00:00:00
12.95m, Survey abandoned, Remark: Unable to survey beyond
blockage.