


ROOM F.21

- Cornice as noted on the plan
- Some of the cornice is damaged and/or missing
- Partially collapsed ceiling as noted on the plan
- Plasterboard ceiling
- Bad water damage to ceiling




existing lathe and plaster ceiling
to be underboarded
[with 2 layers of fire board]
existing cornice to be retained
repaired as necessary
[where cornice is missing
remold will take place]

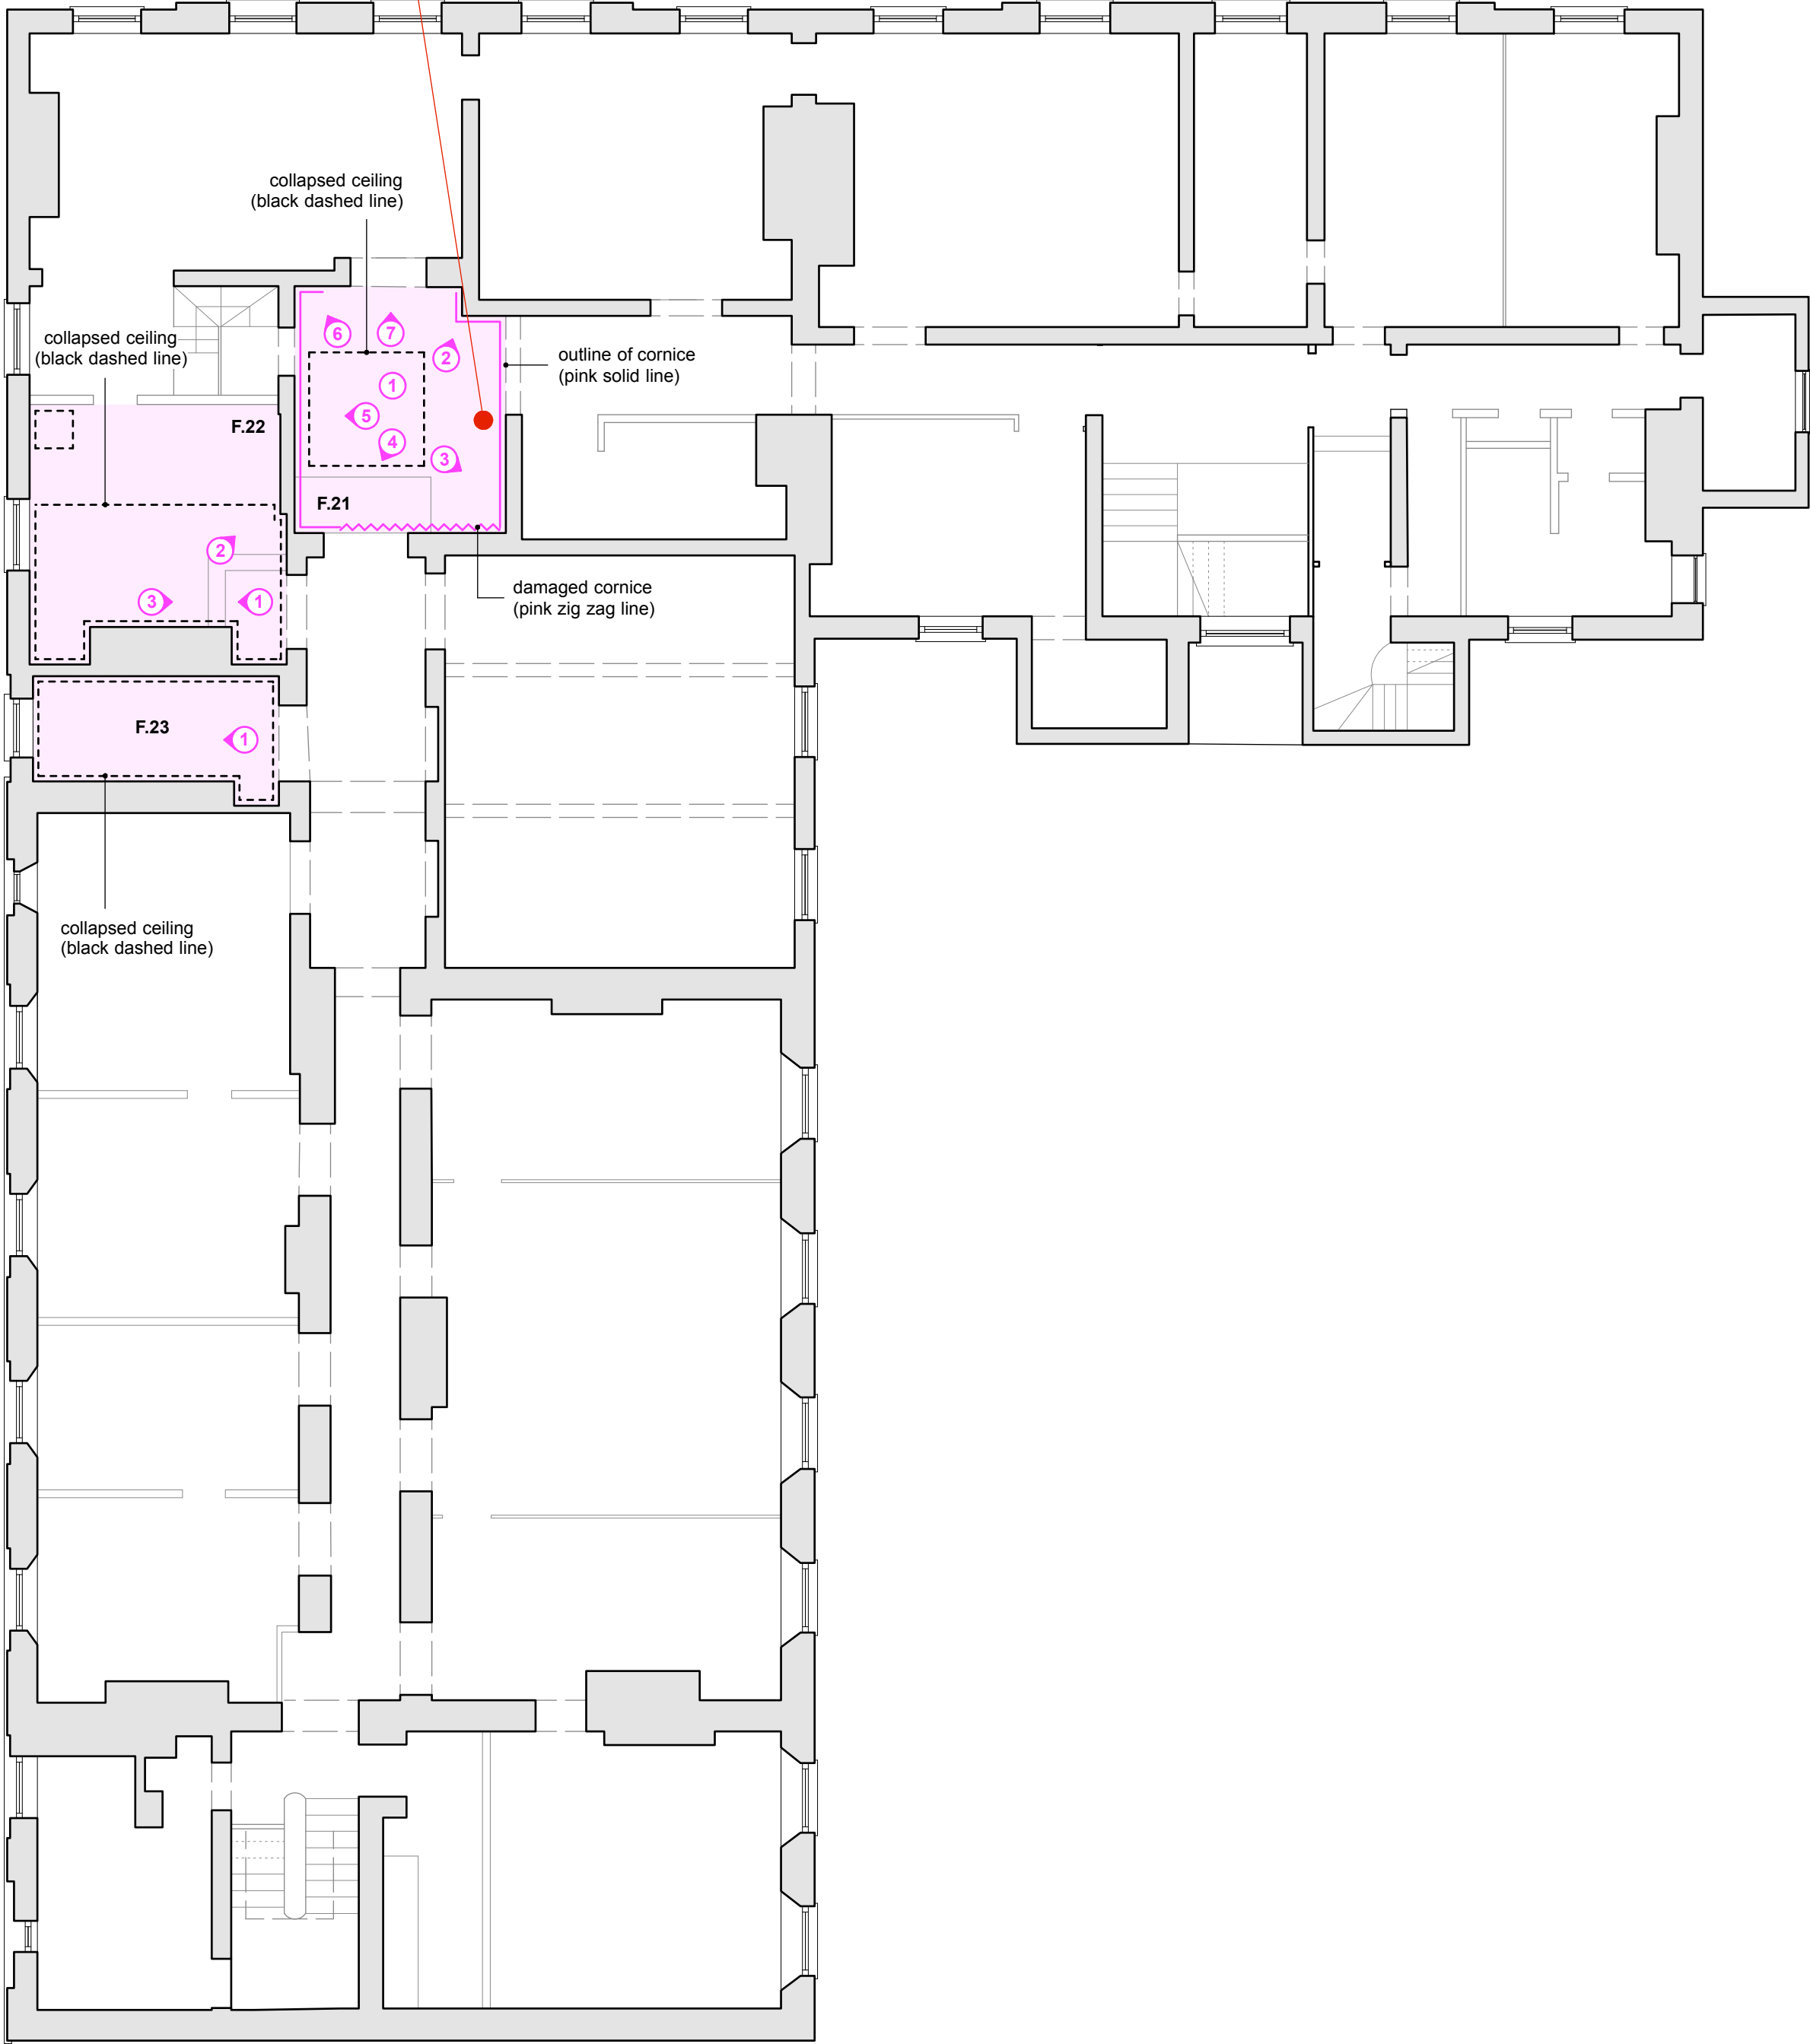

ROOM F.22

- Restricted access - Room is inaccessible due to collapsed ceiling and/or unsafe floor structure
- No cornice
- Most of the ceiling has collapsed - the rest looks damaged

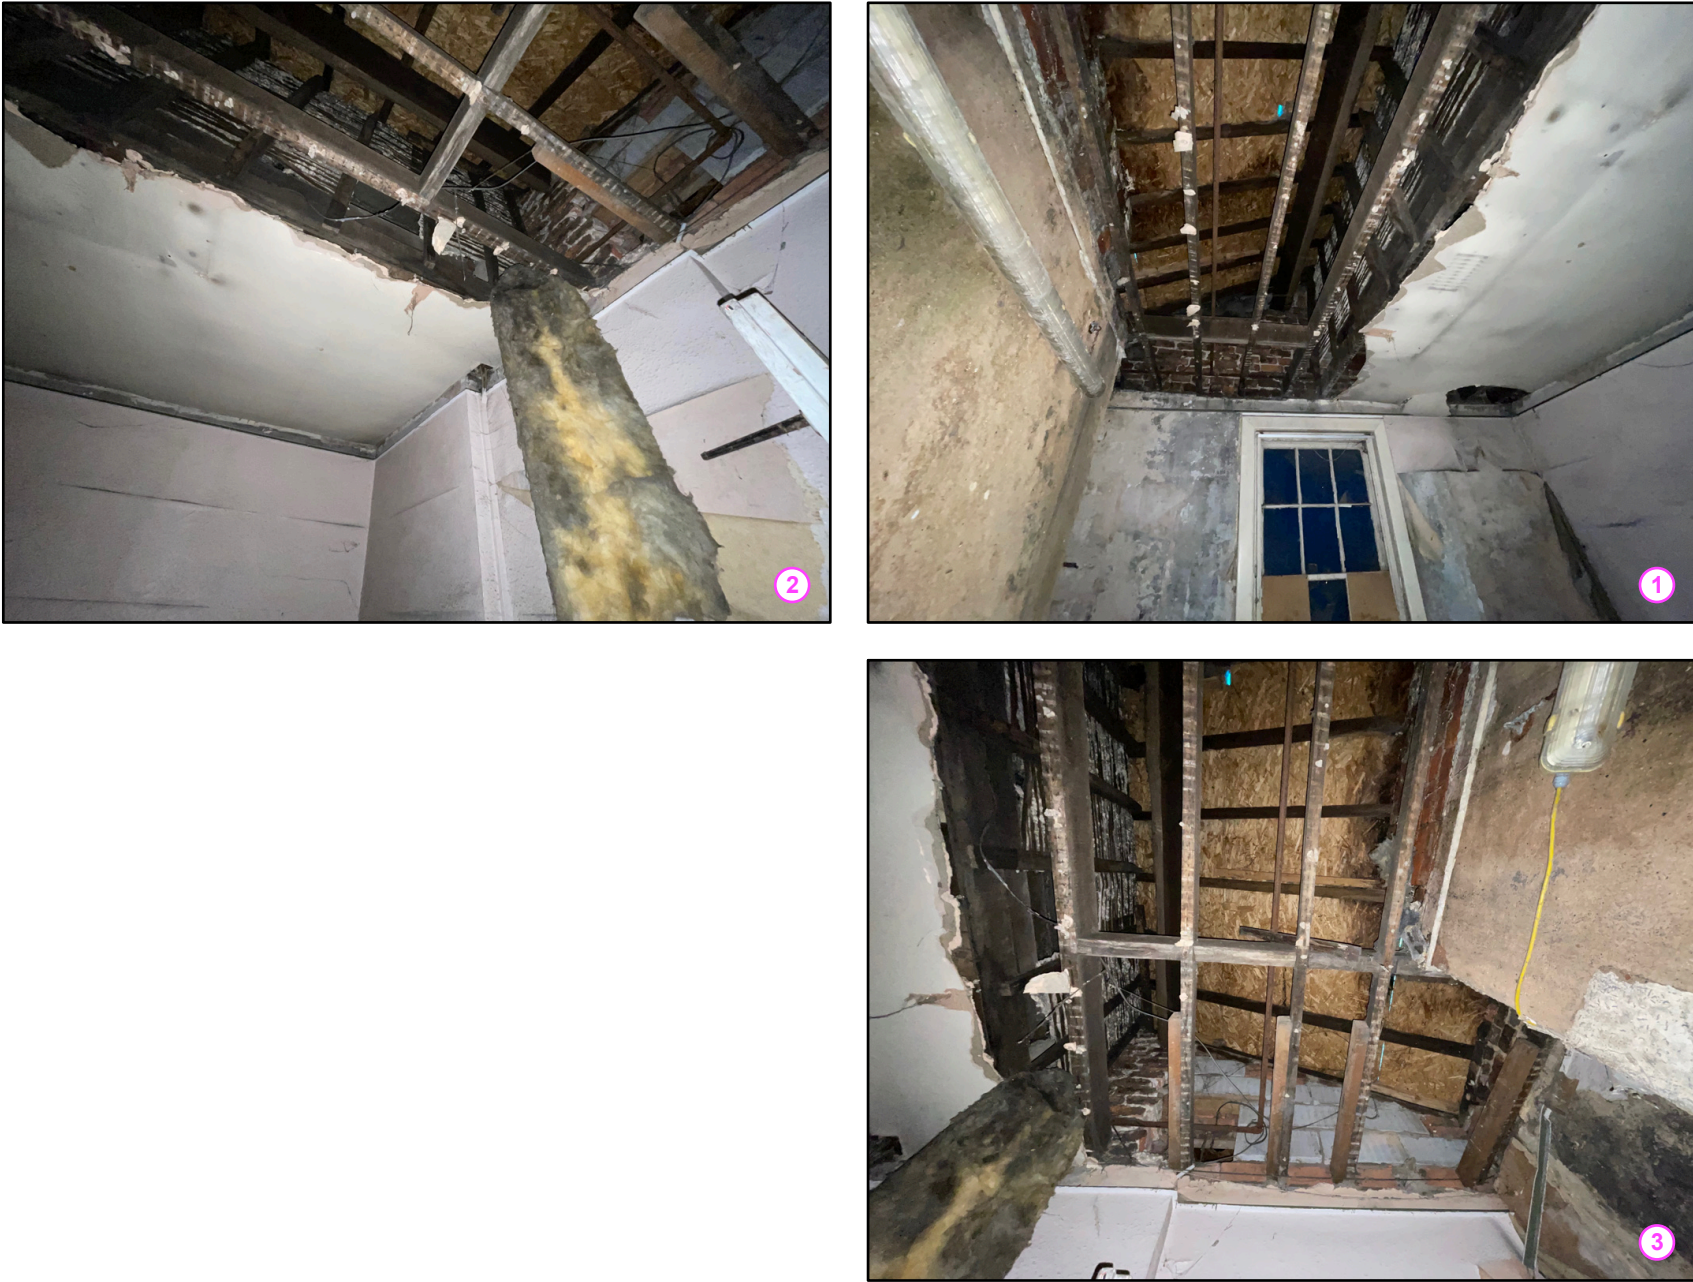

ROOM F.23

- Restricted access - Room is inaccessible due to collapsed ceiling and/or unsafe floor structure
- No cornice
- Ceiling has collapsed completely leaving exposed the timber rafters above



Do not scale from this drawing.
All dimensions are to be checked on site prior to commencing works on site. Discrepancy found between information given on this drawing and that given elsewhere or recorded on site shall be notified immediately to the project architect in writing.

PRELIMINARY ISSUE