


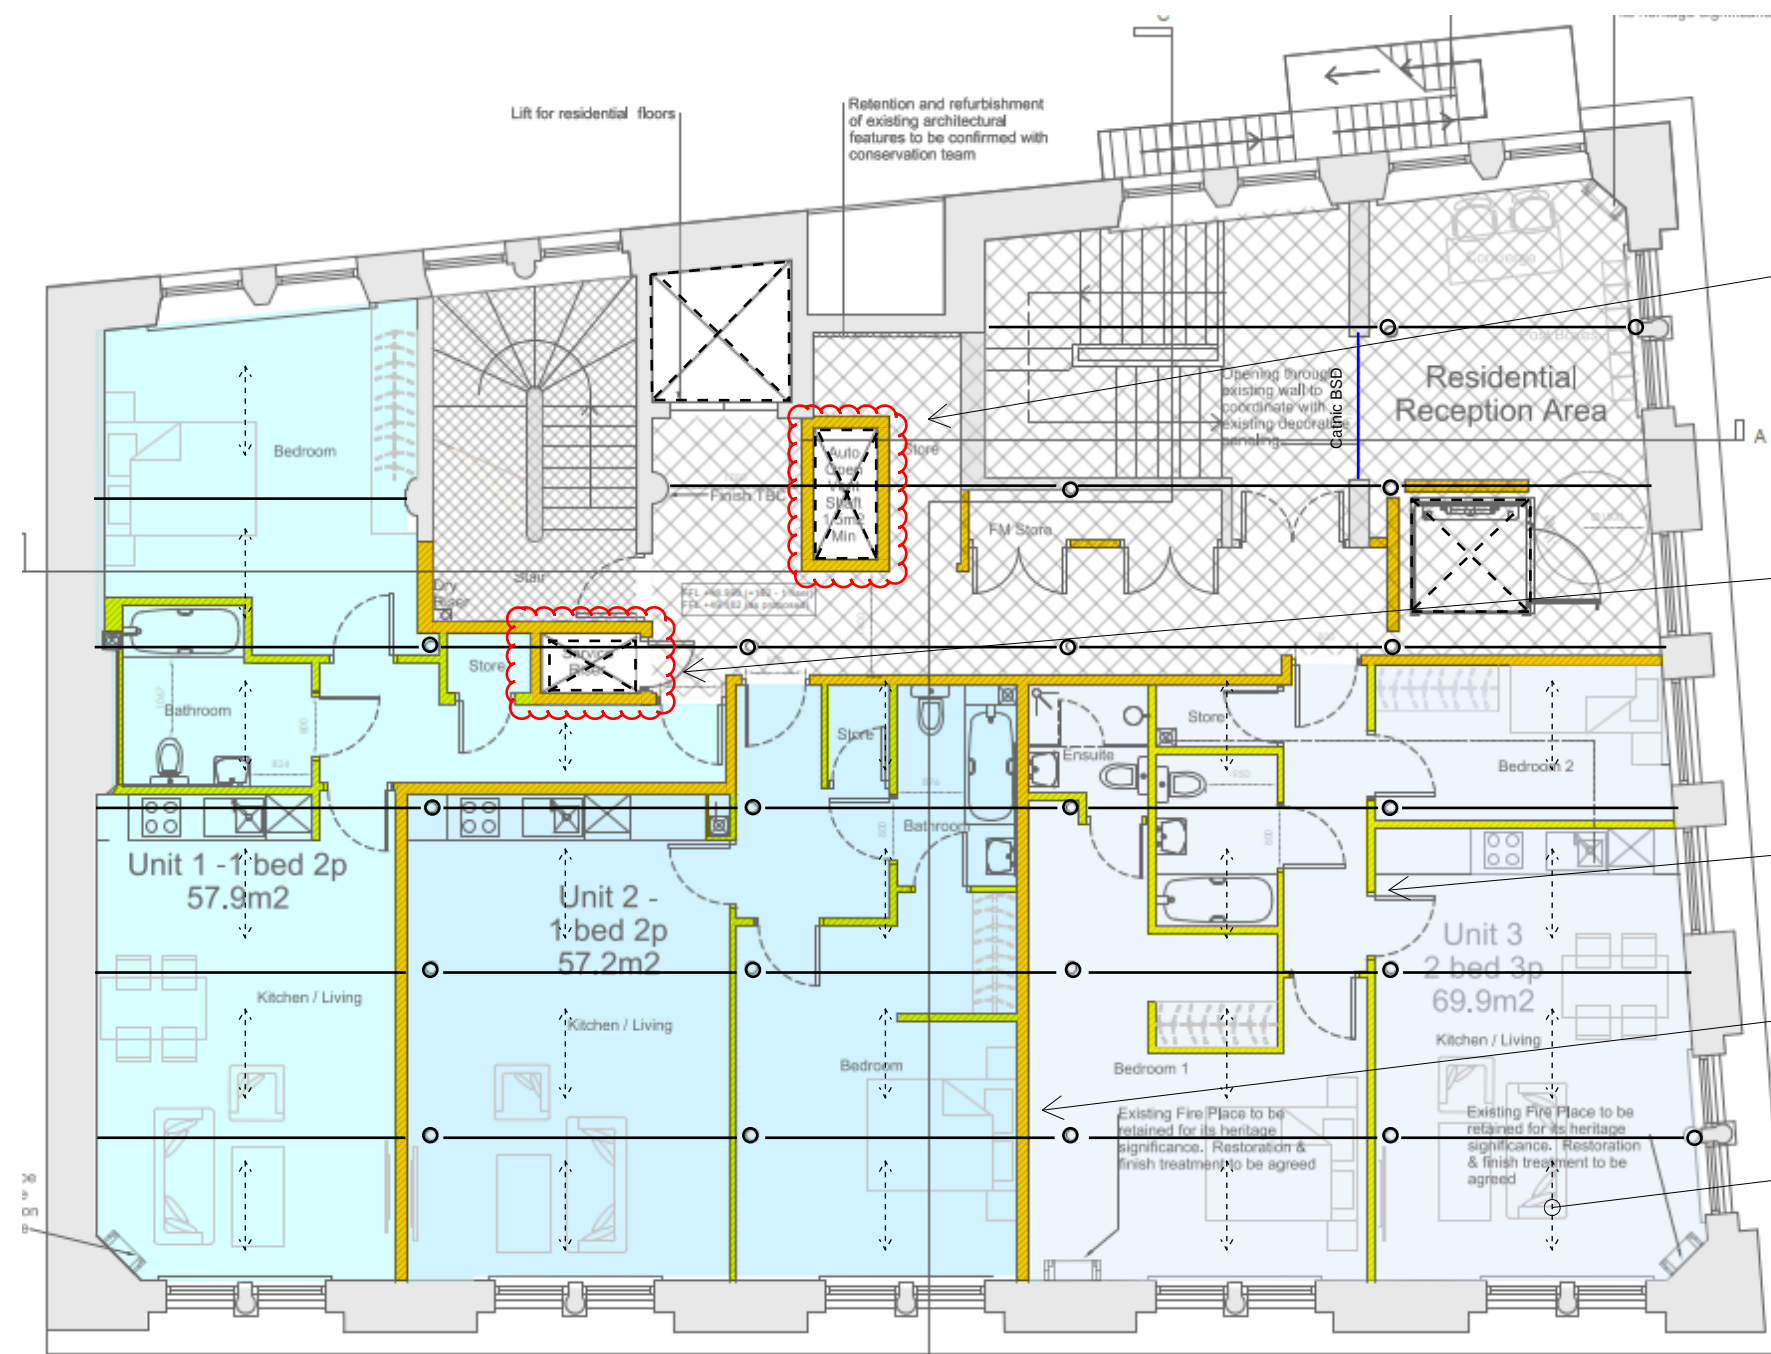

Location of smoke vent cuts through existing primary timber floor beam. Can smoke vent be moved to avoid additional significant structural framing to trim out void for smoke vent. Architects to confirm acceptance.

Location of service riser cuts through existing primary timber floor beam. Can beam continue to pass through service riser to avoid additional significant structural framing to trim out void for smoke vent. Architects & M&E consultants to confirm acceptance.

Non-structural studwork partitions to be built up off the existing timber floor structure.

Structural studwork walls to be built up off the existing timber floor structure.

New raised floor build up to architects design and details.

Drawing Key

- Existing timber beams
- - - Existing metal beams
- o Existing metal columns
- New non-structural studwork fire compartmentation walls
- New non-structural studwork walls
- New non-structural blockwork fire compartmentation walls
- - - New structural steel beams
- New structural timber beams

General Notes

1. The scheme shown is indicative and is subject to detailed design.
2. Locations of the existing structure are indicative and are based on the survey information provided by the client.
3. Scheme shown is based on Architectural planning drawings Rev D.

02/12/2022 P01 Issue
14/04/2023 P02 Issue
17/05/2023 P03 Issue

First Floor Structure Indicating Second Floor Structure Over

Scale: 1:100

Project:	Fraser House	Eng:	MWS
Title:	First floor structure	Date:	May'23
No:	LM21346-DYSE-XX-ZZ-SK-S-0023	Rev:	P03