

| Floor             | Room                       | Item                                | Product Type                                                                      | Asbestos Type   | Sample Reference | Comments                             | Photograph                                                                            |
|-------------------|----------------------------|-------------------------------------|-----------------------------------------------------------------------------------|-----------------|------------------|--------------------------------------|---------------------------------------------------------------------------------------|
| 02 - Second Floor | 045 - Stairwell B          | Mastic seal to windows              | Other Encapsulated Material<br>Bituminous Product(s)<br>Mastic(s) and Adhesive(s) | No ACM detected | S088 (VC)        |                                      |    |
| 02 - Second Floor | 046 - Switchroom           | Mastic seal to windows              | Other Encapsulated Material<br>Bituminous Product(s)<br>Mastic(s) and Adhesive(s) | No ACM detected | S088 (VC)        |                                      |    |
| 02 - Second Floor | 046 - Switchroom           | Bitumen adhesive to floor           | Other Encapsulated Material<br>Bituminous Product(s)<br>Mastic(s) and Adhesive(s) | No ACM detected | S097 (VC)        |                                      |    |
| 02 - Second Floor | 046 - Switchroom           | Vinyl floor tiles - Green and beige | Floor Tiles                                                                       | No ACM detected | S095 (VC)        |                                      |    |
| 02 - Second Floor | 050 - Switchroom           | Bitumen adhesive to floor           | Other Encapsulated Material<br>Bituminous Product(s)<br>Mastic(s) and Adhesive(s) | No ACM detected | S097 (VC)        |                                      |    |
| 02 - Second Floor | 050 - Switchroom           | Vinyl floor tiles - Green and beige | Floor Tiles                                                                       | No ACM detected | S095 (VC)        |                                      |   |
| 02 - Second Floor | 052 - Main Shop Floor Area | Vinyl floor tiles - Beige           | Floor Tiles                                                                       | No ACM detected | S089 (VC)        |                                      |  |
| 02 - Second Floor | 052 - Main Shop Floor Area | Mastic seal to windows              | Other Encapsulated Material<br>Bituminous Product(s)<br>Mastic(s) and Adhesive(s) | No ACM detected | S088 (VC)        | To all original windows to perimeter |  |

## 9.0 General Construction Materials Register

Fibrous materials may exist within the premises which are not ACMs. Where in the judgement of the surveyor, the material is clearly non asbestos containing the surveyor will record findings in the construction register. All building and construction materials used in the premises have been inspected where accessible. The following register identifies each non-asbestos element identified and inspected.

### 02 - Second Floor

| 001 - Refuse Chute |                                                                                     |                                                                                     |
|--------------------|-------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------|
| Element            | Material                                                                            | Photograph                                                                          |
| Ceiling            | Concrete ceiling, steel beams with plaster boxing, mmmf insubatt insulation.        |  |
| Walls              | Brick,block and plaster walls, metal brackets, metal pipework with foam insulation. |                                                                                     |
| Floor              | Concrete floor, vinyl floor tiles, lino floor covering.                             |                                                                                     |
| Doors              | Timber door and casing.                                                             |                                                                                     |
| Windows            | None within location                                                                |                                                                                     |
| Ceiling Void       | Inaccessible, Unable to Investigate because of Unsafe Access                        |                                                                                     |
| Cavities           | No Cavities Present in Room/location                                                |                                                                                     |
| Risers             | Inaccessible, Unable to Investigate because of Unsafe Access                        |                                                                                     |
| Ducting            | No Ducting Present in Room/location                                                 |                                                                                     |
| Pipework           | Accessible, Metal                                                                   |                                                                                     |
| Boxing             | No Boxing Present in Room/location                                                  |                                                                                     |

### 02 - Second Floor

| 004 - Male Toilets |                                                                                                                                     |                                                                                      |
|--------------------|-------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------|
| Element            | Material                                                                                                                            | Photograph                                                                           |
| Ceiling            | Concrete ceiling, steel beams with plaster boxing, metal pipework                                                                   |  |
| Walls              | Brick,block and plaster walls, metal pipework, toilets removed, plasterboard boxing housing plastic soil pipe, ceramic tiled walls. |                                                                                      |
| Floor              | Concrete floor, ceramic floor tiles.                                                                                                |                                                                                      |
| Doors              | Timber door and casing, timber door header panels.                                                                                  |                                                                                      |
| Windows            | Metal windows with ceramic sills                                                                                                    |                                                                                      |
| Ceiling Void       | Inaccessible, Unable to Investigate because of Unsafe Access                                                                        |                                                                                      |
| Cavities           | No Cavities Present in Room/location                                                                                                |                                                                                      |
| Risers             | Inaccessible, Unable to Investigate because of Unsafe Access                                                                        |                                                                                      |
| Ducting            | No Ducting Present in Room/location                                                                                                 |                                                                                      |
| Pipework           | Accessible, Metal                                                                                                                   |                                                                                      |
| Boxing             | No Boxing Present in Room/location                                                                                                  |                                                                                      |

### 02 - Second Floor

| 005 - Circulation |                                                                       |                                                                                       |
|-------------------|-----------------------------------------------------------------------|---------------------------------------------------------------------------------------|
| Element           | Material                                                              | Photograph                                                                            |
| Ceiling           | Concrete ceiling, steel beams with plaster boxing, metal pipework     |  |
| Walls             | Brick,block and plaster walls, metal pipework, timber skirting boards |                                                                                       |
| Floor             | Concrete floor, x2 vinyl floor tiles, x1 lino floor covering          |                                                                                       |
| Doors             | Timber door and casing, timber door header panels.                    |                                                                                       |
| Windows           | None within location                                                  |                                                                                       |
| Ceiling Void      | Inaccessible, Unable to Investigate because of Unsafe Access          |                                                                                       |
| Cavities          | No Cavities Present in Room/location                                  |                                                                                       |
| Risers            | Inaccessible, Unable to Investigate because of Unsafe Access          |                                                                                       |
| Ducting           | No Ducting Present in Room/location                                   |                                                                                       |
| Pipework          | Accessible, Metal                                                     |                                                                                       |
| Boxing            | No Boxing Present in Room/location                                    |                                                                                       |

## 9.0 General Construction Materials Register Continued

### 02 - Second Floor

| 006 - Female Toilets |                                                                                                                                        |                                                                                     |
|----------------------|----------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------|
| Element              | Material                                                                                                                               | Photograph                                                                          |
| Ceiling              | Concrete ceiling, steel beams with plaster boxing, metal pipework                                                                      |  |
| Walls                | Brick, block and plaster walls, metal, ceramic toilet cisterns, bakerlite toilet seats, ceramic tiled walls, timber partition walls.   |                                                                                     |
| Floor                | Concrete floor, ceramic floor tiles.                                                                                                   |                                                                                     |
| Doors                | Timber door and casing.                                                                                                                |                                                                                     |
| Windows              | Metal windows with ceramic sills                                                                                                       |                                                                                     |
| Ceiling Void         | Inaccessible, Unable to Investigate because of Unsafe Access                                                                           |                                                                                     |
| Cavities             | No Cavities Present in Room/location                                                                                                   |                                                                                     |
| Risers               | Inaccessible, Unable to Investigate because of Unsafe Access                                                                           |                                                                                     |
| Ducting              | No Ducting Present in Room/location                                                                                                    |                                                                                     |
| Pipework             | Accessible, Metal                                                                                                                      |                                                                                     |
| Boxing               | No Boxing Present in Room/location                                                                                                     |                                                                                     |
| Comments             | Listed and protected location, no damage made to structure or decorative materials. Inspections only made in areas of existing damage. |                                                                                     |

### 02 - Second Floor

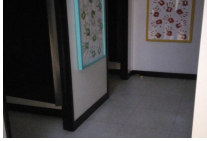
| 007 - Family Room |                                                                                                  |                                                                                      |
|-------------------|--------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------|
| Element           | Material                                                                                         | Photograph                                                                           |
| Ceiling           | Concrete ceiling, steel beams with plaster boxing, metal pipework, metal suspended ceiling grid. |  |
| Walls             | Brick, block and plaster walls, metal, ceramic toilet cisterns, plastic wall sheeting.           |                                                                                      |
| Floor             | Concrete floor, x1 modern lino floor covering, vinyl floor tiles, lino floor covering.           |                                                                                      |
| Doors             | Timber door and casing.                                                                          |                                                                                      |
| Windows           | None within location                                                                             |                                                                                      |
| Ceiling Void      | Inaccessible, Unable to Investigate because of Unsafe Access                                     |                                                                                      |
| Cavities          | No Cavities Present in Room/location                                                             |                                                                                      |
| Risers            | Inaccessible, Unable to Investigate because of Unsafe Access                                     |                                                                                      |
| Ducting           | No Ducting Present in Room/location                                                              |                                                                                      |
| Pipework          | Accessible, Metal                                                                                |                                                                                      |
| Boxing            | No Boxing Present in Room/location                                                               |                                                                                      |

### 02 - Second Floor

| 008 - Female Toilets |                                                                                                                                                                                        |                                                                                       |
|----------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------|
| Element              | Material                                                                                                                                                                               | Photograph                                                                            |
| Ceiling              | Concrete ceiling, steel beams with plaster boxing, metal pipework                                                                                                                      |  |
| Walls                | Brick, block and plaster walls, metal, ceramic toilet cisterns, bakerlite toilet seats, ceramic tiled walls, timber partition walls, plasterboard partition wall, modern water heater. |                                                                                       |
| Floor                | Concrete floor, vinyl floor tiles, lino floor covering.                                                                                                                                |                                                                                       |
| Doors                | Timber door and casing, plasterboard door header.                                                                                                                                      |                                                                                       |
| Windows              | Metal windows with ceramic sills                                                                                                                                                       |                                                                                       |
| Ceiling Void         | Inaccessible, Unable to Investigate because of Unsafe Access                                                                                                                           |                                                                                       |
| Cavities             | No Cavities Present in Room/location                                                                                                                                                   |                                                                                       |
| Risers               | Inaccessible, Unable to Investigate because of Unsafe Access                                                                                                                           |                                                                                       |
| Ducting              | No Ducting Present in Room/location                                                                                                                                                    |                                                                                       |
| Pipework             | Accessible, Metal                                                                                                                                                                      |                                                                                       |
| Boxing               | No Boxing Present in Room/location                                                                                                                                                     |                                                                                       |
| Comments             | Listed and protected location, no damage made to structure or decorative materials. Inspections only made in areas of existing damage.                                                 |                                                                                       |

## 9.0 General Construction Materials Register Continued

### 02 - Second Floor

| 009 - Changing Rooms |                                                                                                                                                     |                                                                                     |
|----------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------|
| Element              | Material                                                                                                                                            | Photograph                                                                          |
| Ceiling              | Concrete ceiling, steel beams with plaster boxing, metal pipework, metal ducting with modern silicone seals, metal and mmmf suspended ceiling grid. |  |
| Walls                | Brick,block and plaster walls, plasterboard partition walls, timber skirting boards.                                                                |                                                                                     |
| Floor                | Concrete floor, x1 modern floor tiles                                                                                                               |                                                                                     |
| Doors                | Timber door and casing.                                                                                                                             |                                                                                     |
| Windows              | None within location                                                                                                                                |                                                                                     |
| Ceiling Void         | Inaccessible, Unable to Investigate because of Unsafe Access                                                                                        |                                                                                     |
| Cavities             | No Cavities Present in Room/location                                                                                                                |                                                                                     |
| Risers               | Inaccessible, Unable to Investigate because of Unsafe Access                                                                                        |                                                                                     |
| Ducting              | No Ducting Present in Room/location                                                                                                                 |                                                                                     |
| Pipework             | Accessible, Metal                                                                                                                                   |                                                                                     |
| Boxing               | No Boxing Present in Room/location                                                                                                                  |                                                                                     |

### 02 - Second Floor

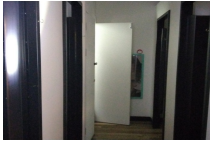
| 010 - Stairwell D |                                                                   |                                                                                     |
|-------------------|-------------------------------------------------------------------|-------------------------------------------------------------------------------------|
| Element           | Material                                                          | Photograph                                                                          |
| Ceiling           | Concrete ceiling, steel beams with plaster boxing, metal pipework |  |
| Walls             | Brick,block and plaster walls, metal pipework.                    |                                                                                     |
| Floor             | Concrete floor, vinyl floor tiles, composite stair nosing.        |                                                                                     |
| Doors             | Timber fire doors and casing.                                     |                                                                                     |
| Windows           | Metal windows with timber.                                        |                                                                                     |
| Ceiling Void      | Inaccessible, Unable to Investigate because of Unsafe Access      |                                                                                     |
| Cavities          | No Cavities Present in Room/location                              |                                                                                     |
| Risers            | Inaccessible, Unable to Investigate because of Unsafe Access      |                                                                                     |
| Ducting           | No Ducting Present in Room/location                               |                                                                                     |
| Pipework          | Accessible, Metal                                                 |                                                                                     |
| Boxing            | No Boxing Present in Room/location                                |                                                                                     |

### 02 - Second Floor

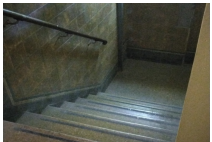
| 011 - Store Room |                                                                                                                                 |                                                                                       |
|------------------|---------------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------|
| Element          | Material                                                                                                                        | Photograph                                                                            |
| Ceiling          | Concrete ceiling, steel beams with plaster boxing, metal pipework, metal ducting with modern sealant.                           |  |
| Walls            | Brick,block and plaster walls, metal pipework, timber skirting boards, modern electrics, timber partition walls, metal conduit. |                                                                                       |
| Floor            | Concrete floor, x1 vinyl floor tiles, x1 lino floor covering.                                                                   |                                                                                       |
| Doors            | Timber door and casing, timber door header panels.                                                                              |                                                                                       |
| Windows          | Metal windows with timber window                                                                                                |                                                                                       |
| Ceiling Void     | Inaccessible, Unable to Investigate because of Unsafe Access                                                                    |                                                                                       |
| Cavities         | No Cavities Present in Room/location                                                                                            |                                                                                       |
| Risers           | Inaccessible, Unable to Investigate because of Unsafe Access                                                                    |                                                                                       |
| Ducting          | No Ducting Present in Room/location                                                                                             |                                                                                       |
| Pipework         | Accessible, Metal                                                                                                               |                                                                                       |
| Boxing           | No Boxing Present in Room/location                                                                                              |                                                                                       |

## 9.0 General Construction Materials Register Continued

### 02 - Second Floor

| 012 - Changing Rooms/Server Room |                                                                                                                                                     |                                                                                     |
|----------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------|
| Element                          | Material                                                                                                                                            | Photograph                                                                          |
| Ceiling                          | Concrete ceiling, steel beams with plaster boxing, metal pipework, metal ducting with modern silicone seals, metal and mmmf suspended ceiling grid. |  |
| Walls                            | Brick, block and plaster walls, plasterboard partition walls, timber skirting boards.                                                               |                                                                                     |
| Floor                            | Concrete floor, x1 modern floor covering, vinyl floor tiles debris, lino floor covering                                                             |                                                                                     |
| Doors                            | Timber door and casing.                                                                                                                             |                                                                                     |
| Windows                          | Metal windows with timber window                                                                                                                    |                                                                                     |
| Ceiling Void                     | Inaccessible, Unable to Investigate because of Unsafe Access                                                                                        |                                                                                     |
| Cavities                         | No Cavities Present in Room/location                                                                                                                |                                                                                     |
| Risers                           | Inaccessible, Unable to Investigate because of Unsafe Access                                                                                        |                                                                                     |
| Ducting                          | No Ducting Present in Room/location                                                                                                                 |                                                                                     |
| Pipework                         | Accessible, Metal                                                                                                                                   |                                                                                     |
| Boxing                           | No Boxing Present in Room/location                                                                                                                  |                                                                                     |

### 02 - Second Floor

| 013 - Stairwell E |                                                                                                                                            |                                                                                     |
|-------------------|--------------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------|
| Element           | Material                                                                                                                                   | Photograph                                                                          |
| Ceiling           | Concrete ceiling, metal beams with plaster boxing.                                                                                         |  |
| Walls             | Brick, block and plaster walls, plasterboard door header panels, ceramic tiled walls, metal conduit, plasterboard partition to lift riser. |                                                                                     |
| Floor             | Ceramic tiles to concrete floor.                                                                                                           |                                                                                     |
| Doors             | X2 double timber fire doors and casings.                                                                                                   |                                                                                     |
| Windows           | None within location.                                                                                                                      |                                                                                     |
| Ceiling Void      | No Ceiling Void Present in Room/location                                                                                                   |                                                                                     |
| Cavities          | No Cavities Present in Room/location                                                                                                       |                                                                                     |
| Risers            | Inaccessible, Unable to Investigate because of Unsafe Access                                                                               |                                                                                     |
| Ducting           | No Ducting Present in Room/location                                                                                                        |                                                                                     |
| Pipework          | No Pipework Present in Room/location                                                                                                       |                                                                                     |
| Boxing            | No Boxing Present in Room/location                                                                                                         |                                                                                     |

### 02 - Second Floor

| 014 - Store Room |                                                                                                                                                   |                                                                                       |
|------------------|---------------------------------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------|
| Element          | Material                                                                                                                                          | Photograph                                                                            |
| Ceiling          | Concrete ceiling, steel beams with plaster boxing, metal pipework, metal ducting with modern sealant.                                             |  |
| Walls            | Brick, block and plaster walls, metal pipework, timber skirting boards, modern electrics, timber and plasterboard partition walls, metal conduit. |                                                                                       |
| Floor            | Concrete floor, x1 vinyl floor tiles, x1 lino floor covering.                                                                                     |                                                                                       |
| Doors            | Timber door and casing, timber door header panels.                                                                                                |                                                                                       |
| Windows          | Metal windows with timber window                                                                                                                  |                                                                                       |
| Ceiling Void     | Inaccessible, Unable to Investigate because of Unsafe Access                                                                                      |                                                                                       |
| Cavities         | No Cavities Present in Room/location                                                                                                              |                                                                                       |
| Risers           | Inaccessible, Unable to Investigate because of Unsafe Access                                                                                      |                                                                                       |
| Ducting          | No Ducting Present in Room/location                                                                                                               |                                                                                       |
| Pipework         | Accessible, Metal                                                                                                                                 |                                                                                       |
| Boxing           | No Boxing Present in Room/location                                                                                                                |                                                                                       |
| Comments         | Listed and protected location, no damage made to structure or decorative materials. Inspections only made in areas of existing damage.            |                                                                                       |

## 9.0 General Construction Materials Register Continued

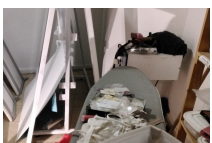
### 02 - Second Floor

| 015 - Store Room |                                                                                                                                                   |                                                                                     |
|------------------|---------------------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------|
| Element          | Material                                                                                                                                          | Photograph                                                                          |
| Ceiling          | Concrete ceiling, steel beams with plaster boxing, metal pipework, metal ducting with modern sealant.                                             |  |
| Walls            | Brick, block and plaster walls, metal pipework, timber skirting boards, modern electrics, timber and plasterboard partition walls, metal conduit. |                                                                                     |
| Floor            | Concrete floor, x1 vinyl floor tiles, x1 lino floor covering.                                                                                     |                                                                                     |
| Doors            | Timber door and casing, timber door header panels.                                                                                                |                                                                                     |
| Windows          | Metal windows with timber window                                                                                                                  |                                                                                     |
| Ceiling Void     | Inaccessible, Unable to Investigate because of Unsafe Access                                                                                      |                                                                                     |
| Cavities         | No Cavities Present in Room/location                                                                                                              |                                                                                     |
| Risers           | Inaccessible, Unable to Investigate because of Unsafe Access                                                                                      |                                                                                     |
| Ducting          | No Ducting Present in Room/location                                                                                                               |                                                                                     |
| Pipework         | Accessible, Metal                                                                                                                                 |                                                                                     |
| Boxing           | No Boxing Present in Room/location                                                                                                                |                                                                                     |
| Comments         | Listed and protected location, no damage made to structure or decorative materials. Inspections only made in areas of existing damage.            |                                                                                     |

### 02 - Second Floor

| 016 - Store Room |                                                                                                                                                   |                                                                                      |
|------------------|---------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------|
| Element          | Material                                                                                                                                          | Photograph                                                                           |
| Ceiling          | Concrete ceiling, steel beams with plaster boxing, metal pipework, metal ducting with modern sealant.                                             |  |
| Walls            | Brick, block and plaster walls, metal pipework, timber skirting boards, modern electrics, timber and plasterboard partition walls, metal conduit. |                                                                                      |
| Floor            | Concrete floor, x1 vinyl floor tiles, x1 lino floor covering.                                                                                     |                                                                                      |
| Doors            | Timber door and casing, timber door header panels.                                                                                                |                                                                                      |
| Windows          | Metal windows with timber window                                                                                                                  |                                                                                      |
| Ceiling Void     | Inaccessible, Unable to Investigate because of Unsafe Access                                                                                      |                                                                                      |
| Cavities         | No Cavities Present in Room/location                                                                                                              |                                                                                      |
| Risers           | Inaccessible, Unable to Investigate because of Unsafe Access                                                                                      |                                                                                      |
| Ducting          | No Ducting Present in Room/location                                                                                                               |                                                                                      |
| Pipework         | Accessible, Metal                                                                                                                                 |                                                                                      |
| Boxing           | No Boxing Present in Room/location                                                                                                                |                                                                                      |
| Comments         | Listed and protected location, no damage made to structure or decorative materials. Inspections only made in areas of existing damage.            |                                                                                      |

### 02 - Second Floor

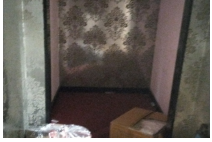
| 017 - Store Room |                                                                                                                                        |                                                                                       |
|------------------|----------------------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------|
| Element          | Material                                                                                                                               | Photograph                                                                            |
| Ceiling          | Concrete ceiling, steel beams with plaster boxing, metal pipework, metal suspended ceiling grid.                                       |  |
| Walls            | Brick, block and plaster walls, metal pipework, timber skirting boards, timber partition walls.                                        |                                                                                       |
| Floor            | Concrete floor, modern vinyl floor tiles                                                                                               |                                                                                       |
| Doors            | Timber door and casing, timber door header panels.                                                                                     |                                                                                       |
| Windows          | None within location                                                                                                                   |                                                                                       |
| Ceiling Void     | Inaccessible, Unable to Investigate because of Unsafe Access                                                                           |                                                                                       |
| Cavities         | No Cavities Present in Room/location                                                                                                   |                                                                                       |
| Risers           | Inaccessible, Unable to Investigate because of Unsafe Access                                                                           |                                                                                       |
| Ducting          | No Ducting Present in Room/location                                                                                                    |                                                                                       |
| Pipework         | Accessible, Metal                                                                                                                      |                                                                                       |
| Boxing           | No Boxing Present in Room/location                                                                                                     |                                                                                       |
| Comments         | Listed and protected location, no damage made to structure or decorative materials. Inspections only made in areas of existing damage. |                                                                                       |

## 9.0 General Construction Materials Register Continued

### 02 - Second Floor

| 018 - Store Room |                                                                                                                                        |                                                                                     |
|------------------|----------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------|
| Element          | Material                                                                                                                               | Photograph                                                                          |
| Ceiling          | Concrete ceiling, steel beams with plaster boxing, metal pipework.                                                                     |  |
| Walls            | Brick,block and plaster walls, metal pipework, timber skirting boards, partition wall                                                  |                                                                                     |
| Floor            | Concrete floor, modern vinyl floor tiles                                                                                               |                                                                                     |
| Doors            | Timber door and casing, timber door header panels.                                                                                     |                                                                                     |
| Windows          | None within location                                                                                                                   |                                                                                     |
| Ceiling Void     | Inaccessible, Unable to Investigate because of Unsafe Access                                                                           |                                                                                     |
| Cavities         | No Cavities Present in Room/location                                                                                                   |                                                                                     |
| Risers           | Inaccessible, Unable to Investigate because of Unsafe Access                                                                           |                                                                                     |
| Ducting          | No Ducting Present in Room/location                                                                                                    |                                                                                     |
| Pipework         | Accessible, Metal                                                                                                                      |                                                                                     |
| Boxing           | No Boxing Present in Room/location                                                                                                     |                                                                                     |
| Comments         | Listed and protected location, no damage made to structure or decorative materials. Inspections only made in areas of existing damage. |                                                                                     |

### 02 - Second Floor

| 019 - Changing Rooms |                                                                                                                                                     |                                                                                      |
|----------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------|
| Element              | Material                                                                                                                                            | Photograph                                                                           |
| Ceiling              | Concrete ceiling, steel beams with plaster boxing, metal pipework, metal ducting with modern silicone seals, metal and mmmf suspended ceiling grid. |  |
| Walls                | Brick,block and plaster walls, plasterboard and timber partition walls, timber skirting boards.                                                     |                                                                                      |
| Floor                | Concrete floor, x1 modern floor tiles, carpet floor covering.                                                                                       |                                                                                      |
| Doors                | Timber door and casing.                                                                                                                             |                                                                                      |
| Windows              | Metal windows with timber window                                                                                                                    |                                                                                      |
| Ceiling Void         | Inaccessible, Unable to Investigate because of Unsafe Access                                                                                        |                                                                                      |
| Cavities             | No Cavities Present in Room/location                                                                                                                |                                                                                      |
| Risers               | Inaccessible, Unable to Investigate because of Unsafe Access                                                                                        |                                                                                      |
| Ducting              | No Ducting Present in Room/location                                                                                                                 |                                                                                      |
| Pipework             | Accessible, Metal                                                                                                                                   |                                                                                      |
| Boxing               | No Boxing Present in Room/location                                                                                                                  |                                                                                      |

### 02 - Second Floor

| 020 - Store Room |                                                                                                 |                                                                                       |
|------------------|-------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------|
| Element          | Material                                                                                        | Photograph                                                                            |
| Ceiling          | Concrete ceiling, steel beams with plaster boxing, metal pipework.                              |  |
| Walls            | Brick,block and plaster walls, plasterboard and timber partition walls, timber skirting boards. |                                                                                       |
| Floor            | Concrete floor, x1 modern floor tiles, carpet floor covering.                                   |                                                                                       |
| Doors            | Timber door and casing.                                                                         |                                                                                       |
| Windows          | Metal windows with timber window                                                                |                                                                                       |
| Ceiling Void     | Inaccessible, Unable to Investigate because of Unsafe Access                                    |                                                                                       |
| Cavities         | No Cavities Present in Room/location                                                            |                                                                                       |
| Risers           | Inaccessible, Unable to Investigate because of Unsafe Access                                    |                                                                                       |
| Ducting          | No Ducting Present in Room/location                                                             |                                                                                       |
| Pipework         | Accessible, Metal                                                                               |                                                                                       |
| Boxing           | No Boxing Present in Room/location                                                              |                                                                                       |

## 9.0 General Construction Materials Register Continued

### 02 - Second Floor

| 021 - Changing Rooms |                                                                                                                                                     |                                                                                     |
|----------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------|
| Element              | Material                                                                                                                                            | Photograph                                                                          |
| Ceiling              | Concrete ceiling, steel beams with plaster boxing, metal pipework, metal ducting with modern silicone seals, metal and mmmf suspended ceiling grid. |  |
| Walls                | Brick,block and plaster walls, plasterboard and timber partition walls, timber skirting boards.                                                     |                                                                                     |
| Floor                | Concrete floor, x1 modern floor tiles, carpet floor covering.                                                                                       |                                                                                     |
| Doors                | Timber door and casing.                                                                                                                             |                                                                                     |
| Windows              | Metal windows with timber window                                                                                                                    |                                                                                     |
| Ceiling Void         | Inaccessible, Unable to Investigate because of Unsafe Access                                                                                        |                                                                                     |
| Cavities             | No Cavities Present in Room/location                                                                                                                |                                                                                     |
| Risers               | Inaccessible, Unable to Investigate because of Unsafe Access                                                                                        |                                                                                     |
| Ducting              | No Ducting Present in Room/location                                                                                                                 |                                                                                     |
| Pipework             | Accessible, Metal                                                                                                                                   |                                                                                     |
| Boxing               | No Boxing Present in Room/location                                                                                                                  |                                                                                     |

### 02 - Second Floor

| 022 - Changing Rooms |                                                                                                                                                     |                                                                                     |
|----------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------|
| Element              | Material                                                                                                                                            | Photograph                                                                          |
| Ceiling              | Concrete ceiling, steel beams with plaster boxing, metal pipework, metal ducting with modern silicone seals, metal and mmmf suspended ceiling grid. |  |
| Walls                | Brick,block and plaster walls, plasterboard and timber partition walls, timber skirting boards.                                                     |                                                                                     |
| Floor                | Concrete floor, x1 modern floor tiles, carpet floor covering.                                                                                       |                                                                                     |
| Doors                | Timber door and casing.                                                                                                                             |                                                                                     |
| Windows              | Metal windows with timber window                                                                                                                    |                                                                                     |
| Ceiling Void         | Inaccessible, Unable to Investigate because of Unsafe Access                                                                                        |                                                                                     |
| Cavities             | No Cavities Present in Room/location                                                                                                                |                                                                                     |
| Risers               | Inaccessible, Unable to Investigate because of Unsafe Access                                                                                        |                                                                                     |
| Ducting              | No Ducting Present in Room/location                                                                                                                 |                                                                                     |
| Pipework             | Accessible, Metal                                                                                                                                   |                                                                                     |
| Boxing               | No Boxing Present in Room/location                                                                                                                  |                                                                                     |

### 02 - Second Floor

| 023 - Stairwell F |                                                                   |                                                                                       |
|-------------------|-------------------------------------------------------------------|---------------------------------------------------------------------------------------|
| Element           | Material                                                          | Photograph                                                                            |
| Ceiling           | Concrete ceiling, steel beams with plaster boxing, metal pipework |  |
| Walls             | Brick,block and plaster walls, metal pipework.                    |                                                                                       |
| Floor             | Concrete floor, vinyl floor tiles, metal and timber stairs.       |                                                                                       |
| Doors             | Timber fire doors and casing.                                     |                                                                                       |
| Windows           | Metal windows with timber.                                        |                                                                                       |
| Ceiling Void      | Inaccessible, Unable to Investigate because of Unsafe Access      |                                                                                       |
| Cavities          | No Cavities Present in Room/location                              |                                                                                       |
| Risers            | Inaccessible, Unable to Investigate because of Unsafe Access      |                                                                                       |
| Ducting           | No Ducting Present in Room/location                               |                                                                                       |
| Pipework          | Accessible, Metal                                                 |                                                                                       |
| Boxing            | No Boxing Present in Room/location                                |                                                                                       |

## 9.0 General Construction Materials Register Continued

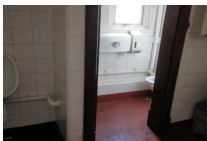
### 02 - Second Floor

| 024 - Office |                                                                                                                                            |                                                                                     |
|--------------|--------------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------|
| Element      | Material                                                                                                                                   | Photograph                                                                          |
| Ceiling      | Concrete ceiling, steel beams with plaster boxing, metal pipework, mmmf suspended ceiling grid.                                            |  |
| Walls        | Brick, block and plaster walls, plasterboard and partition walls, timber skirting boards, metal pipework, timber listed cladding to walls. |                                                                                     |
| Floor        | Concrete floor, carpet floor tile covering with Cork underlay.                                                                             |                                                                                     |
| Doors        | Timber door and casing.                                                                                                                    |                                                                                     |
| Windows      | Metal windows with timber window                                                                                                           |                                                                                     |
| Ceiling Void | Inaccessible, Unable to Investigate because of Unsafe Access                                                                               |                                                                                     |
| Cavities     | No Cavities Present in Room/location                                                                                                       |                                                                                     |
| Risers       | Inaccessible, Unable to Investigate because of Unsafe Access                                                                               |                                                                                     |
| Ducting      | No Ducting Present in Room/location                                                                                                        |                                                                                     |
| Pipework     | Accessible, Metal                                                                                                                          |                                                                                     |
| Boxing       | No Boxing Present in Room/location                                                                                                         |                                                                                     |
| Comments     | Listed and protected location, no damage made to structure or decorative materials. Inspections only made in areas of existing damage.     |                                                                                     |

### 02 - Second Floor

| 025 - Toilet lobby |                                                                                                                                        |                                                                                      |
|--------------------|----------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------|
| Element            | Material                                                                                                                               | Photograph                                                                           |
| Ceiling            | Concrete ceiling, steel beams with plaster boxing, metal pipework, Out of scope                                                        |  |
| Walls              | Brick, block and plaster walls, plasterboard and partition walls, timber skirting boards.                                              |                                                                                      |
| Floor              | Concrete floor, x2 modern lino covering with cork underlay.                                                                            |                                                                                      |
| Doors              | Timber door and casing.                                                                                                                |                                                                                      |
| Windows            | None within location                                                                                                                   |                                                                                      |
| Ceiling Void       | Inaccessible, Unable to Investigate because of Unsafe Access                                                                           |                                                                                      |
| Cavities           | No Cavities Present in Room/location                                                                                                   |                                                                                      |
| Risers             | Inaccessible, Unable to Investigate because of Unsafe Access                                                                           |                                                                                      |
| Ducting            | No Ducting Present in Room/location                                                                                                    |                                                                                      |
| Pipework           | Accessible, Metal                                                                                                                      |                                                                                      |
| Boxing             | No Boxing Present in Room/location                                                                                                     |                                                                                      |
| Comments           | Listed and protected location, no damage made to structure or decorative materials. Inspections only made in areas of existing damage. |                                                                                      |

### 02 - Second Floor

| 026 - Male Toilets |                                                                                                                                                                           |                                                                                       |
|--------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------|
| Element            | Material                                                                                                                                                                  | Photograph                                                                            |
| Ceiling            | Concrete ceiling, steel beams with plaster boxing, metal pipework, Out of scope                                                                                           |  |
| Walls              | Brick, block and plaster walls, ceramic tiles, timber skirting boards, metal and plastic pipework, ceramic cisterns and urinal, plastic toilet seat, modern water heater. |                                                                                       |
| Floor              | Concrete floor, ceramic tiled floor                                                                                                                                       |                                                                                       |
| Doors              | Timber door and casing.                                                                                                                                                   |                                                                                       |
| Windows            | Metal windows with timber window                                                                                                                                          |                                                                                       |
| Ceiling Void       | Inaccessible, Unable to Investigate because of Unsafe Access                                                                                                              |                                                                                       |
| Cavities           | No Cavities Present in Room/location                                                                                                                                      |                                                                                       |
| Risers             | Inaccessible, Unable to Investigate because of Unsafe Access                                                                                                              |                                                                                       |
| Ducting            | No Ducting Present in Room/location                                                                                                                                       |                                                                                       |
| Pipework           | Accessible, Metal                                                                                                                                                         |                                                                                       |
| Boxing             | No Boxing Present in Room/location                                                                                                                                        |                                                                                       |
| Comments           | Listed and protected location, no damage made to structure or decorative materials. Inspections only made in areas of existing damage.                                    |                                                                                       |

## 9.0 General Construction Materials Register Continued

### 02 - Second Floor

| 027 - Office |                                                                                                                                                                |                                                                                     |
|--------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------|
| Element      | Material                                                                                                                                                       | Photograph                                                                          |
| Ceiling      | Concrete ceiling, steel beams with plaster boxing, metal pipework, mmmf suspended ceiling grid.                                                                |  |
| Walls        | Brick, block and plaster walls, plasterboard and partition walls, timber skirting boards with timber packers, metal pipework, timber listed cladding to walls. |                                                                                     |
| Floor        | Concrete floor, carpet floor tile covering with Cork underlay.                                                                                                 |                                                                                     |
| Doors        | Timber door and casing with timber packers.                                                                                                                    |                                                                                     |
| Windows      | Metal windows with timber window                                                                                                                               |                                                                                     |
| Ceiling Void | Inaccessible, Unable to Investigate because of Unsafe Access                                                                                                   |                                                                                     |
| Cavities     | No Cavities Present in Room/location                                                                                                                           |                                                                                     |
| Risers       | Inaccessible, Unable to Investigate because of Unsafe Access                                                                                                   |                                                                                     |
| Ducting      | No Ducting Present in Room/location                                                                                                                            |                                                                                     |
| Pipework     | Accessible, Metal                                                                                                                                              |                                                                                     |
| Boxing       | No Boxing Present in Room/location                                                                                                                             |                                                                                     |

### 02 - Second Floor

| 028 - Office |                                                                                                                                                                    |                                                                                      |
|--------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------|
| Element      | Material                                                                                                                                                           | Photograph                                                                           |
| Ceiling      | Concrete ceiling, steel beams with plaster boxing, metal pipework, modern heater.                                                                                  |  |
| Walls        | Brick, block and plaster walls, plasterboard and partition walls, timber skirting boards, metal pipework, timber listed cladding to walls, listed boxing to walls. |                                                                                      |
| Floor        | Concrete floor, carpet floor tile covering with Cork underlay.                                                                                                     |                                                                                      |
| Doors        | Timber door and casing.                                                                                                                                            |                                                                                      |
| Windows      | Metal windows with timber window                                                                                                                                   |                                                                                      |
| Ceiling Void | Inaccessible, Unable to Investigate because of Unsafe Access                                                                                                       |                                                                                      |
| Cavities     | No Cavities Present in Room/location                                                                                                                               |                                                                                      |
| Risers       | Inaccessible, Unable to Investigate because of Unsafe Access                                                                                                       |                                                                                      |
| Ducting      | No Ducting Present in Room/location                                                                                                                                |                                                                                      |
| Pipework     | Accessible, Metal                                                                                                                                                  |                                                                                      |
| Boxing       | No Boxing Present in Room/location                                                                                                                                 |                                                                                      |
| Comments     | Listed and protected location, no damage made to structure or decorative materials. Inspections only made in areas of existing damage.                             |                                                                                      |

### 02 - Second Floor

| 029 - Office |                                                                                                                                            |                                                                                       |
|--------------|--------------------------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------|
| Element      | Material                                                                                                                                   | Photograph                                                                            |
| Ceiling      | Concrete ceiling, steel beams with plaster boxing, metal pipework.                                                                         |  |
| Walls        | Brick, block and plaster walls, plasterboard and partition walls, timber skirting boards, metal pipework, timber listed cladding to walls. |                                                                                       |
| Floor        | Concrete floor, carpet floor tile covering with Cork underlay.                                                                             |                                                                                       |
| Doors        | Timber door and casing.                                                                                                                    |                                                                                       |
| Windows      | Metal windows with timber window                                                                                                           |                                                                                       |
| Ceiling Void | Inaccessible, Unable to Investigate because of Unsafe Access                                                                               |                                                                                       |
| Cavities     | No Cavities Present in Room/location                                                                                                       |                                                                                       |
| Risers       | Inaccessible, Unable to Investigate because of Unsafe Access                                                                               |                                                                                       |
| Ducting      | No Ducting Present in Room/location                                                                                                        |                                                                                       |
| Pipework     | Accessible, Metal                                                                                                                          |                                                                                       |
| Boxing       | No Boxing Present in Room/location                                                                                                         |                                                                                       |
| Comments     | Listed and protected location, no damage made to structure or decorative materials. Inspections only made in areas of existing damage.     |                                                                                       |

## 9.0 General Construction Materials Register Continued

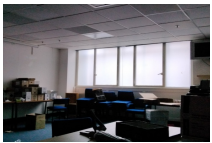
### 02 - Second Floor

| 030 - Office |                                                                                                                                            |                                                                                     |
|--------------|--------------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------|
| Element      | Material                                                                                                                                   | Photograph                                                                          |
| Ceiling      | Concrete ceiling, steel beams with plaster boxing, metal pipework, mmmf suspended ceiling grid, air handling metal ducting.                |  |
| Walls        | Brick, block and plaster walls, plasterboard and partition walls, timber skirting boards, metal pipework, timber listed cladding to walls. |                                                                                     |
| Floor        | Concrete floor, carpet floor tile covering with Cork underlay.                                                                             |                                                                                     |
| Doors        | Timber door and casing.                                                                                                                    |                                                                                     |
| Windows      | Metal windows with timber window                                                                                                           |                                                                                     |
| Ceiling Void | Inaccessible, Unable to Investigate because of Unsafe Access                                                                               |                                                                                     |
| Cavities     | No Cavities Present in Room/location                                                                                                       |                                                                                     |
| Risers       | Inaccessible, Unable to Investigate because of Unsafe Access                                                                               |                                                                                     |
| Ducting      | No Ducting Present in Room/location                                                                                                        |                                                                                     |
| Pipework     | Accessible, Metal                                                                                                                          |                                                                                     |
| Boxing       | No Boxing Present in Room/location                                                                                                         |                                                                                     |
| Comments     | Listed and protected location, no damage made to structure or decorative materials. Inspections only made in areas of existing damage.     |                                                                                     |

### 02 - Second Floor

| 031 - Locker Room |                                                                                                                                                                               |                                                                                      |
|-------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------|
| Element           | Material                                                                                                                                                                      | Photograph                                                                           |
| Ceiling           | Concrete ceiling, steel beams with plaster boxing, metal pipework, metal air handling ducting, mmmf insulation to metal ducting.                                              |  |
| Walls             | Brick, block and plaster walls, plasterboard and partition walls, timber skirting boards, metal pipework, timber listed cladding to walls, no access to concealed lift shaft. |                                                                                      |
| Floor             | Concrete floor, ceramic tiles, carpet floor covering.                                                                                                                         |                                                                                      |
| Doors             | Timber door and casing.                                                                                                                                                       |                                                                                      |
| Windows           | Metal windows with timber window                                                                                                                                              |                                                                                      |
| Ceiling Void      | Inaccessible, Unable to Investigate because of Unsafe Access                                                                                                                  |                                                                                      |
| Cavities          | No Cavities Present in Room/location                                                                                                                                          |                                                                                      |
| Risers            | Inaccessible, Unable to Investigate because of Unsafe Access                                                                                                                  |                                                                                      |
| Ducting           | No Ducting Present in Room/location                                                                                                                                           |                                                                                      |
| Pipework          | Accessible, Metal                                                                                                                                                             |                                                                                      |
| Boxing            | No Boxing Present in Room/location                                                                                                                                            |                                                                                      |
| Comments          | Listed and protected location, no damage made to structure or decorative materials. Inspections only made in areas of existing damage.                                        |                                                                                      |

### 02 - Second Floor

| 032 - Staff room |                                                                                                                                            |                                                                                       |
|------------------|--------------------------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------|
| Element          | Material                                                                                                                                   | Photograph                                                                            |
| Ceiling          | Concrete ceiling, steel beams with plaster boxing, metal pipework, mmmf suspended ceiling grid, air handling metal ducting.                |  |
| Walls            | Brick, block and plaster walls, plasterboard and partition walls, timber skirting boards, metal pipework, timber listed cladding to walls. |                                                                                       |
| Floor            | Concrete floor, carpet floor tiles                                                                                                         |                                                                                       |
| Doors            | Timber door and casing.                                                                                                                    |                                                                                       |
| Windows          | Metal windows with timber window                                                                                                           |                                                                                       |
| Ceiling Void     | Inaccessible, Unable to Investigate because of Unsafe Access                                                                               |                                                                                       |
| Cavities         | No Cavities Present in Room/location                                                                                                       |                                                                                       |
| Risers           | Inaccessible, Unable to Investigate because of Unsafe Access                                                                               |                                                                                       |
| Ducting          | No Ducting Present in Room/location                                                                                                        |                                                                                       |
| Pipework         | Accessible, Metal                                                                                                                          |                                                                                       |
| Boxing           | No Boxing Present in Room/location                                                                                                         |                                                                                       |
| Comments         | Listed and protected location, no damage made to structure or decorative materials. Inspections only made in areas of existing damage.     |                                                                                       |

## 9.0 General Construction Materials Register Continued

### 02 - Second Floor

| 033 - Office |                                                                                                                                        |                                                                                     |
|--------------|----------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------|
| Element      | Material                                                                                                                               | Photograph                                                                          |
| Ceiling      | Concrete ceiling, steel beams with plaster boxing, metal pipework                                                                      |  |
| Walls        | Brick, block and plaster walls, plasterboard and partition walls, timber skirting boards with timber packers, metal pipework.          |                                                                                     |
| Floor        | Concrete floor, carpet floor tile covering, vinyl tile floor covering.                                                                 |                                                                                     |
| Doors        | Timber doors and casing with timber packers.                                                                                           |                                                                                     |
| Windows      | None within location                                                                                                                   |                                                                                     |
| Ceiling Void | Inaccessible, Unable to Investigate because of Unsafe Access                                                                           |                                                                                     |
| Cavities     | No Cavities Present in Room/location                                                                                                   |                                                                                     |
| Risers       | Inaccessible, Unable to Investigate because of Unsafe Access                                                                           |                                                                                     |
| Ducting      | No Ducting Present in Room/location                                                                                                    |                                                                                     |
| Pipework     | Accessible, Metal                                                                                                                      |                                                                                     |
| Boxing       | No Boxing Present in Room/location                                                                                                     |                                                                                     |
| Comments     | Listed and protected location, no damage made to structure or decorative materials. Inspections only made in areas of existing damage. |                                                                                     |

### 02 - Second Floor

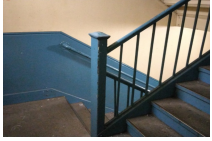
| 034 - Office |                                                                                                                                        |                                                                                      |
|--------------|----------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------|
| Element      | Material                                                                                                                               | Photograph                                                                           |
| Ceiling      | Concrete ceiling, steel beams with plaster boxing, metal pipework                                                                      |  |
| Walls        | Brick, block and plaster walls, plasterboard and partition walls, timber skirting boards with timber packers, metal pipework.          |                                                                                      |
| Floor        | Concrete floor, carpet floor tile covering, vinyl tile floor covering.                                                                 |                                                                                      |
| Doors        | Timber door and casing with timber packers.                                                                                            |                                                                                      |
| Windows      | None within location                                                                                                                   |                                                                                      |
| Ceiling Void | Inaccessible, Unable to Investigate because of Unsafe Access                                                                           |                                                                                      |
| Cavities     | No Cavities Present in Room/location                                                                                                   |                                                                                      |
| Risers       | Inaccessible, Unable to Investigate because of Unsafe Access                                                                           |                                                                                      |
| Ducting      | No Ducting Present in Room/location                                                                                                    |                                                                                      |
| Pipework     | Accessible, Metal                                                                                                                      |                                                                                      |
| Boxing       | No Boxing Present in Room/location                                                                                                     |                                                                                      |
| Comments     | Listed and protected location, no damage made to structure or decorative materials. Inspections only made in areas of existing damage. |                                                                                      |

### 02 - Second Floor

| 035 - Store Room |                                                                                                                               |                                                                                       |
|------------------|-------------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------|
| Element          | Material                                                                                                                      | Photograph                                                                            |
| Ceiling          | Concrete ceiling, steel beams with plaster boxing, metal pipework                                                             |  |
| Walls            | Brick, block and plaster walls, plasterboard and partition walls, timber skirting boards with timber packers, metal pipework. |                                                                                       |
| Floor            | Concrete floor, carpet floor tile covering, vinyl tile floor covering.                                                        |                                                                                       |
| Doors            | Timber door and casing with timber packers.                                                                                   |                                                                                       |
| Windows          | None within location                                                                                                          |                                                                                       |
| Ceiling Void     | Inaccessible, Unable to Investigate because of Unsafe Access                                                                  |                                                                                       |
| Cavities         | No Cavities Present in Room/location                                                                                          |                                                                                       |
| Risers           | Inaccessible, Unable to Investigate because of Unsafe Access                                                                  |                                                                                       |
| Ducting          | No Ducting Present in Room/location                                                                                           |                                                                                       |
| Pipework         | Accessible, Metal                                                                                                             |                                                                                       |
| Boxing           | No Boxing Present in Room/location                                                                                            |                                                                                       |

## 9.0 General Construction Materials Register Continued

### 02 - Second Floor

| 036 - Stairwell G |                                                                               |                                                                                     |
|-------------------|-------------------------------------------------------------------------------|-------------------------------------------------------------------------------------|
| Element           | Material                                                                      | Photograph                                                                          |
| Ceiling           | Metal underside of stairs                                                     |  |
| Walls             | Brick, block and plaster walls, metal pipework, listed timber skirting boards |                                                                                     |
| Floor             | Concrete floor, lino floor covering                                           |                                                                                     |
| Doors             | Timber fire doors and casing, plasterboard door header panel.                 |                                                                                     |
| Windows           | None within location                                                          |                                                                                     |
| Ceiling Void      | Inaccessible, Unable to Investigate because of Unsafe Access                  |                                                                                     |
| Cavities          | No Cavities Present in Room/location                                          |                                                                                     |
| Risers            | Inaccessible, Unable to Investigate because of Unsafe Access                  |                                                                                     |
| Ducting           | No Ducting Present in Room/location                                           |                                                                                     |
| Pipework          | Accessible, Metal                                                             |                                                                                     |
| Boxing            | No Boxing Present in Room/location                                            |                                                                                     |

### 02 - Second Floor

| 037 - Riser  |                                                                             |                                                                                     |
|--------------|-----------------------------------------------------------------------------|-------------------------------------------------------------------------------------|
| Element      | Material                                                                    | Photograph                                                                          |
| Ceiling      | Open riser                                                                  |  |
| Walls        | Brick and block walls, metal brackets, metal pipework with foam insulation. |                                                                                     |
| Floor        | Open riser                                                                  |                                                                                     |
| Doors        | Timber door and casing                                                      |                                                                                     |
| Windows      | None within location                                                        |                                                                                     |
| Ceiling Void | Inaccessible, Unable to Investigate because of Unsafe Access                |                                                                                     |
| Cavities     | No Cavities Present in Room/location                                        |                                                                                     |
| Risers       | Inaccessible, Unable to Investigate because of Unsafe Access                |                                                                                     |
| Ducting      | No Ducting Present in Room/location                                         |                                                                                     |
| Pipework     | Accessible, Metal                                                           |                                                                                     |
| Boxing       | No Boxing Present in Room/location                                          |                                                                                     |
| Comments     | To be removed by a LARC                                                     |                                                                                     |

### 02 - Second Floor

| 038 - Circulation |                                                                                                                               |                                                                                       |
|-------------------|-------------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------|
| Element           | Material                                                                                                                      | Photograph                                                                            |
| Ceiling           | Concrete ceiling, steel beams with plaster boxing, metal pipework with mmmf insulation, metal suspended ceiling grid          |  |
| Walls             | Brick, block and plaster walls, plasterboard and partition walls, timber skirting boards with timber packers, metal pipework. |                                                                                       |
| Floor             | Concrete floor, carpet floor tile covering, vinyl tile floor covering.                                                        |                                                                                       |
| Doors             | Timber door and casing with timber packers.                                                                                   |                                                                                       |
| Windows           | None within location                                                                                                          |                                                                                       |
| Ceiling Void      | Inaccessible, Unable to Investigate because of Unsafe Access                                                                  |                                                                                       |
| Cavities          | No Cavities Present in Room/location                                                                                          |                                                                                       |
| Risers            | Inaccessible, Unable to Investigate because of Unsafe Access                                                                  |                                                                                       |
| Ducting           | No Ducting Present in Room/location                                                                                           |                                                                                       |
| Pipework          | Accessible, Metal                                                                                                             |                                                                                       |
| Boxing            | No Boxing Present in Room/location                                                                                            |                                                                                       |

## 9.0 General Construction Materials Register Continued

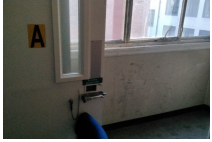
### 02 - Second Floor

| 039 - Lift Circulation |                                                                                                      |                                                                                     |
|------------------------|------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------|
| Element                | Material                                                                                             | Photograph                                                                          |
| Ceiling                | Concrete ceiling, steel beams with plaster boxing, metal pipework with mmmf insulation               |  |
| Walls                  | Brick, block and plaster walls, metal pipework, timber skirting boards, plasterboard partition walls |                                                                                     |
| Floor                  | Concrete floor, modern vinyl floor tiles.                                                            |                                                                                     |
| Doors                  | Timber door and casing, timber door header panels.                                                   |                                                                                     |
| Windows                | None within location                                                                                 |                                                                                     |
| Ceiling Void           | Inaccessible, Unable to Investigate because of Unsafe Access                                         |                                                                                     |
| Cavities               | No Cavities Present in Room/location                                                                 |                                                                                     |
| Risers                 | Inaccessible, Unable to Investigate because of Unsafe Access                                         |                                                                                     |
| Ducting                | No Ducting Present in Room/location                                                                  |                                                                                     |
| Pipework               | Accessible, Metal                                                                                    |                                                                                     |
| Boxing                 | No Boxing Present in Room/location                                                                   |                                                                                     |

### 02 - Second Floor

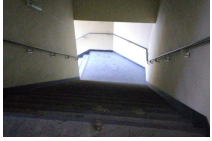
| 040 - Switchroom |                                                                                                      |                                                                                     |
|------------------|------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------|
| Element          | Material                                                                                             | Photograph                                                                          |
| Ceiling          | Concrete ceiling, steel beams with plaster boxing, metal pipework with mmmf insulation               |  |
| Walls            | Brick, block and plaster walls, metal pipework, timber skirting boards, plasterboard partition walls |                                                                                     |
| Floor            | Concrete floor, modern vinyl floor tiles.                                                            |                                                                                     |
| Doors            | Timber door and casing, timber door header panels.                                                   |                                                                                     |
| Windows          | None within location                                                                                 |                                                                                     |
| Ceiling Void     | Inaccessible, Unable to Investigate because of Unsafe Access                                         |                                                                                     |
| Cavities         | No Cavities Present in Room/location                                                                 |                                                                                     |
| Risers           | Inaccessible, Unable to Investigate because of Unsafe Access                                         |                                                                                     |
| Ducting          | No Ducting Present in Room/location                                                                  |                                                                                     |
| Pipework         | Accessible, Metal                                                                                    |                                                                                     |
| Boxing           | No Boxing Present in Room/location                                                                   |                                                                                     |

### 02 - Second Floor

| 042 - Stairwell A Circulation |                                                                   |                                                                                       |
|-------------------------------|-------------------------------------------------------------------|---------------------------------------------------------------------------------------|
| Element                       | Material                                                          | Photograph                                                                            |
| Ceiling                       | Concrete ceiling, steel beams with plaster boxing, metal pipework |  |
| Walls                         | Brick, block and plaster walls, metal pipework.                   |                                                                                       |
| Floor                         | Concrete floor, lino floor covering.                              |                                                                                       |
| Doors                         | Timber fire doors and casing.                                     |                                                                                       |
| Windows                       | Metal windows with timber.                                        |                                                                                       |
| Ceiling Void                  | Inaccessible, Unable to Investigate because of Unsafe Access      |                                                                                       |
| Cavities                      | No Cavities Present in Room/location                              |                                                                                       |
| Risers                        | Inaccessible, Unable to Investigate because of Unsafe Access      |                                                                                       |
| Ducting                       | No Ducting Present in Room/location                               |                                                                                       |
| Pipework                      | Accessible, Metal                                                 |                                                                                       |
| Boxing                        | No Boxing Present in Room/location                                |                                                                                       |

## 9.0 General Construction Materials Register Continued

### 02 - Second Floor

| 043 - Stairwell A |                                                                   |                                                                                     |
|-------------------|-------------------------------------------------------------------|-------------------------------------------------------------------------------------|
| Element           | Material                                                          | Photograph                                                                          |
| Ceiling           | Concrete ceiling, steel beams with plaster boxing, metal pipework |  |
| Walls             | Brick, block and plaster walls, metal pipework.                   |                                                                                     |
| Floor             | Concrete floor, lino floor covering. Composite stair nosing       |                                                                                     |
| Doors             | Timber fire doors and casing.                                     |                                                                                     |
| Windows           | Metal windows with timber.                                        |                                                                                     |
| Ceiling Void      | Inaccessible, Unable to Investigate because of Unsafe Access      |                                                                                     |
| Cavities          | No Cavities Present in Room/location                              |                                                                                     |
| Risers            | Inaccessible, Unable to Investigate because of Unsafe Access      |                                                                                     |
| Ducting           | No Ducting Present in Room/location                               |                                                                                     |
| Pipework          | Accessible, Metal                                                 |                                                                                     |
| Boxing            | No Boxing Present in Room/location                                |                                                                                     |

### 02 - Second Floor

| 044 - Stairwell B Circulation |                                                                   |                                                                                     |
|-------------------------------|-------------------------------------------------------------------|-------------------------------------------------------------------------------------|
| Element                       | Material                                                          | Photograph                                                                          |
| Ceiling                       | Concrete ceiling, steel beams with plaster boxing, metal pipework |  |
| Walls                         | Brick, block and plaster walls, metal pipework.                   |                                                                                     |
| Floor                         | Concrete floor, lino floor covering.                              |                                                                                     |
| Doors                         | Timber fire doors and casing.                                     |                                                                                     |
| Windows                       | Metal windows with timber.                                        |                                                                                     |
| Ceiling Void                  | Inaccessible, Unable to Investigate because of Unsafe Access      |                                                                                     |
| Cavities                      | No Cavities Present in Room/location                              |                                                                                     |
| Risers                        | Inaccessible, Unable to Investigate because of Unsafe Access      |                                                                                     |
| Ducting                       | No Ducting Present in Room/location                               |                                                                                     |
| Pipework                      | Accessible, Metal                                                 |                                                                                     |
| Boxing                        | No Boxing Present in Room/location                                |                                                                                     |

### 02 - Second Floor

| 045 - Stairwell B |                                                                   |                                                                                       |
|-------------------|-------------------------------------------------------------------|---------------------------------------------------------------------------------------|
| Element           | Material                                                          | Photograph                                                                            |
| Ceiling           | Concrete ceiling, steel beams with plaster boxing, metal pipework |  |
| Walls             | Brick, block and plaster walls, metal pipework.                   |                                                                                       |
| Floor             | Concrete floor, lino floor covering. Composite stair nosing       |                                                                                       |
| Doors             | Timber fire doors and casing.                                     |                                                                                       |
| Windows           | Metal windows with timber.                                        |                                                                                       |
| Ceiling Void      | Inaccessible, Unable to Investigate because of Unsafe Access      |                                                                                       |
| Cavities          | No Cavities Present in Room/location                              |                                                                                       |
| Risers            | Inaccessible, Unable to Investigate because of Unsafe Access      |                                                                                       |
| Ducting           | No Ducting Present in Room/location                               |                                                                                       |
| Pipework          | Accessible, Metal                                                 |                                                                                       |
| Boxing            | No Boxing Present in Room/location                                |                                                                                       |

## 9.0 General Construction Materials Register Continued

### 02 - Second Floor

| 046 - Switchroom |                                                                                                                                        |                                                                                     |
|------------------|----------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------|
| Element          | Material                                                                                                                               | Photograph                                                                          |
| Ceiling          | Concrete ceiling, steel beams with plaster boxing, metal pipework.                                                                     |  |
| Walls            | Brick,block and plaster walls, plasterboard partition walls, timber skirting boards, metal electrics, metal conduit.                   |                                                                                     |
| Floor            | Concrete floor, x1 vinyl floor tiles, modern lino floor covering.                                                                      |                                                                                     |
| Doors            | Timber door and casing, timber door header panels.                                                                                     |                                                                                     |
| Windows          | Metal windows with timber window                                                                                                       |                                                                                     |
| Ceiling Void     | Inaccessible, Unable to Investigate because of Unsafe Access                                                                           |                                                                                     |
| Cavities         | No Cavities Present in Room/location                                                                                                   |                                                                                     |
| Risers           | Inaccessible, Unable to Investigate because of Unsafe Access                                                                           |                                                                                     |
| Ducting          | No Ducting Present in Room/location                                                                                                    |                                                                                     |
| Pipework         | Accessible, Metal                                                                                                                      |                                                                                     |
| Boxing           | No Boxing Present in Room/location                                                                                                     |                                                                                     |
| Comments         | Listed and protected location, no damage made to structure or decorative materials. Inspections only made in areas of existing damage. |                                                                                     |

### 02 - Second Floor

| 049 - Lift Lobby |                                                                   |                                                                                     |
|------------------|-------------------------------------------------------------------|-------------------------------------------------------------------------------------|
| Element          | Material                                                          | Photograph                                                                          |
| Ceiling          | Concrete ceiling, steel beams with plaster boxing, metal pipework |  |
| Walls            | Brick,block and plaster walls, plasterboard partition walls       |                                                                                     |
| Floor            | Concrete floor.                                                   |                                                                                     |
| Doors            | Timber door                                                       |                                                                                     |
| Windows          | None within location                                              |                                                                                     |
| Ceiling Void     | Inaccessible, Unable to Investigate because of Unsafe Access      |                                                                                     |
| Cavities         | No Cavities Present in Room/location                              |                                                                                     |
| Risers           | Inaccessible, Unable to Investigate because of Unsafe Access      |                                                                                     |
| Ducting          | No Ducting Present in Room/location                               |                                                                                     |
| Pipework         | Accessible, Metal                                                 |                                                                                     |
| Boxing           | No Boxing Present in Room/location                                |                                                                                     |

### 02 - Second Floor

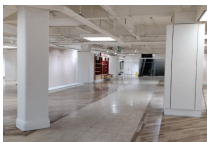
| 050 - Switchroom |                                                                                                                                        |                                                                                       |
|------------------|----------------------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------|
| Element          | Material                                                                                                                               | Photograph                                                                            |
| Ceiling          | Concrete ceiling, steel beams with plaster boxing, metal pipework.                                                                     |  |
| Walls            | Brick,block and plaster walls, plasterboard partition walls, timber skirting boards, metal electrics, metal conduit.                   |                                                                                       |
| Floor            | Concrete floor, x1 vinyl floor tiles, modern lino floor covering.                                                                      |                                                                                       |
| Doors            | Timber door and casing, timber door header panels.                                                                                     |                                                                                       |
| Windows          | None within location                                                                                                                   |                                                                                       |
| Ceiling Void     | Inaccessible, Unable to Investigate because of Unsafe Access                                                                           |                                                                                       |
| Cavities         | No Cavities Present in Room/location                                                                                                   |                                                                                       |
| Risers           | Inaccessible, Unable to Investigate because of Unsafe Access                                                                           |                                                                                       |
| Ducting          | No Ducting Present in Room/location                                                                                                    |                                                                                       |
| Pipework         | Accessible, Metal                                                                                                                      |                                                                                       |
| Boxing           | No Boxing Present in Room/location                                                                                                     |                                                                                       |
| Comments         | Listed and protected location, no damage made to structure or decorative materials. Inspections only made in areas of existing damage. |                                                                                       |

## 9.0 General Construction Materials Register Continued

### 02 - Second Floor

| 051 - Stairwell C |                                                                               |                                                                                     |
|-------------------|-------------------------------------------------------------------------------|-------------------------------------------------------------------------------------|
| Element           | Material                                                                      | Photograph                                                                          |
| Ceiling           | Metal underside of stairs                                                     |  |
| Walls             | Brick, block and plaster walls, metal pipework, listed timber skirting boards |                                                                                     |
| Floor             | Concrete floor, lino floor covering                                           |                                                                                     |
| Doors             | Timber fire doors and casing, plasterboard door header panel.                 |                                                                                     |
| Windows           | None within location                                                          |                                                                                     |
| Ceiling Void      | Inaccessible, Unable to Investigate because of Unsafe Access                  |                                                                                     |
| Cavities          | No Cavities Present in Room/location                                          |                                                                                     |
| Risers            | Inaccessible, Unable to Investigate because of Unsafe Access                  |                                                                                     |
| Ducting           | No Ducting Present in Room/location                                           |                                                                                     |
| Pipework          | Accessible, Metal                                                             |                                                                                     |
| Boxing            | No Boxing Present in Room/location                                            |                                                                                     |

### 02 - Second Floor

| 052 - Main Shop Floor Area |                                                                                                                                                                                                                               |                                                                                     |
|----------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------|
| Element                    | Material                                                                                                                                                                                                                      | Photograph                                                                          |
| Ceiling                    | Concrete ceiling, steel beams with plaster boxing, metal and plastic pipework, modern air handling units, metal and mmmf suspended ceiling grid.                                                                              |  |
| Walls                      | Brick, block and plaster walls, plasterboard and timber partition walls, timber skirting boards inspected where possible, metal electrics, metal conduit, plasterboard and timber partition walls and cladding to escalators. |                                                                                     |
| Floor                      | Concrete floor, mixture of modern lino floor coverings inspected beneath.                                                                                                                                                     |                                                                                     |
| Doors                      | Timber fire doors and casings throughout, timber door header panels.                                                                                                                                                          |                                                                                     |
| Windows                    | Metal windows with timber window                                                                                                                                                                                              |                                                                                     |
| Ceiling Void               | Inaccessible, Unable to Investigate because of Unsafe Access                                                                                                                                                                  |                                                                                     |
| Cavities                   | No Cavities Present in Room/location                                                                                                                                                                                          |                                                                                     |
| Risers                     | Inaccessible, Unable to Investigate because of Unsafe Access                                                                                                                                                                  |                                                                                     |
| Ducting                    | No Ducting Present in Room/location                                                                                                                                                                                           |                                                                                     |
| Pipework                   | Accessible, Metal                                                                                                                                                                                                             |                                                                                     |
| Boxing                     | No Boxing Present in Room/location                                                                                                                                                                                            |                                                                                     |
| Comments                   | Listed and protected location, no damage made to structure or decorative materials. Inspections only made in areas of existing damage.                                                                                        |                                                                                     |

## 10.0 Conclusions and Actions

The report has been produced to assist the Duty Holder/Client in meeting their specific instructions and more generally as part of the Duty to Manage Asbestos (Regulation 4 CAR2012).

The Duty Holder/Client should check the accuracy of this survey report to ensure that it meets their specific requirements. Where ACMs have been identified, please refer to the Executive Summary and Asbestos Register for specific details. Sampling locations and occurrences of ACMs and presumed ACMs identified are depicted on the Site Plan enclosed in Section 8 of this report.

Where ACMs have been identified/presumed, recommendations have been provided based upon the surveyor's observations and levels of risk as determined by the material and priority risk assessments conducted. Please refer to the Executive Summary and asbestos register for details.

The Client/Duty Holder should be aware of the possibility of the presence of ACMs to those areas not accessible at the time of the Survey (please refer to Executive Summary) or Outside the Scope of this Survey. The Client/Duty Holder is advised that this Survey is not the end point in managing asbestos. The Client/Duty Holder is informed that in order to comply with Regulation 3 of the Management of Health & Safety at Work Regulations (as amended) 1999 and Regulation 4 (paragraph 8) of CAR2012 retained ACMs should be supported by:

- "...a determination of the risk..."
- "...a written plan identifying those parts of the premises concerned..."
- "...the measures which are to be taken for managing the risk are specified..."

The Client/Duty Holder is advised to ensure:

- That ACMs identified are brought to the attention of anyone likely to disturb them;
- This report is not used for any Measurement of ACMs or as a Bill of Quantities for abatement work. The report should be used as a reference document only when tendering. All quantities detailed within the Asbestos Survey Report are approximations and should be verified by a competent person;
- Any access/disturbance into areas outside the scope of the Survey Report is precluded by an inspection and testing of any suspect materials by OHS Ltd.

The Client/Duty Holder should now prepare an Asbestos Register/Asbestos Management Plan to encompass all elements of asbestos compliance.

OHS Ltd can assist in all elements of asbestos risk management including the provision of Asbestos Management Plans, Policies, Procedures and Training.

**Please note:** that OHA are fully capable, resourced and insured to assist with the safe and efficient remediation of identified ACMs. We are able to provide a full specification and tendering service, and end to end project management packaged to support planned asbestos abatement works.

### Asbestos Knowledge Chain

OHA have prepared the following Asbestos Knowledge Chain to provide transparency of the process of achieving and maintaining compliance with the CAR2012:



## 10.0 Conclusions and Actions Continued

---

OHS Ltd would be pleased to assist in all the above and on-going compliance. In the first instance, for more details and for support we will be pleased to assist, please contact OHS Ltd on 0330 088 1239 or by email [info@ohs.co.uk](mailto:info@ohs.co.uk) for more details and for support. We will be pleased to assist.

### Assessments

Two types of assessment may be carried out, a Material Assessment and a Priority Assessment. Generally it is not a requirement of Refurbishment or Demolition surveys to assess the condition of material, due to the fact that the material is most likely to be removed. However there is a possibility that materials may be managed for a period of time (Longer than 3 months) before removal and to assist with this OHA have completed Material Assessments within this report.

Should items remain in situ then the priority must be established by carrying out a priority assessment which requires a detailed knowledge of the property. The responsibility for this lies with the duty holder, although OHA can assist with the provision of information or generic assessments where agreed. Further details of these are given in Appendix 1 & 2.

### Recommendations

The recommendations given within this report are categorised as follows:

#### MANAGE

Where asbestos is left in situ **there is a duty to formulate and implement a Management Plan** to help prevent accidental damage occurring and to help prevent accidental exposure.

The basic requirements of this policy are (from L143):

- Keep and maintain an up-to-date record of the location, condition, maintenance and removal of all asbestos-containing materials
- Maintain it in a good state of repair and regularly monitor the condition
- Inform anyone who is likely to disturb it about the location and condition of the material
- Have arrangements and procedures in place, so that work which may disturb the materials complies with the Control of Asbestos Regulations 2012
- Review the plan at regular intervals

*(The monitoring and labelling of asbestos is discussed overleaf and is based on 'A comprehensive guide to managing asbestos in premises' HSG 227).*

**OHA can provide a suitable Management Plan to accompany any asbestos register / survey on request.**

#### Monitoring

The condition of ACMs should be monitored and recorded. The time period between monitoring will vary depending on the type of ACM, its location and the activities in the area concerned, but should not be more than 12 months.

Monitoring would involve a visual inspection, looking for signs of disturbance, scratches, broken edges, cracked or peeling paint and debris.

Where deterioration has occurred, a recommendation on what remedial action to take would need to be made.

#### Labelling

A decision is required on whether to label ACMs. The decision will depend on the confidence in the administration of the asbestos management system and whether communication with workers and contractors coming to work on site is effective.

Labelling ACMs should not be solely relied on as a control measure; however it is one of the most effective methods of preventing exposure to building occupants (and, in particular, maintenance workers). If, for any reason, management procedures fail, it may act as an effective last barrier to uncontrolled damage to the ACM.

Most ACMs can be marked with an asbestos warning label similar to that shown to the right.

## 10.0 Conclusions and Actions Continued

---

It may not always be prudent or practical to label all installations of asbestos; for example high level items such as roof sheets, flue cowls and soffits or items such as gaskets to pipe flanges, textured coating and floor tiles.

**OHA can provide labels or a labeling service on request.**

### ENCAPSULATE & MANAGE

When this recommendation has been given, the ACM is raw and requires encapsulating with a suitable sealant or the existing sealant or covering has deteriorated and the installation requires either a complete or partial re-encapsulation. Suitable sealants for encapsulation or minor repair work may include the following:

Asbestos insulating board can be treated with an elastomeric paint.

Asbestos cement can be sealed with an alkali resistant and water-permeable sealant. Where asbestos cement roofing has been identified, such as to garages or sheds, it will usually only be necessary to seal the internal surfaces.

Sectional pipe insulation can usually be coated with a calico wrap and then painted over with an elastomeric paint. Minor holes in hard-set thermal insulation can be filled with non-asbestos plaster and if necessary wrapped with calico.

Spray coating can be overlain with strips of calico and painted over with an elastomeric paint.

The following points on sealant materials used in the encapsulation/repair of an installation should be noted:

- The sealant must be adequately fire-rated / resistant to any generated heat
- The sealant must not cause delamination of the product because of the weight increase
- If impermeable paint is used, back painting is required

**We recommend that sealing or painting of damaged insulating board, insulation or coatings should be undertaken by a licensed contractor and is likely to be subject to a 14-day notification to the HSE, (as per the Control of Asbestos Regulations 2012).**

### REMOVE

Where an ACM is damaged, in a position whereby it may be vulnerable to damage or will be disturbed in forthcoming refurbishment/ maintenance works; then a recommendation for removal has been made.

All work with asbestos must be carried out in accordance with the Control of Asbestos Regulations 2012.

### Works with Asbestos Cement

Works on or removal of asbestos cement should be carried out following the guidelines of the HSE within HSG 189/2 Working with Asbestos Cement. Whilst there is no requirement for these works to be carried out by a licensed contractor, in practice it is unlikely that an unlicensed contractor will possess the necessary expertise or insurance to undertake such works properly.

### Works with licensable ACMs

**Work with asbestos insulation, asbestos coating and asbestos insulation board should in most cases be undertaken by a licensed contractor and is likely to be subject to a 14 day notification to the HSE, (as per the Control of Asbestos Regulations 2012). Works should be carried out in accordance to HSG 247 - Asbestos: The licensed contractors guide.**

Items of asbestos debris, residue or dust may require either a localised decontamination of the immediate area adjacent to the identified asbestos or a full decontamination of the room/area.

The exact extent of any asbestos installation or asbestos debris / residue / dust may not always be stated within the survey report. The survey report will also not state which methods of removal/decontamination should be followed and does not represent a Scope/ Specification of Works.

## 10.0 Conclusions and Actions Continued

---

Removal of non-asbestos materials, which are located close to the asbestos source and which are either fibrous or porous by their nature, such as Machine Made Mineral Fibre (MMMF) ceiling tiles or MMMF pipe insulation, may be deemed necessary during the asbestos removal, due to possible contamination before or during the works.

Four-stage clearance involving air monitoring and visual inspections of the affected work area will be required; such procedures should be carried out in accordance to HSG 248 - Asbestos: The analyst's guide for sampling, analysis and clearance procedures.

**Where asbestos debris has been identified, access to these areas should be restricted until such remedial works have been undertaken. If access is required then a further assessment should be undertaken to ascertain the potential for exposure.**

### Works with Notifiable, Non-Licensable ACM

**As of 6 April 2012, work with certain ACM will be classed as Notifiable, Non-Licensed Work (NNLW), depending on material type and work being carried out and the likely hood of fibre release. This work will require notification to the relevant enforcing authority (no minimum notification period); training and medical examinations for staff carrying out the work and health registers kept for this staff if the work is being carried out by non-licensed operatives.**

Works on or removal of such materials should be carried out following the guidelines of the HSE within HSG 210 Asbestos Task Manual. Whilst there is no requirement for these works to be carried out by a licensed contractor, in practice it is unlikely that an unlicensed contractor will possess the necessary expertise or insurance to undertake such works properly.

### SPECIFIC

Specific recommendations may include such options as placing a physical barrier to prevent the accidental disturbance of the ACM, or enclosing the ACM with an airtight barrier.

The following points on enclosing an ACM should be noted:

- Any barriers / enclosing material must be adequately fire-rated / resistant to any generated heat
- An assessment should be made whether access is required to the enclosure for maintenance or repairs

**If the ACM is asbestos insulation, asbestos coating or asbestos insulation board and the enclosure of it is likely to cause disturbance, then the work should in most cases be undertaken by a licensed contractor and is likely to be subject to a 14-day notification to the HSE, (as per the Control of Asbestos Regulations 2012).**

*Further Investigation may be recorded if the results of sample analysis are inconclusive.*

Where a presumed asbestos item is in good condition (and sealed) it may often be prudent to manage the item as asbestos rather than undergo the additional cost of sampling.

Where a presumed asbestos item is in poor condition (and/or unsealed) and requires attention, it may often be prudent to undergo the additional cost of sampling the item first, to ensure that it does contain asbestos, prior to undergoing removal/remediation works.

## Appendix 1 Material Risk Assessment Matrix (HSG264)

The Material Risk Assessment assesses the potential of a material for airborne fibre release. The assessment is usually undertaken at the same time of the survey. The parameters against which each identified hazard is measured are:

- Product Type
- Extent of Damage or any Deterioration
- Surface Treatment
- Asbestos Fibre Type

| Assessment Factor   | Score | Score Variables                                                                                                                                                |
|---------------------|-------|----------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Product type        | 1     | Asbestos Reinforced Composites (Plastics, Resins, Mastics, Roofing Felts, Vinyl Floor Tiles, Semi-Rigid Paints, Decorative Finishes, Asbestos Cement)          |
|                     | 2     | Asbestos Insulating Board (AIB), Millboards, Other Low-Density Insulation Boards, Asbestos Textiles, Gaskets, Ropes, Woven Textiles and Asbestos Paper or Felt |
|                     | 3     | Thermal Insulating (e.g. Pipe and Boiler Lagging) Sprayed Asbestos, Loose Asbestos, Asbestos Mattresses and Packing                                            |
| Extent of Damage    | 0     | Good Condition: No Visible Damage                                                                                                                              |
|                     | 1     | Low Damage: A Few Scratches or Surface Marks. Broken Edges on Boards or Tiles                                                                                  |
|                     | 2     | Medium Damage: Significant Breakage of Material or Several Small Areas where Material has been Damaged Revealing Loose Asbestos Fibre                          |
|                     | 3     | High Damage: Delaminating of Materials, Sprays and Thermal Insulation, Visible Asbestos Debris                                                                 |
| Surface Treatment   | 0     | Composite Materials Containing Asbestos: Reinforced Plastics, Resins, Vinyl Tiles                                                                              |
|                     | 1     | Enclosed Sprays and lagging, AIB with Exposed Face Painted or Encapsulated, Asbestos Cement Sheets etc                                                         |
|                     | 2     | Unsealed AIB or Encapsulated Lagging and Sprays                                                                                                                |
|                     | 3     | Unsealed Lagging and Sprays                                                                                                                                    |
| Asbestos Fibre Type | 1     | Chrysotile (White)                                                                                                                                             |
|                     | 2     | Amphibole Asbestos, Amosite (Brown), Actinolite, Ampholyte, Anthophyllite and Tremolite                                                                        |
|                     | 3     | Crocidolite (Blue)                                                                                                                                             |

| Material Risk Score | Risk Level    |
|---------------------|---------------|
| 10-12               | High Risk     |
| 07-09               | Medium Risk   |
| 05-06               | Low Risk      |
| 02-04               | Very Low Risk |

### High Risk (10-12)

The potential hazard arising from this category warrants urgent action. Immediate plans should be made for the removal/containment of the ACM. If delay in remedial action is likely to occur the affected area should initially be sealed-off and appropriate warning signs posted.

### Medium Risk (07-09)

This category indicates that deterioration in any of the contributory factors may result in fibre release. Therefore all asbestos should be contained/sealed/encapsulated.

### Low Risk (05-07)

This category indicates the need for regular monitoring. Although the current risk of fibre release is low, this material may suffer deterioration through age/local accidental damage.

### Very Low Risk (02-04)

Similarly this category requires regular monitoring. Although the current risk of fibre release is low, this material may suffer deterioration through age/local accidental damage.

## Appendix 2 Priority Risk Assessment Matrix

The Priority Risk Assessment is conducted whenever possible with direct input from the property manager or the Duty Holder. An average score of the likelihood of disturbance scores is added to the average score of the human exposure potential scores and the maintenance activity average score. The sum of those three scores is then added to the normal occupancy score to generate the Priority Risk Assessment Score.

| Assessment Factor                 | Score         | Score Variables                                                                                                |
|-----------------------------------|---------------|----------------------------------------------------------------------------------------------------------------|
| Type of Activity                  |               |                                                                                                                |
| Main Type of Activity in Area     | 0             | Rare Disturbance Activity (e.g. Little used Store Room)                                                        |
|                                   | 1             | Low Disturbance Activities (e.g. Office Type Activity)                                                         |
|                                   | 2             | Periodic Disturbance (e.g. Industrial or Vehicular Activity which may contact ACMs)                            |
|                                   | 3             | High Levels of Disturbance (e.g. Door with AIB Sheeting in Constant Use)                                       |
| Secondary Activity in Area        | As Above      |                                                                                                                |
| Likelihood of Disturbance         |               |                                                                                                                |
| Location                          | 0             | Outdoors                                                                                                       |
|                                   | 1             | Large Rooms or Well Ventilated Areas                                                                           |
|                                   | 2             | Rooms up to 100m <sup>2</sup>                                                                                  |
|                                   | 3             | Confined Spaces                                                                                                |
| Accessibility                     | 0             | Usually Inaccessible or Unlikely to be Disturbed                                                               |
|                                   | 1             | Occasionally Likely to be Disturbed                                                                            |
|                                   | 2             | Easily Disturbed                                                                                               |
|                                   | 3             | Routinely Disturbed                                                                                            |
| Extent/amount                     | 0             | Small Amounts or Items (e.g. Gaskets or Strings)                                                               |
|                                   | 1             | ≤10m <sup>2</sup> or 10m Pipe Run                                                                              |
|                                   | 2             | >10m to 50m Pipe Run                                                                                           |
|                                   | 3             | >50m <sup>2</sup> or >50m Pipe Run                                                                             |
| Human Exposure Potential          |               |                                                                                                                |
| Number of Occupants               | 0             | None                                                                                                           |
|                                   | 1             | 1 to 3                                                                                                         |
|                                   | 2             | 4 to 10                                                                                                        |
|                                   | 3             | > 10                                                                                                           |
| Frequency of Use in Area          | 0             | Infrequent                                                                                                     |
|                                   | 1             | Monthly                                                                                                        |
|                                   | 2             | Weekly                                                                                                         |
|                                   | 3             | Daily                                                                                                          |
| Average Time in Use               | 0             | < 1 Hour                                                                                                       |
|                                   | 1             | >1 to <3 Hours                                                                                                 |
|                                   | 2             | >3 to <6 Hours                                                                                                 |
|                                   | 3             | >6 Hours                                                                                                       |
| Maintenance Activity              |               |                                                                                                                |
| Type of Maintenance Activity      | 0             | Minor Disturbance (e.g. Possibility of Contact when Gaining Access)                                            |
|                                   | 1             | Low Disturbance (e.g. Changing Light Bulbs in AIB Ceiling)                                                     |
|                                   | 2             | Medium Disturbance (e.g. Lifting One or Two AIB Ceiling Tiles to access valves)                                |
|                                   | 3             | High Level of Disturbance (e.g. Removing a Number of AIB Ceiling Tiles to Replace a Valve or Re-cabling Works) |
| Frequency of Maintenance Activity | 0             | ACM Unlikely to be Disturbed for Maintenance                                                                   |
|                                   | 1             | <1 per Year                                                                                                    |
|                                   | 2             | >1 per Year                                                                                                    |
|                                   | 3             | >1 per Month                                                                                                   |
| Priority Risk Score               |               |                                                                                                                |
| 10-12                             | High Risk     |                                                                                                                |
| 07-09                             | Medium Risk   |                                                                                                                |
| 05-06                             | Low Risk      |                                                                                                                |
| 02-04                             | Very Low Risk |                                                                                                                |

## Appendix 2 Priority Risk Assessment Matrix Continued

### High Risk (10-12)

The potential hazard arising from this category warrants urgent action. Immediate plans should be made for the removal/containment of the ACM. If delay in remedial action is likely to occur the affected area should initially be sealed-off and appropriate warning signs posted.

### Medium Risk (07-09)

This category indicates that deterioration in any of the contributory factors may result in fibre release. Therefore all asbestos should be contained/sealed/encapsulated.

### Low Risk (05-07)

This category indicates the need for regular monitoring. Although the current risk of fibre release is low, this material may suffer deterioration through age/local accidental damage.

### Very Low Risk (02-04)

Similarly this category requires regular monitoring. Although the current risk of fibre release is low, this material may suffer deterioration through age/local accidental damage.

## Overall Risk Assessment Matrix

The Material Risk Assessment Score is added to the Priority Risk Assessment Score to determine the Total Risk Score. Factors such as planned maintenance or refurbishment activities may override the risk assessments carried out at the time of survey.

| Total Risk Score | Risk Level    |
|------------------|---------------|
| 20 - 24          | High Risk     |
| 14 - 19          | Medium Risk   |
| 10 - 13          | Low Risk      |
| 04 - 09          | Very Low Risk |

The Total Risk Assessment Algorithm is calculated by adding the Material Risk Assessment Score obtained during the survey to the Priority Risk Assessment Score.

### High Risk (20-24)

The potential hazard arising from this category warrants urgent action. Immediate plans should be made for the removal/containment of the ACM. If delay in remedial action is likely to occur the affected area should initially be sealed-off and appropriate warning signs posted.

### Medium Risk (14-19)

This category indicates that deterioration in any of the contributory factors may result in fibre release. Therefore all asbestos should be contained/sealed/encapsulated.

### Low Risk (10-13)

This category indicates the need for regular monitoring. Although the current risk of fibre release is low, this material may suffer deterioration through age/local accidental damage.

### Very Low Risk (04-09)

Similarly this category requires regular monitoring. Although the current risk of fibre release is low, this material may suffer deterioration through age/local accidental damage.

# Certificate of Sample Analysis Results

| Client Details                                                            |
|---------------------------------------------------------------------------|
| HNC Reclaim Limited                                                       |
| Property Details                                                          |
| Rylands Building (Former Debenhams), Market Street<br>Manchester, M60 1TA |

| Project & Analysis Details |                         |                     |               |
|----------------------------|-------------------------|---------------------|---------------|
| Project Number             | PR355                   | No. of Points       | 13            |
| Batch Number               | MAN-21-272              | Laboratory Location | Manchester    |
| Date(s) Samples Taken      | 11/08/2021 - 16/08/2021 | Date(s) of Analysis | 18/08/2021    |
| No. of Samples             | 18                      | Name of Analyst     | Roopesh Patel |

| Sample Reference | Floor             | Room                 | Specific Location                               | Item Name                                                    | Product Type                                                                          | Asbestos Type*                         | Comment                                  |
|------------------|-------------------|----------------------|-------------------------------------------------|--------------------------------------------------------------|---------------------------------------------------------------------------------------|----------------------------------------|------------------------------------------|
| S086             | 02 - Second Floor | 001 - Refuse Chute   | Floor                                           | Lino floor covering                                          | Other Lino floor covering                                                             | No Asbestos Detected                   |                                          |
| S087             | 02 - Second Floor | 001 - Refuse Chute   | Floor                                           | Vinyl floor tiles - Red                                      | Other Floor Tiles                                                                     | No Asbestos Detected                   |                                          |
| S088             | 02 - Second Floor | 004 - Male Toilets   | Other To windows                                | Mastic seal to windows                                       | Other Encapsulated Material Bituminous Product(s) Mastic(s) and Adhesive(s)           | No Asbestos Detected                   |                                          |
| S089             | 02 - Second Floor | 005 - Circulation    | Floor                                           | Vinyl floor tiles - Beige                                    | Other Floor Tiles                                                                     | No Asbestos Detected                   |                                          |
| S090             | 02 - Second Floor | 006 - Female Toilets | Other Toilet seats                              | Bakelite toilet seats                                        | Other Other Encapsulated Material Reinforced Plastic & Resin Composite(s) Toilet Seat | No Asbestos Detected                   |                                          |
| S091             | 02 - Second Floor | 007 - Family Room    | Floor                                           | Vinyl floor tiles - Black and grey                           | Other Floor Tiles                                                                     | No Asbestos Detected                   |                                          |
| S092             | 02 - Second Floor | 010 - Stairwell D    | Other Insulating board beading to door glazing  | Insulating board beading to door glazing                     | Asbestos Board(s) Insulating Board Panel(s)                                           | Amphibole (exc. Crocidolite) Amosite   |                                          |
| S093             | 02 - Second Floor | 010 - Stairwell D    | Floor                                           | Vinyl floor tiles and bitumen adhesive                       | Other Encapsulated Material Flooring Vinyl Floor Tiles with Adhesive                  | Chrysotile                             | Both tile and bitumen contain chrysotile |
| S094             | 02 - Second Floor | 010 - Stairwell D    | Floor                                           | Stair nosings                                                | Other Other Encapsulated Material Flooring Nosing                                     | No Asbestos Detected                   |                                          |
| S095             | 02 - Second Floor | 011 - Store Room     | Floor                                           | Vinyl floor tiles - Green and beige                          | Other Floor Tiles                                                                     | No Asbestos Detected                   |                                          |
| S096             | 02 - Second Floor | 016 - Store Room     | Other Within fuse boards                        | Flashguards                                                  | Textile(s) Flash Pads to Fuse Box                                                     | Chrysotile                             |                                          |
| S097             | 02 - Second Floor | 024 - Office         | Other To underside of underlay                  | Bitumen adhesive to floor                                    | Other Encapsulated Material Bituminous Product(s) Mastic(s) and Adhesive(s)           | No Asbestos Detected                   |                                          |
| S098             | 02 - Second Floor | 029 - Office         | Other Beneath carpet floor covering             | Beige lino floor covering                                    | Other Lino floor covering                                                             | No Asbestos Detected                   |                                          |
| S099             | 02 - Second Floor | 030 - Office         | Other Mastic seal to ducting with ceiling void. | Mastic seal to ducting                                       | Other Encapsulated Material Bituminous Product(s) Mastic(s) and Adhesive(s)           | Chrysotile                             |                                          |
| S100             | 02 - Second Floor | 032 - Staff room     | Gasket                                          | Gaskets to pipework                                          | Other Encapsulated Material Bituminous Product(s) Mastic(s) and Adhesive(s)           | No Asbestos Detected                   |                                          |
| S101             | 02 - Second Floor | 033 - Office         | Floor                                           | Vinyl floor tiles and adhesive - Beige                       | Other Floor Tiles                                                                     | No Asbestos Detected                   |                                          |
| S102             | 02 - Second Floor | 037 - Riser          | Other To walls and pipework throughout          | Thermal insulation residues to walls and pipework throughout | Insulation Debris/residue                                                             | Crocidolite Chrysotile and Crocidolite |                                          |
| S103             | 02 - Second Floor | 043 - Stairwell A    | Other To windows                                | Stair nosings                                                | Other Encapsulated Material Flooring Nosing                                           | Chrysotile                             |                                          |

OHA is a trading name of OHS Ltd, analysis was carried out in accordance with our documented in-house methods and HSG 248 by Stereo and Polarised Light Microscopy using Dispersion Staining Techniques and is covered by our UKAS accreditation. Samples are retained for not less than 6 months from the date of analysis unless specifically requested.

Where samples are taken by OHA, sampling is carried out in accordance with our documented in-house methods, HSG 248 and HSG 264 and is covered by our OHA accreditation. \*\*Where the sample is not taken by OHA, cannot be responsible for inaccurate or unrepresentative sampling.

Opinions lie outside the scope of our UKAS accreditation. \*When samples are provided for analysis by the client and described as Cement, this is based on the opinions of the analyst completing the analysis. This opinion is not covered by our UKAS accreditation. \*\* When samples have been provided by a third party, OHS cannot validate the sample source or method on which the sample was taken including sample strategy or size submitted for analysis.

Results are reported on sample as seen and received only.



  
Analyst Name  
Roopesh Patel  
18/08/2021 16:24

OHS Ltd  
1st Floor, 2 City Approach, Albert Street, Manchester, M30 0BL  
18/08/2021 16:24 – UID747 SC[000] – PR355  
Page 3 of 3  
002 V1/1 05/02/2021





**Asbestos**

2 City Approach, First Floor, Albert Street  
Eccles, Manchester, M30 0BL  
[info@ohs.co.uk](mailto:info@ohs.co.uk) / [www.ohs.co.uk](http://www.ohs.co.uk)  
Telephone: 0113 350 7820

**HNC Reclaim Limited**

Rylands Building (Former Debenhams)

Market Street  
Manchester, M60 1TA

Project No: PR355/FS486

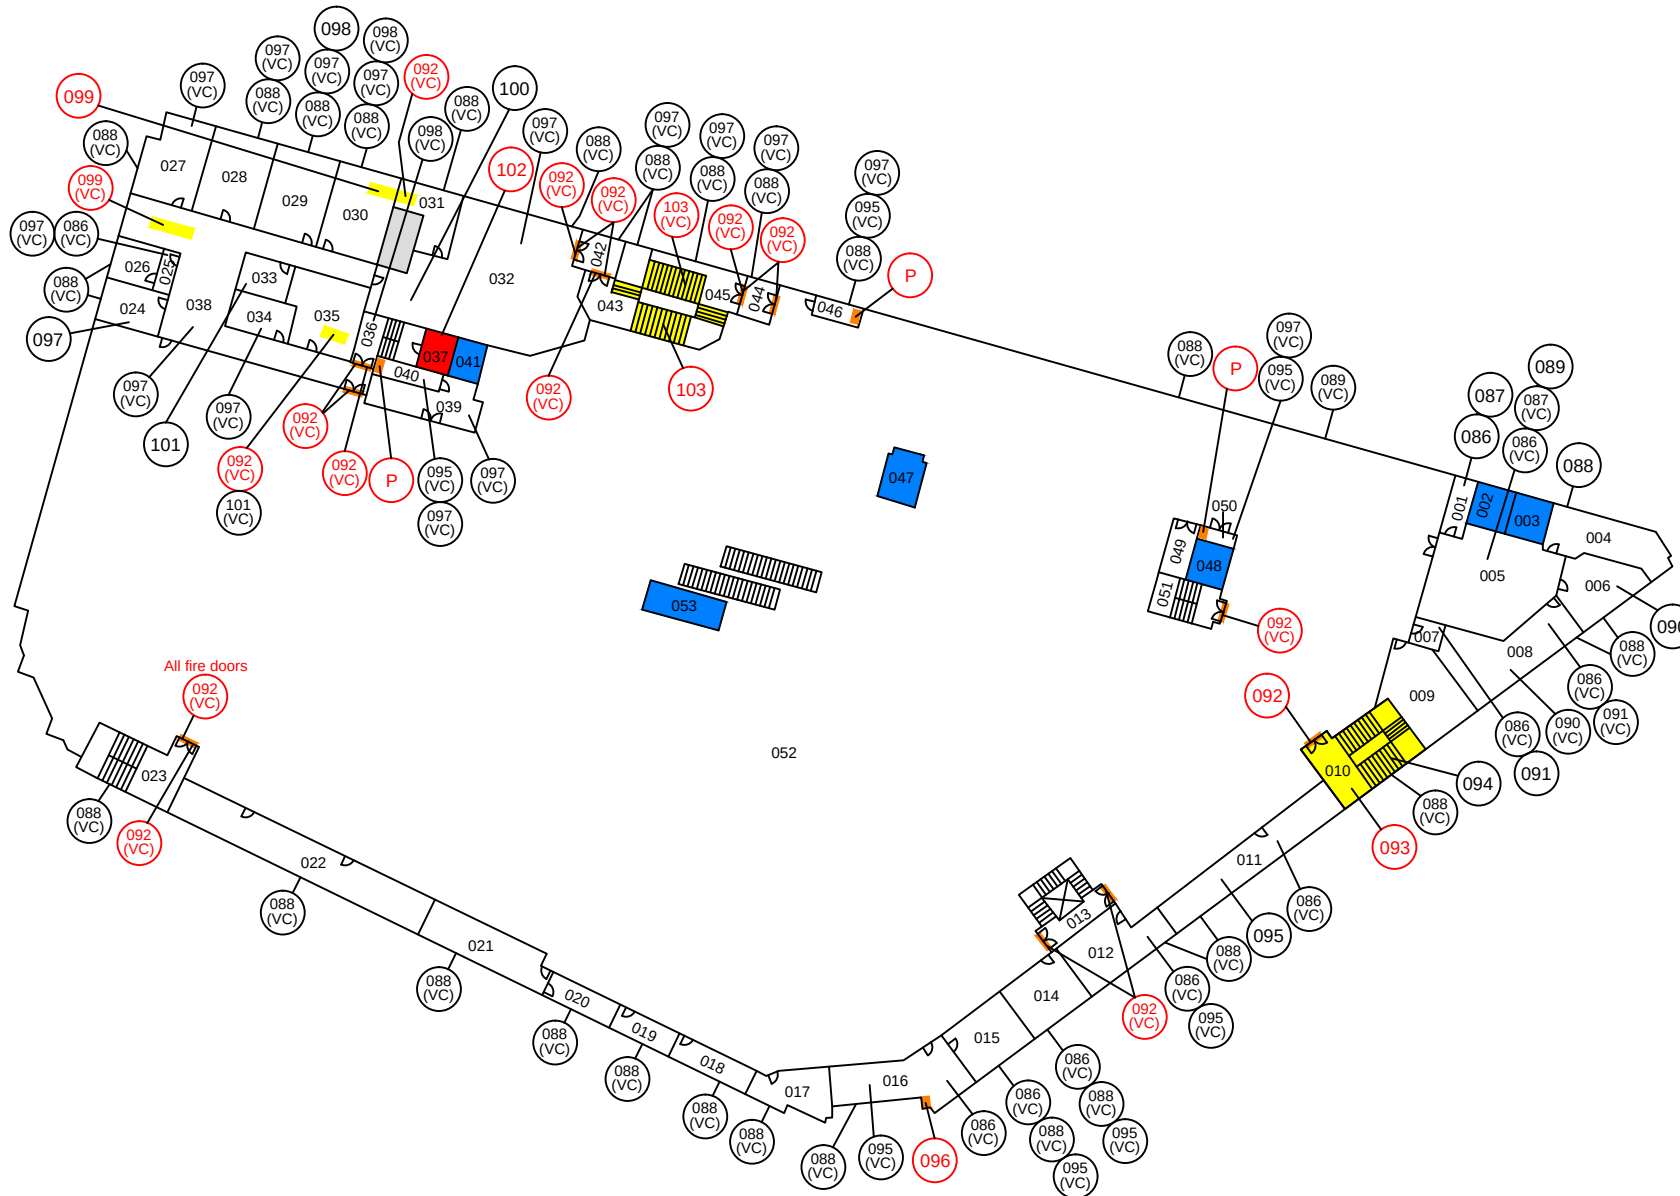
Floor Level: Second

Page No: 1 of 1

**Key**

-  Thermal Insulation (e.g. Pipe & Boiler Lagging) Sprayed Asbestos, Loose Asbestos, Asbestos Mattresses & Packing
-  Asbestos Insulating Board (AIB), Millboards, Insulation Boards, Asbestos Textiles, Gaskets, Ropes, & Asbestos Paper or Felt
-  Asbestos Reinforced Composites (Plastics, Resins, Mastics, Roofing Felts, Vinyl Floor Tiles, Semi-Rigid Paints, Decorative Finishes, Bitumen) & Cement
-  No Access / Limited Access Areas
-  Outside Scope of Survey
-  Scope of Survey
-  Positive Sample Location
-  Positive Visually Consistent Sample Location
-  Strongly Presumed Sample Location
-  Presumed Sample Location
-  Negative Sample Location

This Drawing is for illustration purposes only and should not be used for detailed construction works as the drawing is not to scale and represents layout only. The hatching on the drawing denotes positive asbestos items found during the course of the survey and potential areas where asbestos could be found as those areas were inaccessible at the time the survey was undertaken.



# Appendix C



Your property compliance partner  
**Asbestos Fire Water**

**You're in safe hands**



Your property compliance partner  
**Asbestos Fire Water**

**You're in safe hands**



## HSG264 Asbestos Refurbishment Survey

**Rylands Building (Former Debenhams)**  
**Market Street**  
**Manchester**  
**M60 1TA**

**Date of Inspection:** 12/08/2021  
**Date of Survey Report:** 15/08/2021  
**Project Number:** PR355  
**Issue Number:**

*On behalf of*



**Client:** HNC Reclaim Limited  
**Client Reference:** CO165  
**Client Contact:** Phillip Cork  
**Client Address:** The Yard, Lynmouth Avenue, Stockport, Cheshire

OHS Ltd  
1st Floor, 2 City Approach, Albert Street, Manchester, M30 0BL  
**Telephone:** 0330 088 1239 **Email:** info@ohs.co.uk  
OHA is a trading name of OHS Ltd



# Contents Page

---

1.0 Property Information, Survey Scope of Work and Signatory

2.0 Management Survey

3.0 Asbestos Risk Items with Recommendations

4.0 Non-Assessed or Limited Accessed Rooms and Items

5.0 Methodology and Limitations

6.0 Scoping Table

7.0 Asbestos Register

8.0 Identified as Non-Asbestos

9.0 General Construction Materials Register

10.0 Conclusions and Actions

Appendix 1 Material Risk Assessment Matrix (HSG264)

Appendix 2 Priority Risk Assessment Matrix

Appendix 3 Bulk Analysis Certificate

Appendix 4 Survey Drawings

## 1.0 Property Information, Survey Scope of Work and Signatory

This HSG264 Asbestos Refurbishment Survey report has been technically reviewed and authorised for issue to OHS by the following authorised members of the OHA Technical Team. This document holds legal status under the Control of Asbestos Regulations 2012 and should be used and made available accordingly.

### Property Details

Property Reference: PL1350  
Property Block:  
Property Name: Rylands Building (Former Debenhams)  
Property Address: Market Street, Manchester

### Property Construction

Property Status: Not Operational  
Property Occupied: Not Occupied  
Primary Use: Retail  
Secondary Use: Commercial  
Construction Age: 1822  
Construction Type: Art Deco

### Description of Work Completed

Prior to proposed development to shopping arcade and office space.

Refurbishment survey to all floors excluding 7th floor internal areas. M & E soft strip works proposed to the entire building, with a focus on removal of all live services and plant, but building structure to remain, especially those areas that are deemed listed with ornate features e.g. column cladding, ceramic tiles, ceramic skirting lift core cage areas etc

### Related Project Information

| Date of inspection | Project Ref | Issue Number | Document Type |
|--------------------|-------------|--------------|---------------|
| No Information.    |             |              |               |

### Survey Signatory

| Document Authorisation                                                                                                                |                                                                                                                                     |                                                                                                                                            |
|---------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------|
| <br>Project Manager<br>Gareth Cooper<br>15/08/2021 | <br>Lead Surveyor<br>Daniel Albert<br>15/08/2021 | <br>Quality Checked By<br>Gareth Cooper<br>15/08/2021 |

OHA is a trading name of OHS Ltd and are UKAS accredited for asbestos works only

## 2.0 Executive Summary

---

### Introduction

OHA is a trading name of OHS Ltd was instructed by Phillip Cork of HNC Reclaim Limited, to provide an Refurbishment Survey (as defined in HSG264 Asbestos: The Survey Guide) for the presence of asbestos containing materials (ACMs) for the premises known a Rylands Building (Former Debenhams).

The purpose of a Refurbishment Survey, as defined within the HSE publication HSG 264 Asbestos: The Survey Guide is to locate and describe, as far as reasonably practicable, the presence and extent of any suspect asbestos containing material (ACM) in the area where the refurbishment will take place or in the whole building if demolition is planned.

The survey is fully intrusive and involves destructive inspection, as necessary, to gain access to all areas. Any exclusions applicable to the survey are detailed within the Scoping Table within Section 7.0 of the report and have been pre-agreed with the client. Any variations to this will be listed within Section 7.0 of this report.

It should be noted that this type of survey is disruptive and involves aggressive inspection techniques that are likely to cause damage to the fabric of the building. Unless prior agreement has been made with regards to re-instatement OHA will cover any penetrations made with tape and polythene, where this is reasonably practicable to do so.

### Property Status

The inspection and testing was conducted during working hours minimising any disruption to the occupiers as far as practical. It should be noted that occupied or operational buildings place certain restrictions on the scope of the survey in respect of intrusive access and sampling strategy and that it may prove impossible to adequately investigate all areas of the property at the time of the initial survey. Where this is the case it may be required to undertake additional surveys or inspections just prior to or during the proposed refurbishment or demolition works, in order to account for all hidden ACMs.

The property was not occupied at the time of the property visit.

The scope of the survey should be noted in conjunction with all agreed exclusions and any additional access limitations. Additional limitations may affect the validity of this report and additional works may be required in order to ensure the report is fit for purpose.

This report must be used for the safe management of asbestos within the premises under Regulation 4 of the Control of Asbestos Regulations 2012. Under Regulation 4 (Duty to Manage) the Duty Holder has a legal obligation to:

- Identify, locate and assess the condition of asbestos containing materials in the premises
- Conduct a suitable and sufficient risk assessment for each suspect ACM
- Compile an asbestos register based on the above information
- Develop and implement a plan to manage all risk posed by ACMs in the premises
- Periodically re-inspect the condition of all ACMs in the premises
- Ensure the asbestos management plan is kept up to date and remains valid at all times
- Provide information regarding asbestos risk in the premises to all building users, occupiers, contractors and visitors to the building who may come into contact with those materials (i.e. those at risk from asbestos)

For any refurbishment or demolition works, a separate HSG264 Refurbishment or Demolition Survey must be commissioned.

OHS can provide advice on this matter should it be necessary. In the first instance please contact OHS Ltd on [0330 088 1239](tel:03300881239) or by email at [info@ohs.co.uk](mailto:info@ohs.co.uk) and we will be pleased to help. There is further information in Section 11 Conclusions and Actions.

### 3.0 Asbestos Risk Items with Recommendations

The details for each identified occurrence of ACMs/Presumed ACMs are located in the Asbestos Register. Each ACM/Presumed ACM identified during the surveys has a Material Risk Assessment conducted to allow a Risk Category to be assigned.

The Material Risk Assessments were made based upon the conditions of the materials and their application at the time of survey/inspection and as such OHA cannot accept liability for the validity of assessments provided when changes in condition have occurred subsequent to the issue of this document. The duty holder/client should be aware that if the condition of the specific materials change, then the assessment should be reviewed as part of the ongoing management of the project risks.

#### Prohibit Access/Remove

| Floor            | Room                | Specific Location             | Item                                     | Product Type                                                         | Sample Reference | Recommendations | MRA |
|------------------|---------------------|-------------------------------|------------------------------------------|----------------------------------------------------------------------|------------------|-----------------|-----|
| 03 - Third Floor | 010 - Stairwell D   | Floor                         | Vinyl floor tiles and bitumen adhesive   | Other Encapsulated Material Flooring Vinyl Floor Tiles with Adhesive | S073 (OS)        | Remove          | 2   |
| 03 - Third Floor | 010 - Stairwell D   | Other Beading to door glazing | Insulating board beading to door glazing | Asbestos Board(s) Insulating Board Panel(s)                          | S075 (OS)        | Remove          | 6   |
| 03 - Third Floor | 013 - Circulation   | Other Beading to door glazing | Insulating board beading to door glazing | Asbestos Board(s) Insulating Board Panel(s)                          | S075 (VC)        | Remove          | 6   |
| 03 - Third Floor | 014 - Stairwell E   | Other Beading to door glazing | Insulating board beading to door glazing | Asbestos Board(s) Insulating Board Panel(s)                          | S075 (VC)        | Remove          | 6   |
| 03 - Third Floor | 020 - Stairwell C   | Other Beading to door glazing | Insulating board beading to door glazing | Asbestos Board(s) Insulating Board Panel(s)                          | S075 (VC)        | Remove          | 6   |
| 03 - Third Floor | 023 - Switch Room   | Other Within fuse boards      | Flashguards                              | Textile(s) Flash Pads to Fuse Box                                    | N/A              | Remove          | 5   |
| 03 - Third Floor | 024 - Circulation A | Other Beading to door glazing | Insulating board beading to door glazing | Asbestos Board(s) Insulating Board Panel(s)                          | S075 (VC)        | Remove          | 6   |
| 03 - Third Floor | 025 - Stairwell A   | Floor                         | Stair nosings                            | Other Encapsulated Material Flooring Nosing                          | S076 (OS)        | Remove          | 2   |

## Prohibit Access/Remove

| Floor            | Room                  | Specific Location                      | Item                                                         | Product Type                                                                | Sample Reference | Recommendations | MRA |
|------------------|-----------------------|----------------------------------------|--------------------------------------------------------------|-----------------------------------------------------------------------------|------------------|-----------------|-----|
| 03 - Third Floor | 025 - Stairwell A     | Other Beading to door glazing          | Insulating board beading to door glazing                     | Asbestos Board(s) Insulating Board Panel(s)                                 | S075 (VC)        | Remove          | 6   |
| 03 - Third Floor | 027 - Stairwell B     | Other Beading to door glazing          | Insulating board beading to door glazing                     | Asbestos Board(s) Insulating Board Panel(s)                                 | S075 (VC)        | Remove          | 6   |
| 03 - Third Floor | 027 - Stairwell B     | Other To windows                       | Stair nosings                                                | Other Encapsulated Material Flooring Nosing                                 | S076 (VC)        | Remove          | 2   |
| 03 - Third Floor | 028 - Disabled Toilet | Other To air handling ducting          | Mastic seal to air handling ducting                          | Other Encapsulated Material Bituminous Product(s) Mastic(s) and Adhesive(s) | S077 (OS)        | Remove          | 2   |
| 03 - Third Floor | 029 - Male Toilets    | Other To air handling ducting          | Mastic seal to ducting                                       | Other Encapsulated Material Bituminous Product(s) Mastic(s) and Adhesive(s) | S077 (VC)        | Remove          | 2   |
| 03 - Third Floor | 031 - Female Toilets  | Other To air handling ducting          | Mastic seal to ducting                                       | Other Encapsulated Material Bituminous Product(s) Mastic(s) and Adhesive(s) | S077 (VC)        | Remove          | 2   |
| 03 - Third Floor | 033 - Circulation     | Other Vinyl floor tiles                | Vinyl floor tiles and bitumen adhesive                       | Other Encapsulated Material Flooring Vinyl Floor Tiles with Adhesive        | S078 (OS)        | Remove          | 2   |
| 03 - Third Floor | 033 - Circulation     | Other To air handling ducting          | Mastic seal to ducting                                       | Other Encapsulated Material Bituminous Product(s) Mastic(s) and Adhesive(s) | S077 (VC)        | Remove          | 2   |
| 03 - Third Floor | 033 - Circulation     | Other Within fuse boards               | Flashguards                                                  | Textile(s) Flash Pads to Fuse Box                                           | N/A              | Remove          | 5   |
| 03 - Third Floor | 034 - Stairwell G     | Other Beading to door glazing          | Insulating board beading to door glazing                     | Asbestos Board(s) Insulating Board Panel(s)                                 | S075 (VC)        | Remove          | 6   |
| 03 - Third Floor | 035 - Riser           | Other To wall and pipework throughout. | Thermal insulation residues to walls and pipework throughout | Insulation Debris/residue                                                   | S079 (OS)        | Remove          | 12  |

## Prohibit Access/Remove

| Floor            | Room              | Specific Location             | Item                                     | Product Type                                                                | Sample Reference | Recommendations | MRA |
|------------------|-------------------|-------------------------------|------------------------------------------|-----------------------------------------------------------------------------|------------------|-----------------|-----|
| 03 - Third Floor | 037 - Store       | Other Beading to door glazing | Insulating board beading to door glazing | Asbestos Board(s) Insulating Board Panel(s)                                 | S075 (VC)        | Remove          | 6   |
| 03 - Third Floor | 041 - Circulation | Other To air handling ducting | Mastic seal to ducting                   | Other Encapsulated Material Bituminous Product(s) Mastic(s) and Adhesive(s) | S077 (VC)        | Remove          | 2   |
| 03 - Third Floor | 041 - Circulation | Other Beading to door glazing | Insulating board beading to door glazing | Asbestos Board(s) Insulating Board Panel(s)                                 | S075 (VC)        | Remove          | 6   |
| 03 - Third Floor | 042 - Kitchen     | Other To air handling ducting | Mastic seal to ducting                   | Other Encapsulated Material Bituminous Product(s) Mastic(s) and Adhesive(s) | S077 (VC)        | Remove          | 2   |
| 03 - Third Floor | 044 - Store       | Other To air handling ducting | Mastic seal to ducting                   | Other Encapsulated Material Bituminous Product(s) Mastic(s) and Adhesive(s) | S077 (VC)        | Remove          | 2   |
| 03 - Third Floor | 046 - Circulation | Other To air handling ducting | Mastic seal to ducting                   | Other Encapsulated Material Bituminous Product(s) Mastic(s) and Adhesive(s) | S077 (VC)        | Remove          | 2   |
| 03 - Third Floor | 052 - Kitchen     | Other Beading to door glazing | Insulating board beading to door glazing | Asbestos Board(s) Insulating Board Panel(s)                                 | S075 (VC)        | Remove          | 6   |
| 03 - Third Floor | 052 - Kitchen     | Other To air handling ducting | Mastic seal to ducting                   | Other Encapsulated Material Bituminous Product(s) Mastic(s) and Adhesive(s) | S077 (VC)        | Remove          | 2   |
| 03 - Third Floor | 054 - Canteen     | Other To air handling ducting | Mastic seal to ducting                   | Other Encapsulated Material Bituminous Product(s) Mastic(s) and Adhesive(s) | S077 (VC)        | Remove          | 2   |
| 03 - Third Floor | 054 - Canteen     | Other Beading to door glazing | Insulating board beading to door glazing | Asbestos Board(s) Insulating Board Panel(s)                                 | S075 (VC)        | Remove          | 6   |
| 03 - Third Floor | 055 - Store       | Other To air handling ducting | Mastic seal to ducting joints            | Other Encapsulated Material Bituminous Product(s) Mastic(s) and Adhesive(s) | S077 (VC)        | Remove          | 2   |

## Prohibit Access/Remove

| Floor            | Room                  | Specific Location                             | Item                                               | Product Type                                                                | Sample Reference | Recommendations | MRA |
|------------------|-----------------------|-----------------------------------------------|----------------------------------------------------|-----------------------------------------------------------------------------|------------------|-----------------|-----|
| 03 - Third Floor | 056 - Locker Room     | Other To air handling ducting                 | Mastic seal to ducting                             | Other Encapsulated Material Bituminous Product(s) Mastic(s) and Adhesive(s) | S077 (VC)        | Remove          | 2   |
| 03 - Third Floor | 057 - Stairwell F     | Other Floor tiles and adhesive                | Vinyl floor tiles and bitumen adhesive             | Other Encapsulated Material Flooring Vinyl Floor Tiles with Adhesive        | S080 (OS)        | Remove          | 2   |
| 03 - Third Floor | 057 - Stairwell F     | Other Beading to door glazing                 | Insulating board beading to door glazing           | Asbestos Board(s) Insulating Board Panel(s)                                 | S075 (VC)        | Remove          | 6   |
| 03 - Third Floor | 058 - Circulation     | Other Beading to door glazing                 | Insulating board beading to door glazing           | Asbestos Board(s) Insulating Board Panel(s)                                 | S075 (VC)        | Remove          | 6   |
| 03 - Third Floor | 060 - Circulation     | Other Beading to door glazing                 | Insulating board beading to door glazing           | Asbestos Board(s) Insulating Board Panel(s)                                 | S075 (VC)        | Remove          | 6   |
| 03 - Third Floor | 060 - Circulation     | Other Floor tiles and adhesive                | Vinyl floor tiles and bitumen adhesive             | Other Encapsulated Material Flooring Vinyl Floor Tiles with Adhesive        | S080 (VC)        | Remove          | 2   |
| 03 - Third Floor | 061 - Store           | Other Fascia panel to suspended ceiling grid. | Insulating board fascia panel to suspended ceiling | Asbestos Board(s) Insulating Board Panel(s)                                 | S081 (OS)        | Remove          | 8   |
| 03 - Third Floor | 061 - Store           | Other To air handling ducting                 | Mastic seal to ducting joints                      | Other Encapsulated Material Bituminous Product(s) Mastic(s) and Adhesive(s) | S077 (VC)        | Remove          | 2   |
| 03 - Third Floor | 062 - Restaurant Area | Other To air handling ducting                 | Mastic seal to ducting                             | Other Encapsulated Material Bituminous Product(s) Mastic(s) and Adhesive(s) | S077 (VC)        | Remove          | 2   |
| 03 - Third Floor | 062 - Restaurant Area | Other Beading to door glazing                 | Insulating board beading to door glazing           | Asbestos Board(s) Insulating Board Panel(s)                                 | S075 (VC)        | Remove          | 6   |

## Prohibit Access/Remove

| Floor            | Room                       | Specific Location              | Item                                     | Product Type                                                                | Sample Reference | Recommendations | MRA |
|------------------|----------------------------|--------------------------------|------------------------------------------|-----------------------------------------------------------------------------|------------------|-----------------|-----|
| 03 - Third Floor | 063 - Kitchen              | Other Beading to door glazing  | Insulating board beading to door glazing | Asbestos Board(s) Insulating Board Panel(s)                                 | S075 (VC)        | Remove          | 6   |
| 03 - Third Floor | 063 - Kitchen              | Other To air handling ducting  | Mastic seal to ducting                   | Other Encapsulated Material Bituminous Product(s) Mastic(s) and Adhesive(s) | S077 (VC)        | Remove          | 2   |
| 03 - Third Floor | 063 - Kitchen              | Other Floor tiles and adhesive | Vinyl floor tiles and bitumen adhesive   | Other Encapsulated Material Flooring Vinyl Floor Tiles with Adhesive        | S080 (VC)        | Remove          | 2   |
| 03 - Third Floor | 064 - Main Shop Floor Area | Other Perimeter wall void.     | Insulating board debris                  | Asbestos Board(s) Insulating Board Debris                                   | N/A              | Remove          | 9   |
| 03 - Third Floor | 064 - Main Shop Floor Area | Other To air handling ducting  | Mastic seal to ducting                   | Other Encapsulated Material Bituminous Product(s) Mastic(s) and Adhesive(s) | S077 (VC)        | Remove          | 2   |
| 03 - Third Floor | 064 - Main Shop Floor Area | Other Beading to door glazing  | Insulating board beading to door glazing | Asbestos Board(s) Insulating Board Panel(s)                                 | S075 (VC)        | Remove          | 6   |

## Encapsulate/Repair & Manage

| Floor           | Room | Specific Location | Item | Product Type | Sample Reference | Recommendations | MRA |
|-----------------|------|-------------------|------|--------------|------------------|-----------------|-----|
| No Information. |      |                   |      |              |                  |                 |     |

## Manage & Re-Inspect

| Floor           | Room | Specific Location | Item | Product Type | Sample Reference | Recommendations | MRA |
|-----------------|------|-------------------|------|--------------|------------------|-----------------|-----|
| No Information. |      |                   |      |              |                  |                 |     |

**Please note:** Property Externals have been given a Floor Reference of 99 in the Survey Report.

## 4.0 Non-Assessed or Limited Accessed Rooms and Items

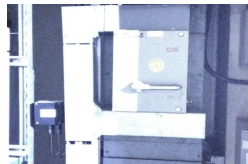
Whilst every effort has been made to adhere to the scope of the survey, the following areas have not been accessed or fully accessed for the defined reasons. Asbestos must be presumed to be present in these areas until full access can be obtained to definitively determine whether ACMs are present or not, through inspection and sampling of suspect materials as necessary.

**Please note:** asbestos should be presumed to be present within all locations not accessed until a further assessment can be undertaken.

### Non-Accessed Rooms

| Floor            | Room                 | Reason for No Access                                            | Photograph                                                                            |
|------------------|----------------------|-----------------------------------------------------------------|---------------------------------------------------------------------------------------|
| 03 - Third Floor | 002 - Goods Lift 5   | No access as area requires specially trained engineer/operative |    |
| 03 - Third Floor | 003 - Lift Shaft     | No access as area requires specially trained engineer/operative |    |
| 03 - Third Floor | 018 - Goods Lift 4   | No access as area requires specially trained engineer/operative |    |
| 03 - Third Floor | 022 - Goods Lift 2   | No access as area requires specially trained engineer/operative |  |
| 03 - Third Floor | 026 - Customer Lifts | No access as area requires specially trained engineer/operative |  |
| 03 - Third Floor | 032 - Goods Lift 1   | No access as area requires specially trained engineer/operative |  |

## Non-Accessed Items

| Floor            | Room                       | Item                    | Reason for No Access                                       | Photograph                                                                          |
|------------------|----------------------------|-------------------------|------------------------------------------------------------|-------------------------------------------------------------------------------------|
| 03 - Third Floor | 023 - Switch Room          | Flashguards             | Unable to Sample due to Live Unit                          |  |
| 03 - Third Floor | 033 - Circulation          | Flashguards             | Unable to Sample due to Live Unit                          |  |
| 03 - Third Floor | 064 - Main Shop Floor Area | Insulating board debris | Limited access behind all partitioning to perimeter walls. |  |

## 5.0 Methodology and Limitations

---

OHA was instructed to provide a HSG264 Refurbishment Survey of Rylands Building (Former Debenhams), Market Street, Manchester.

The survey has been undertaken in accordance with the HSE publication HSG 264 Asbestos: The Survey Guide. The survey involves a thorough visual examination of all building materials, as far as reasonably practicable with representative samples taken to confirm the location and extent of any ACMs. Once materials have been found to contain asbestos other similar materials used in the same way in the building can be strongly presumed to contain asbestos.

It is the duty holder's responsibility to ensure that additional refurbishment or demolition surveys are carried out for any works which are additional to, or different from, those described in the demolition brief for this survey.

ACMs found that are affected by the Demolition scope are usually removed imminently, in line with the requirement for all ACMs to be removed as far as reasonably practicable before Demolition works are carried out. However, it is acknowledged that the works may not be carried out immediately, and so there is still the need to manage these ACMs during this interval, or if the related works do not go ahead.

Therefore all the ACMs have been given a Material Assessment to enable them to be managed. Nevertheless, as the survey type undertaken was a Demolition survey, all identified asbestos materials have been recommended for removal.

If arrangements cannot be confirmed beforehand, access for the surveyor may be restricted for many reasons beyond the surveyor's control such as height, inconvenience to others, immovable obstacles or confined space. Where electrical, gas, water, fluids equipment is present and is to be examined as part of the survey or otherwise impacts on the survey process no access will be attempted until proof of its safe isolation is provided. For safety reasons it is not possible to inspect internal areas of live electrical items, heating, ventilation, or mechanical plant and machinery without isolation of such services.

Although every care has been taken to identify all ACMs within the areas surveyed, this survey does not include those areas where obtaining a sample would cause undue damage to the integrity and security of the building, risk the safety of our operatives or where access could not be gained. Asbestos should be assumed to be present within any areas not surveyed until a further assessment can be carried out.

Areas in this scope of works where access cannot be gained due to them being behind/beneath suspected ACM's, found during the course of the survey, should be assumed to contain further ACM's until proven otherwise. Whether this initial substrate is found to asbestos-containing or not, this would determine the nature of further investigation that would require return visits with additional costs, and could be quoted for if required.

If arrangements cannot be confirmed beforehand, access for the surveyor may be restricted for many reasons beyond the surveyor's control such as height, inconvenience to others, immovable obstacles or confined space. Where electrical, gas, water, fluids equipment is present and is to be examined as part of the survey or otherwise impacts on the survey process no access will be attempted until proof of its safe isolation is provided.

To ensure compliance with HSG264 and OHA own in-house procedures, a thorough desktop study was conducted prior to site activities taking place. The desktop study includes an evaluation of the scope and limitations of the survey required by HNC Reclaim Limited. Details of the desktop study findings are located in Section 8 of this document. Suitable risk assessments have been conducted prior to site attendance and further site-specific assessments were carried out on site prior to survey work commencing.

If arrangements cannot be confirmed beforehand, access for the surveyor may be restricted for many reasons beyond the surveyor's control such as height, inconvenience to others, immovable obstacles or confined space. Where electrical, gas, water, fluids equipment is present and is to be examined as part of the survey or otherwise impacts on the survey process no access will be attempted until proof of its safe isolation is provided.

Although every care has been taken to identify all ACMs within the areas surveyed, this survey does not include those areas where obtaining a sample would cause undue damage to the integrity and security of the building, risk the safety of our operatives or where access could not be gained. Asbestos should be assumed to be present within any areas not surveyed until a further assessment can be carried out.

Decorative coatings and paints etc. (such as "Artex") may contain a trace quantity of Chrysotile asbestos. Applications of this product may be non-homogenous and, with a generally low asbestos content, they may elicit both positive and NAD (no asbestos detected) sample results. Where both positive and NAD samples are obtained the client should presume that the textured coatings contain Chrysotile throughout even though a non-detected result has been obtained. It should also be noted that asbestos may exist in paint with no obvious textured appearance. Random sampling of such paint is not carried out routinely unless specifically requested.

It is assumed at the commencement of the survey that the site/land is non-contaminated. Methods use to carry out the survey were agreed with the client prior to any works being commenced. It is always possible after a survey that asbestos-based materials of one sort or another may remain in the property or area covered by that survey, which could be due to various reasons:

- Where a survey is carried out under the guidance of the owner of the property, or his representative, then the scope of the survey will be

as per their instructions and guidance at that time.

- OHA cannot be held responsible for necessary damage caused as part of this survey due to the nature of sampling for asbestos.
- Where asbestos removal works have previously been undertaken in the area included within the scope of the survey it is possible that microscopic asbestos debris may remain.

The survey includes taking dust samples from areas where contamination is suspected to be present due to visible signs of damage to asbestos or signs of previous asbestos removal works but does not include random dust sampling.

It is important to note that the degree of inspection performed during an asbestos survey is not as detailed as the inspections and analytical processes carried out following the removal of ACMs. These 'visual inspections' during clearance procedures involve a detailed examination of all areas and surfaces within an asbestos enclosure and although a survey should identify asbestos containing materials within an area where inadequate asbestos removal activities have been previously undertaken, it is not designed to check on the effectiveness of such inspections. Where previous asbestos removal work has taken place, reference should also be made to clearance documentation when reading this report.

ACMs may be hidden or obscured by other items or covered by one or more finishes (including over boarding). Where this is the case, then its detection will be impaired. Asbestos containing materials may be hidden within the structure of a building and may not become visible until the structure is dismantled. Where suspect materials are identified as part of any works that do not appear to be detailed within the survey report then these materials should be treated with caution and presumed to contain asbestos until sampled and analysed.

A limited inspection only has been carried out of pipework concealed by overlying non-asbestos insulation. Inspection of pipework has been restricted primarily to the insulation visible. The presence of residue to pipework, which is not readily visible or would require removal of insulation, was considered outside the scope of this survey.

Materials have been referred to as Asbestos Insulating Board or Asbestos Cement based upon their asbestos content and visual appearance alone. Water absorption testing, as detailed within L143, has not been carried out unless stated otherwise.

Where asbestos gaskets to pipe flanges have been identified it is not practical to trace these throughout the length of pipework within the property. All such gaskets are presumed to contain asbestos.

Unless specifically identified within the report, no responsibility can be accepted by OHA, for non-systematic or random use of asbestos within the property.

Unless specifically identified within the report, no responsibility can be accepted by OHA for stored or portable items of asbestos. Owing to the nature and necessity of sampling for asbestos, some damage is unavoidable, but effort has been made to limit it to that which was necessary for the taking of the sample.

The term "floor slab" can constitute a floor to any level and is not just limited to the ground floor. These areas have not been intrusively inspected to any particular depth. An inspection has been carried out which will have involved the scrapping of any superficial top layer but this does not constitute as a full depth intrusive inspection of the slab. Should this level of inspection be required for future works then specialist heavy engineering drilling tools will be required to be used followed by a further specific survey to this area on completion. Material extents are approximations only, assigned by the surveyor at the time of the survey. If materials such as insulation board, mill board or cement sheets in the form of wall panels, service duct panels, ceiling panels and tiles were inspected, the condition and extent of the material applied to section of those materials that were visually exposed and accessible to the surveyor i.e. panels /ceiling tiles, were not dismantled / removed or disturbed in any way to enable the visual inspection of the unexposed surface that existed to the internal side of a ceiling void, wall partition void service duct etc. The same applied to assessing additional quantities of the material that may also have existed within the void areas and were not physically visible for inspection.

**It should be noted that this report is not intended as a scope of works or bill of quantities for asbestos removal and that a detailed technical document can be provided upon request. Any contractor using this report for the purpose of asbestos removal do so at their own risk.**

Recommendations contained within this report are based upon a combination of the Material and Priority Assessments. Should any changes occur to the usage of a location then a revised assessment should be undertaken. It should be noted that the recommendation is based on controlling the material score and that consideration should also be given to controlling the priority score through actions such as restricting access etc.

## 5.0 Methodology and Limitations Continued

---

This survey however, forms only part of the obligations set out by the Duty to Manage Asbestos (Regulation 4 CAR2012). If we can be of further assistance to you in relation to this report, its recommendations, or legal compliance, please contact us on [0330 088 1239](tel:03300881239) or by email via [info@ohs.co.uk](mailto:info@ohs.co.uk) or your dedicated OHS contact.

Compliance can be achieved by following the OHS Knowledge Chain (see Section 11 of this report).

If access is specifically required, an agreement will have been made in advance with the client and documented below.

## 6.0 Scoping Table

Refurbishment Survey - Access Allowances – The following access requirements have been agreed at Quotation Stage. As part of a standard Refurbishment Survey access into structural components of the building fabric will be automatically included within the survey scope. Should access be required into any of these locations then please ensure that these are indicated at the time of quotation.

| Survey Allowance Summary                                     |                                               |                                                                                    |
|--------------------------------------------------------------|-----------------------------------------------|------------------------------------------------------------------------------------|
| Access Allowances – Based on the agreed Refurbishment Survey | Areas included within the Scope of the Survey | Access Allowance Further Details and Comment                                       |
| Below Ground Drainage Systems                                | No                                            | Out of scope                                                                       |
| Beyond Suspected or Known Asbestos                           | No                                            | Out of scope                                                                       |
| Boxing                                                       | Yes                                           | As required by scope of works                                                      |
| Ceiling Void                                                 | No                                            | Out of scope                                                                       |
| Concealed Voids                                              | Yes                                           | As required by scope of works                                                      |
| Confined Spaces                                              | No                                            | Out of scope                                                                       |
| Door Frames                                                  | No                                            | Out of scope                                                                       |
| Doors Internally                                             | Yes                                           | Representative inspection                                                          |
| Electrical Switchgear                                        | No                                            | Surveyor to record electrical installations as a presumed item based on assessment |
| Escalator Pits                                               | No                                            | Out of scope                                                                       |
| External Soffits & Fascias                                   | No                                            | Out of scope                                                                       |
| Fixed Ceiling (Plaster/Fibreboard/Interlocking)              | Yes                                           | As required by scope of works                                                      |
| Fixed Flooring                                               | Yes                                           | Representative inspection                                                          |
| Floor Ducts                                                  | Yes                                           | Representative inspection from entry points 1m either side only                    |
| Floor Voids                                                  | Yes                                           | Representative inspection                                                          |
| Glazing                                                      | Yes                                           | Representative inspection                                                          |
| Height Access Provision                                      | Standard (3m)                                 | 2 Man team required                                                                |
| Installations                                                | No                                            | Out of scope                                                                       |
| Lift Shafts                                                  | No                                            | Out of scope                                                                       |
| Locked Room/locations                                        | No                                            | Out of scope                                                                       |
| Loft Spaces                                                  | Yes                                           | Representative inspection                                                          |
| Partition Walls                                              | Yes                                           | Representative inspection                                                          |
| Plant & Equipment                                            | No                                            | Surveyor to record plant installations as a presumed item based on assessment      |
| Roof                                                         | No                                            | Out of scope                                                                       |
| Skirting                                                     | Yes                                           | Representative inspection                                                          |
| Slab                                                         | No                                            | Out of scope                                                                       |
| Solid Wall Cavities                                          | No                                            | Out of scope                                                                       |
| Ventilation Trunking                                         | No                                            | Out of scope                                                                       |
| Wall Cladding & Covering                                     | Yes                                           | Representative inspection                                                          |
| Window Frames                                                | Yes                                           | Representative inspection                                                          |
| Window Sills                                                 | No                                            | Out of scope                                                                       |

The use of forced access to locked locations identified on the day of the survey would be individually assessed and may be subject to an additional site visit which would be subject to an additional cost.

Health and Safety – should any locations be deemed inaccessible due to health and safety reasons then these will not be accessed and will be reported at the time of the survey.

**Please note:** If any activities are to be undertaken within areas that have not been accessed as part of this survey then a further survey and assessment should be carried out prior to these works.

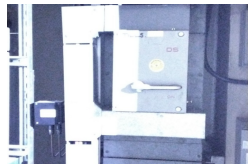
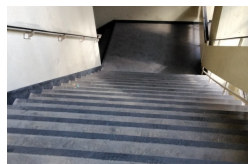
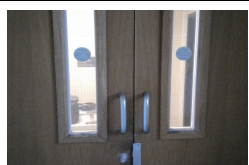
## 7.0 Asbestos Register

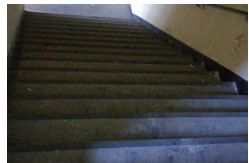
The details for each identified occurrence of ACMs/Presumed ACMs are located in the Asbestos Register. Each ACM/Presumed ACM identified during the surveys has a Material Risk Assessment conducted to allow a Risk Category to be assigned.

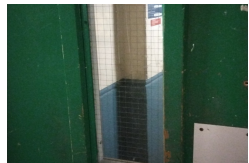
The Material Risk Assessments were made based upon the conditions of the materials and their application at the time of survey/inspection and as such OHA cannot accept liability for the validity of assessments provided when changes in condition have occurred subsequent to the issue of this document. The duty holder/client should be aware that if the condition of the specific materials change, then the assessment should be reviewed as part of the ongoing management of the project risks.

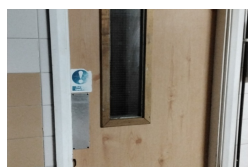
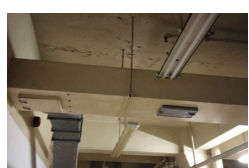
### 03 - Third Floor

| Room              | Specific Location             | Item                                     | Accessibility | Product Type                                                         | Asbestos Type             | Extent           | Sample Reference | MRA | PAS | TRA | Recommendation | Comments                                 | Photograph                                                                            |
|-------------------|-------------------------------|------------------------------------------|---------------|----------------------------------------------------------------------|---------------------------|------------------|------------------|-----|-----|-----|----------------|------------------------------------------|---------------------------------------------------------------------------------------|
| 010 - Stairwell D | Floor                         | Vinyl floor tiles and bitumen adhesive   | N/A           | Other Encapsulated Material Flooring Vinyl Floor Tiles with Adhesive | Identified Chrysotile     | 6 m <sup>2</sup> | S073 (OS)        | 02  | N/A | 02  | Remove         | Both tile and bitumen contain chrysotile |    |
| 010 - Stairwell D | Other Beading to door glazing | Insulating board beading to door glazing | N/A           | Asbestos Board(s) Insulating Board Panel(s)                          | Identified Amosite        | 1 Number         | S075 (OS)        | 06  | N/A | 06  | Remove         | 1 double door                            |    |
| 013 - Circulation | Other Beading to door glazing | Insulating board beading to door glazing | N/A           | Asbestos Board(s) Insulating Board Panel(s)                          | Strongly Presumed Amosite | 1 Number         | S075 (VC)        | 06  | N/A | 06  | Remove         | 1 double door                            |   |
| 014 - Stairwell E | Other Beading to door glazing | Insulating board beading to door glazing | N/A           | Asbestos Board(s) Insulating Board Panel(s)                          | Strongly Presumed Amosite | 2 Number         | S075 (VC)        | 06  | N/A | 06  | Remove         | 2 double doors                           |  |

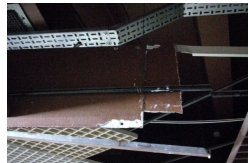
| Room                | Specific Location             | Item                                     | Accessibility | Product Type                                | Asbestos Type                | Extent     | Sample Reference | MRA | PAS | TRA | Recommendation | Comments                                     | Photograph                                                                            |
|---------------------|-------------------------------|------------------------------------------|---------------|---------------------------------------------|------------------------------|------------|------------------|-----|-----|-----|----------------|----------------------------------------------|---------------------------------------------------------------------------------------|
| 020 - Stairwell C   | Other Beading to door glazing | Insulating board beading to door glazing | N/A           | Asbestos Board(s) Insulating Board Panel(s) | Strongly Presumed Amosite    | 1 Number   | S075 (VC)        | 06  | N/A | 06  | Remove         | 1 double door. beading to both sides of door |    |
| 023 - Switch Room   | Other Within fuse boards      | Flashguards                              | N/A           | Textile(s) Flash Pads to Fuse Box           | Strongly Presumed Chrysotile | 10 Box(es) | N/A              | 05  | N/A | 05  | Remove         |                                              |    |
| 024 - Circulation A | Other Beading to door glazing | Insulating board beading to door glazing | N/A           | Asbestos Board(s) Insulating Board Panel(s) | Strongly Presumed Amosite    | 2 Number   | S075 (VC)        | 06  | N/A | 06  | Remove         | 2 double doors                               |    |
| 025 - Stairwell A   | Floor                         | Stair nosings                            | N/A           | Other Encapsulated Material Flooring Nosing | Identified Chrysotile        | 21 Number  | S076 (OS)        | 02  | N/A | 02  | Remove         |                                              |    |
| 025 - Stairwell A   | Other Beading to door glazing | Insulating board beading to door glazing | N/A           | Asbestos Board(s) Insulating Board Panel(s) | Strongly Presumed Amosite    | 1 Number   | S075 (VC)        | 06  | N/A | 06  | Remove         | 1 double door                                |   |
| 027 - Stairwell B   | Other Beading to door glazing | Insulating board beading to door glazing | N/A           | Asbestos Board(s) Insulating Board Panel(s) | Strongly Presumed Amosite    | 1 Number   | S075 (VC)        | 06  | N/A | 06  | Remove         | 1 double door. beading to both sides of door |  |

| Room                  | Specific Location             | Item                                   | Accessib<br>ility | Product Type                                                                | Asbestos Type                | Extent    | Sample Referenc<br>e | MRA | PAS | TRA | Recommendati<br>on | Comments                                 | Photograph                                                                            |
|-----------------------|-------------------------------|----------------------------------------|-------------------|-----------------------------------------------------------------------------|------------------------------|-----------|----------------------|-----|-----|-----|--------------------|------------------------------------------|---------------------------------------------------------------------------------------|
| 027 - Stairwell B     | Other To windows              | Stair nosings                          | N/A               | Other Encapsulated Material Flooring Nosing                                 | Strongly Presumed Chrysotile | 21 Number | S076 (VC)            | 02  | N/A | 02  | Remove             |                                          |    |
| 028 - Disabled Toilet | Other To air handling ducting | Mastic seal to air handling ducting    | N/A               | Other Encapsulated Material Bituminous Product(s) Mastic(s) and Adhesive(s) | Identified Chrysotile        | 2 m       | S077 (OS)            | 02  | N/A | 02  | Remove             |                                          |    |
| 029 - Male Toilets    | Other To air handling ducting | Mastic seal to ducting                 | N/A               | Other Encapsulated Material Bituminous Product(s) Mastic(s) and Adhesive(s) | Strongly Presumed Chrysotile | 2 m       | S077 (VC)            | 02  | N/A | 02  | Remove             |                                          |    |
| 031 - Female Toilets  | Other To air handling ducting | Mastic seal to ducting                 | N/A               | Other Encapsulated Material Bituminous Product(s) Mastic(s) and Adhesive(s) | Strongly Presumed Chrysotile | 2 m       | S077 (VC)            | 02  | N/A | 02  | Remove             |                                          |    |
| 033 - Circulation     | Other Vinyl floor tiles       | Vinyl floor tiles and bitumen adhesive | N/A               | Other Encapsulated Material Flooring Vinyl Floor Tiles with Adhesive        | Identified Chrysotile        | 4 m       | S078 (OS)            | 02  | N/A | 02  | Remove             | Both tile and bitumen contain chrysotile |   |
| 033 - Circulation     | Other To air handling ducting | Mastic seal to ducting                 | N/A               | Other Encapsulated Material Bituminous Product(s) Mastic(s) and Adhesive(s) | Strongly Presumed Chrysotile | 2 m       | S077 (VC)            | 02  | N/A | 02  | Remove             |                                          |  |

| Room              | Specific Location                      | Item                                                         | Accessib<br>ility | Product Type                                                                      | Asbestos Type                                     | Extent             | Sample Referenc<br>e | MRA | PAS | TRA | Recommendati<br>on | Comments                       | Photograph                                                                            |
|-------------------|----------------------------------------|--------------------------------------------------------------|-------------------|-----------------------------------------------------------------------------------|---------------------------------------------------|--------------------|----------------------|-----|-----|-----|--------------------|--------------------------------|---------------------------------------------------------------------------------------|
| 033 - Circulation | Other Within fuse boards               | Flashguards                                                  | N/A               | Textile(s)<br>Flash Pads to Fuse Box                                              | Strongly Presumed Chrysotile                      | 15 Box(es)         | N/A                  | 05  | N/A | 05  | Remove             |                                |    |
| 034 - Stairwell G | Other Beading to door glazing          | Insulating board beading to door glazing                     | N/A               | Asbestos Board(s)<br>Insulating Board Panel(s)                                    | Strongly Presumed Amosite                         | 1 Number           | S075 (VC)            | 06  | N/A | 06  | Remove             | 1 double door                  |    |
| 035 - Riser       | Other To wall and pipework throughout. | Thermal insulation residues to walls and pipework throughout | N/A               | Insulation Debris/residue                                                         | Identified Crocidolite Chrysotile and Crocidolite | Throughout Unknown | S079 (OS)            | 12  | N/A | 12  | Remove             |                                |    |
| 037 - Store       | Other Beading to door glazing          | Insulating board beading to door glazing                     | N/A               | Asbestos Board(s)<br>Insulating Board Panel(s)                                    | Strongly Presumed Amosite                         | 1 Number           | S075 (VC)            | 06  | N/A | 06  | Remove             | 1 double door                  |    |
| 041 - Circulation | Other To air handling ducting          | Mastic seal to ducting                                       | N/A               | Other Encapsulated Material<br>Bituminous Product(s)<br>Mastic(s) and Adhesive(s) | Strongly Presumed Chrysotile                      | 2 m                | S077 (VC)            | 02  | N/A | 02  | Remove             |                                |   |
| 041 - Circulation | Other Beading to door glazing          | Insulating board beading to door glazing                     | N/A               | Asbestos Board(s)<br>Insulating Board Panel(s)                                    | Strongly Presumed Amosite                         | 4 Number           | S075 (VC)            | 06  | N/A | 06  | Remove             | 3 double doors & 1 single door |  |

| Room              | Specific Location             | Item                                     | Accessib<br>ility | Product Type                                                                | Asbestos Type                | Extent   | Sample Referenc<br>e | MRA | PAS | TRA | Recommendati<br>on | Comments                       | Photograph                                                                           |
|-------------------|-------------------------------|------------------------------------------|-------------------|-----------------------------------------------------------------------------|------------------------------|----------|----------------------|-----|-----|-----|--------------------|--------------------------------|--------------------------------------------------------------------------------------|
| 042 - Kitchen     | Other To air handling ducting | Mastic seal to ducting                   | N/A               | Other Encapsulated Material Bituminous Product(s) Mastic(s) and Adhesive(s) | Strongly Presumed Chrysotile | 2 m      | S077 (VC)            | 02  | N/A | 02  | Remove             |                                |   |
| 044 - Store       | Other To air handling ducting | Mastic seal to ducting                   | N/A               | Other Encapsulated Material Bituminous Product(s) Mastic(s) and Adhesive(s) | Strongly Presumed Chrysotile | 2 m      | S077 (VC)            | 02  | N/A | 02  | Remove             |                                |   |
| 046 - Circulation | Other To air handling ducting | Mastic seal to ducting                   | N/A               | Other Encapsulated Material Bituminous Product(s) Mastic(s) and Adhesive(s) | Strongly Presumed Chrysotile | 1 m      | S077 (VC)            | 02  | N/A | 02  | Remove             |                                |   |
| 052 - Kitchen     | Other Beading to door glazing | Insulating board beading to door glazing | N/A               | Asbestos Board(s) Insulating Board Panel(s)                                 | Strongly Presumed Amosite    | 3 Number | S075 (VC)            | 06  | N/A | 06  | Remove             | 1 double door & 2 single doors |   |
| 052 - Kitchen     | Other To air handling ducting | Mastic seal to ducting                   | N/A               | Other Encapsulated Material Bituminous Product(s) Mastic(s) and Adhesive(s) | Strongly Presumed Chrysotile | 4 m      | S077 (VC)            | 02  | N/A | 02  | Remove             |                                |  |

| Room              | Specific Location              | Item                                     | Accessib ility | Product Type                                                                | Asbestos Type                | Extent   | Sample Referenc e | MRA | PAS | TRA | Recommendati on | Comments                                 | Photograph                                                                            |
|-------------------|--------------------------------|------------------------------------------|----------------|-----------------------------------------------------------------------------|------------------------------|----------|-------------------|-----|-----|-----|-----------------|------------------------------------------|---------------------------------------------------------------------------------------|
| 054 - Canteen     | Other To air handling ducting  | Mastic seal to ducting                   | N/A            | Other Encapsulated Material Bituminous Product(s) Mastic(s) and Adhesive(s) | Strongly Presumed Chrysotile | 8 m      | S077 (VC)         | 02  | N/A | 02  | Remove          |                                          |    |
| 054 - Canteen     | Other Beading to door glazing  | Insulating board beading to door glazing | N/A            | Asbestos Board(s) Insulating Board Panel(s)                                 | Strongly Presumed            | 2 Number | S075 (VC)         | 06  | N/A | 06  | Remove          | 1 double door & 1 single door            |    |
| 055 - Store       | Other To air handling ducting  | Mastic seal to ducting joints            | N/A            | Other Encapsulated Material Bituminous Product(s) Mastic(s) and Adhesive(s) | Strongly Presumed Chrysotile | 3 m      | S077 (VC)         | 02  | N/A | 02  | Remove          |                                          |    |
| 056 - Locker Room | Other To air handling ducting  | Mastic seal to ducting                   | N/A            | Other Encapsulated Material Bituminous Product(s) Mastic(s) and Adhesive(s) | Strongly Presumed Chrysotile | 3 m      | S077 (VC)         | 02  | N/A | 02  | Remove          |                                          |    |
| 057 - Stairwell F | Other Floor tiles and adhesive | Vinyl floor tiles and bitumen adhesive   | N/A            | Other Encapsulated Material Flooring Vinyl Floor Tiles with Adhesive        | Identified Chrysotile        | 25 m²    | S080 (OS)         | 02  | N/A | 02  | Remove          | Both tile and bitumen contain chrysotile |   |
| 057 - Stairwell F | Other Beading to door glazing  | Insulating board beading to door glazing | N/A            | Asbestos Board(s) Insulating Board Panel(s)                                 | Strongly Presumed Amosite    | 3 Number | S075 (VC)         | 06  | N/A | 06  | Remove          | 3 double doors                           |  |

| Room                  | Specific Location                             | Item                                               | Accessib ility | Product Type                                                                | Asbestos Type                | Extent   | Sample Referenc e | MRA | PAS | TRA | Recommendati on | Comments                                 | Photograph                                                                            |
|-----------------------|-----------------------------------------------|----------------------------------------------------|----------------|-----------------------------------------------------------------------------|------------------------------|----------|-------------------|-----|-----|-----|-----------------|------------------------------------------|---------------------------------------------------------------------------------------|
| 058 - Circulation     | Other Beading to door glazing                 | Insulating board beading to door glazing           | N/A            | Asbestos Board(s) Insulating Board Panel(s)                                 | Strongly Presumed Amosite    | 2 Number | S075 (VC)         | 06  | N/A | 06  | Remove          | 2 double doors                           |    |
| 060 - Circulation     | Other Beading to door glazing                 | Insulating board beading to door glazing           | N/A            | Asbestos Board(s) Insulating Board Panel(s)                                 | Strongly Presumed Amosite    | 2 Number | S075 (VC)         | 06  | N/A | 06  | Remove          | 2 double doors                           |    |
| 060 - Circulation     | Other Floor tiles and adhesive                | Vinyl floor tiles and bitumen adhesive             | N/A            | Other Encapsulated Material Flooring Vinyl Floor Tiles with Adhesive        | Strongly Presumed Chrysotile | 25 m²    | S080 (VC)         | 02  | N/A | 02  | Remove          | Both tile and bitumen contain chrysotile |    |
| 061 - Store           | Other Fascia panel to suspended ceiling grid. | Insulating board fascia panel to suspended ceiling | N/A            | Asbestos Board(s) Insulating Board Panel(s)                                 | Identified Amosite           | 8 m      | S081 (OS)         | 08  | N/A | 08  | Remove          |                                          |    |
| 061 - Store           | Other To air handling ducting                 | Mastic seal to ducting joints                      | N/A            | Other Encapsulated Material Bituminous Product(s) Mastic(s) and Adhesive(s) | Strongly Presumed Chrysotile | 10 m     | S077 (VC)         | 02  | N/A | 02  | Remove          |                                          |   |
| 062 - Restaurant Area | Other To air handling ducting                 | Mastic seal to ducting                             | N/A            | Other Encapsulated Material Bituminous Product(s) Mastic(s) and Adhesive(s) | Strongly Presumed Chrysotile | <80 m    | S077 (VC)         | 02  | N/A | 02  | Remove          |                                          |  |