NOTES

- Drawings to approximate scale, for reference only.
- Architect and contractor to survey following cleaning to agree areas of repointing.
- Method of protection TBA with Conservation Architect.
- No fixings permitted into Historic Building. Consult Conservation Architect.

Outline specification for mortar mix for repointing:
3.5:1
NHL2: moist pink silica sand: nosterfield sand

NOTE: Particular specification TBA with Conservation Architect following completion of samples.


Area to be surveyed

Areas for proposed indent stone repairs. Cut out decayed / damaged stone and fit new stone indent repair

Cracks to stone to be pinned or repaired with grout/ mortar repair ('P' indicates a pin is required)

Area within hatch to be re-pointed, precise areas to be confirmed with architect.

Carefully rake out mortar. If mechanical methods required they are to be undertaken by a skilled operative

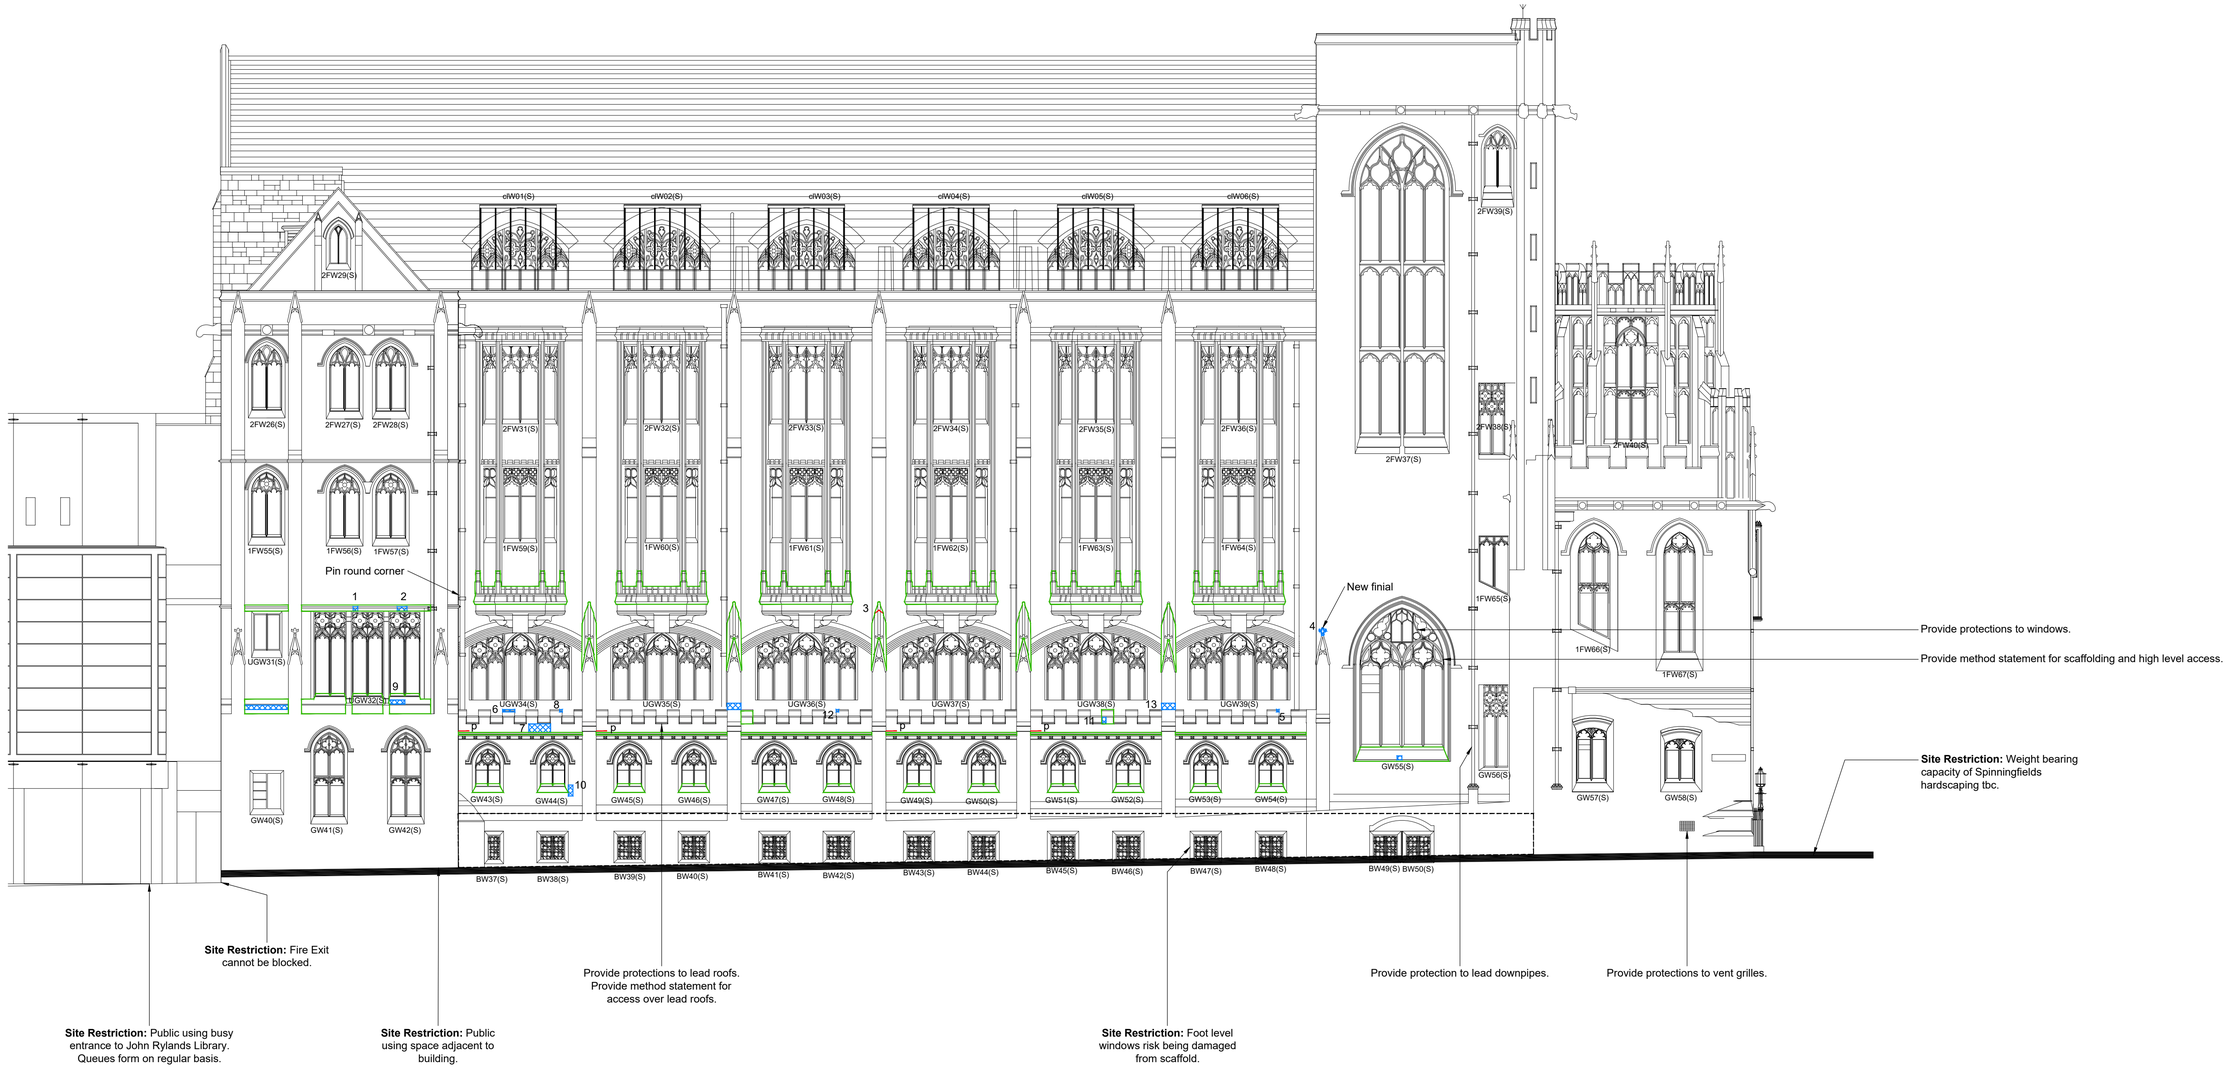

0 1 2 5
Scale 1:100 m

Notes

1. Any dwg format drawing is to be read in conjunction with and at the scale of the accompanying pdf.
2. Where colours other than black or grey are used, the drawing must be plotted in colour.
3. For status 'C' (Construction) drawings all dimensions are to be checked on site by the contractor, scaling is for Local Authority purposes only.
4. Unless otherwise indicated, all dimensions are in millimeters.
5. All information on this drawing is to be read in conjunction with the relevant Donald Insall Associates specification and trade contractors' drawings and information by specialists.
6. In the event of any discrepancy, please contact us immediately.
7. This drawing may contain survey information by others and is to be used solely for the purposes for which it was issued.
8. These are uncontrolled documents issued for information purposes only. If you have any queries regarding the drawings, please contact DIA immediately.
9. Please note DIA cannot be held responsible for any errors arising from changes made to an uncontrolled dwg file.

© 2019 DONALD INSALL ASSOCIATES LTD

Drawing Status

F Feasibility
S Sketch Design
P Planning
B Building Control
D Developed Design
M Measurement
T Tender
C Construction
R Record

Rev	Date	Dwn	Auth	Revision
2	09-01-24	ELE	RZM	Issued for discharge of conditions
1	16-12-22	ELE	RZM	Updated Following Survey
0	29-11-22	ELE	RXC	Initial Issue

Donald Insall Associates
Chartered Architects and Historic Building Consultants
Bridgegate House, 5 Bridge Place
Chester CH1 1SA
(+44) 01244 350 063
chester@insall-architects.co.uk

John Rylands Library and Beyer Building, Manchester

John Rylands Library - Stone Repairs
Spinningfields Elevation

Project	No
MAN.JRL.02	2220
Scale (A1)	Status / Revision
1:100	M / 2