


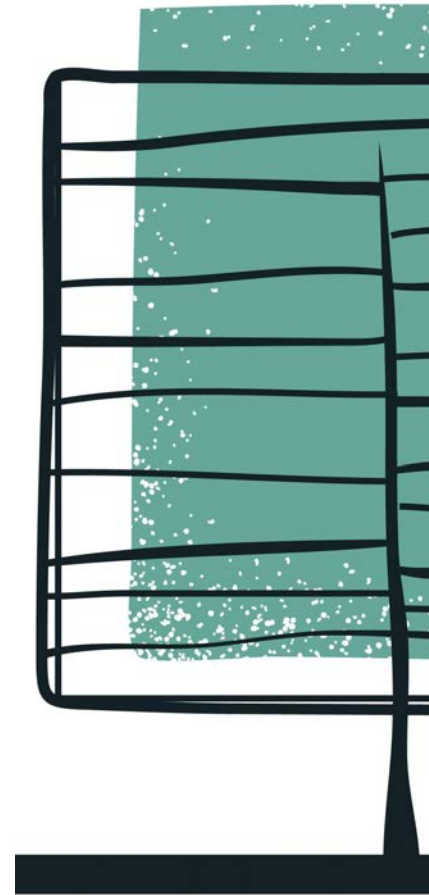

Report No: LTM0502.AIA.01

Date: 11/05/2022

Project: 13 Maple Avenue, Chorlton-cum-Hardy, M21 8BD

BS 5837:2012 Arboricultural Impact Assessment

Inspection Record.

Date of Inspection	Surveyor
21/04/2022	Matthew Lally. FdSc MArborA

Lally Tree Management.

36 Goldsworthy Road, Urmston, Manchester, M41 8US

[T] 07305 740120 [E] matt@lallytreemanagement.co.uk [W] <https://www.lallytreemanagement.co.uk/>

This report is the property of Lally Tree management. This report may only be reproduced or disclosed to third parties with express written consent from Lally Tree Management.

Revision	Date	Prepared by	Status
Final	11/05/2022	M. Lally	Complete

Contents

Executive Summary	4
1.0 Introduction	5
2.0 Planning Policy	7
3.0 Legislation	8
4.0 Survey Methodology	9
Veteran and Ancient Trees	9
5.0 Development Proposals	11
6.0 Impact Assessment.....	12
7.0 Mitigation Proposals	12
7.1 Supervised Root Pruning & Excavation.....	12
7.2 Re-Laying of Existing Driveway	13
8.0 Caveats and Limitations	13
Appendix One Tree Survey Data & Site Notes	
Appendix Two Glossary of Terms	
Appendix Three Cascade Chart	
Appendix Four Plans	

Executive Summary

The proposed development site is located within a residential suburb of Chorlton near the town centre. The site consists of a lawned area to the rear and a paved driveway to the front.

Trees present that could be potentially affected by the development are as follows:

Category A	Category B	Category C	Category U
2 Trees	0	3 Trees	0

It is proposed to refurbish the existing dwelling and re-landscape the garden area. A new light well at the front of the property is to be dug within the RPA of 2 trees. To facilitate this development, trees requiring removal or other works are as follows:

	Tree Category. Trees Requiring Works			
Tree Work Type	Category A	Category B	Category C	Category U
Tree Removal	0	0	0	0
Pruning Works	0	0	0	0
Supervised Excavation & Root Pruning	2 Trees	0	0	0

It is felt that the mitigation measure proposed in this report will be sufficient to prevent any adverse effects on the retained trees at this site.

1.0 Introduction

- 1.0.1 The author of this report is Matthew Lally (MAborA) FdSc. Matthew is a professional member of the Arboricultural Association, The Consulting Arborist Society and an Associate member of the Institute of Chartered Foresters and is therefore required to uphold ethical standards laid out by these institutions.
- 1.0.2 This Arboricultural Impact Assessment has been commissioned by Armistead Property Limited and is prepared in relation to the proposed development at 13 Maple Avenue, Chorlton, M21 8BD.

An outline of the assessment boundary can be found in figure 1.



Figure 1. Assessment Boundary Plan

- 1.0.3 The tree survey & assessment of existing trees has been guided by the recommendations within British Standard 5837:2012 'Trees in Relation to Design, Demolition and Construction - Recommendations'. The recommendations set out a structured assessment methodology to assist in determining which trees would be deemed either as being suitable or unsuitable for retention.
- 1.0.4 British Standard 5837:2012 'Trees in Relation to Design, Demolition and Construction - Recommendations' includes guidance for considering the relationship between existing trees and how to integrate their needs into a successful development. A harmonious and sustainable relationship between any retained trees and new structure and/or hard surfaces is at the heart of the guidance.
- 1.0.5 The survey was carried out Thursday 21st April 2022 by means of inspection from ground level by an experienced and qualified arboriculturalist. The inspection can be restricted in cases where trees were Ivy clad or surrounded by dense vegetation.

1.0.6 British Standard 5837:2012 recommends the assessment of trees is made as objectively as possible, but the findings will always remain the opinions of the surveyor. The tree categorisation method identifies the quality and value of the existing tree stock, allowing informed decisions to be made concerning development design layout.

1.0.7 Table 1 provides a summary of the documents that have been made available by the client:

Table 1 – Documents made available by client.

Document Type	Reference No.	Author	Date
Topographical Survey & proposed Site Plan	159-13MAP-PL-GL1	Simon James ARQ	10/05/2022

1.0.8 The supplied drawing did include tree positions; however, some trees were not located on the plan. Additions and corrections have been made by eye and any dimensions regarding tree positions and protective fencing must be checked on site.

1.0.9 Weather conditions during the survey were dry and still.

1.0.10 Assessing the potential influence of trees upon load bearing soils, beneath existing and proposed structures resulting from water abstraction by trees or rehydration of shrinkable soils was not included in the contract brief and is therefore not considered in the report. The consultant cannot be held responsible for damage arising from such action.

1.0.11 Potentially hazardous trees are highlighted, and appropriate recommendations are made. However, this report is not a substitute for a full tree risk assessment or management plan which are specifically designed to minimise risk and liability associated with responsibility for trees.

2.0 Planning Policy

2.1 National Planning Policy Framework (NPPF)

2.1.1 When determining planning applications, Local Planning Authority's (LPA) should apply the following principles:

- If significant harm to biodiversity resulting from a development cannot be avoided (through locating on an alternate site with less harmful impacts), adequately mitigated, or, as a last resort, compensated for, then planning permission should be refused.
- Development resulting in the loss or deterioration of irreplaceable habitats (such as ancient woodland and ancient or veteran trees) should be refused unless there are wholly exceptional reasons, and a suitable compensation strategy exists.
- Development whose primary objective is to conserve or enhance biodiversity should be supported; while opportunities to incorporate biodiversity improvements in and around developments should be encouraged, especially where this can secure measurable net gains for biodiversity (paragraph 175).

2.1.2. No trees are proposed for removal within this report and therefore the principles for refusal within the NPPF would not be considered applicable.

2.2 Local Planning policy

Guide to Development in Manchester Supplementary Planning Document and Planning Guidance Adopted April 2007

4.15: DP Part 1 Policies E2.3 and E2.4 require the protection of wildlife, wildlife habitats, and where possible, the creation of new nature reserves and features which will sustain wildlife. Part 1 Policy E2.6 states that the City Council wishes to prevent the loss of existing trees. Developers will need to contribute to Manchester's Biodiversity Strategy by demonstrating in their Environment Standards Statement how they have taken full account of the effect of their proposed development on biodiversity. This should highlight how existing species and habitats would be protected and how the proposed development would enhance the ecological value of the site. Mature trees and hedges should be retained on site wherever possible. Where this is not possible, developers will be expected to agree an appropriate scheme for replanting with the Development Control case officers. Developments should result in no net loss in overall biodiversity value and maximise opportunities to meet and exceed our target to achieve a 10% net increase in tree cover across new developments. In exceptional cases, where planting is unachievable on site, permission may be granted to plant elsewhere in the City to ensure no overall net loss in tree resources. Existing green links across the site should be maintained and the opportunity taken to create new links as appropriate. Landscaping and new planting should include species appropriate for the proposed development that will encourage wildlife. Full plans should be included in the report showing retained, enhanced and new ecological features, the number of on-site trees pre and post development, and a 5 year management plan. Wood and wood products should come from Forest Stewardship Council sources. Tropical hardwoods should be avoided.

3.0 Legislation

Statutory Considerations

3.0.1 A Tree Preservation Order (TPO) is an order made by a local planning authority to protect specific trees, groups of trees or woodlands in the interests of amenity. A TPO prohibits the:

- cutting down
- topping
- lopping
- uprooting
- willful damage
- willful destruction

of trees without the local planning authority's written consent. If consent is given, it can be subject to conditions which have to be followed. In the Secretary of State's view, cutting roots is also a prohibited activity and requires the authority's consent. Anyone found guilty of such an offence is liable and in serious cases, may result in prosecution and incur an unlimited fine.

3.0.2 It is understood following consultation with the Local Planning Authority, Manchester City Council, that 'there are no Tree Preservation Orders affecting the property/land at 13 Maple Avenue, Manchester, M21 8BD and it is not within a Conservation Area. As a result, any work to trees within the boundary/curtilage of the property does not require planning permission. However, if the trees are outside the boundary of the property on the public highway, you must contact the Council's Arboricultural team as they are responsible for the maintenance of these trees. If this is the case, email contact@manchester.gov.uk with your request for works'.

3.0.3 Felling Licence

3.0.4 Tree felling is also restricted under the Forestry Act 1967. Under this act, there is an exemption from the need for a felling licence for "Felling trees immediately required for the purpose of carrying out development authorised by planning permission (granted under the Town and Country Planning Act 1990) ..."

3.0.5 If full planning permission is granted, then any trees which require felling to implement the approved plans are exempt from this statutory protection. Outline planning permission does not provide an exemption to the regulations that control tree felling in the Forestry Act 1967.

4.0 Survey Methodology

- 4.0.1 The trees were surveyed in accordance with Chapter 4 of BS5837:2012. The tree metrics have been recorded in the tree schedule in appendix one. Where groups of trees and woodland groups have been recorded, average height, average crown spread and average diameter at breast height (DBH) are reported. Where access to the base of any trees was limited then measurements were estimated.
- 4.0.2 Trees have been assessed as individual trees (T), groups of trees (G), hedgerows (H) or woodland Groups (W) where it has been determined appropriate.
- The term group has been applied where trees form cohesive arboricultural features either aerodynamically, visually or culturally.
 - For the purposes of this assessment, a hedgerow is described as any boundary line of trees or shrubs less than 5m wide at the base and are managed or have been managed under a regular pruning regime.
 - For the purposes of this assessment, woodland is described as a habitat where 'trees are the dominant plant form. The individual tree canopies generally overlap and interlink, often forming a more or less continuous canopy'.
- 4.0.3 All the trees were assessed using: a grading A to C (retention) and U (removal); condition and age class as defined in appendix two.
- 4.0.4 Where appropriate, canopy spread for each tree was recorded at four cardinal points in order to reproduce an accurate representation of the crown shape of the tree on the tree plan in appendix four.
- 4.0.5 The survey included all trees within the proposal area and trees near to the proposal.

Veteran and Ancient Trees

- 4.0.6 Veteran trees and Ancient Woodland are important components of the landscape, their importance can be for a number of reasons including that of their ecological, social, cultural and historic value.
- 4.0.7 Veteran Trees and Ancient Woodlands are material considerations within the planning process and their importance is specifically recognised within the National Planning Policy Framework (NPPF) 2019
- 4.0.8 Ancient Tree Guide No4 Published by the Woodland Trust and the Ancient Tree Forum states that:

'An ancient tree is one that has passed beyond maturity and is old, or aged, in comparison with other trees of the same species. Its canopy may be small. It will probably have a very wide trunk relative to other trees of the same species and it is very likely that it will be hollow'

AND

'Veteran is a term describing a tree with habitat features such as wounds or decay. The terms ancient and veteran have been used interchangeably in the past, however, it is important to know what the differences between them [are]. A veteran tree is a survivor that has developed some of the features found on an ancient tree, not necessarily as a consequence of time, but of its life or environment. Ancient veterans are ancient trees, not all veterans are old enough to be ancient. A veteran may be a young tree with a relatively small girth in contrast to an ancient tree but bearing the 'scars' of age such as decay in the trunk, branches or roots, fungal fruiting bodies, or dead wood. These veteran features will still provide wildlife habitat'

4.0.9 Different methodologies are available for the defining of Veteran & Ancient trees in the field. Lally Tree Management use RAVEN (Recognition of Ancient, Veteran and Notable Trees) allowing quick and easy assessments to be made, whilst trying to ensure these valuable assets to our environment do not go un-noticed.

4.0.10 No Veteran Trees or Ancient Trees were identified on this site.

5.0 Development Proposals

5.0.1 Overlaying the development plans & their associated infrastructure over the existing site plans has highlighted a number of areas where trees are in conflict with the proposal. This plan has been made available in appendix 4 and given the title 'Arboricultural Implications Plan'

5.0.2 In order to fully assess the impact of the proposals an Impact Table has been created detailing each tree, which shows the proximity of the associated works to the tree.

5.0.3 The aforementioned data and plans are analysed to determine whether the development will have a detrimental impact on the health of each tree. Once this has been determined, remedial measures can be detailed to reduce the impact the proposals will have on the treescape.

5.0.4 Impact Table: -

Tree No.	Root Protection Area identified (m ²) in Table 2 of BS 5837:2012	Distance to Proposed Hard Standing (m)	Distance to Proposed Development (m)	Can the Tree/s be Successfully Retained	Retention Category
T1	8	1.00	n/a	Yes, as outlined in section 7.2	C1
T2#	1	1.44	n/a	Yes	C1
T3#	1	0.55	n/a	Yes	C1
T4	163	1.90	7.60	Yes, as outlined in section 7.1 & 7.2	A2
T5#	180	12.80	7.70	Yes, as outlined in section 7.1 & 7.2	A2

6.0 Impact Assessment

6.1 To assess the implications of the Impact Table each tree can be categorised in the following way: -

	Trees to be Retained		Trees to be Removed	
	With No Impact	With detailed construction	Due to Condition	Due to Development
Category A	-	T4, T5#	-	-
Category B	-	-	-	-
Category C	T2#, T3#	T1	-	-
Category U	-	-	-	-
TOTAL	2	3	0	0

7.0 Mitigation Proposals

7.1 Supervised Root Pruning & Excavation.

7.1.1 The proposed construction of the light well at the front of the property encroaches into the RPA of T4 & T5# by 1.8% & 1.1% respectively.

7.1.2 The adjustment of the levels for the widening of the path at the front of the property encroaches into the RPA of T4 by 1.7%

7.1.3 To facilitate the development and prevent damage to any tree roots within the RPAs of these trees, all excavations should be supervised by an Arboricultural Consultant and any root pruning that is required should be undertaken by the Arboricultural Consultant.

7.1.4 As the amounts of encroachment are so small it is felt that if the following points are adhered to then the long-term health and retention of T4 & T5# will not be adversely affected.

- Excavation must be carried out using hand tools to avoid direct damage to the bark of the roots. It may be possible in some instances to use specialised equipment such as high air pressure machinery to excavate the soil with minimal disturbance to roots.
- Exposed roots will be wrapped in moist, clean Hessian to prevent the roots from drying out in hot or dry weather. The hessian must be removed before backfilling.
- Roots less than 25mm diameter may be pruned back, preferably to a growing point. A sharp cutting tool such as bypass secateurs or a handsaw should be used to leave the smallest wound possible. Roots greater than 25mm in diameter should be retained wherever possible.

- Root pruning should be carried out under the supervision of the Arboricultural Consultant.
- Backfilling of any excavation must be carried out by hand to avoid direct root damage or compaction, where possible. Builder sand must not be used in the backfill material.

7.2 Re-Laying of Existing Hardstanding

- 7.2.1 The uplift & re-laying of the existing hardstanding could have implications for T1, T4, & T5# and may adversely affect the Safe Useful Life Expectancy of these trees.
- 7.2.2 It is felt that during the uplift & re-laying of the existing hardstanding within the RPA of any retained trees that if any excavation within the RPA of these trees is limited to the existing hardstanding layer and work is undertaken with hand tools only, then their Safe Useful Life Expectancy will not be adversely affected

8.0 Caveats and Limitations

- 8.1 The report is for the sole use of the client and its reproduction or use by anyone else is forbidden unless written consent is given by the author.
- 8.2 This is an arboricultural report and as such no reliance should be given to comments relating to buildings, engineering, soils ecological or archaeological data. If either is commented upon within the report further professional advice should be sought.
- 8.3 This is not a Tree Risk Assessment. As such this report should not be taken to mean or imply that any of the inspected trees should be considered safe. A Tree Risk Assessment can be provided but would be subject to additional survey requirement and further fees.
- 8.4 Trees are growing dynamic structures. Whilst reasonable effort has been made to identify defects within the trees inspected, no guarantee can be given as to the absolute safety or otherwise of any individual tree. No tree is ever absolutely safe due to the unpredictable laws and forces of nature. As a result of this, natural failure of intact trees will occur; extreme climatic conditions can cause damage to even apparently healthy trees.
- 8.5 For the purposes of this survey all dimensions of trees and their associated parts are based on estimation unless otherwise stated.
- 8.6 Trees are living organisms whose health, condition and structure can change quickly and without warning. Therefore, the contents of this report are valid for a period of one year from the date of this survey.

Appendix One

Tree Survey Data & Site Notes

*The recommendations in this section are based on the site survey only and are NOT recommendation based on any proposed development plans.



BS5837:2012 TREE SCHEDULE



DATE OF SURVEY: 21/04/2022


JOB REFERENCE: LTM0502.AIA.01

SITE ADDRESS: 13 Maple Ave. Chorlton

Tree No.	Species	Stem Dia (mm)	RPA (m ²)	RPA Radius (m)	Height (m)	Age Class	Crown Spread (m)				Crown Clearance (m)	Condition	Comments	Recommendations	Remaining Contribution	BS5837 Retention Category
							N	E	S	W						
T1	Birch	130	8	1.56	8	SM	1	1	1	1	1.5S	A	Located in rear garden in close proximity to boundary wall. Good form and vitality. No significant risk features observed	No action	40+	C1
T2#	Hawthorn	50	1	0.6	4	Y	0.5	1	1	0.5	2S	A	Located on rear boundary in close proximity to boundary wall. Good vitality. Asymmetrical crown. No significant risk features observed	No action	40+	C1
T3#	Rowan	50	1	0.6	3	SM	1	1	1	1	1S	A	Good form and vitality. No significant risk features observed	No action	40+	C1
T4	Lime	600	163	7.2	19	M	5	5	5	5	4N	A	Mature street tree. Good vitality. No significant risk features observed. Highly visible from public viewpoints. Intrinsic part of formal street planting	No action	40+	A2
T5#	Lime	630	180	7.56	19	M	5	5	5	5	3N	A	Mature street tree. Good vitality. No significant risk features observed. Highly visible from public viewpoints. Intrinsic part of formal street planting	No action	40+	A2

Appendix Two

Glossary of Terms

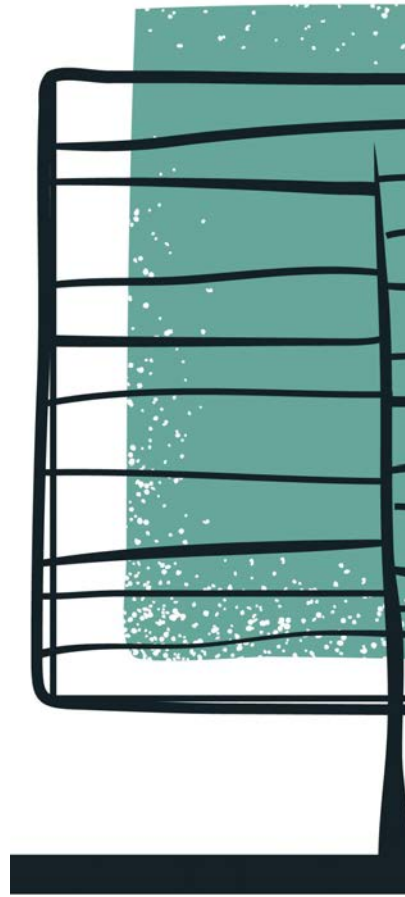

The following terms are concurrent with best Arboricultural practice and within the guidelines set by the International Society of Arboriculture (ISA), the Arboricultural Association (AA) and the British Standards Institute (BSI).

Age Range:

Age is site specific and categorised:

Young (Y)	Out-planted trees that have not yet established.
Semi-Mature (SM)	Established trees up to 1/3 of expected height and crown.
Early Mature (EM)	Between 1/3 and 2/3 of expected height and crown.
Mature (M)	Between 2/3 and full expected height and crown.
Fully Mature (FM)	Full expected height and crown.
Over Mature (OM)	Crown beginning to break-up and decrease in size.
Senescent (S)	Crown in advanced stage of break-up.

Height: Height is estimated and recorded in metres.

DBH: Diameter at Breast Height is measured at 1.5m and recorded in metres. Where a tree becomes multi-stemmed below 1.5m the highest possible diameter is measured and indicated. Alternatively, above 1.5m the diameter of each stem or an average diameter is measured and indicated.

Condition: Assessment of current physiological condition and structural morphology incorporating vigour and vitality and categorised:

- A -** Tree needing little, if any attention
- B -** Tree with minor, but rectifiable defects, or in the early stages of physiological stress
- C -** Tree with significant structural and physiological flaws and/or extremely stressed
- D -** Tree that is dead, biologically/physically moribund or dangerous.

Desirability to Retain – As Outlined in Table 1 of BS 5837:2005 (Trees in Relation to Construction - Recommendations)

Definition of Physiological & Morphological Terms

Adaptive Growth - The process whereby wood formation is influenced both in quantity and in quality by the action of gravitational force and mechanical stresses on the cambial zone.

Bifurcation – Forked or divided union.

Brown Rot - Form of decay where cellulose is degraded, while lignin is only modified.

Cankers- A localised area of dead bark and cambium on a stem or branch, caused by fungal or bacterial organisms, characterised by wound wood development on the periphery. This may be annual or perennial.

Cavity - An open wound, characterised by the presence of extensive decay and resulting in a hollow.

Chlorotic Leaf - Lacking in chlorophyll, typically yellow in colour.

Compartmentalisation - The physiological process that creates the chemical and mechanical boundaries that act to limit the spread of disease and decay organisms.

Crack - Longitudinal split in stem or branch, involving bark and/or underlying wood. These may be vertically and horizontally orientated.

Decay - Process of degradation of woody tissues by fungi and bacteria through decomposition of cellulose and lignin.

Deadwood - Deadwood is often present within the crown or on the stems of trees. In some instances, it may be an indication of ill health, however, it may also indicate natural growth processes. If a target is present beneath the tree, deadwood may fall and cause injury or damage and should be removed, otherwise deadwood can remain intact for conservation purposes (insects, fungi, birds etc.).

End Weight -	The concentration of foliage at the distal ends of stems and deficient in secondary branches.
Girdling Root -	Root which circles and constricts the stem or roots causing death of phloem and/or cambial tissue.
Hazard Beam -	An upwardly curved branch in which strong internal stresses may occur without the compensatory formation of extra wood (longitudinal splitting may occur in some cases).
Included Bark Union -	Pattern of development at branch junctions where bark is turned inward rather than pushed out. Potential weakness due to a lack of a woody union.
Ivy Growth -	Ivy growth may ascend into the tree's crown, increasing wind resistance, concealing potential defects and reducing the tree's photosynthetic capacity. Ivy growth is often acceptable in woodland areas as a conservation benefit.
Live Crown Ratio -	The relative proportion of photosynthetic mass (leaf area) to overall tree height.
Reaction Wood -	Specialised secondary xylem, which develops in response to a lean or similar mechanical stress, attempting to restore the stem to the vertical.
Root Plate Lift -	The physical movement of the rooting plate causing soils to shift and crack. May occur during adverse weather conditions. Trees may become unstable.
Structural Defect -	Internal or external points of weakness, which reduce the stability of the tree.
Suppressed -	Trees which are dominated by surrounding vegetation and whose crown development is restricted from above.
Topping -	A highly disfiguring practise, likely to cause severe xylem dysfunction and decay in major structural parts of the wood.

- White Rot -** Form of decay where both cellulose and lignin are degraded.
- Wound -** Any injury, which induces a compartmentalisation response.
- Wound wood -** Wood with atypical anatomical features, formed in the vicinity of a wound and a term to describe the occluding tissues around a wound as opposed to the ambiguous term “callus.”
- Woodland Structure -** The vertical and horizontal arrangement of trees within a group or woodland i.e. Dominant - trees with a crown above the upper layer of the canopy, Co-dominant - trees that define the general upper edge of the canopy, Intermediate - trees that have been largely overgrown by others, Suppressed - trees that have been overgrown and occupy an under storey position and grow slowly, often severely asymmetrical.

Note: *The definitions described above, may not necessarily be included within the Arboricultural Survey Data.*

Appendix Three


Cascade Chart



Trees for removal			
Category and definition	Criteria		
Category U Those in such a condition that they cannot realistically be retained as living trees in the context of the current land use for longer than 10 years	- o Trees that have a serious, irremediable, structural defect, such that their early loss is expected due to collapse, including those that will become unviable after removal of other U Category trees (i.e. where, for whatever reason, the loss of companion shelter cannot be mitigated by pruning) - o Trees that are dead or are showing signs of significant, immediate, and irreversible overall decline. - o Trees infected with pathogens of significance to the health and/or safety of other trees nearby) e.g. Dutch elm disease), or very low-quality trees suppressing adjacent trees of better quality. NOTE: <i>Category U trees can have existing or potential conservation value which might be desirable to preserve; see section 4.7.5</i>		
Trees to be considered for retention			
Category and definition	Criteria and sub-categories		
	1) Mainly arboricultural values	2) Mainly landscape values	3) Mainly cultural values (including conservation)
Category A Trees of high quality: with an estimated remaining life expectancy of at least 40 years	Trees that are particularly good examples of their species especially if rare or unusual, or essential components of groups, or of formal or semi-formal arboricultural features (e.g. the dominant and/or principal trees within an avenue)	Trees, groups or woodlands of particular visual importance as arboricultural and or landscape features	Trees, groups or woodlands of significant conservation, historical commemorative or other value (e.g. veteran trees or wood-pastures)
Category B Those of moderate quality: with an estimated remaining life expectancy of at least 20 years	Trees that might be included in category A, but are downgraded because of impaired condition (e.g. presence of significant though remediable defects, including unsympathetic past management and storm damage), such that they are unlikely to be suitable for retention for beyond 40 years; or trees lacking the special quality necessary to merit the category A designation	Trees present in numbers, usually growing as groups or woodlands, such that they attract a higher collective rating than they might as individuals; or trees occurring as collectives but situated so as to make little visual contribution to the wider area	Trees with clearly identifiable conservation or other cultural benefits
Category C Those of low quality with an estimated remaining life expectancy of at least 10 years, or young trees with a stem diameter below 150mm	Unremarkable trees of very limited merit or such impaired condition that they do not qualify in the higher categories	Trees present in groups or woodlands, but without this conferring on them significantly greater landscape value, and/or trees offering low or only temporary screening benefit.	Trees with no material conservation or other cultural value

Appendix Four

Plans

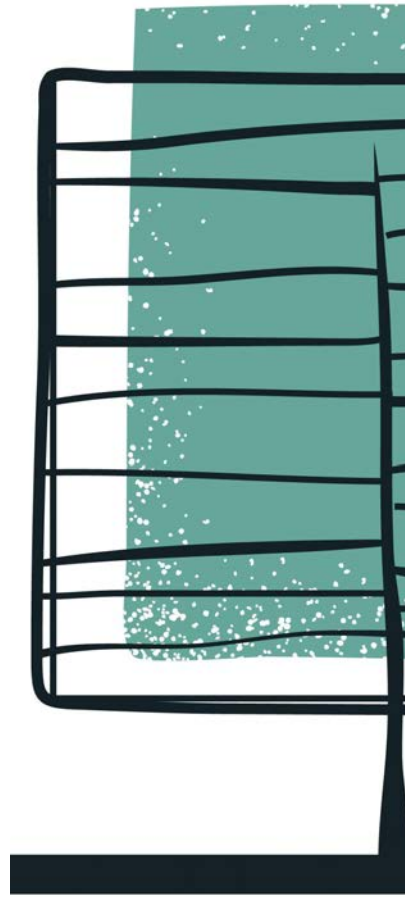

Do not scale this drawing (printed or electronic version).
Contractors must check all dimensions from site
This drawing is for use on this site only and should be used in conjunction with all relevant consultants drawings..

LEGEND





- Category A
- Category B
- Category C
- Category U
- Root Protection Area (RPA)
- Position estimated on site



Scale:	1:200@A3	Date:	21/04/2022
Job:	LTM0502.AIA.01		
Address	13 Maple Ave, Chorlton-cum-Hardy, Manchester M21 8BD		
Client:	Armistead Property Ltd		
Drawing Number:	LTM0502.TCP.01		
Drawn by:	Matthew Lally		


TREE CONSTRAINTS PLAN


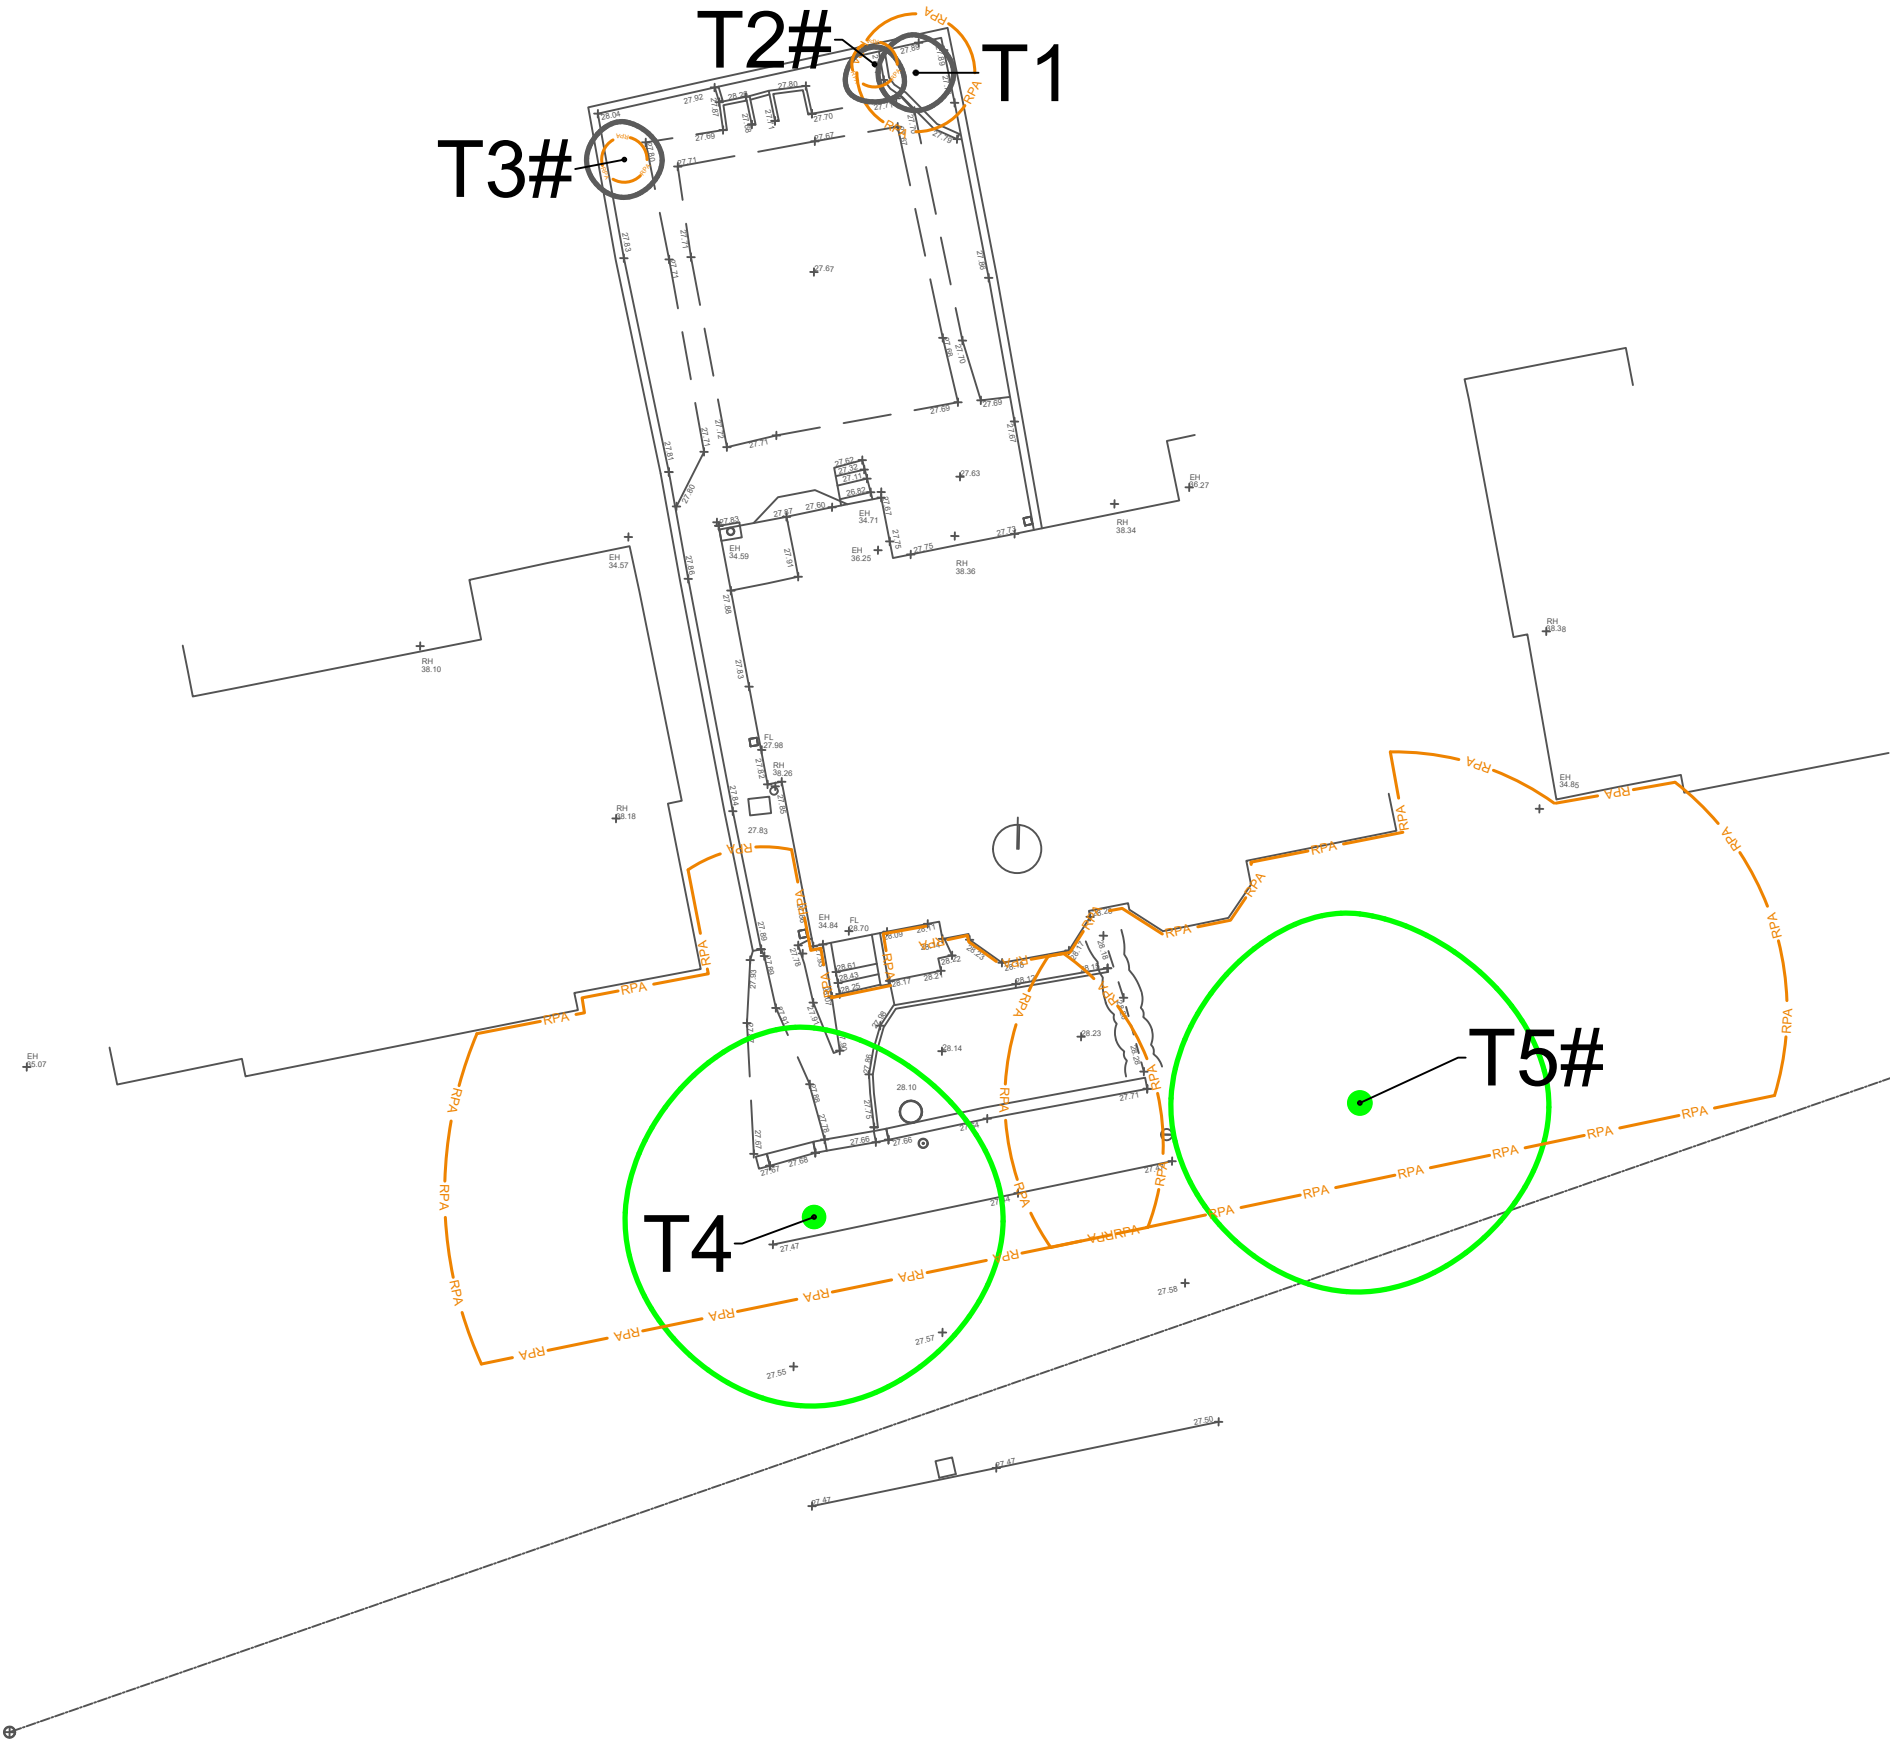


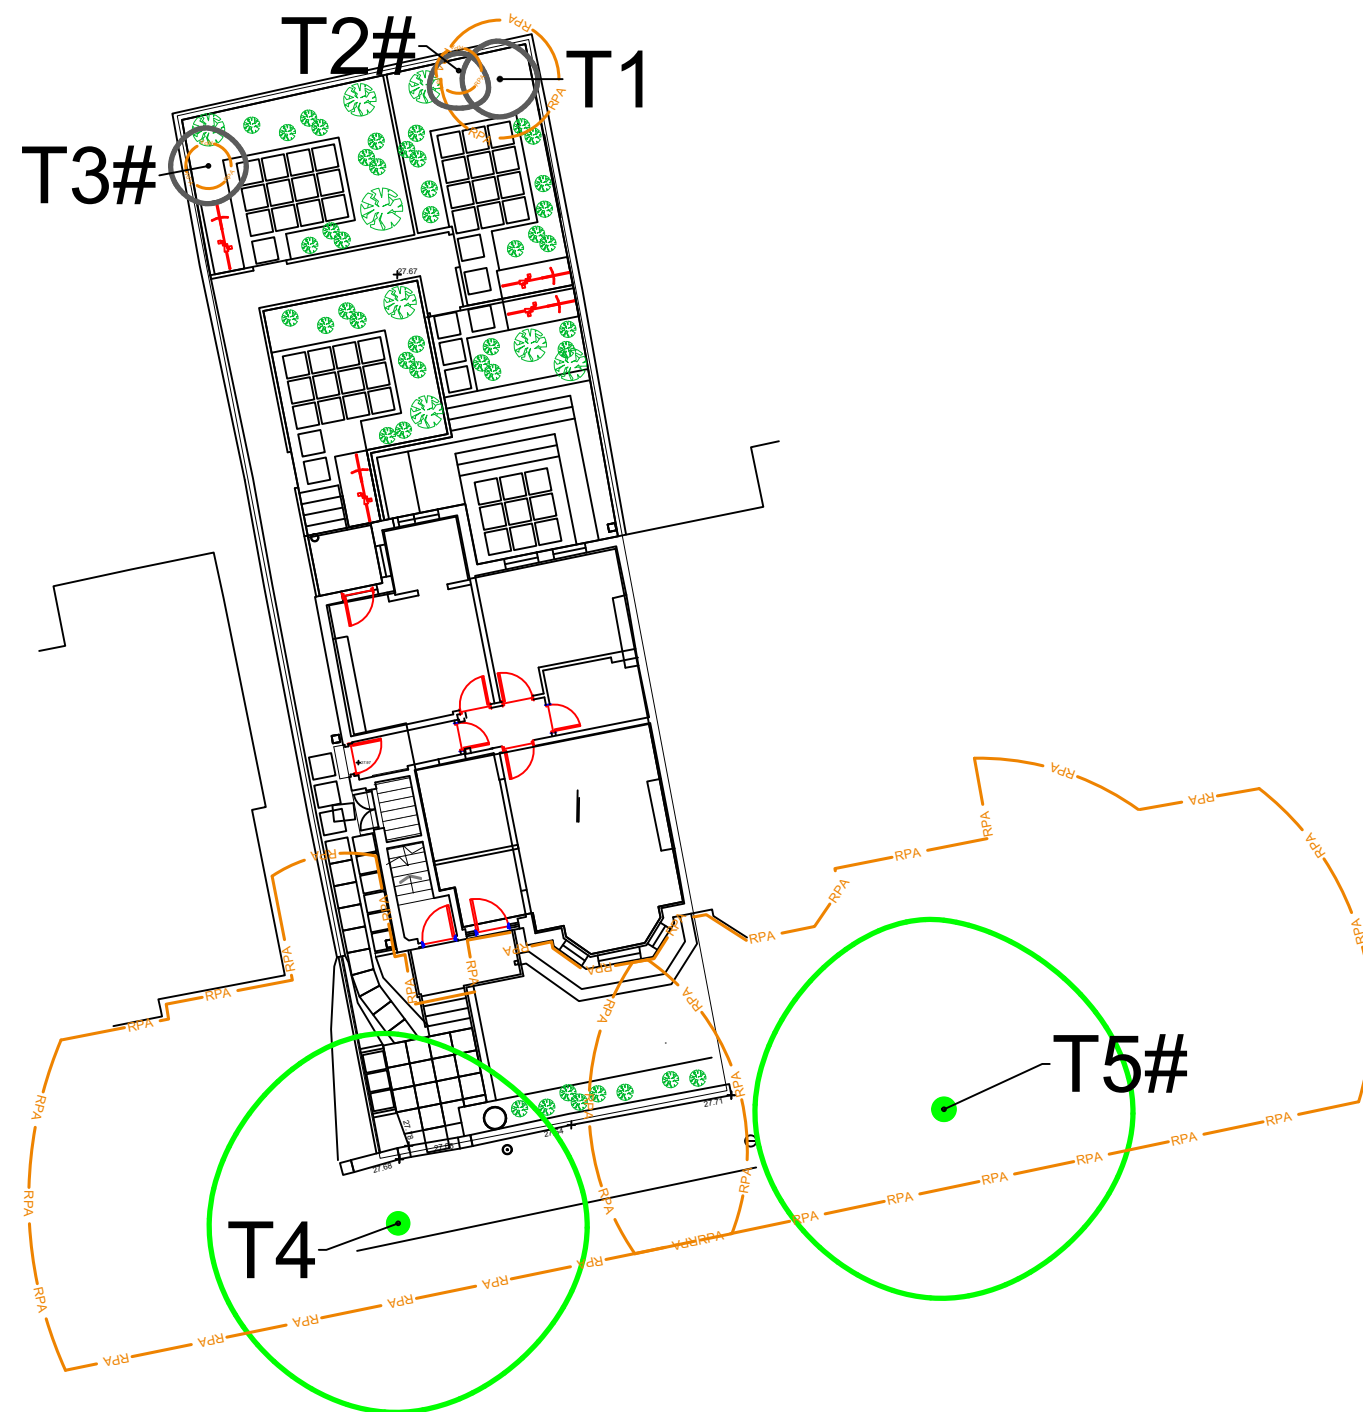

Do not scale this drawing (printed or electronic version).
Contractors must check all dimensions from site.
This drawing is for use on this site only and should be used in conjunction with all relevant consultants drawings..

LEGEND



-  Category A
-  Category B
-  Category C
-  Category U
-  Root Protection Area (RPA)
-  Position estimated on site



Scale:	1:200@A3	Date:	11/05/2022
Job:	LTM0502.AIA.01		
Address	13 Maple Ave, Chorlton-cum-Hardy, Manchester M21 8BD		
Client:	Armistead Property Ltd		
Drawing Number:	LTM0502.AIP.01		
Drawn by:	Matthew Lally		
ARBORICULTURAL IMPLICATIONS PLAN			