





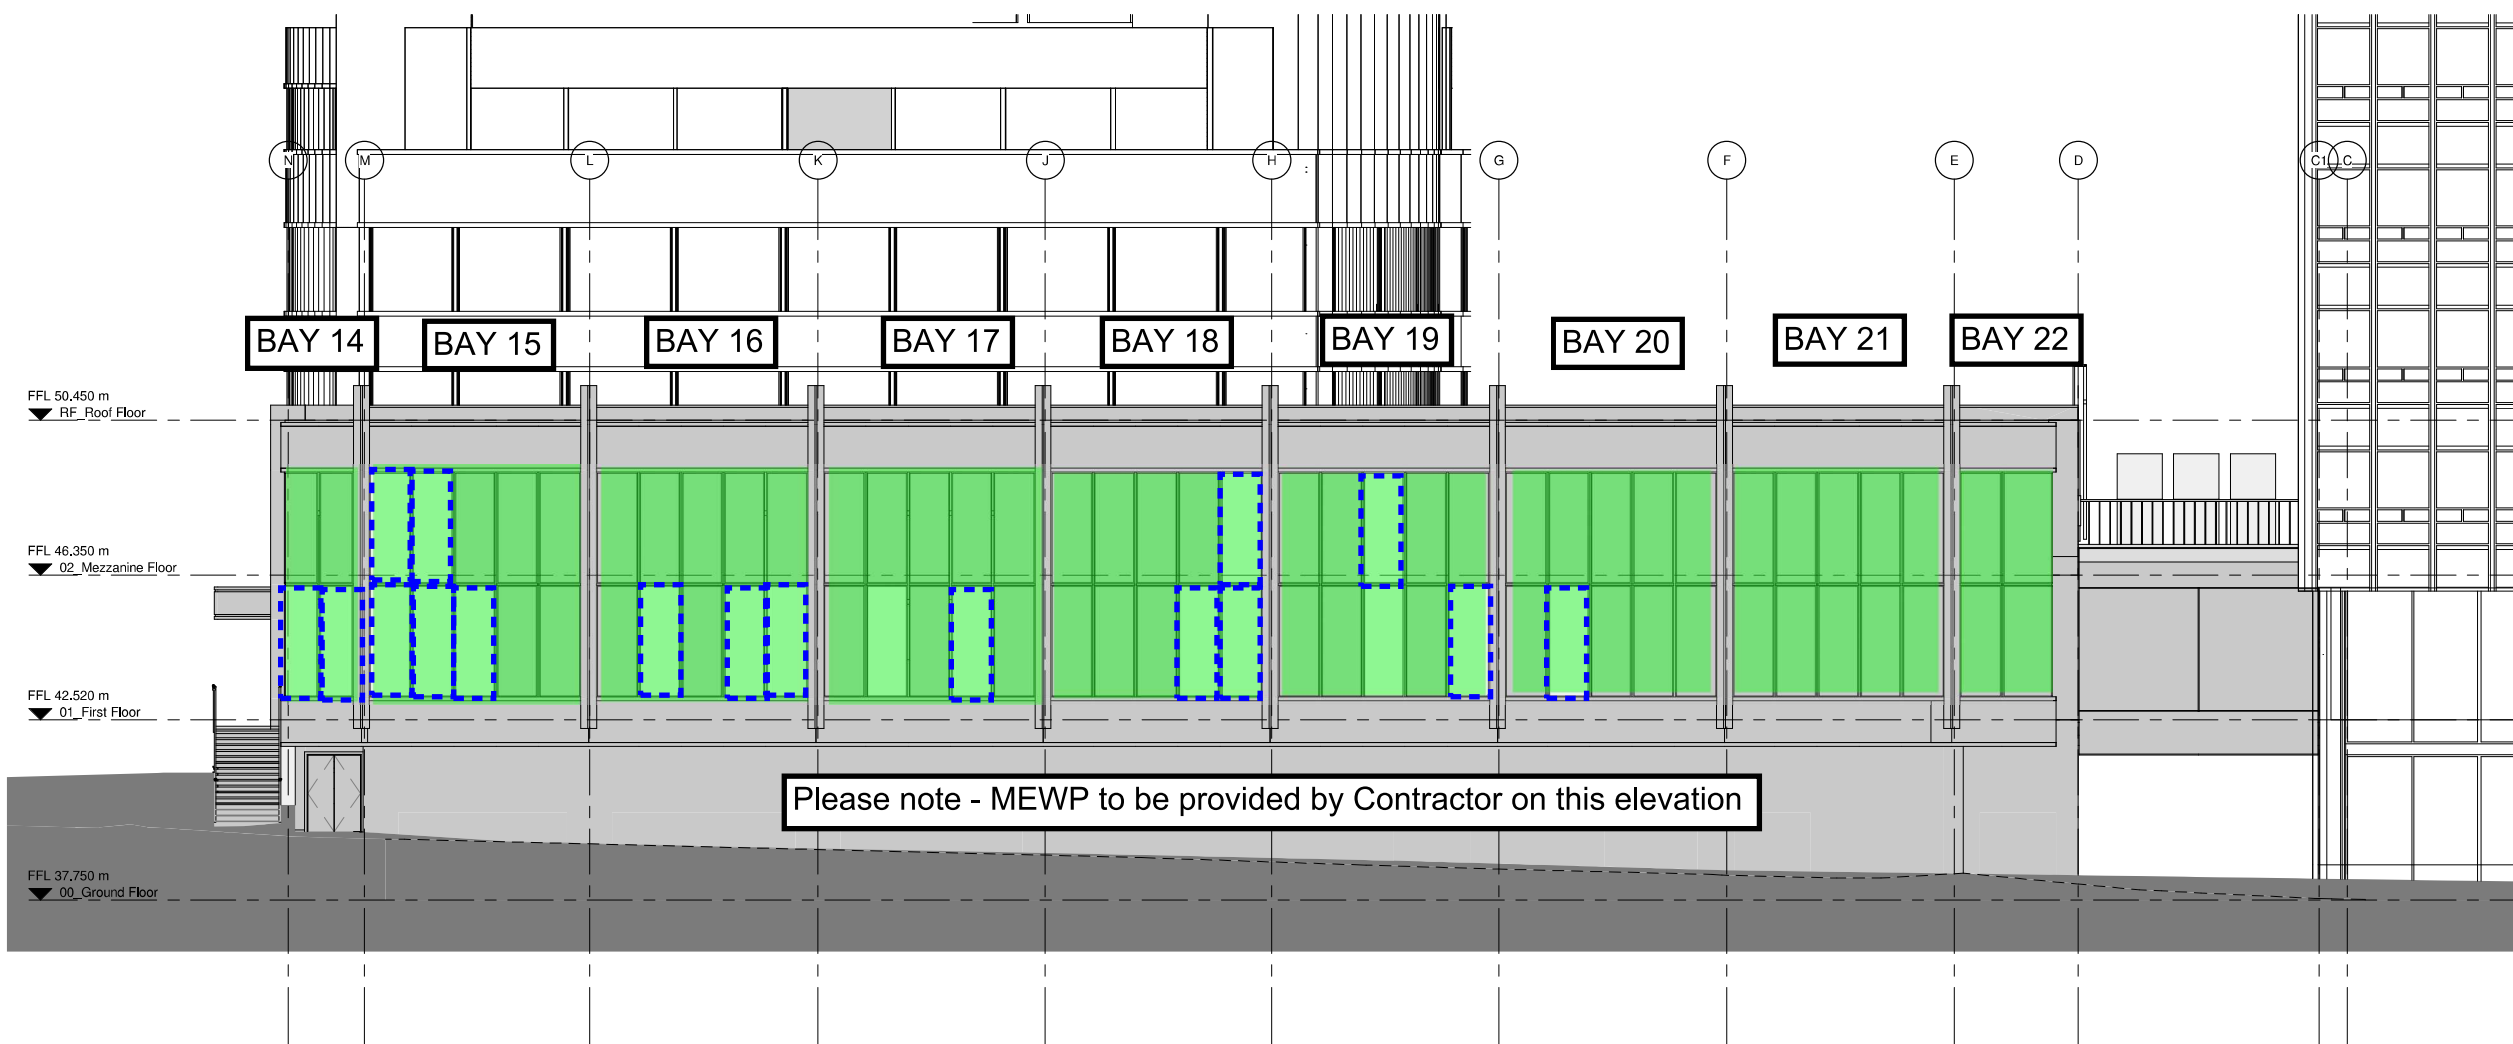

**North Elevation - Miller Street**  
1 : 100

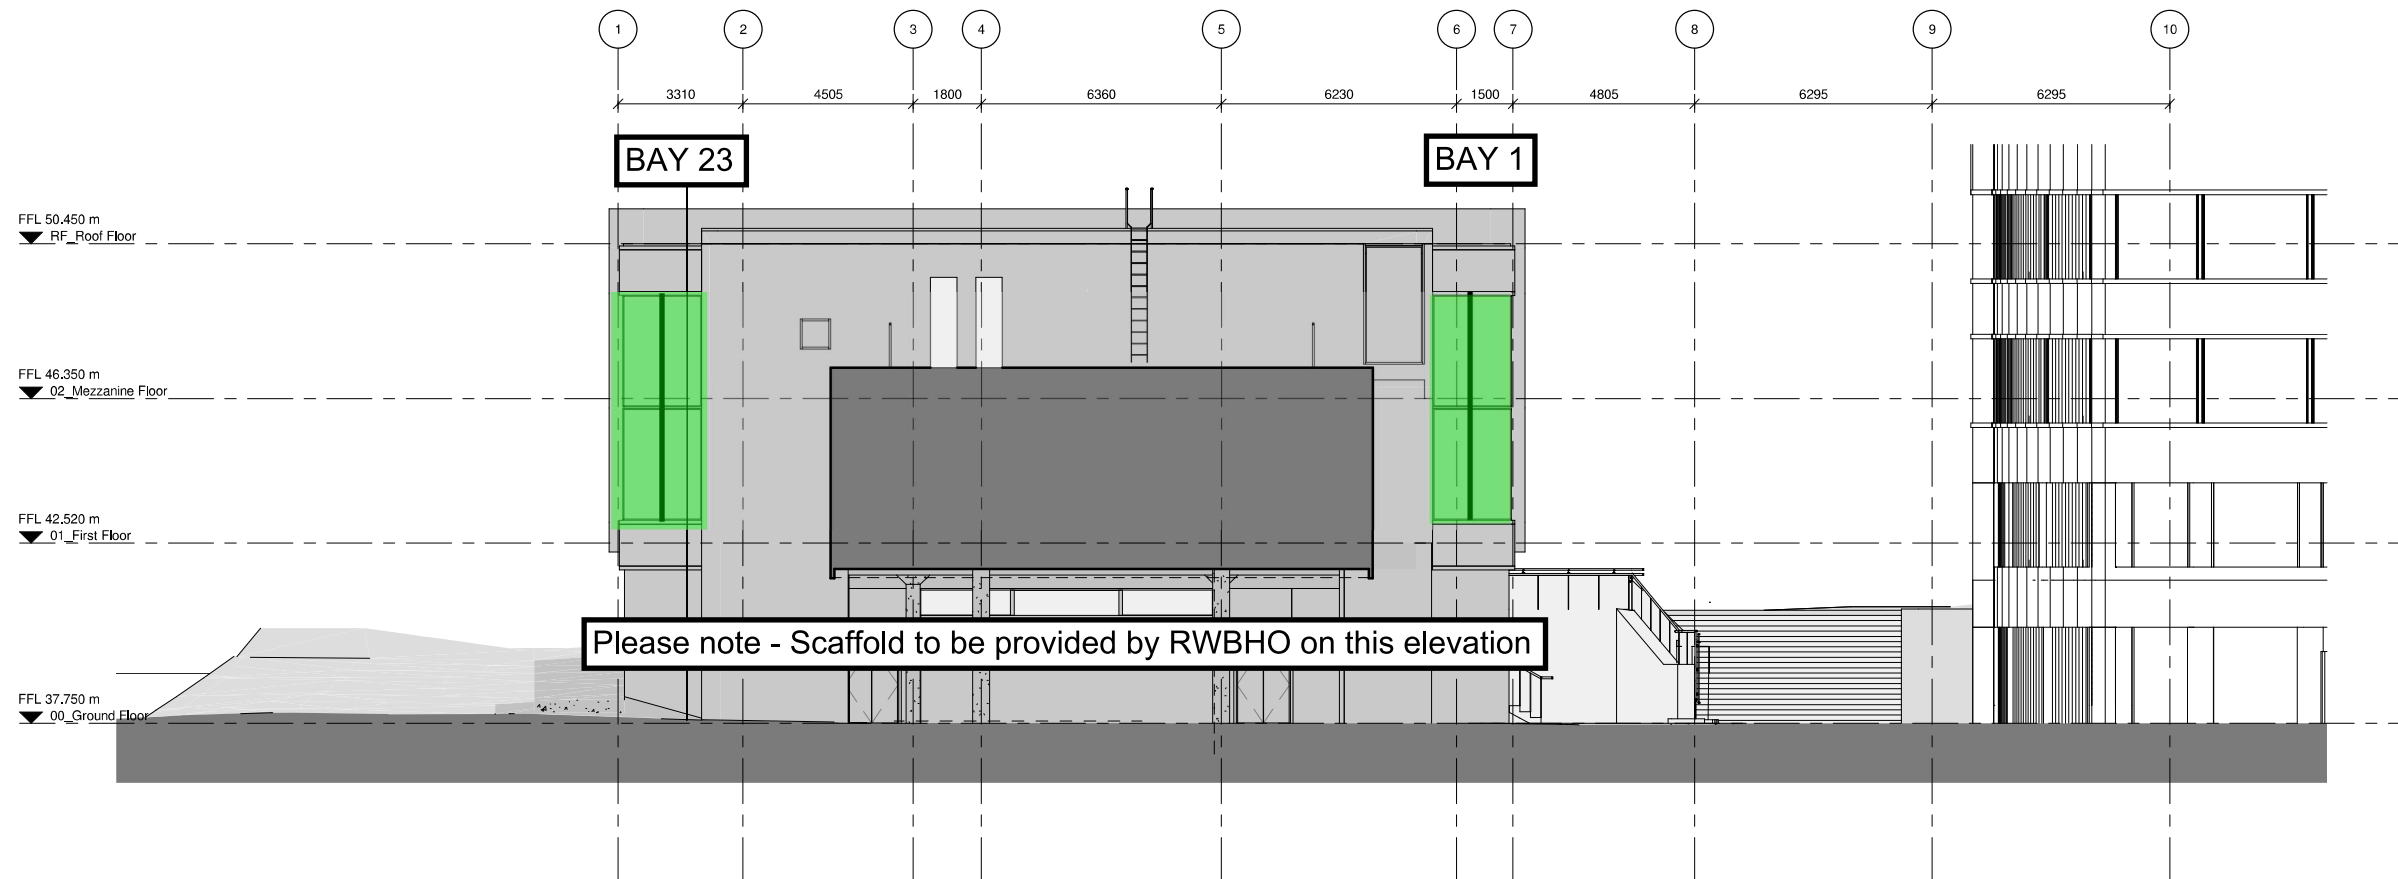


**GA Existing West Elevation - Pedestrian Link**  
1 : 100




Black structural mastic to be applied to the perimeter of all windows


**New Century Hall - Scope of Works -**  
**Exisitng Curtain Wall - Mastic Works -**  
**07/05/21 - Rev A**

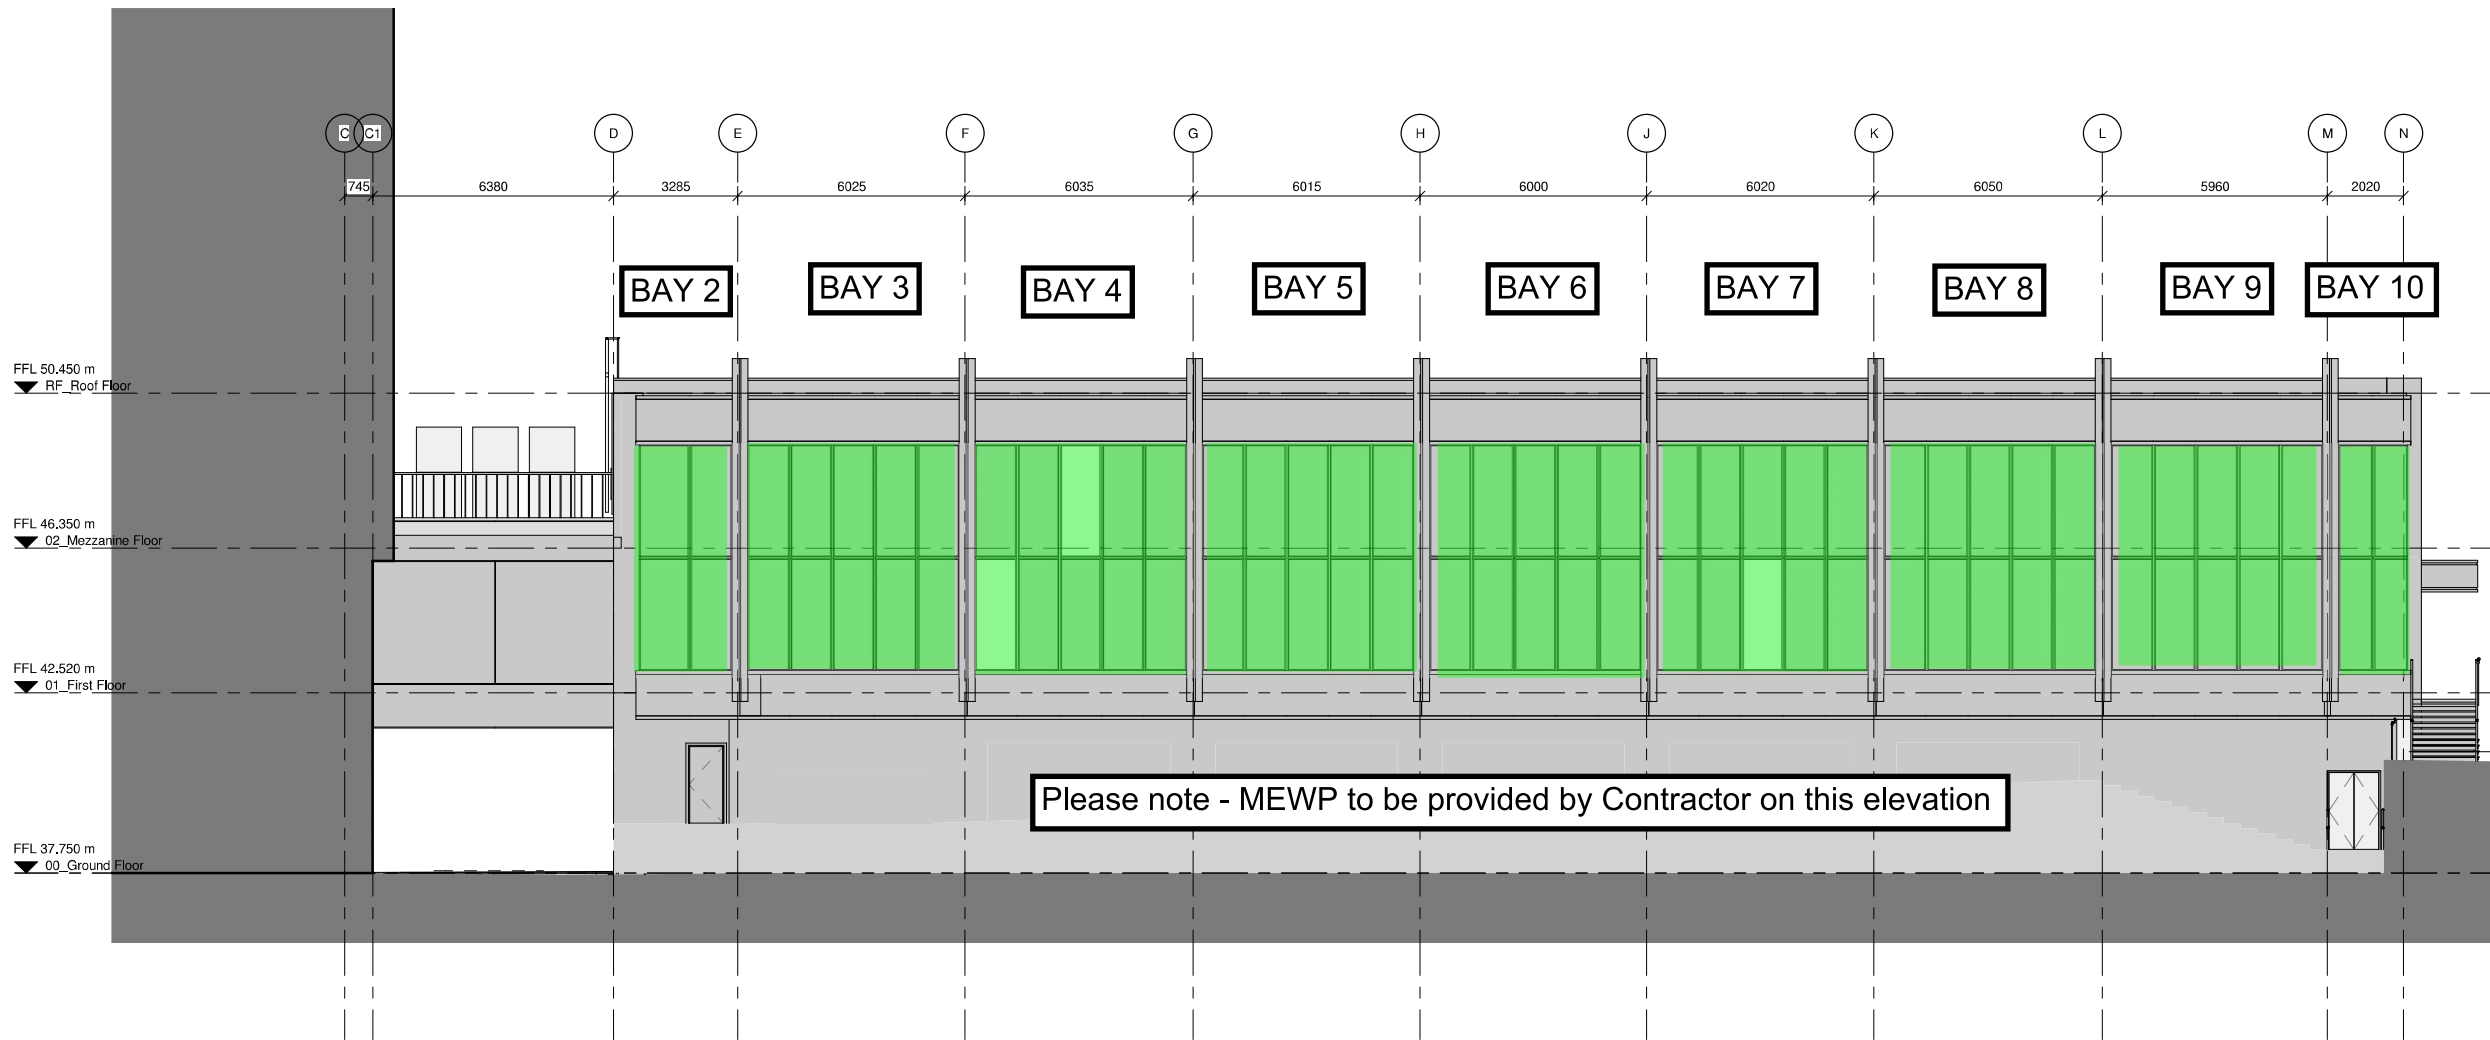


GA Existing South Elevation - Mayes Street  
1 : 100

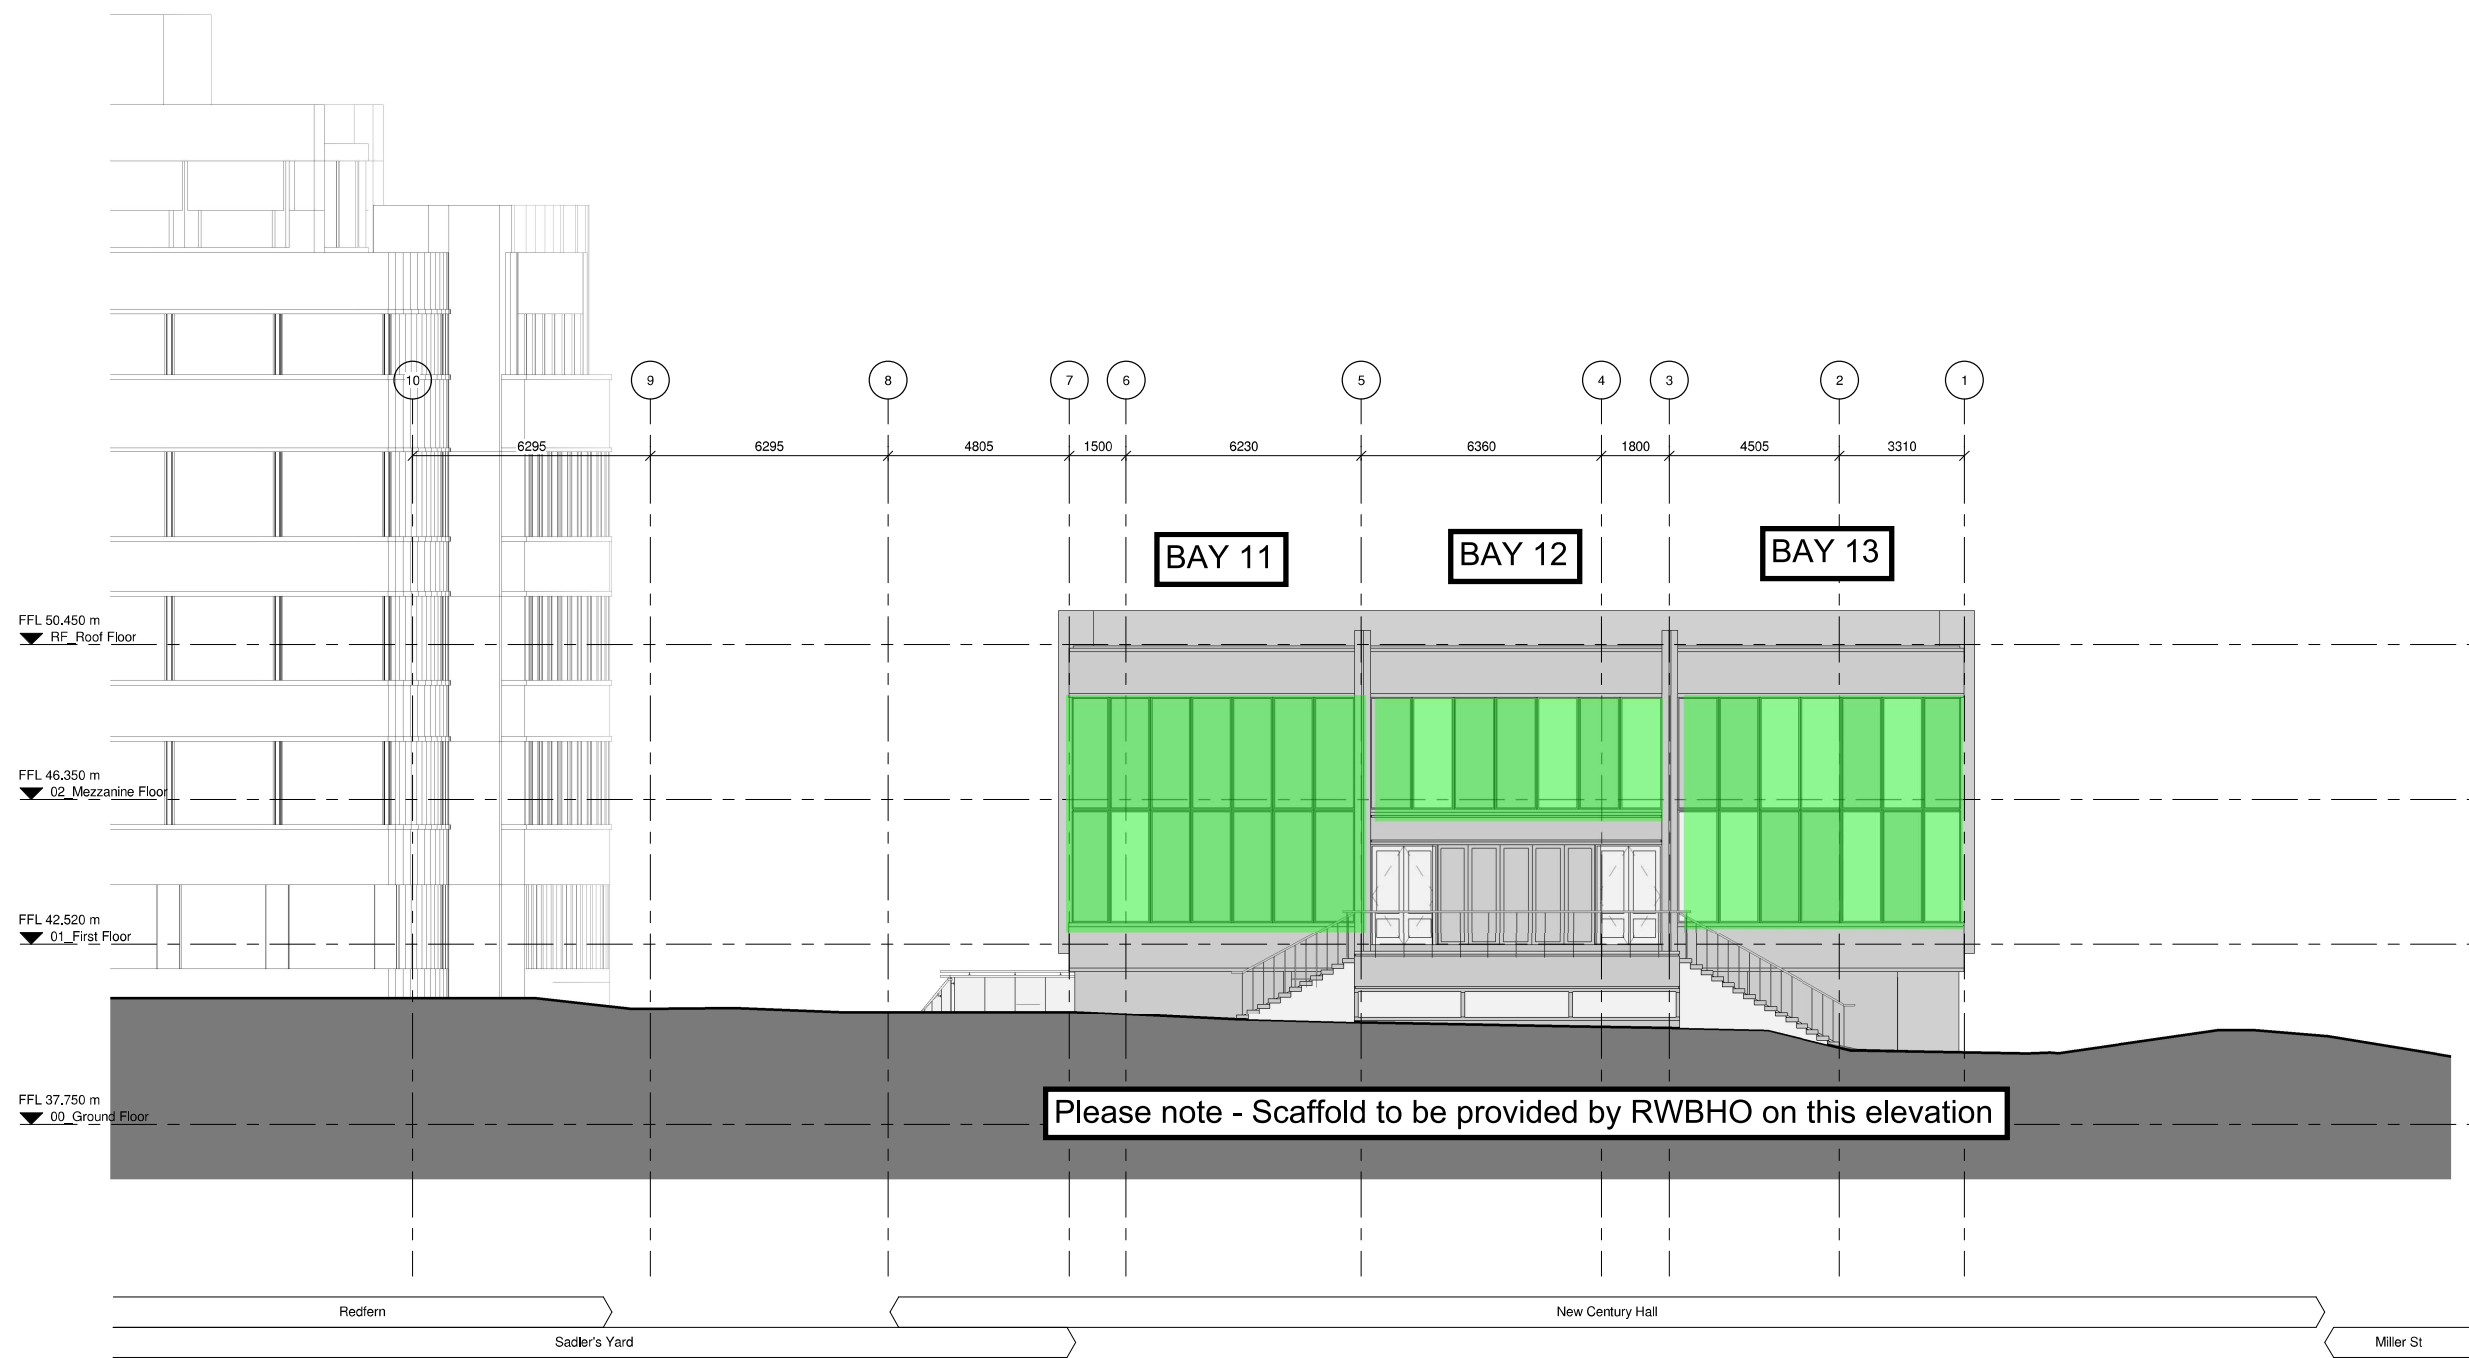

**GA Existing East Elevation - Dantzic Street**  
1:100

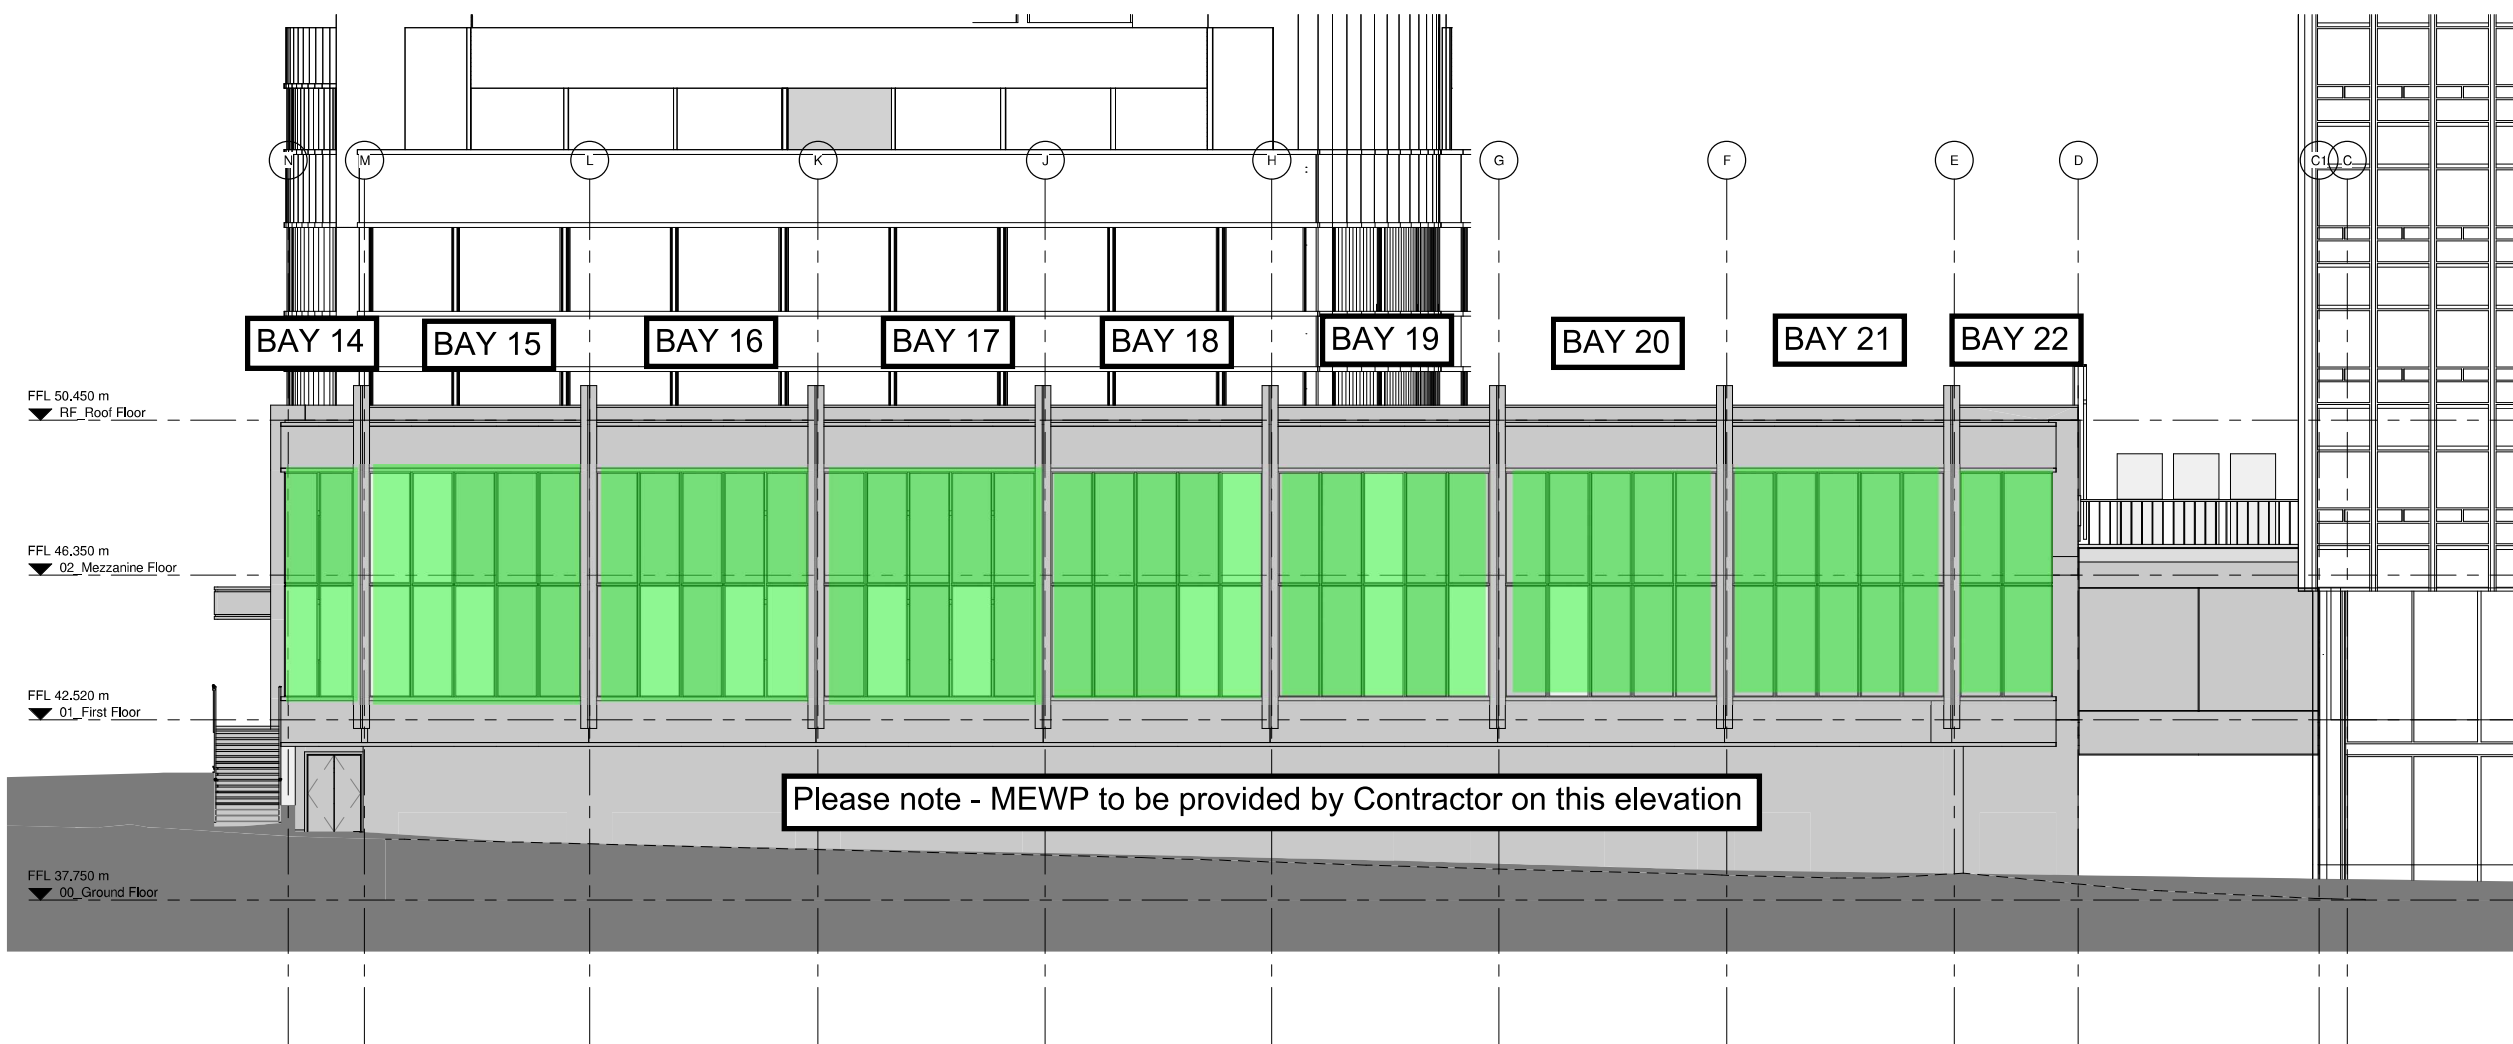

**North Elevation - Miller Street**  
1 : 100

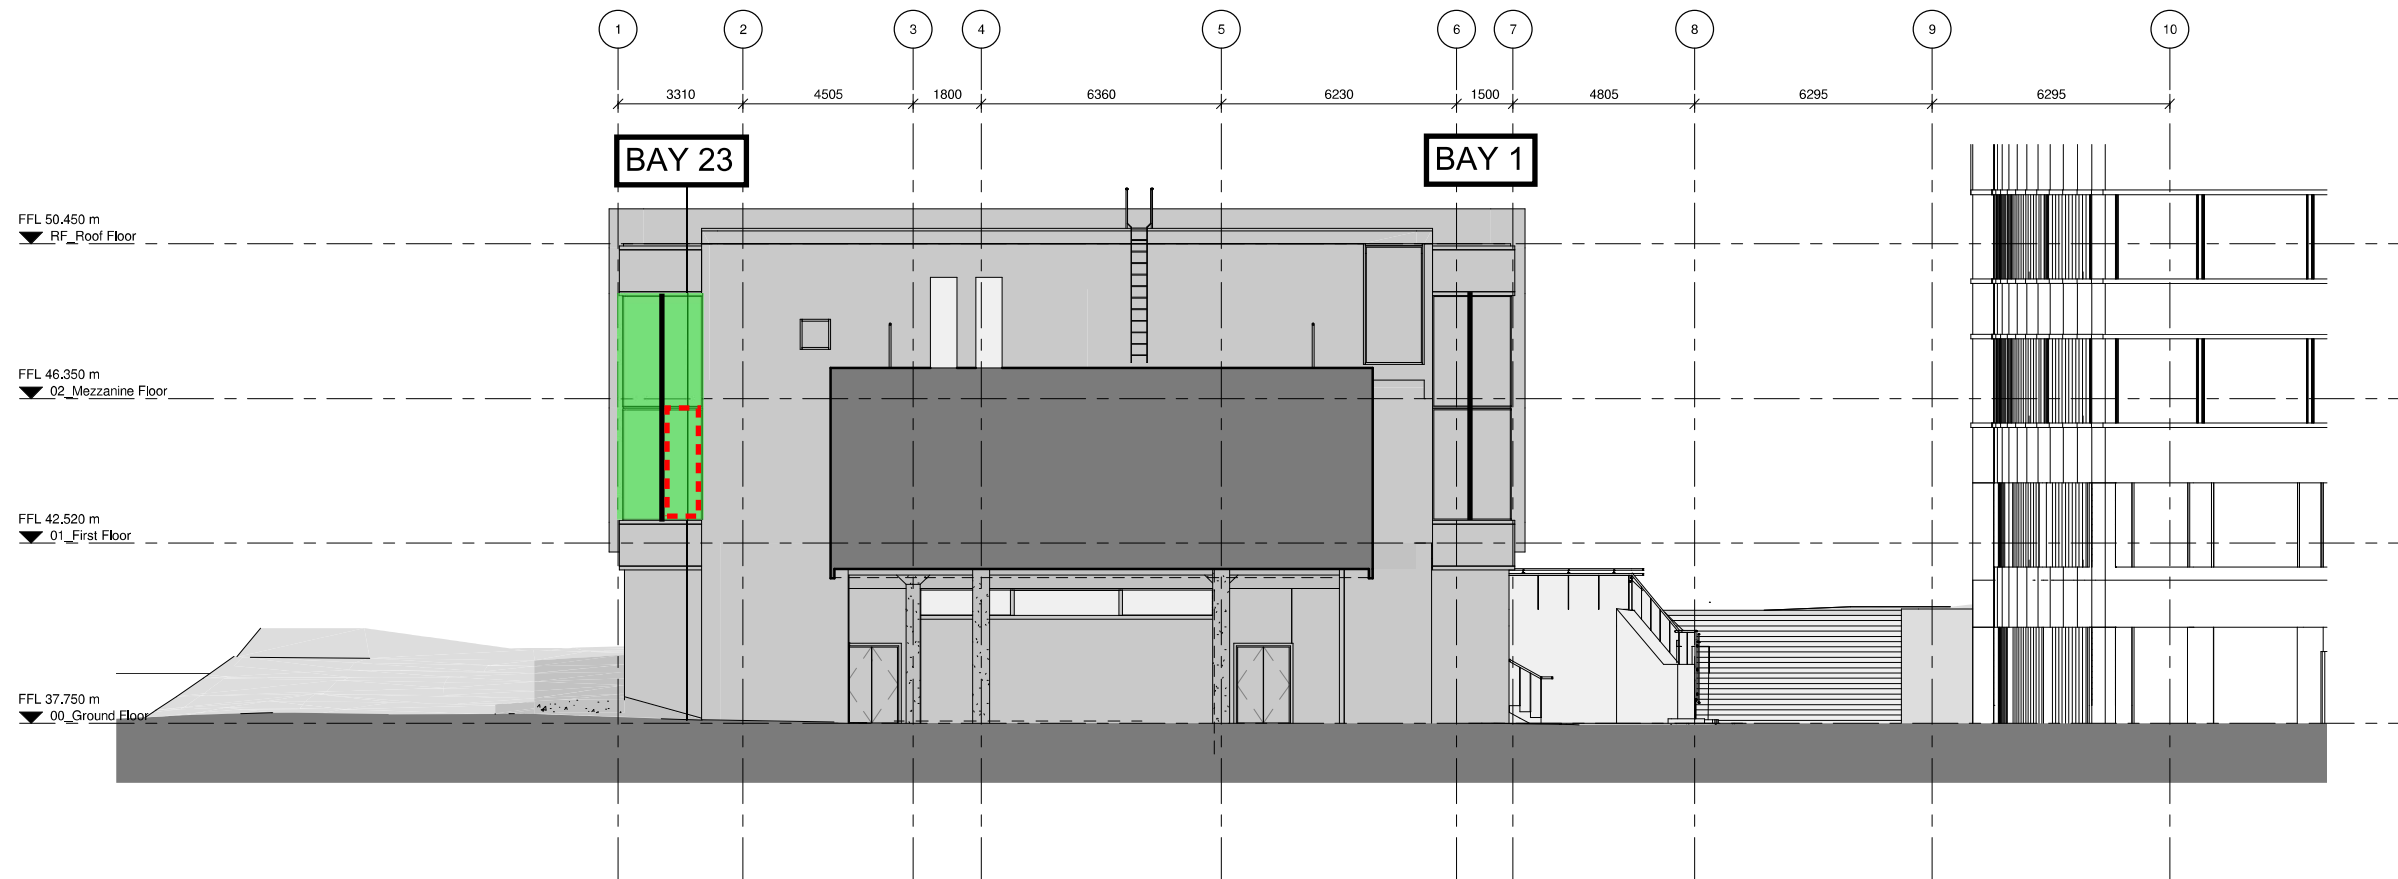

**GA Existing West Elevation - Pedestrian Link**  
1 : 100




Install previously removed glass and new glass as highlighted in green and red. Remove existing butyl mastic, prepare opening and adhere new butyl tape to the perimeter of each frame. Existing beads to be reused with new fixings required. Access is to be via MEWP's.




New glass to be installed in these locations.


## New Century Hall - Scope of Works - Exisitng Curtain Wall - Glazing Works - 11/05/21 - Rev B

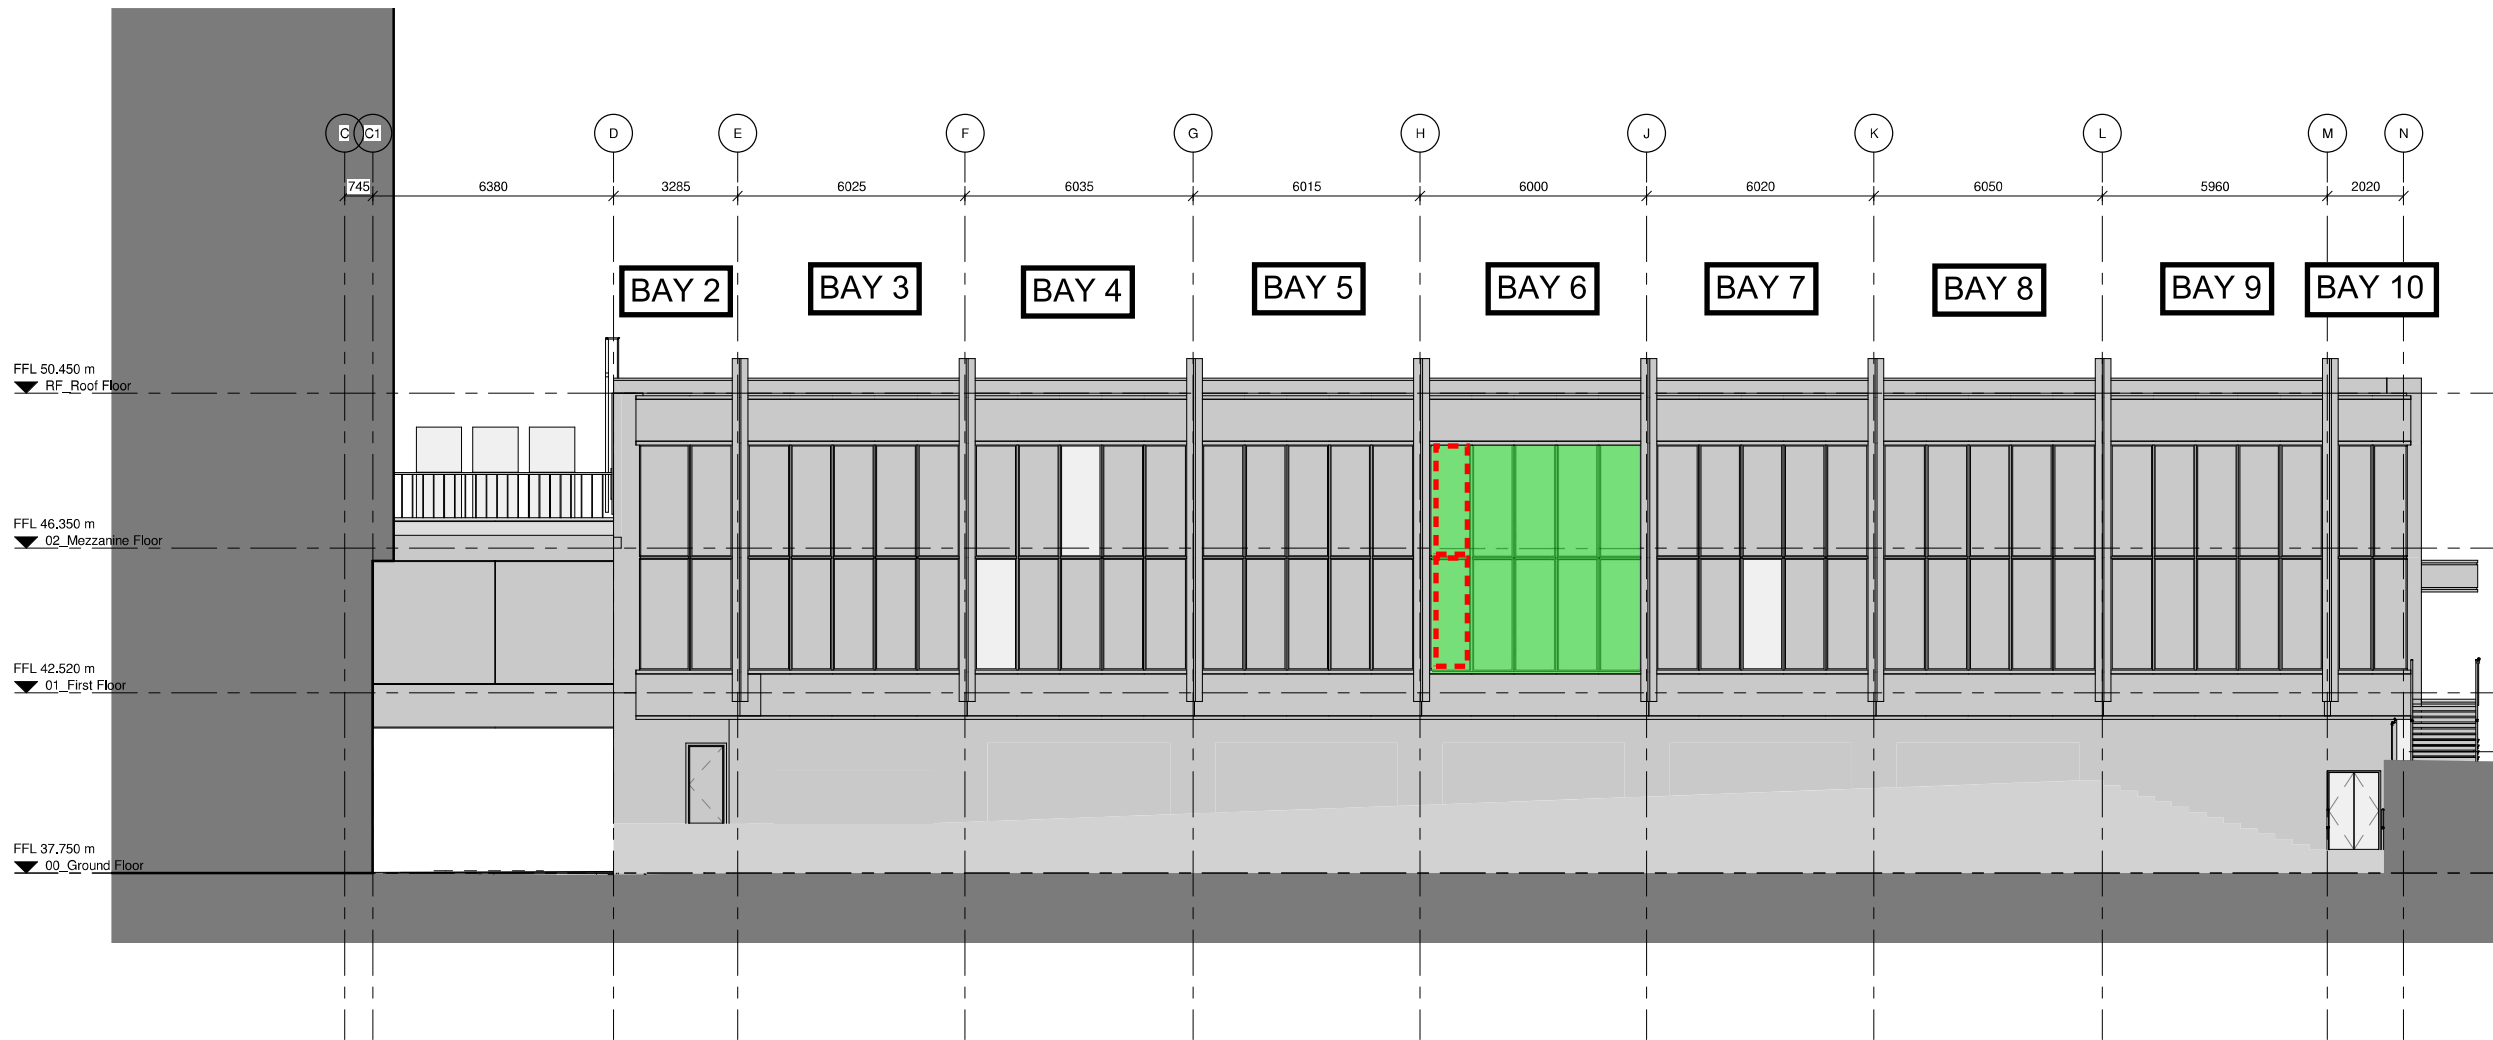


GA Existing South Elevation - Mayes Street  
1 : 100

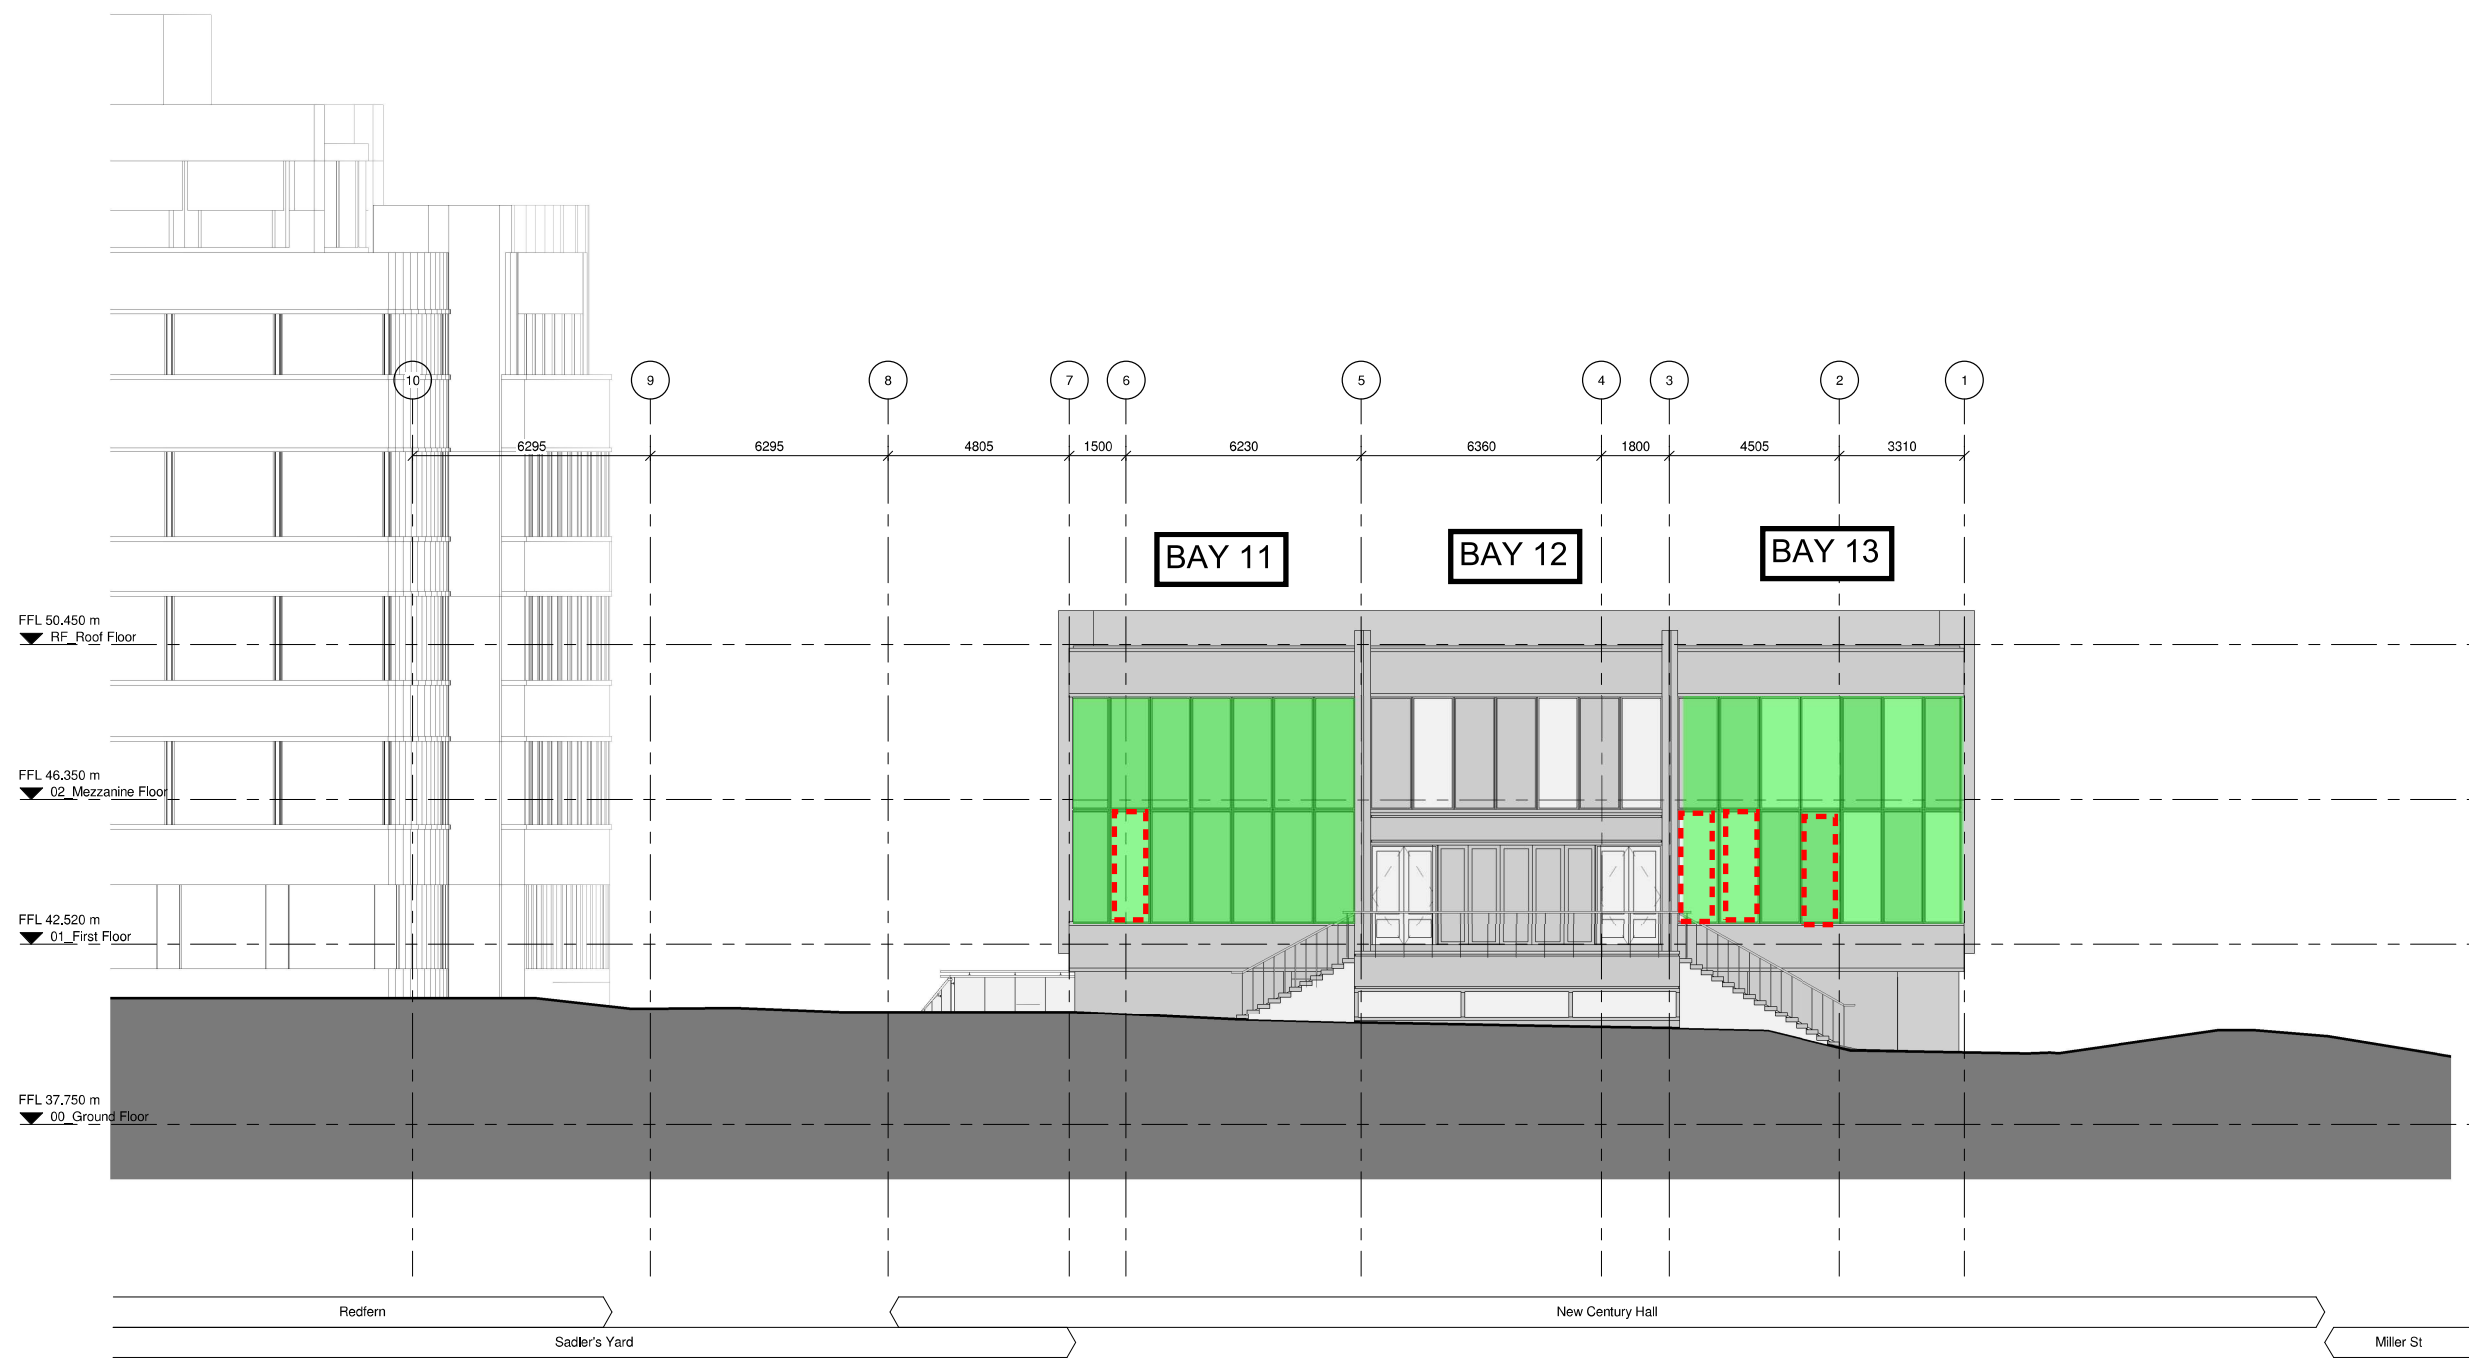


**GA Existing East Elevation - Dantzic Street**  
1:100

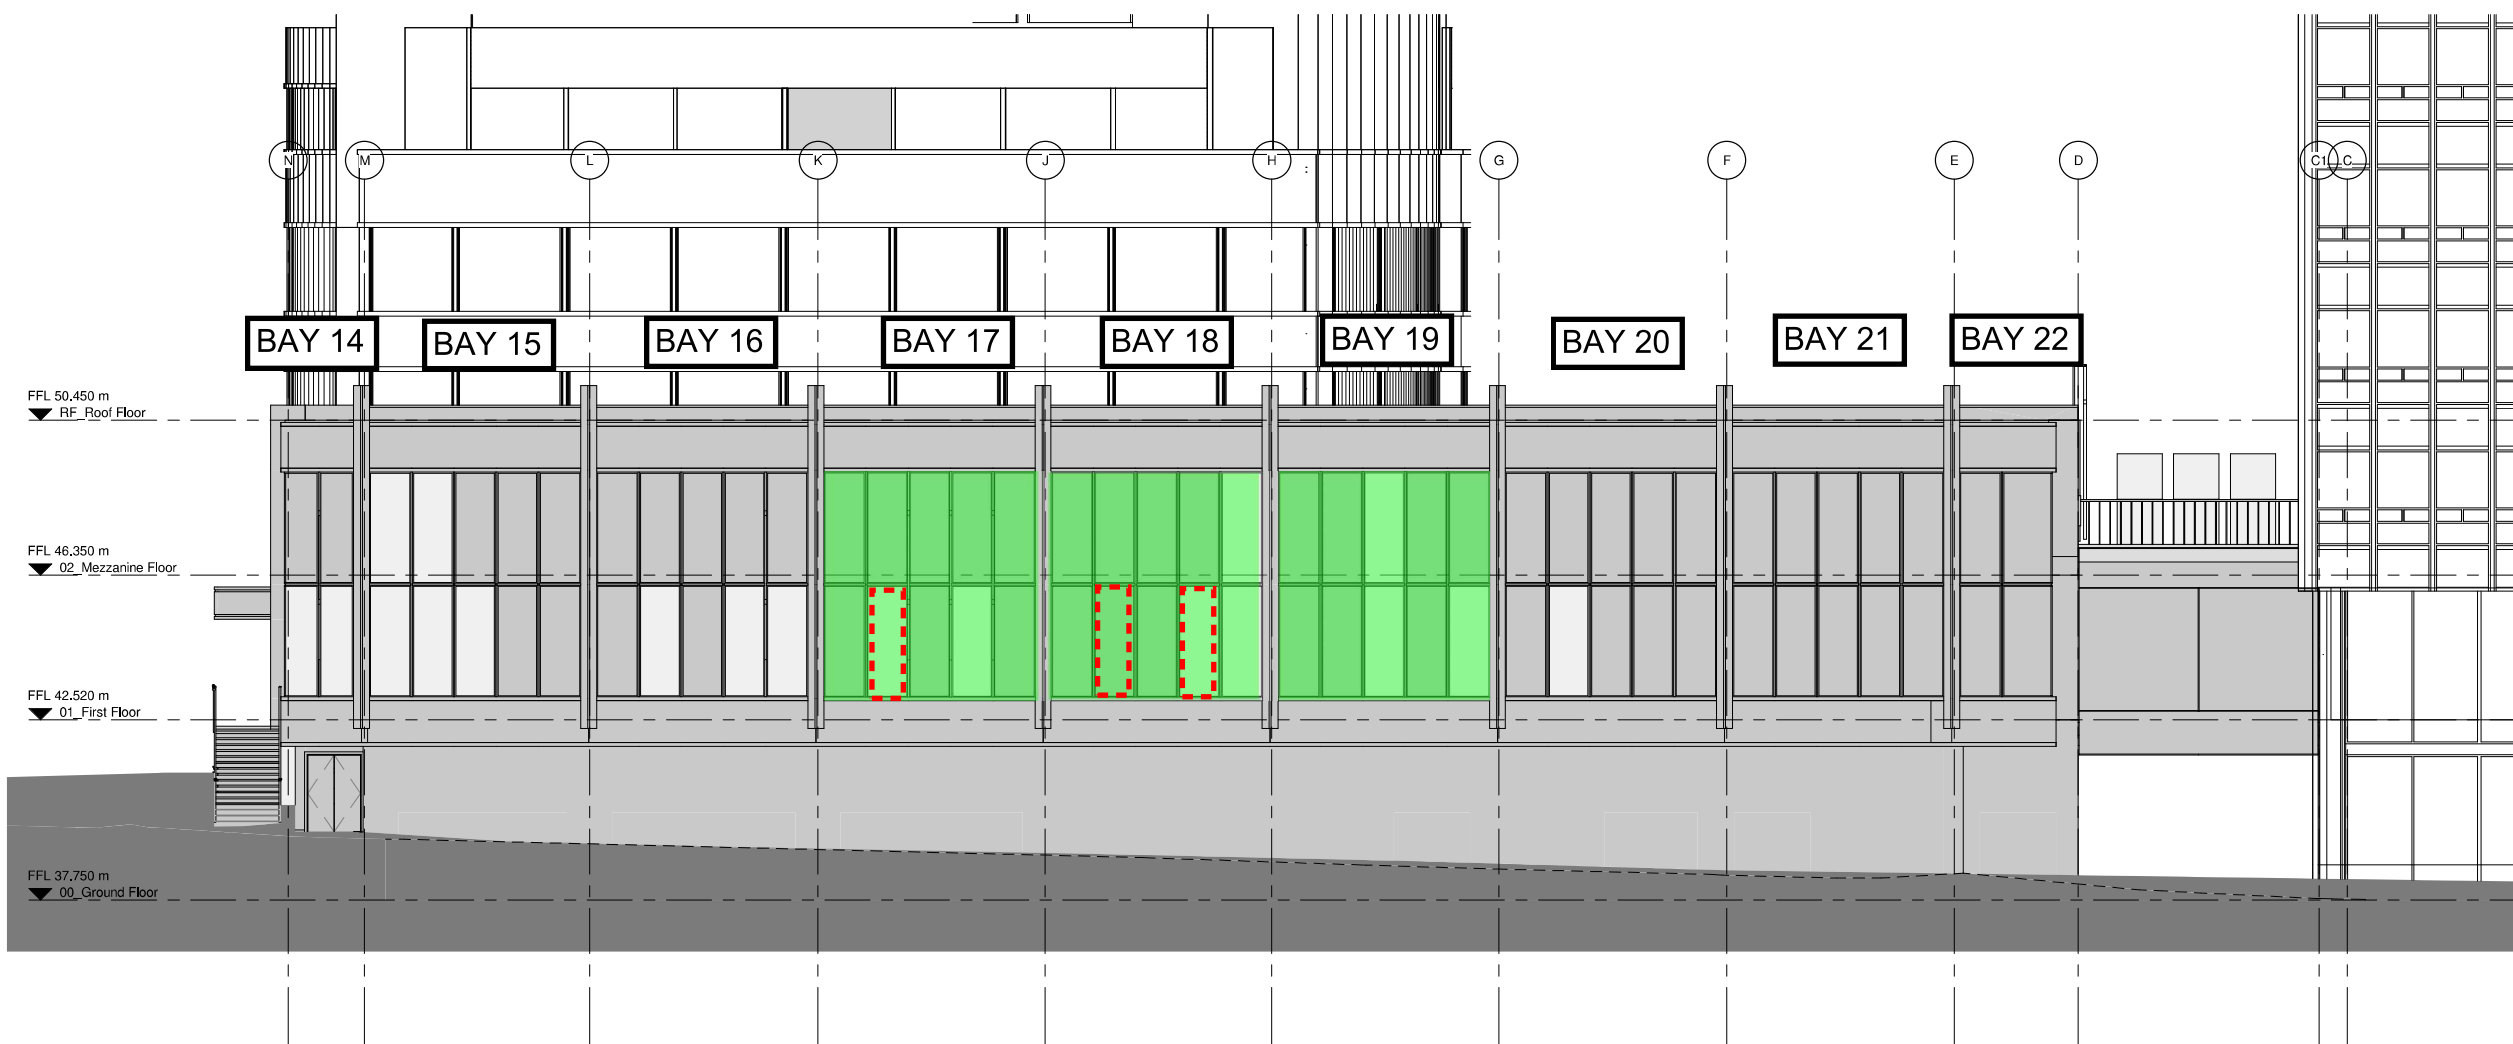

**North Elevation - Miller Street**  
1 : 100

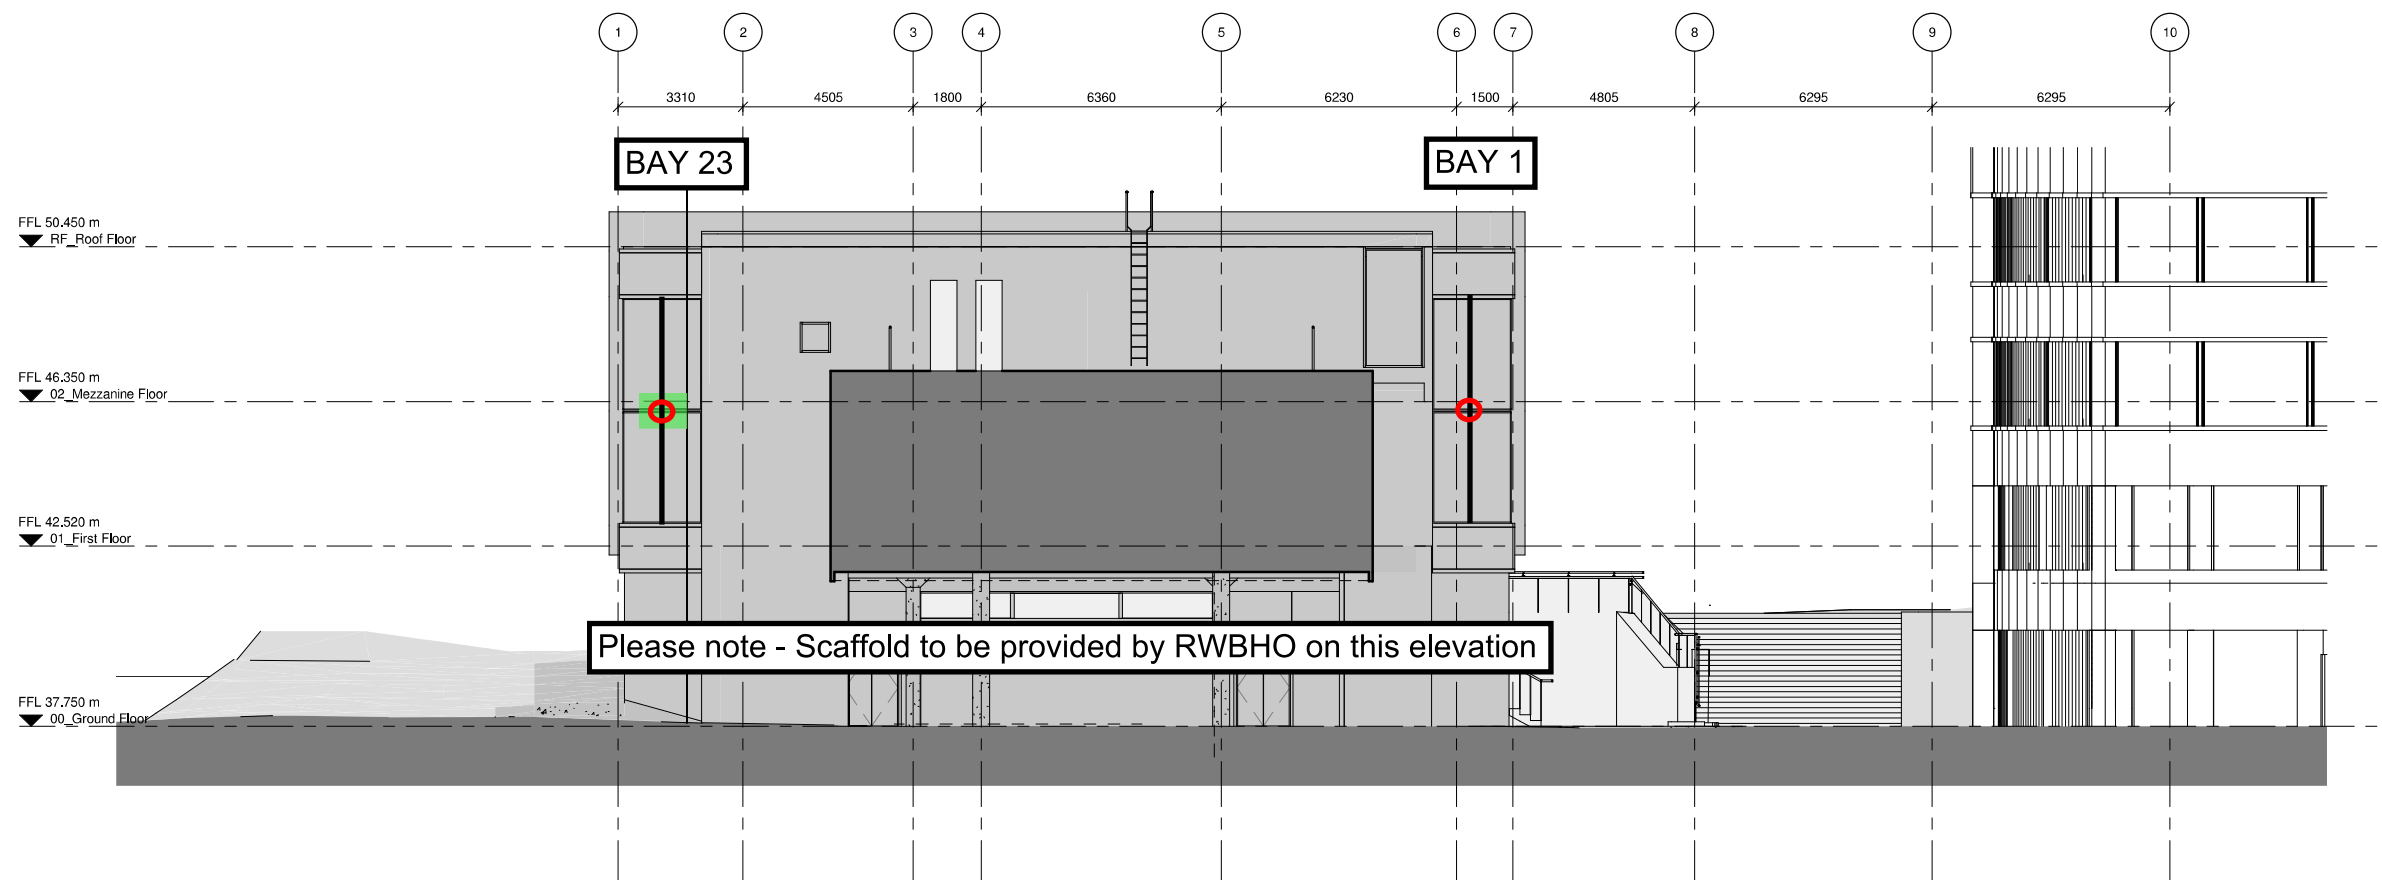

GA Existing West Elevation - Pedestrian Link  
1 : 100

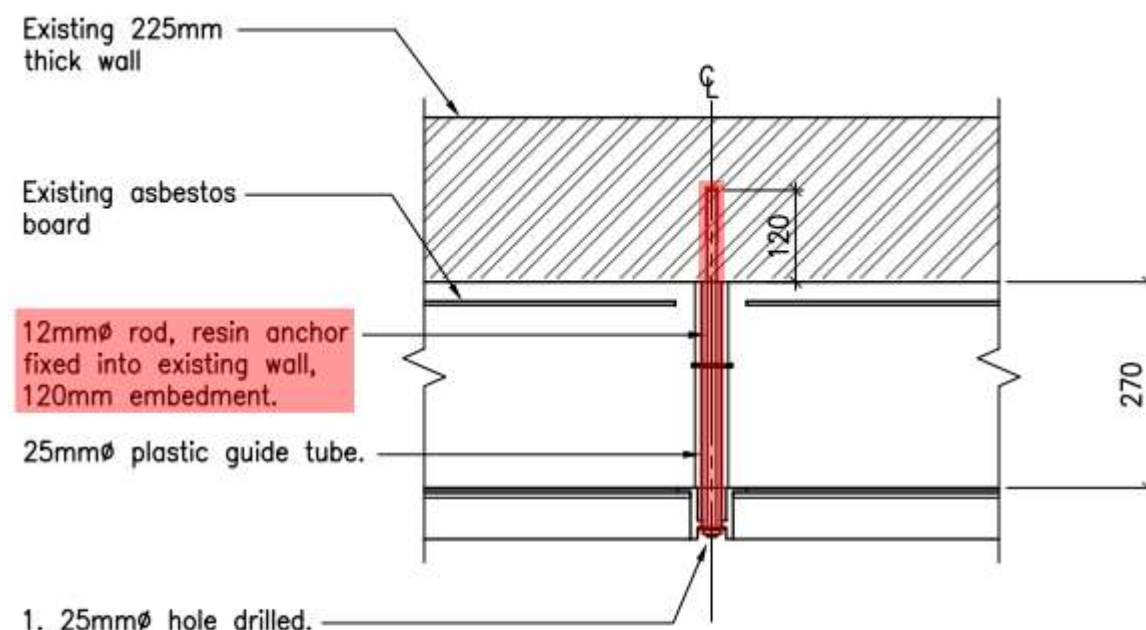


1. 25mmØ hole drilled.
2. 35mm wide x 75mm long x 5mm thick washer plate, with 14mmØ hole drilled in centre (Plate backed with neoprene to isolate aluminum from existing steel).
3. 12mmØ rod, resin anchor fixed into existing wall, 120mm embedment.


### STAGE 1 (1:10@A1)

- Carry out pull test and report as highlighted in green to each fixing - 29no (39%). Allow for all other stage 1 fixings to be torqued, along with report to monitor this further down the line - 45no (61%).
- Stage 1 fixing works circled/highlighted in red. Fixing to be embedded into Hilti- HY-200 resin.


## New Century Hall - Scope of Works - Existing Curtain Wall - Central Fixings - 11/05/21 - Rev B

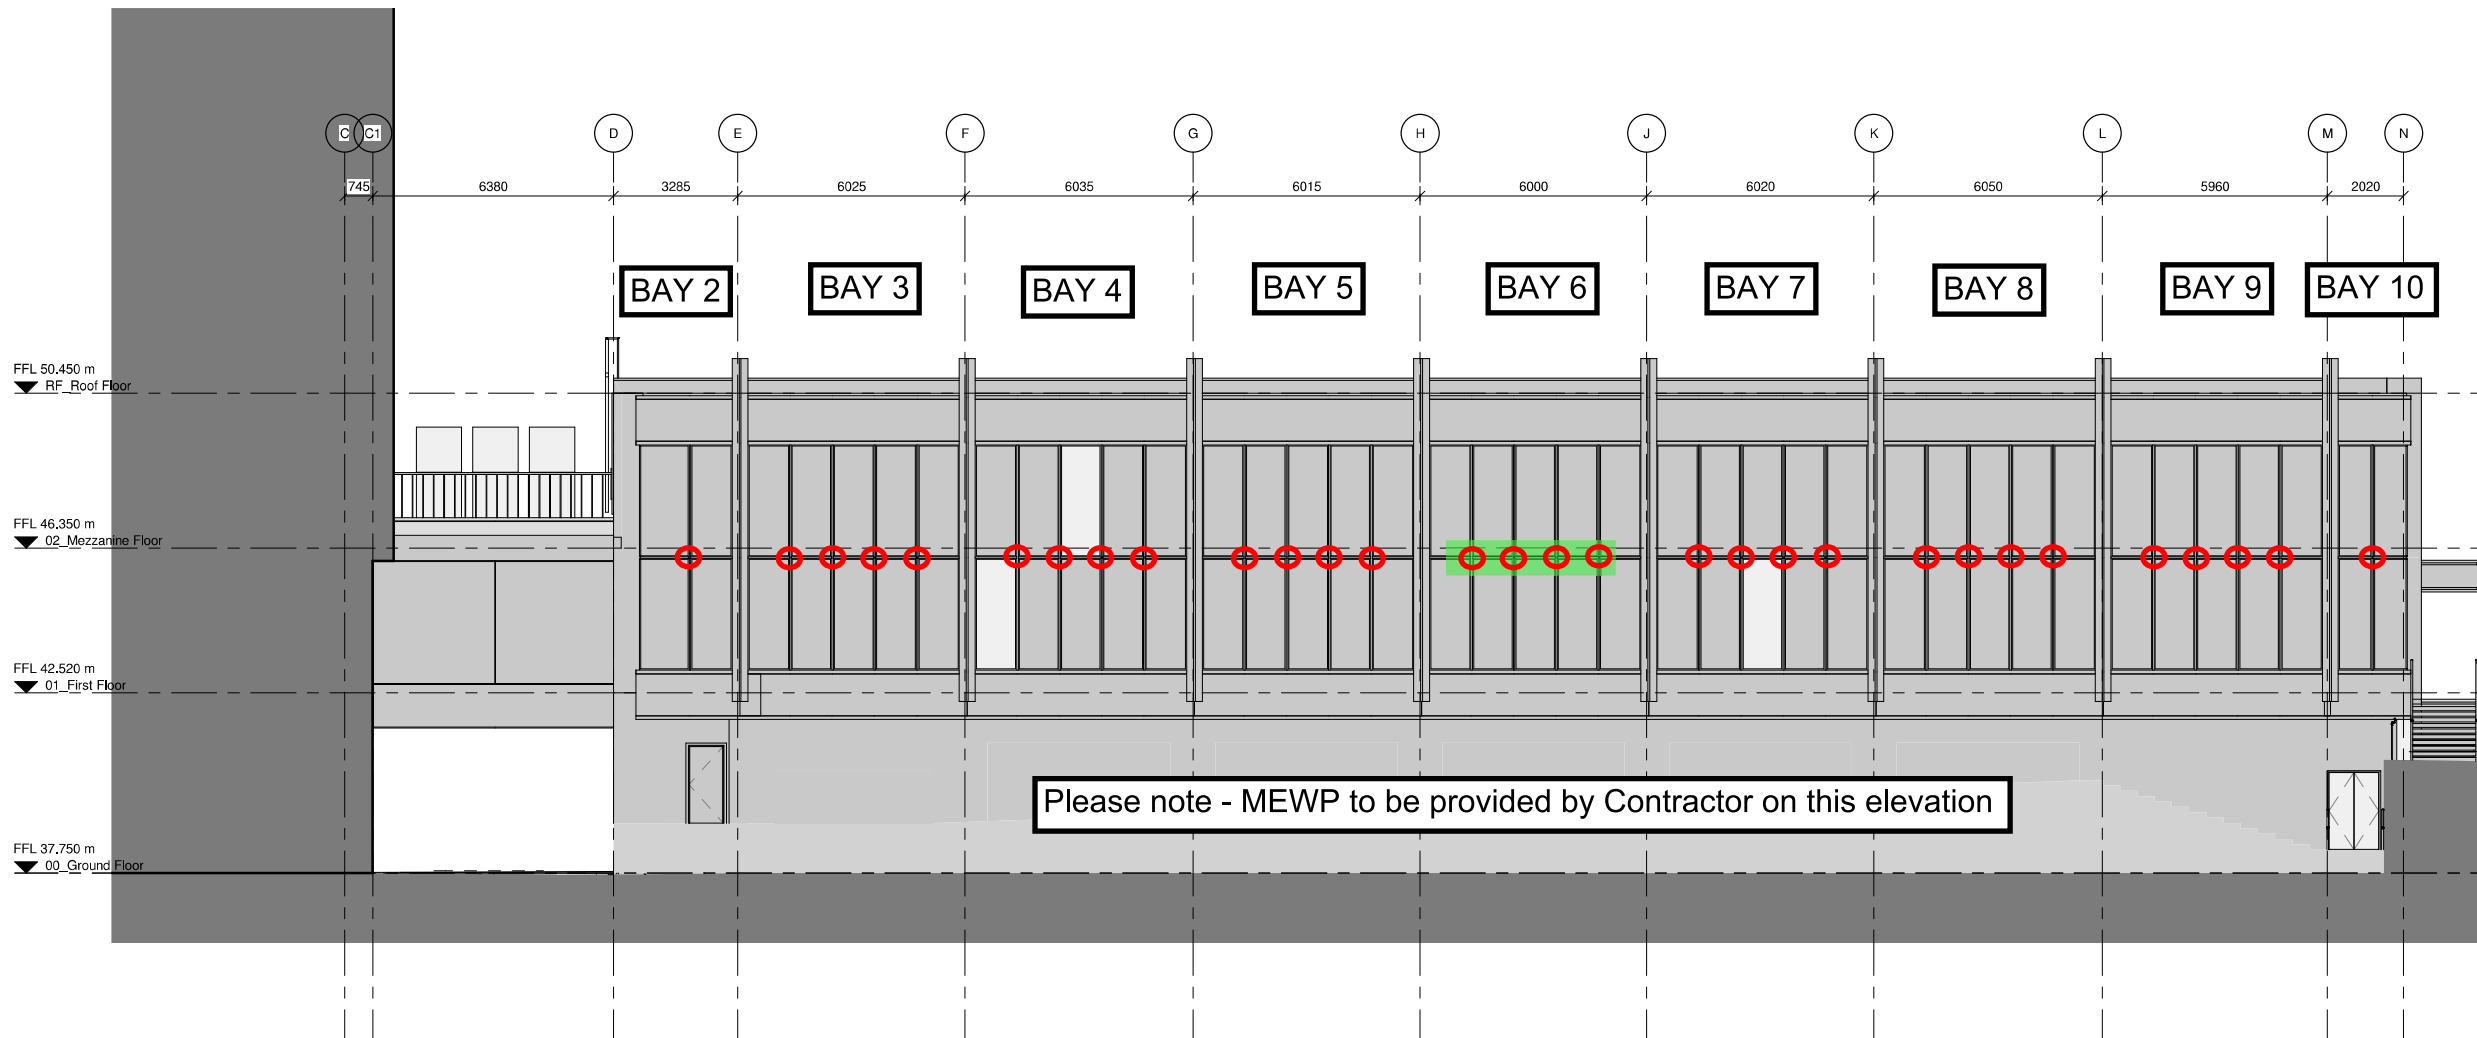

GA Existing South Elevation - Mayes Street  
1 : 100

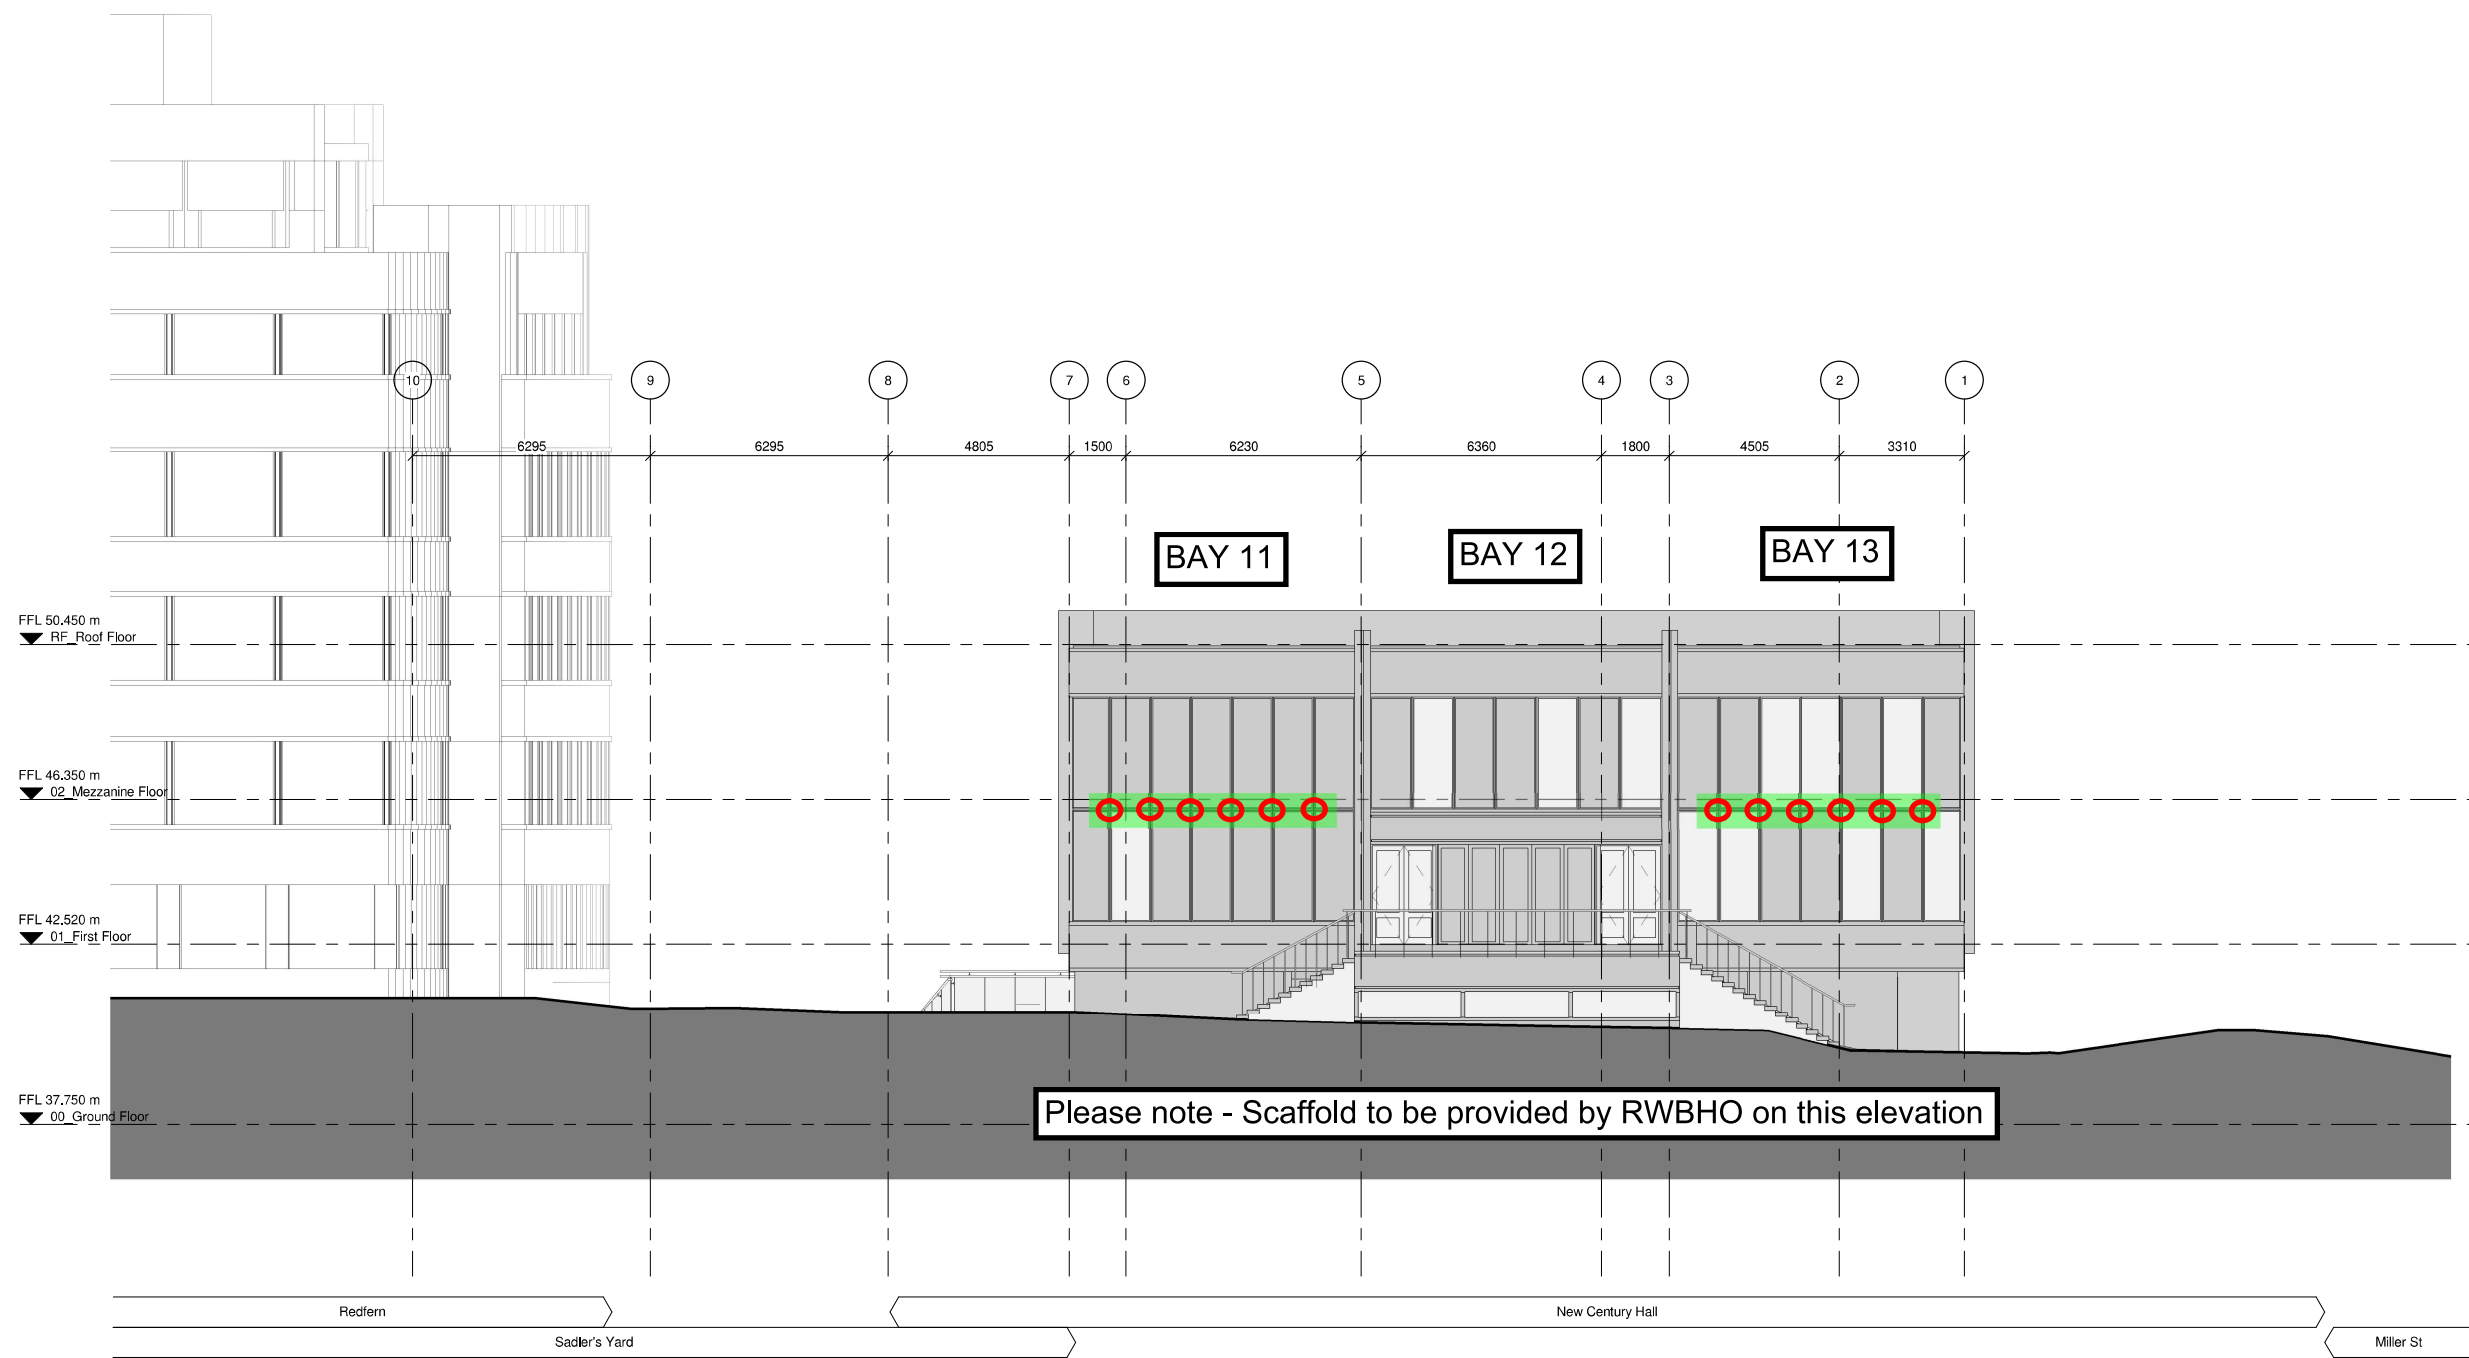

**GA Existing East Elevation - Dantzic Street**  
1:100

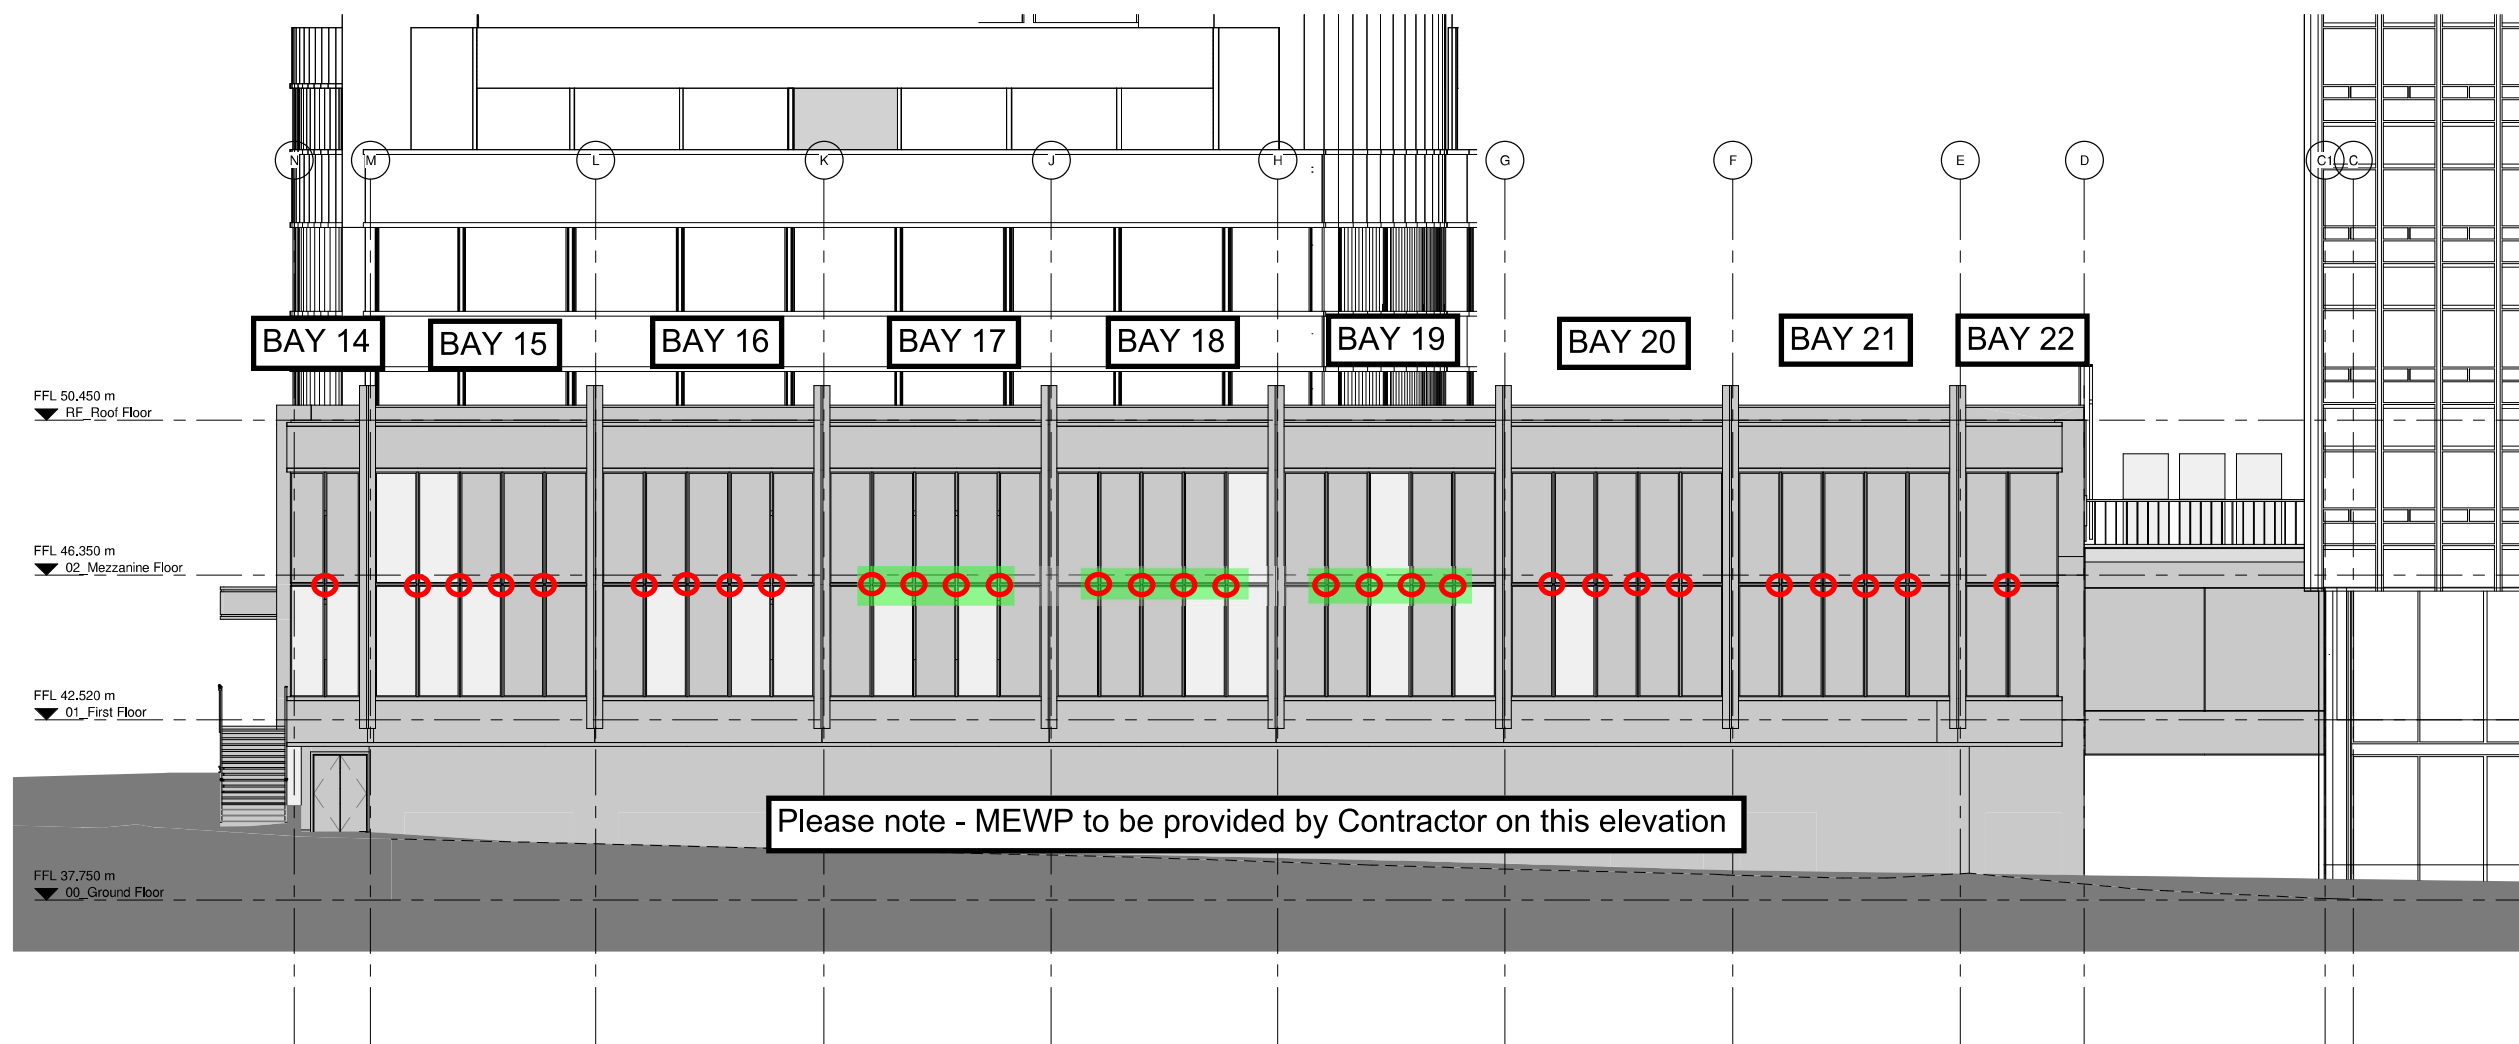

**North Elevation - Miller Street**  
1 : 100