



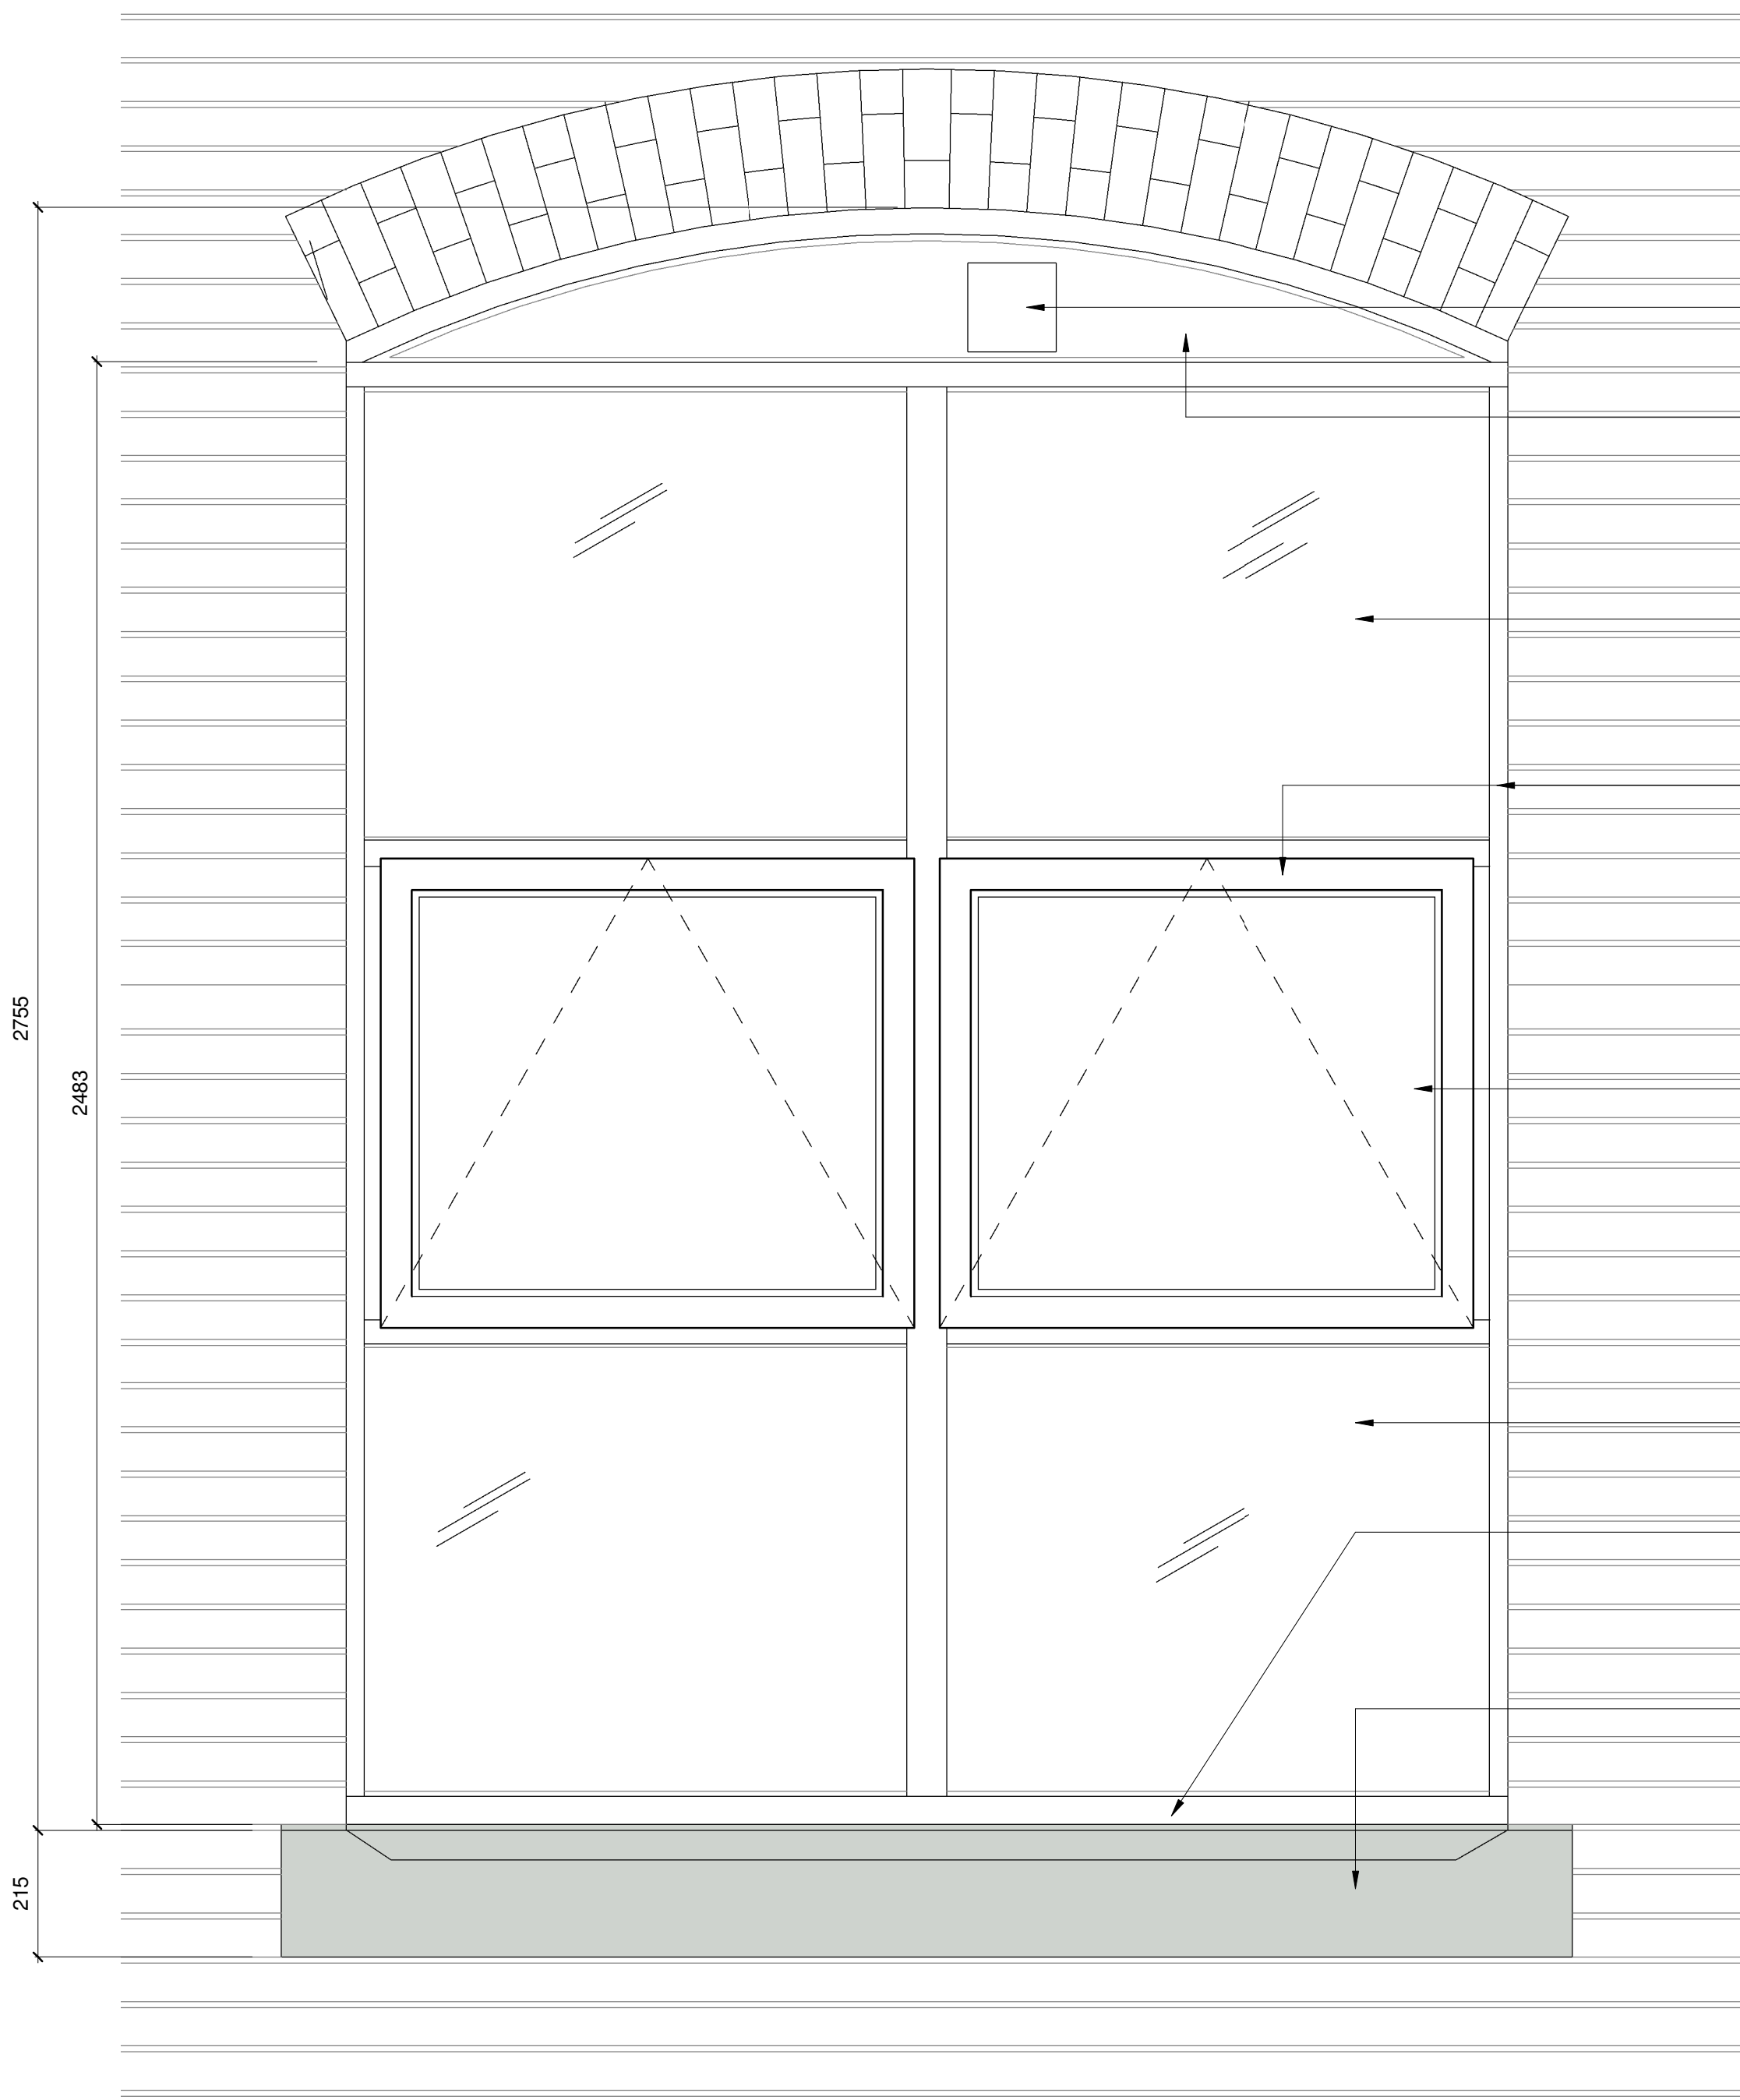


- Curved brick head repaired & repointed as necessary
- Extact fan pipes to new matching external grilles
- Solid insulated infill panel to match window frame
- Fixed lights - double glazed
- Treated softwood frames
- Top hung double glazed opening lights - reflex hinges to allow reversal for cleaning from inside
- Fixed lights - double glazed
- Treated timber stub cill oversailing stone cill, bedded on silicon mastic
- Stone cill cleaned, repaired and sealed.

ELEVATION of PROPOSED WINDOW from outside
Scale 1:10

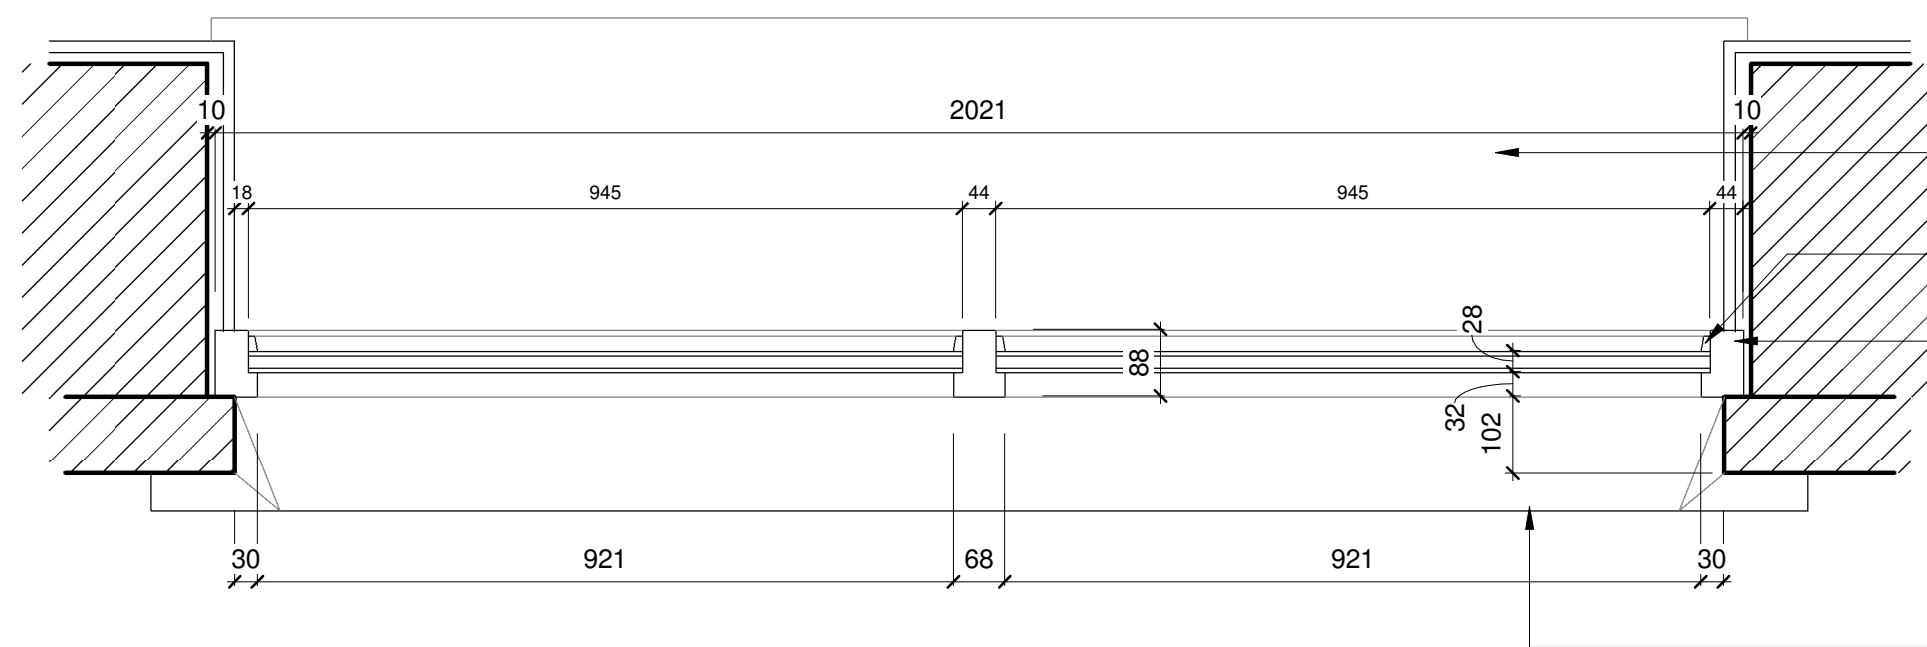

PLAN of PROPOSED WINDOW
Scale 1:10

- Softwood cill board
- 12 x 18 mm splayed beads to all glazing
- Ex 100 x 63 mm treated rebated s/w frames. Finished size 88 x 56 mm
- Stone cill cleaned, repaired and sealed.

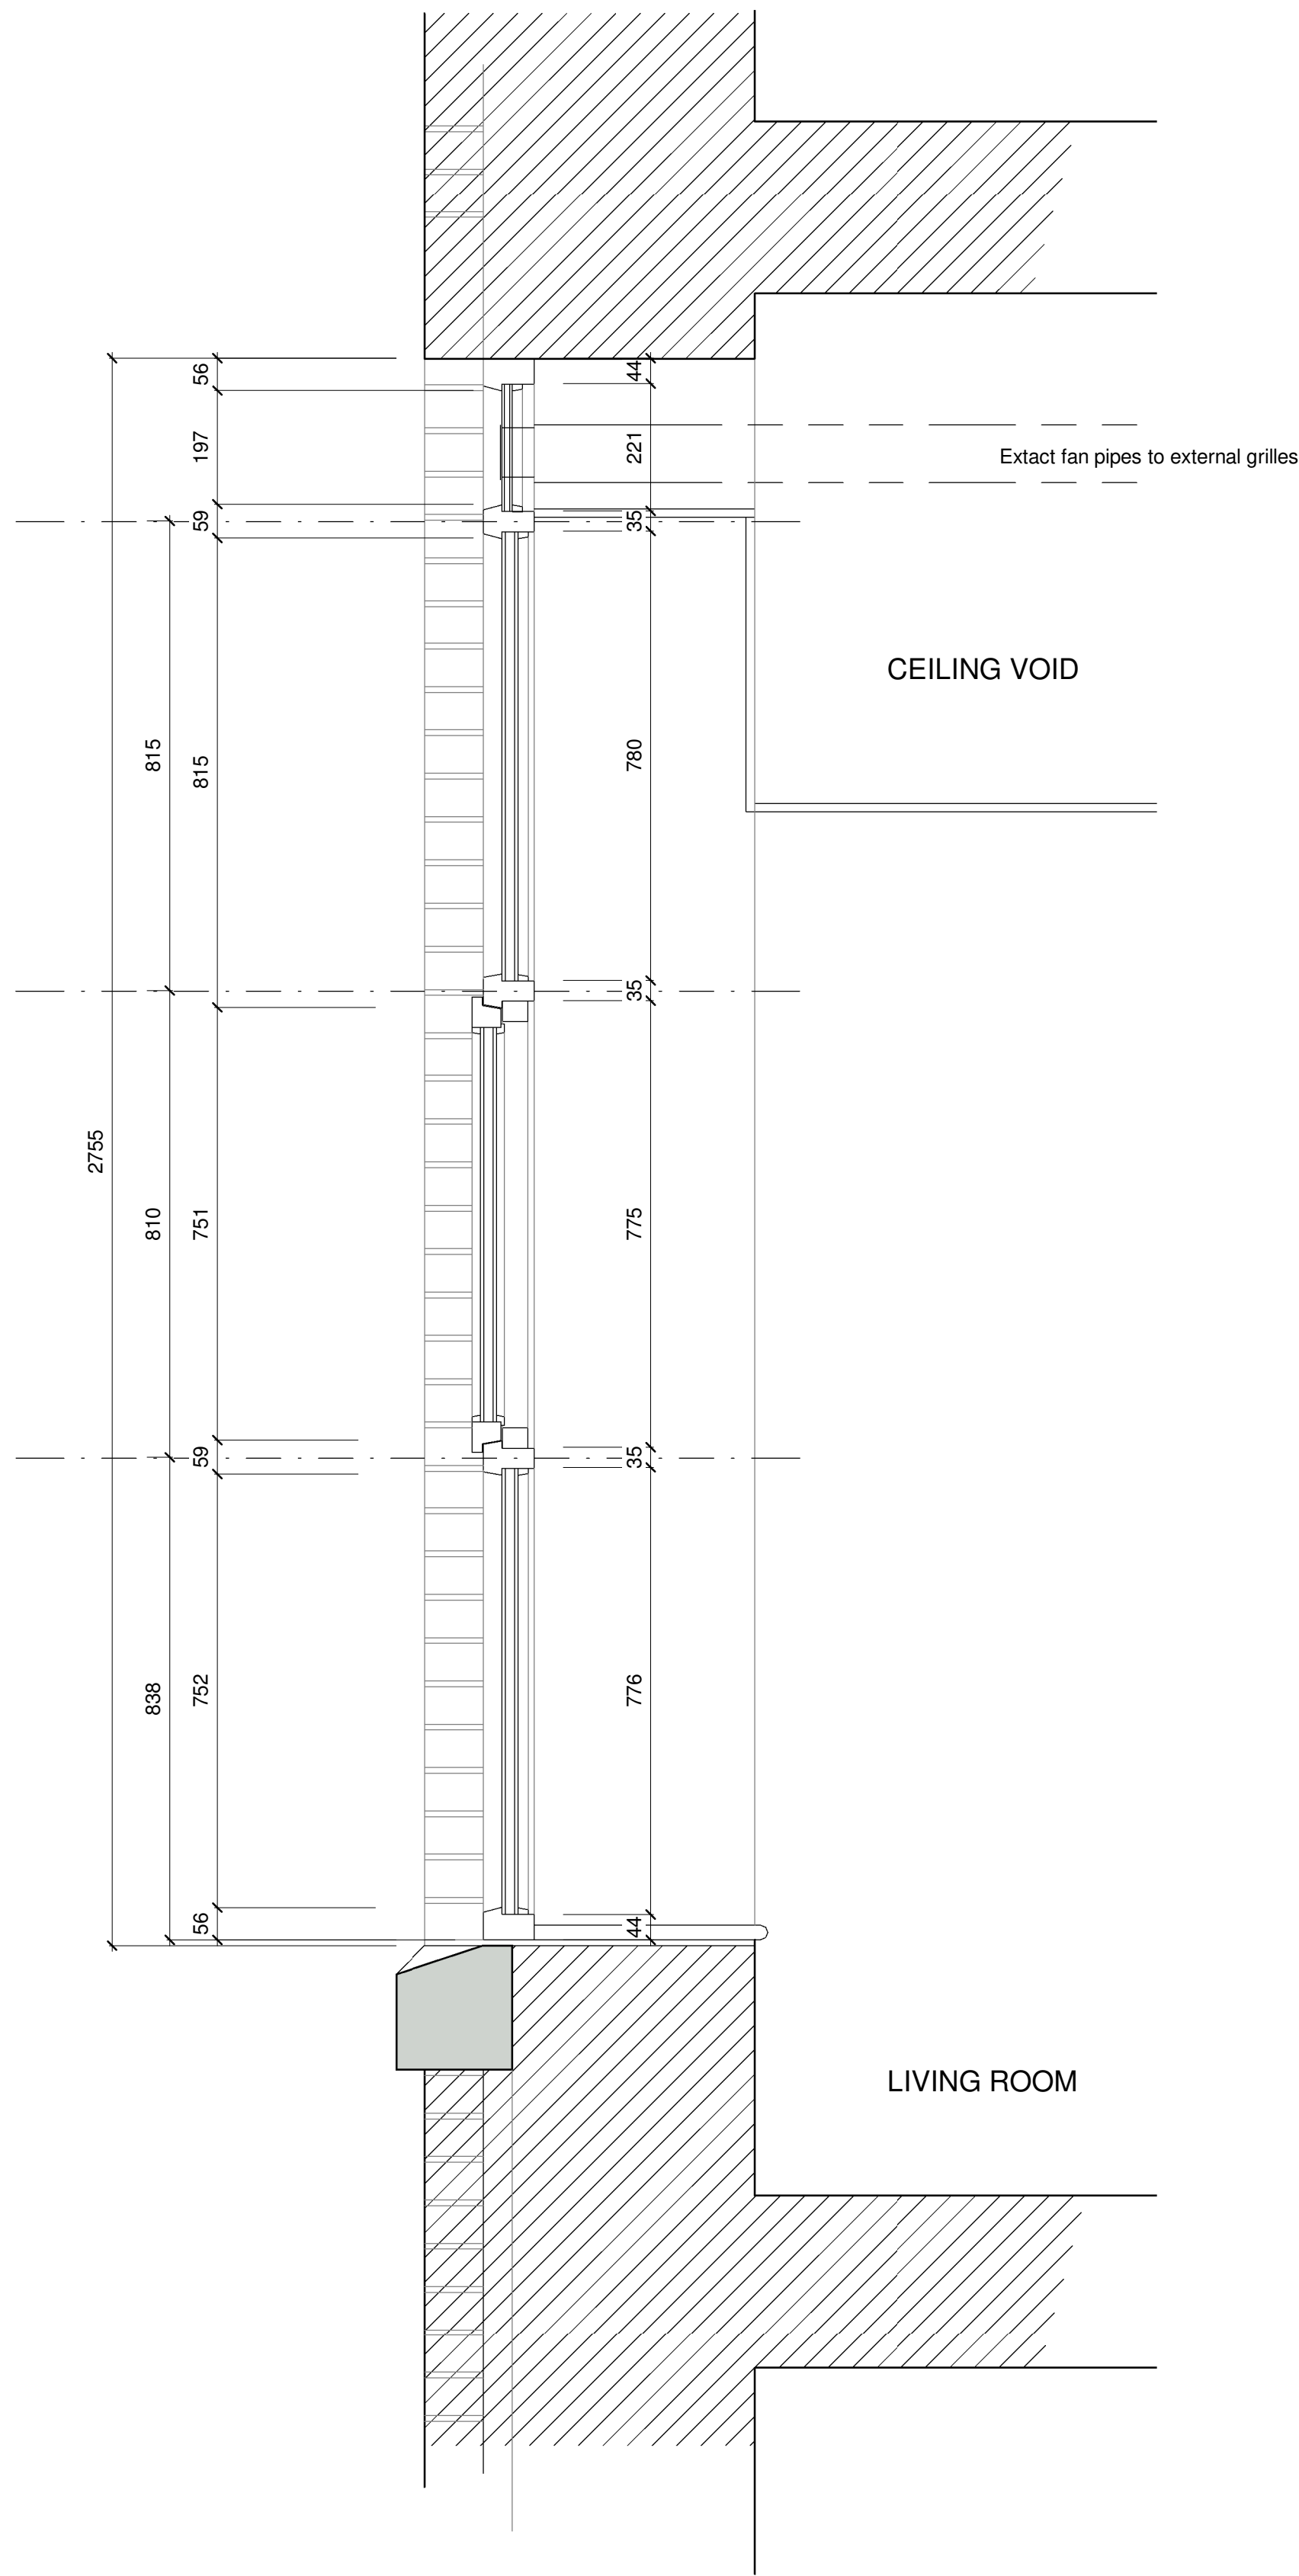

SECTION of PROPOSED WINDOW
Scale 1:10

•	•
•	•
•	•
•	•
■ DRAWING NOT TO BE SCALED. ■ REPORT ERRORS & OMISSIONS TO ARCHITECT. ■ CHECK ALL DIMENSIONS ON SITE ■ DRAWING TO BE READ IN CONJUNCTION WITH THE HEALTH AND SAFETY PLAN AND ALL RELEVANT RISK ASSESSMENTS	

SPECIFICATION

Proposed Windows:
2 No new windows both 1.97 x 2.45m
Treated softwood window frames and beads with
2 no central opening lights to each window, reflex hinge reversible casements.

Colour and dimensions to match existing windows.
Dulux Weathershield paint finish RAL 3005 externally, white satinwood gloss internally.

Insulated double glazed units, internally beaded.
Inner pane - 6mm Low E glass
16mm argon filled cavity
Outer pane - 6mm Solar control glass

Double glazing units to be fitted into frame on the appropriate spacers and to have a 10 year written warranty.

For details of existing windows, refer to drawing 20-03-002

B	28/04/21	Opening lights shown as double glazed on section
A	27/04/21	Proposed windows amended to timber

REV.	DATE	DRN.	CHKD.
------	------	------	-------

PROJECT Flat 409 Victoria Mill, 10 Lower Vickers Street, Manchester M40 7LL				
CLIENT A. Bristow				
DRAWING Proposed replacement windows				
SCALE 1 : 10	SHEET SIZE @ A1	DRAWN CB	CHECKED Checker	DATE 16/02/21

• VICTORIA	•
• MILL	•
• WINDOW	•
• REPLACEMENT	•

JOB No 20-03	DRAWING No 003	REVISION B
STATUS		

