


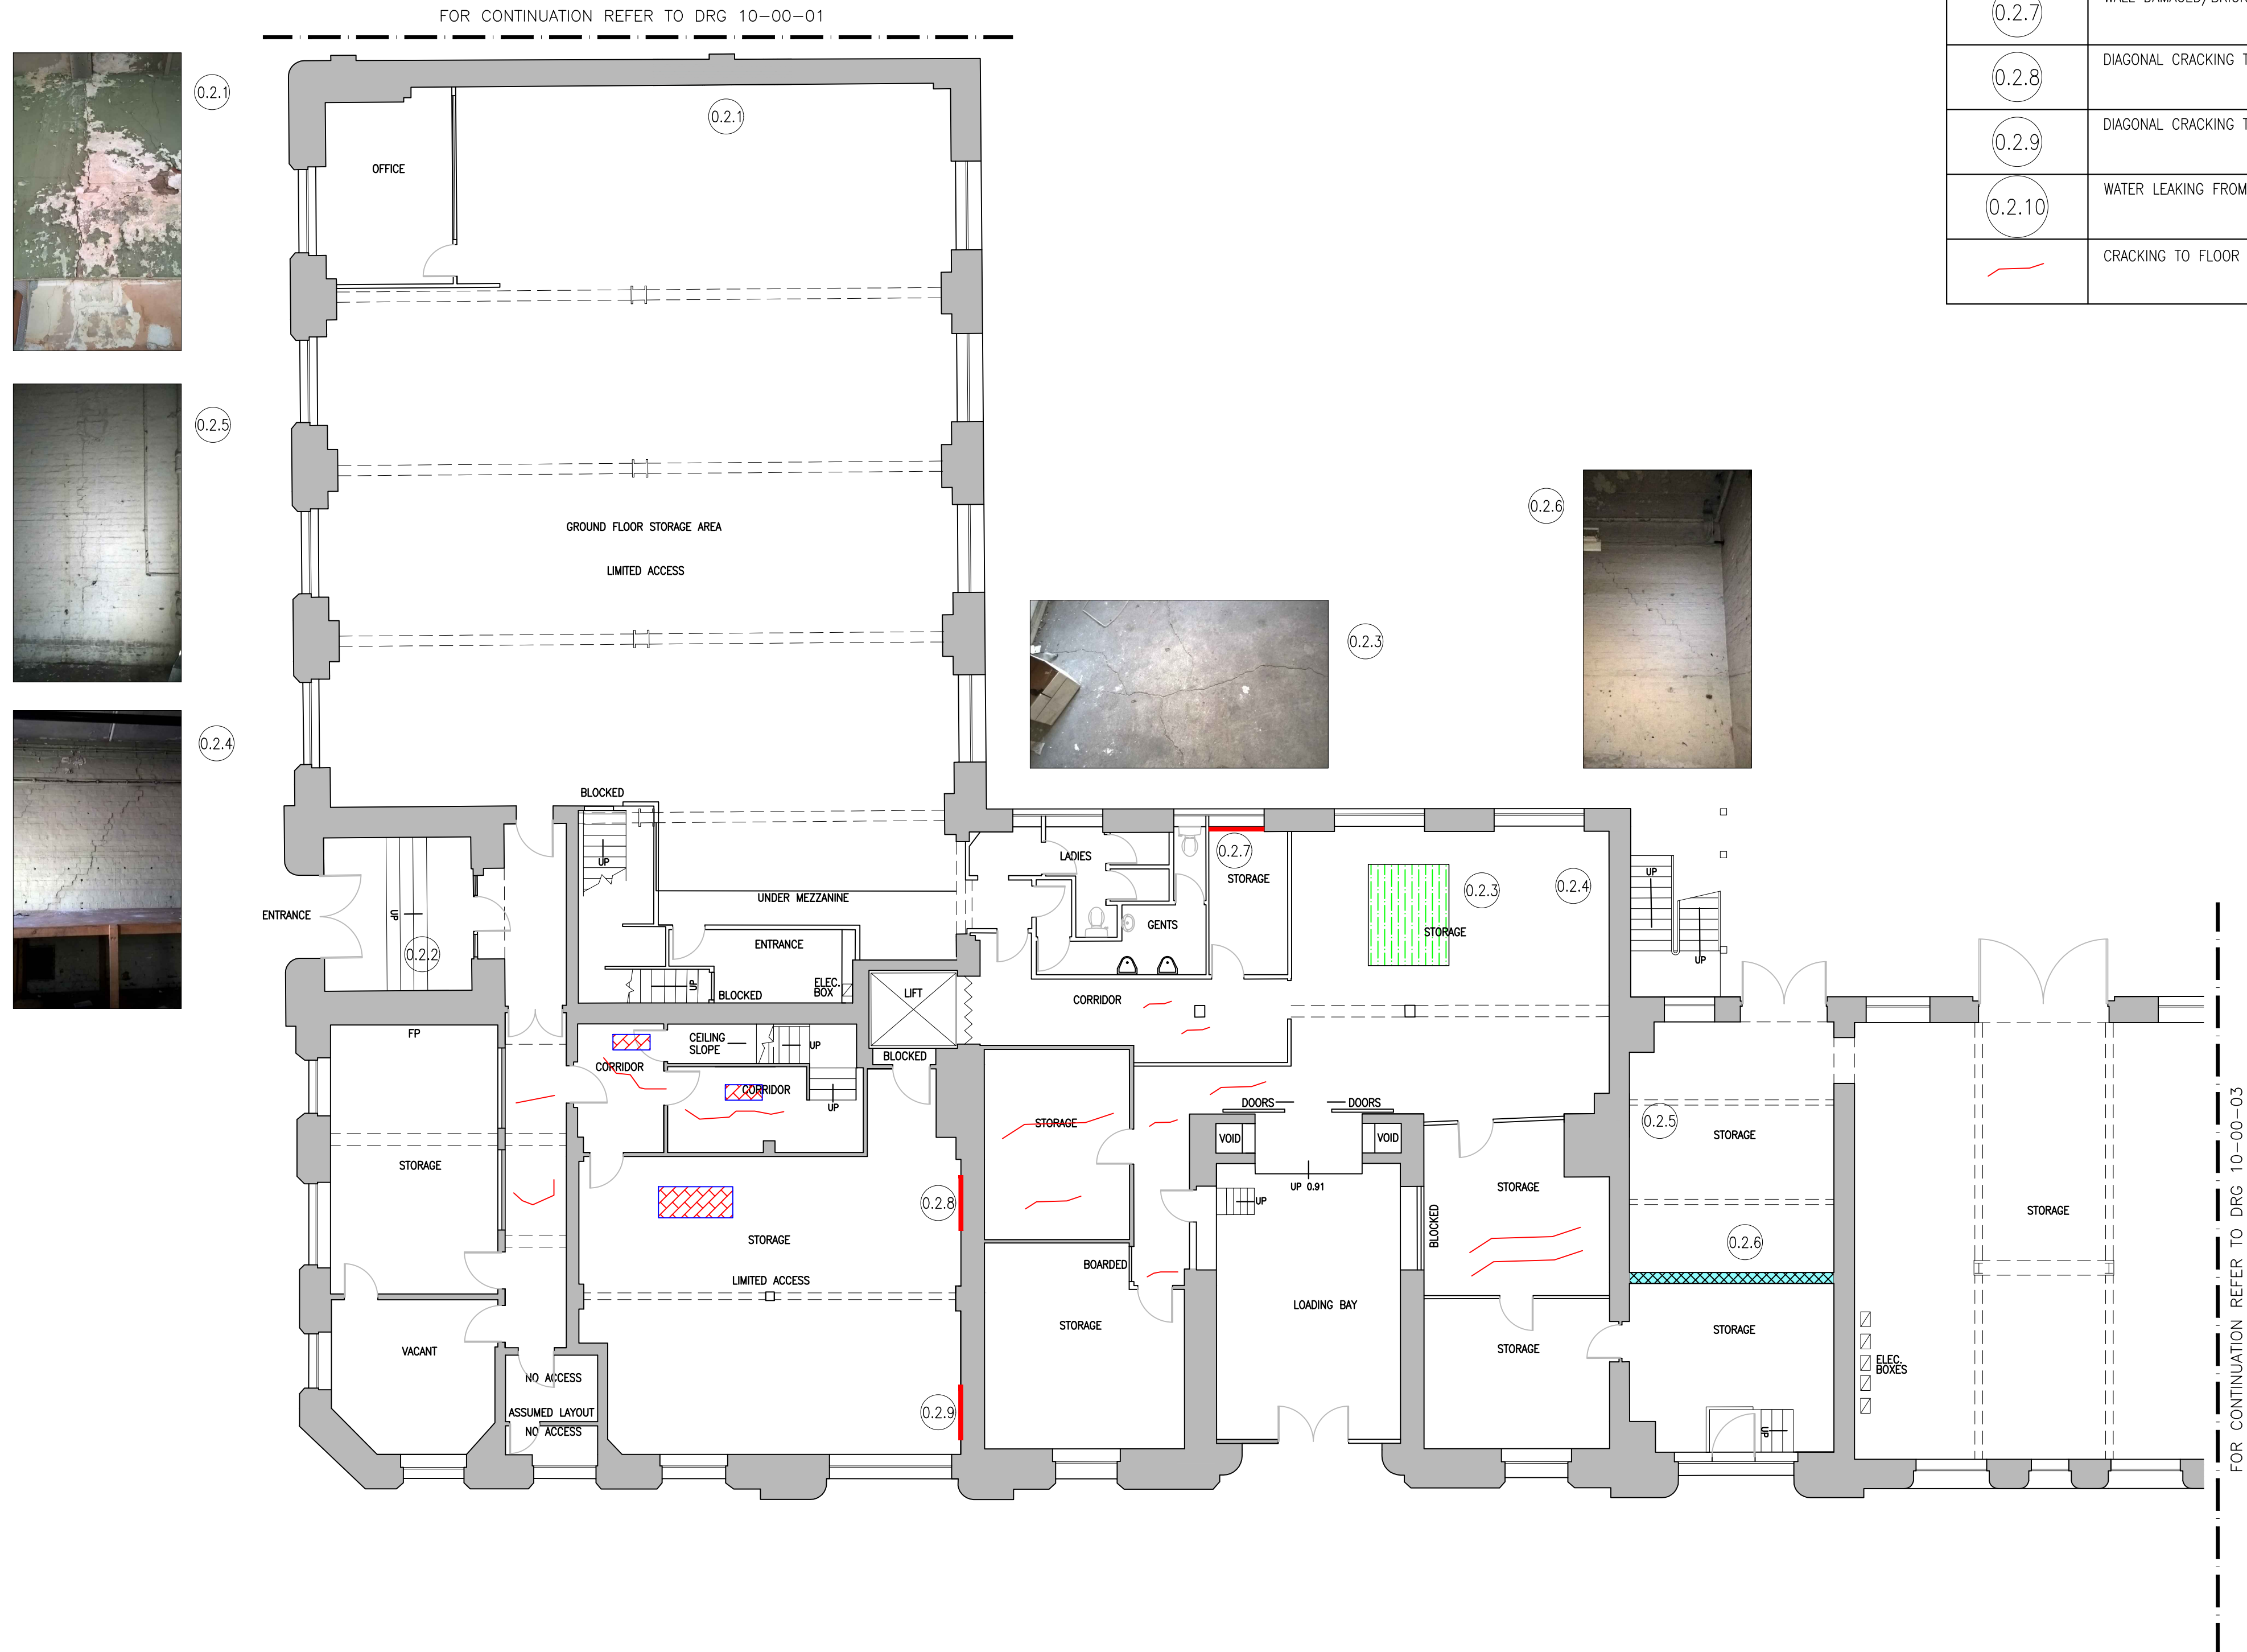


PLAN ON EXISTING GROUND FLOOR
SCALE 1:100

REF	OBSERVATION
0.2.1	FULL HEIGHT CRACK IN WALL IN LINE WITH TRANSFER BEAM ABOVE.
0.2.2	CRACKING TO FINISHES.
0.2.3	CRACKING TO FLOOR SCREED.
0.2.4	DIAGONAL CRACKING TO WALL EVIDENT TO ONE SIDE ONLY.
0.2.5	STRAIGHT FULL HEIGHT CRACK IN MASONRY.
0.2.6	DIAGONAL CRACK THROUGH MASONRY PARTITION WALL EVIDNET FROM BOTH SIDES.
0.2.7	WALL DAMAGED/BRICKWORK BROKEN OFF
0.2.8	DIAGONAL CRACKING TO THE WALL FINISHES.
0.2.9	DIAGONAL CRACKING TO WALL ALONG THE MORTAR JOINT.
0.2.10	WATER LEAKING FROM THE CEILING.
	CRACKING TO FLOOR FINISHES/SCREED

NOTES:

1. THIS DRAWING IS TO BE READ IN CONJUNCTION WITH ALL RELEVANT ARCHITECTS AND ENGINEERS DRAWINGS AND SPECIFICATIONS.
2. DO NOT SCALE THIS DRAWING.
3. ALL DIMENSIONS ARE IN MILLIMETRES UNLESS NOTED OTHERWISE.
4. DRAWING TO BE READ IN CONJUNCTION WITH DETAILED VISUAL SURVEY REPORT BY CURTINS CONSULTING.

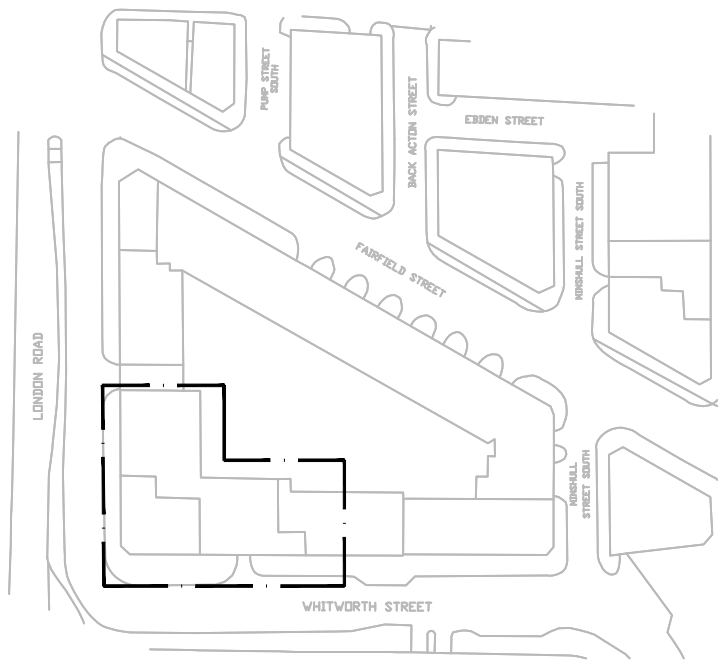

KEY
SCALE 1:1500

V01	INITIAL ISSUE	21/01/20	PC	DS
Rev:	Description:	Date:	By:	Chkd:

Curtins Consulting Ltd,
Merchant Exchange, 17-19 Whitworth Street West, M1 5WG
t: 0161 236 2394
e: manchester@curtins.com
www.curtins.com

Structures • Civils • Environmental • Infrastructure • Transport Planning • Sustainability • Expert Advisory Services
Birmingham • Bristol • Cardiff • Douglas • Edinburgh • Kentish • Leeds • Liverpool • London • Manchester • Nottingham

Status:	INFORMATION
---------	-------------

Project:	LONDON ROAD FIRE STATION
----------	--------------------------

Drg Title:	GROUND FLOOR OBSERVATIONS SHEET 2 OF 3
------------	---

Scale:	Size:	First Issue:	Drawn:	Checked:
AS SHOWN	A1	05.04.16	CH	PB

Drg No:	Rev:
060270 / 10-00-02	V01