


Existing coving damaged in parts to be repaired.



Existing coving missing in parts, to be reinstated with new to match existing.

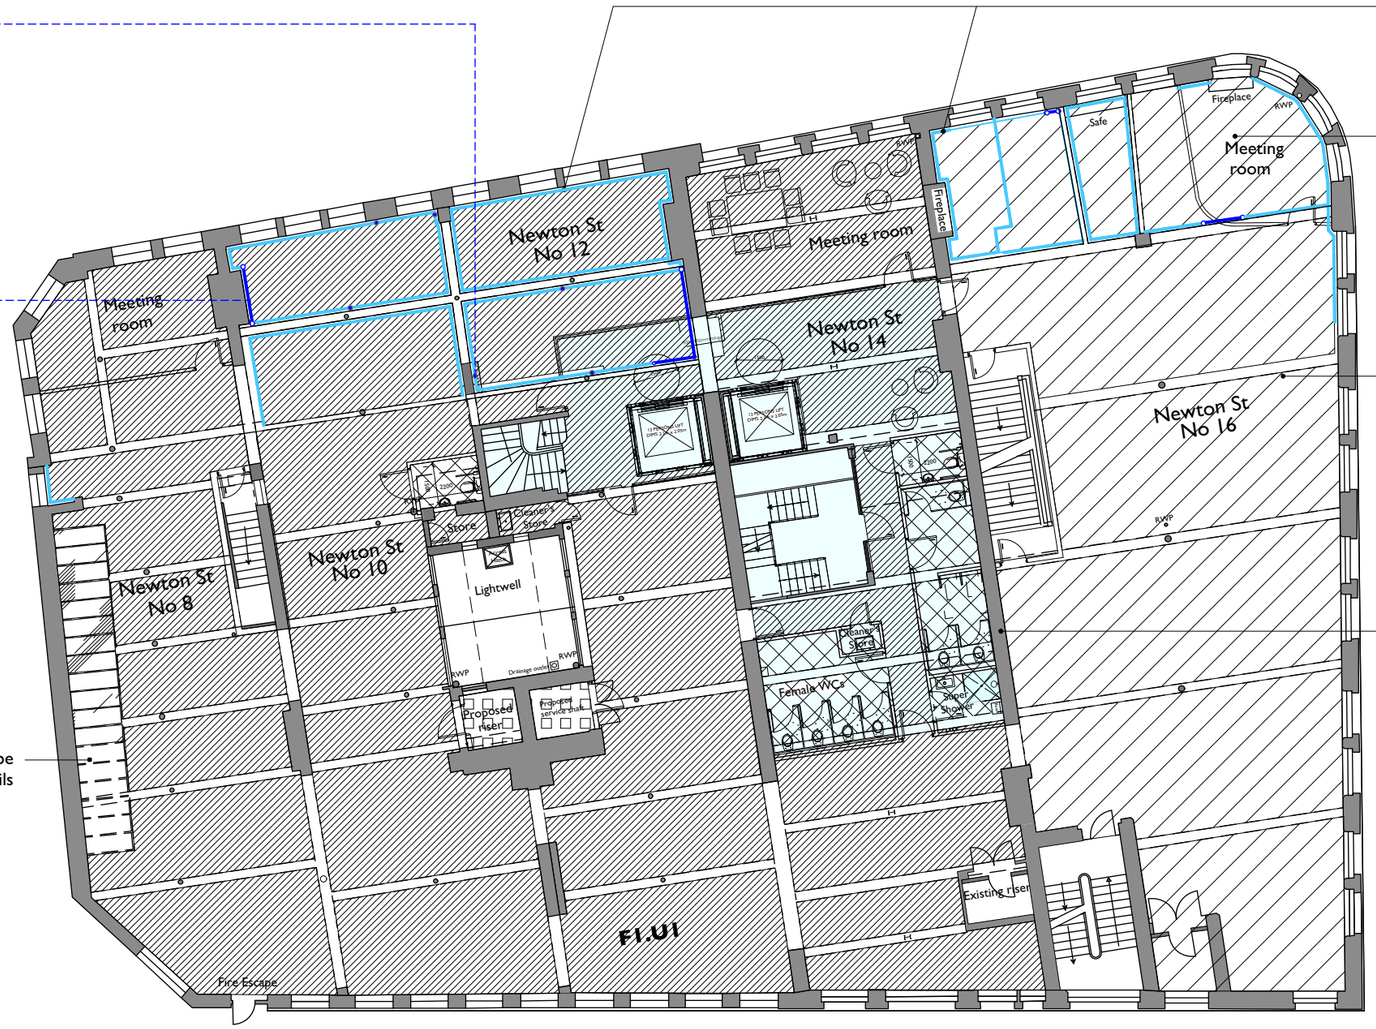

Existing covings to be retained and restained

Ceiling assumed to be T&G timber, currently covered by paper. Paper to be carefully removed and ceiling boards exposed.

Change in ceiling height

A 500mm downstand to be retained where the existing cross-wall has been removed

Existing patent glazing to be repaired - see P(403) for details

COPYRIGHT OF ATELIER MB LTD
DO NOT SCALE FROM THIS DRAWING
DIMENSIONS TO BE CHECKED ON SITE

All dimensions to be checked on site prior to any commencing work.

N

KEY

- Existing
- Proposed
- Existing T&G timber ceiling to be retained, repainted and left exposed
- Lath & plaster ceiling to be underboarded with plasterboard - see P(402)1,2
- Ceiling in wet spaces to be CasoLine MF suspended ceiling.
- Ceiling in service riser spaces to be metal grid.
- Existing coving damaged in parts to be repaired.
- Existing coving missing in parts, to be reinstated with new to match existing.

Rev	Note	DRN	CHK
B 10.10.18	Drawing revised to suit updated plan (revised circulation and relocated WCs)	RD	ZS
A 11.05.18	Annotation added Covings revised.	ZS	ZS

8-16 Newton Street

First Floor Plan
Proposed Reflected Ceiling

scheme	1665
drwg no.	**P(133)**
rev	B
scale	**1:200@A3**
date first drawn	May 18
drawn	ZS

***SK** sketch **P** proposed **T** tender **C** construction **AB** asbuilt*

www.ateliermb.co.uk
t 0161 236 0051
e architect@ateliermb.co.uk

Atelier MB
Urban Architects