
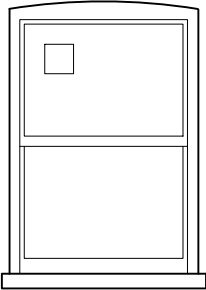
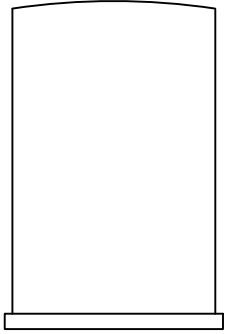
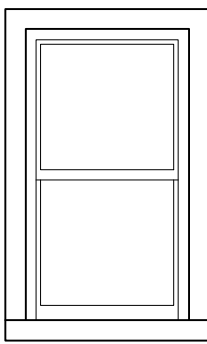
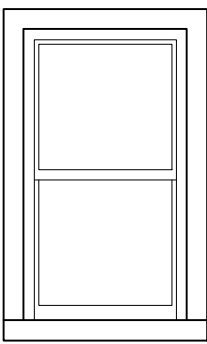


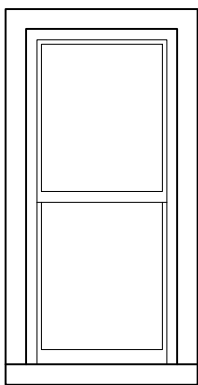
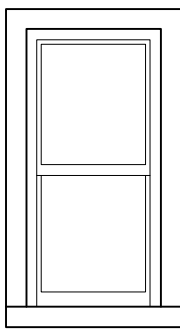
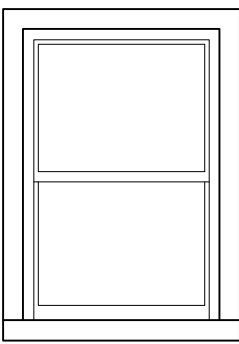
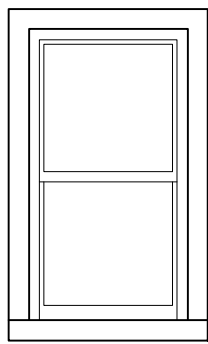
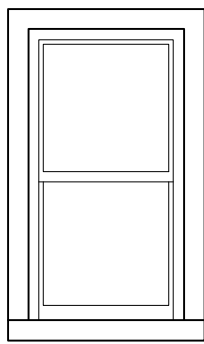
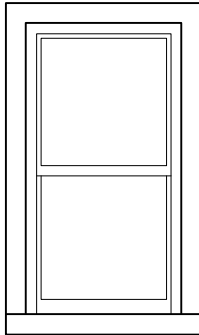
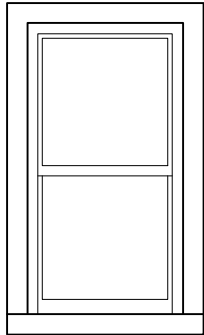
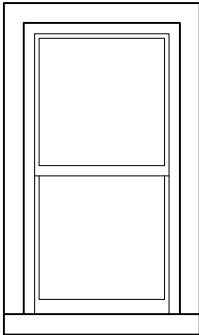
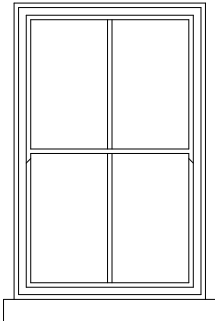


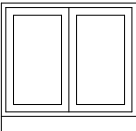
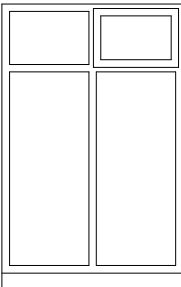
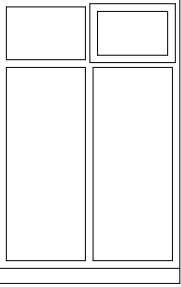



FIRST FLOOR
WINDOW SCHEDULE

ELEMENT ID	FF W1 - SAP Issue 26	FF W2 - SAP Issue 28	FF W3 - SAP Issue 23	FF W4 - SAP Issue 22	FF W5 - SAP Issue 21	FF W6 - SAP Issue 20	FF W7 - SAP Issue 19	FF W8 - SAP Issue 18	FF W9 - SAP Issue 17	FF W10 - SAP Issue 10	FF W11 - SAP Issue 15
FLOOR LEVEL	First Floor	First Floor	First Floor	First Floor	First Floor	First Floor	First Floor	First Floor	First Floor	First Floor	First Floor
WIDTH (APPROX)	1100	1070	1075	1075	975	975	975	1250	1300	1070	1070
HEIGHT (APPROX)	1700	1800	1900	1900	2210	2210	2210	2860	1925	1800	1800
DESCRIPTION	Sash	Blocked off externally	Sash	Sash	Sash	Sash	Sash	Sash	Sash	Sash	Sash
DRAWING											
DILAPIDATION NOTES	Cut out and replace repair rotten section of window cill. Overhaul sash and make openable / operational , allow to replace sash cord, fit new sash window lock, restrictor. Remove fan and re-glaze upper section.	Window boarded up, investigate condition of window behind on site and if in good condition allow for repairs and redecorations.	Retain as existing, to be prepped and painted.	Retain as existing, to be prepped and painted.	Retain as existing, to be prepped and painted.	Retain as existing, to be prepped and painted.	Retain as existing, to be prepped and painted.	Retain as existing, to be prepped and painted. Remove Bars and make good.	Retain as existing, to be prepped and painted.	Needs further investigation due to render crack around window.	Window cill to be replaced. Putty repaired.

FIRST FLOOR
WINDOW SCHEDULE

ELEMENT ID	FF W12 - SAP Issue 14	FF W13 - SAP Issue 13	FF W14 - SAP Issue 12	FF W15 - SAP Issue 41	FF W16 - SAP Issue 43	FF W17 - SAP Issue 44	FF W18 - SAP Issue 45	FF W19 - SAP Issue 46	FF W20 - SAP Issue 47	FF W21 - SAP Issue 48	FF W22 - SAP Issue 49
FLOOR LEVEL	First Floor	First Floor	First Floor	First Floor	First Floor	First Floor	First Floor	First Floor	First Floor	First Floor	First Floor
WIDTH (APPROX)	1070	1070	1070	1265	460	575	750	1200	1200	420	420
HEIGHT (APPROX)	1800	1800	1800	1950	920	920	900	1780	1780	720	720
DESCRIPTION	Sash	Sash	Sash	Sash	Casement	Casement	Casement	Casement	Casement	Casement	Casement
DRAWING											
DILAPIDATION NOTES	Retain as existing, to be prepped and painted. To receive putty repairs and filled.	To be replaced with new timber sash window (Type A) and decorated.	To be replaced with new timber sash window (Type A) and decorated.	Overhaul sash and make openable / operational , allow to replace sash cord, fit new sash window lock, restrictor.	Overhaul and make openable. Replace hinges to opening light, fit new window lock and stay.	Overhaul and make openable. Replace hinges to opening light, fit new window lock and stay.	Overhaul and make openable. Replace hinges to opening light, fit new window lock and stay.	Overhaul and make openable. Replace hinges to opening light, fit new window lock and stay.	Overhaul and make openable. Replace hinges to opening light, fit new window lock and stay.	Overhaul and make openable. Replace hinges to opening light, fit new window lock and stay.	Overhaul and make openable. Replace hinges to opening light, fit new window lock and stay.



B	Scope of works update	JH	06-05-25
A	Scope of works update	NH	28-01-25
Rev	Description	By	Date

INVENTIVE DESIGN ASSOCIATES
ARCHITECTURE & INTERIOR DESIGN

57 Station Road, Cheadle Hulme
Stockport, Greater Manchester SK8 7AA
Company Reg No: 9251414

TRUST PUBS
The Brunswick
97 Piccadilly, Manchester M1 2DB
EXISTING FF SCHEDULE

0161 428 0310
office@inventiveda.com
www.inventiveda.com
@inventiveda

DRAWN	JW	DATE	28-01-25	DRAWING NO.	22108-702A
SCALE	1:50@A2	REV.	B		