
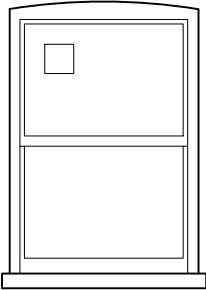
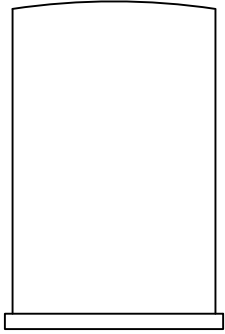
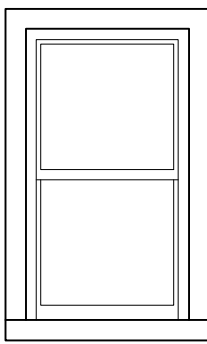
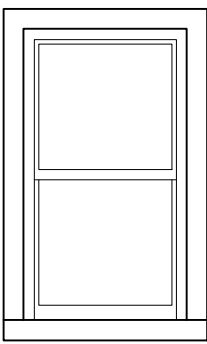


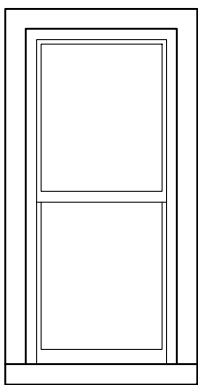
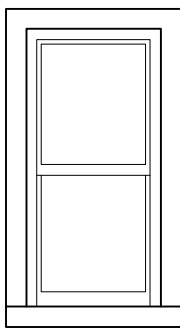
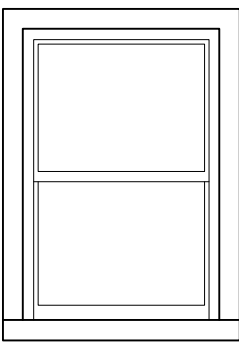
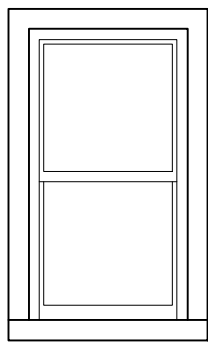
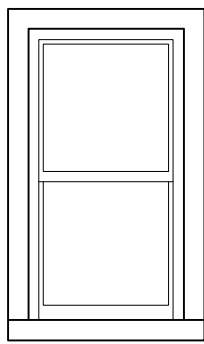
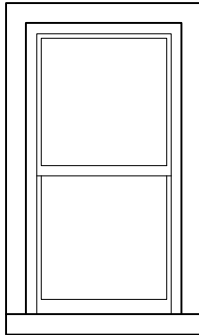
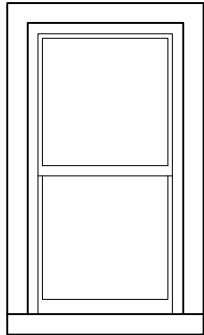
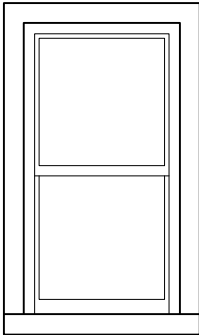
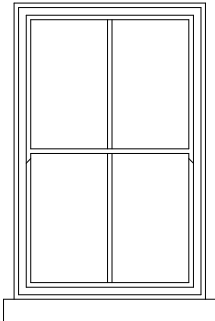


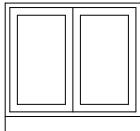
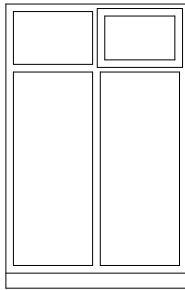
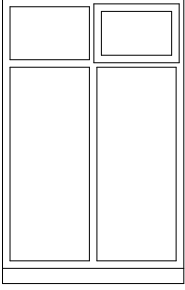



FIRST FLOOR
WINDOW SCHEDULE

ELEMENT ID	FF W1 - SAP Issue 26	FF W2 - SAP Issue 28	FF W3 - SAP Issue 29	FF W4 - SAP Issue 30	FF W5 - SAP Issue 31	FF W6 - SAP Issue 32	FF W7 - SAP Issue 33	FF W8 - SAP Issue 34	FF W9 - SAP Issue 35	FF W10 - SAP Issue 36	FF W11 - SAP Issue 37
FLOOR LEVEL	First Floor	First Floor	First Floor	First Floor	First Floor	First Floor	First Floor	First Floor	First Floor	First Floor	First Floor
WIDTH (APPROX)	1100	1070	1075	1075	975	975	975	1250	1300	1070	1070
HEIGHT (APPROX)	1700	1800	1900	1900	2210	2210	2210	2860	1925	1800	1800
DESCRIPTION	Sash	Blocked off externally	Sash	Sash	Sash	Sash	Sash	Sash	Sash	Sash	Sash
DRAWING											
DILAPIDATION NOTES	Cut out and replace repair rotten section of window cill. Overhaul sash and make openable / operational , allow to replace sash cord, fit new sash window lock, restrictor. Remove fan and re-glaze upper section.	Window boarded up, investigate condition of window behind on site and if in good condition allow for repairs and redecorations.	Overhaul sash and make openable / operational , allow to replace sash cord, fit new sash window lock, restrictor.	Overhaul sash and make openable / operational , allow to replace sash cord, fit new sash window lock, restrictor.	Overhaul sash and make openable / operational , allow to replace sash cord, fit new sash window lock, restrictor.	Overhaul sash and make openable / operational , allow to replace sash cord, fit new sash window lock, restrictor. Replace missing beads on inside of the window.	Overhaul sash and make openable / operational , allow to replace sash cord, fit new sash window lock, restrictor.	Remove steel security bars and make good. Overhaul sash and make openable / operational , allow to replace sash cord, fit new sash window lock, restrictor.	Overhaul sash and make openable / operational , allow to replace sash cord, fit new sash window lock, restrictor.	Carry out isolated splice repairs to window frames and opening sash windows. Overhaul sash and make openable / operational , allow to replace sash cord, fit new sash window lock, restrictor.	Carry out isolated splice repairs to window frames and opening sash windows. Overhaul sash and make openable / operational , allow to replace sash cord, fit new sash window lock, restrictor.

FIRST FLOOR
WINDOW SCHEDULE

ELEMENT ID	FF W12 - SAP Issue 38	FF W13 - SAP Issue 39	FF W14 - SAP Issue 40	FF W15 - SAP Issue 41	FF W16 - SAP Issue 43	FF W17 - SAP Issue 44	FF W18 - SAP Issue 45	FF W19 - SAP Issue 46	FF W20 - SAP Issue 47	FF W21 - SAP Issue 48	FF W22 - SAP Issue 49
FLOOR LEVEL	First Floor	First Floor	First Floor	First Floor	First Floor	First Floor	First Floor	First Floor	First Floor	First Floor	First Floor
WIDTH (APPROX)	1070	1070	1070	1265	460	575	750	1200	1200	420	420
HEIGHT (APPROX)	1800	1800	1800	1950	920	920	900	1780	1780	720	720
DESCRIPTION	Sash	Sash	Sash	Sash	Casement	Casement	Casement	Casement	Casement	Casement	Casement
DRAWING											
DILAPIDATION NOTES	Carry out isolated splice repairs to window frames and opening sash windows. Overhaul sash and make openable / operational , allow to replace sash cord, fit new sash window lock, restrictor.	Carry out isolated splice repairs to window frames and opening sash windows. Overhaul sash and make openable / operational , allow to replace sash cord, fit new sash window lock, restrictor.	Carry out isolated splice repairs to window frames and opening sash windows. Overhaul sash and make openable / operational , allow to replace sash cord, fit new sash window lock, restrictor.	Overhaul sash and make openable / operational , allow to replace sash cord, fit new sash window lock, restrictor.	Overhaul and make openable. Replace hinges to opening light, fit new window lock and stay.	Overhaul and make openable. Replace hinges to opening light, fit new window lock and stay.	Overhaul and make openable. Replace hinges to opening light, fit new window lock and stay.	Overhaul and make openable. Replace hinges to opening light, fit new window lock and stay.	Overhaul and make openable. Replace hinges to opening light, fit new window lock and stay.	Overhaul and make openable. Replace hinges to opening light, fit new window lock and stay.	Overhaul and make openable. Replace hinges to opening light, fit new window lock and stay.



0161 428 0310
office@inventiveda.com
www.inventiveda.com
@inventiveda

A	Scope of works update	NH	28-01-25
Rev	Description	By	Date
INVENTIVE DESIGN ASSOCIATES ARCHITECTURE & INTERIOR DESIGN			
57 Station Road, Cheadle Hulme Stockport, Greater Manchester SK8 7AA Company Reg No: 9251414			
TRUST PUBS The Brunswick 97 Piccadilly, Manchester M1 2DB EXISTING FF SCHEDULE			
DRAWN	JW	DATE	28-01-25
SCALE	1:50@A2	REV.	A
		DRAWING NO. 22108-702A	