


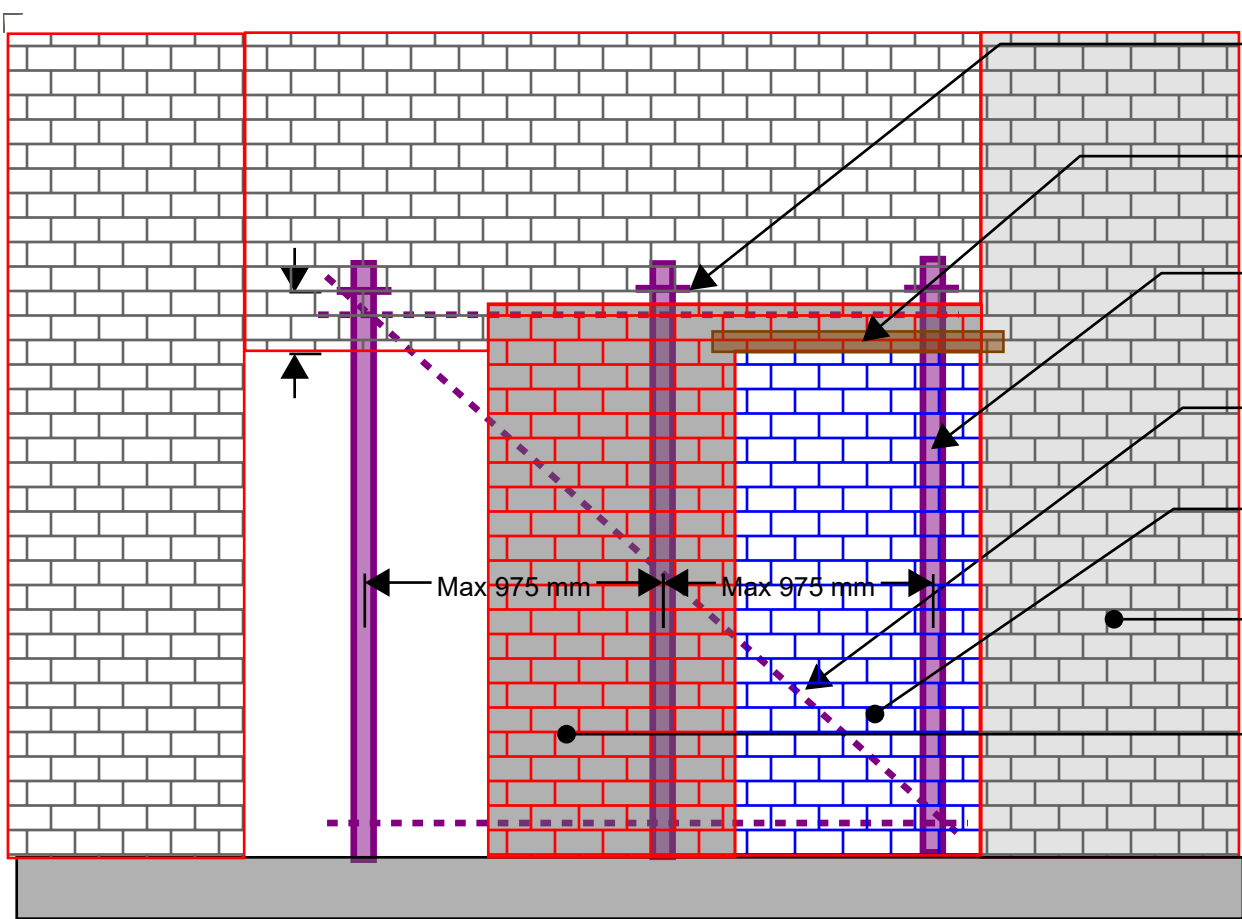

Elevation 1-1

Readyarm Buildersmate brick support or similar approved product at the head of each prop

Existing timber lintels of poor quality to be removed


3no. of type 1 Acrow prop spaced at 975mm ctrs

Props to be laced and braced with standard scaffold tubes


Existing doorway to be in filled with masonry and toothed into existing masonry wall with

Existing chimney wall not to be part of propped structure

Section of wall with poor quality bonding and arrangement to be rebuilt back to masonry deemed good quality

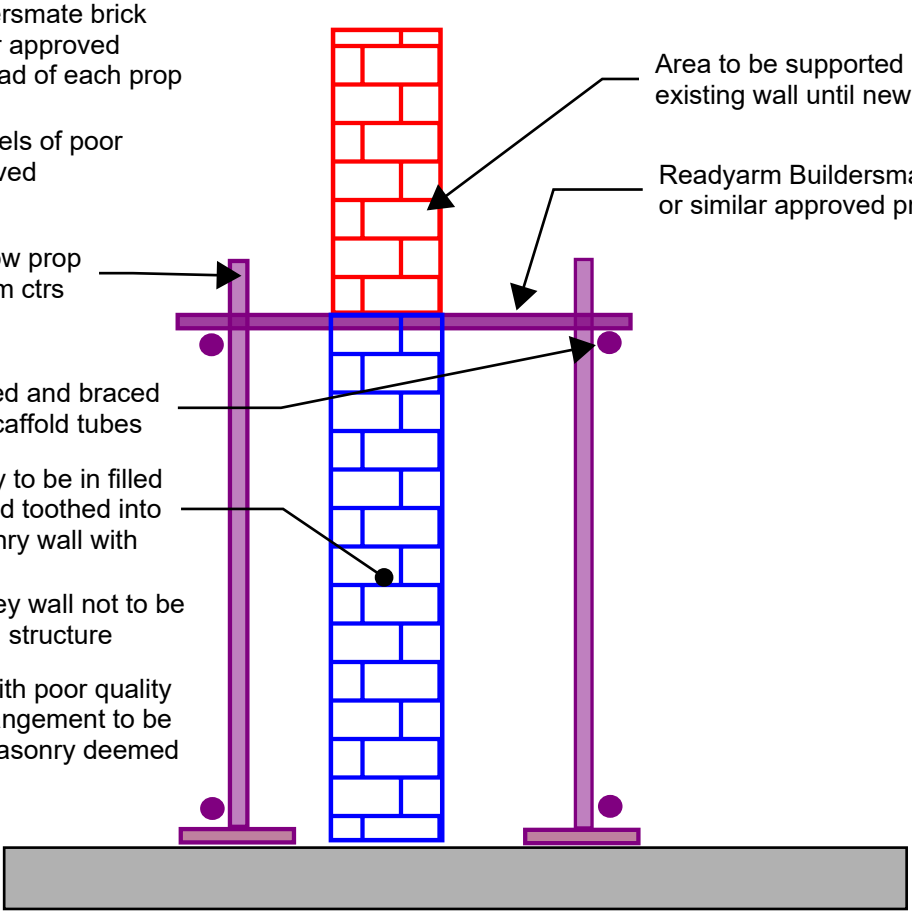

Section A - A

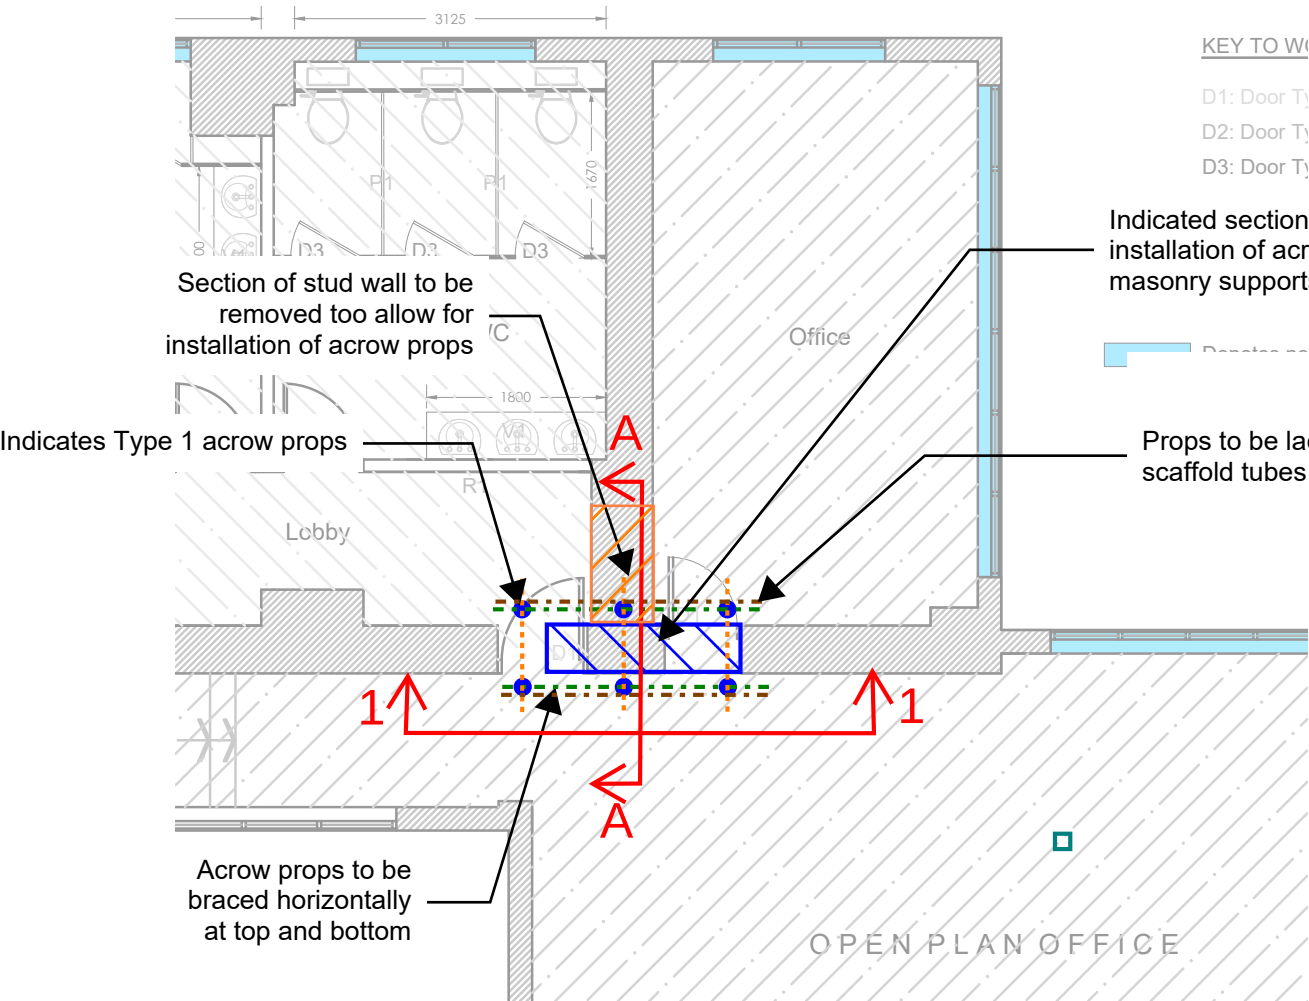

PLAN

KEY TO WALL

D1: Door T1
D2: Door T1
D3: Door T1

Indicated section of wall to be rebuilt following installation of acrow props and readyarm buildersmate masonry supports

Props to be laced and braced with standard scaffold tubes

Acrow props to be braced horizontally at top and bottom

Rev	Description	By	Chk.	Date
Drawing Status :				
Suitability Code :				
RIBA Stage / Project Status :				

ACIES
an RSK company

FOURWAYS HOUSE,
57 HILTON STREET, MANCHESTER,
M1 2EJ
Tel : 0161 260 1369
www.aciesgroup.co.uk

Client : **GE Healthcare Trustees Ltd**

Project : **3F St Ann's square
Manchester**

Drawing : **Masonry Wall Repair
and Infill Details**

Job No : 1229	Scale @ A3 : NTS	Date : 21.05.24
Drawn : KS	Checked : BF	Approved : CO
Drawing No : 1229-ACS-XX-XX-D-S-SK05	Rev : P01	