


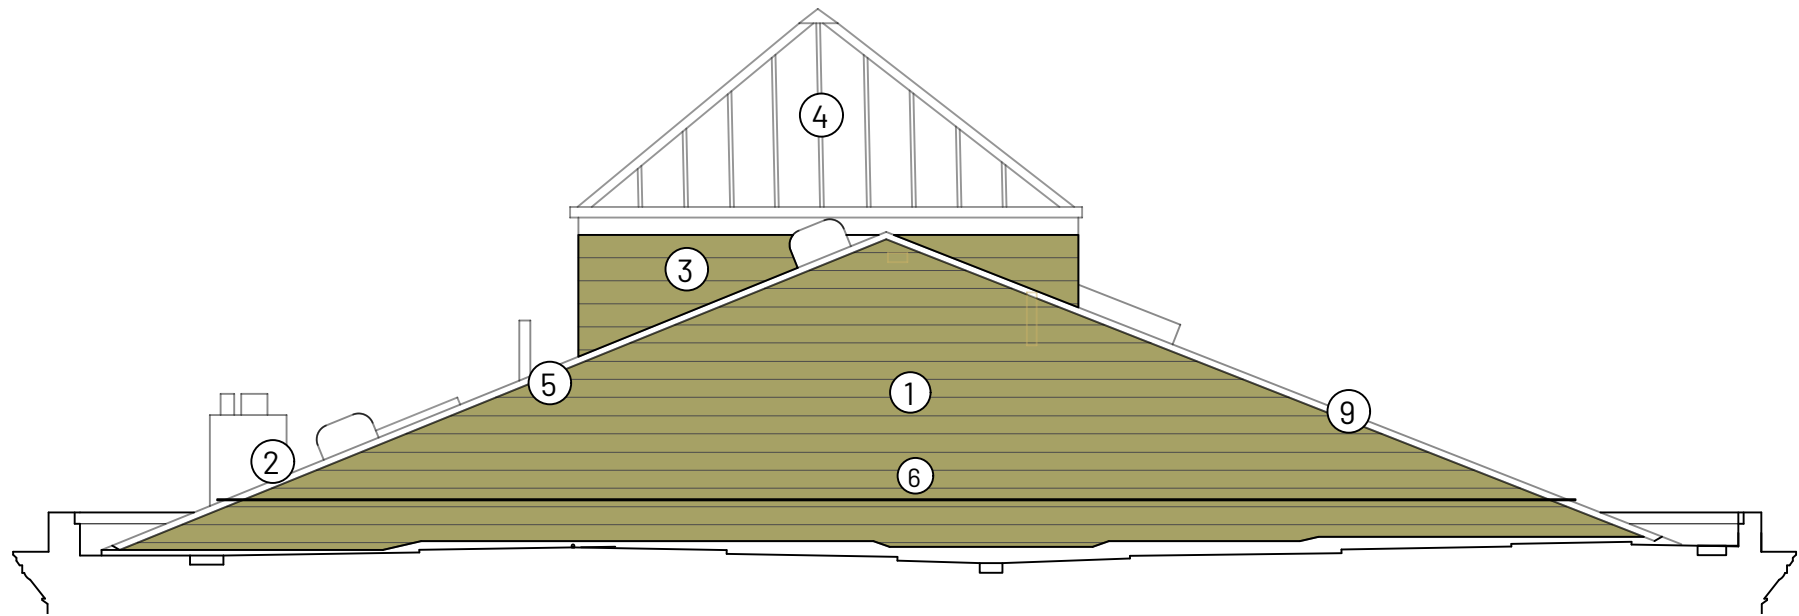


#### Repairs Notes

- Existing cementitious slates and sarking to be replaced with breathable sarking and natural slates. All roof penetration seals and flashing to be renewed.
- Existing lead stepped flashing to be removed and replaced with new Code 4 lead stepped flashings.
- Existing vertical slates to be removed and replaced with natural slate. Flashings at abutment with pitched roofs with be repalced with Code 4 lead flashing.
- Existing glazing to be inspected, perished seals and damaged panes to be replaced.
- Existing hip tiles to be replaced with lead roll hip with soakers
- New man safe system mounted onto pitched roof

1

#### Ridgefield Gutter Section Looking Inward


Scale: 1:100

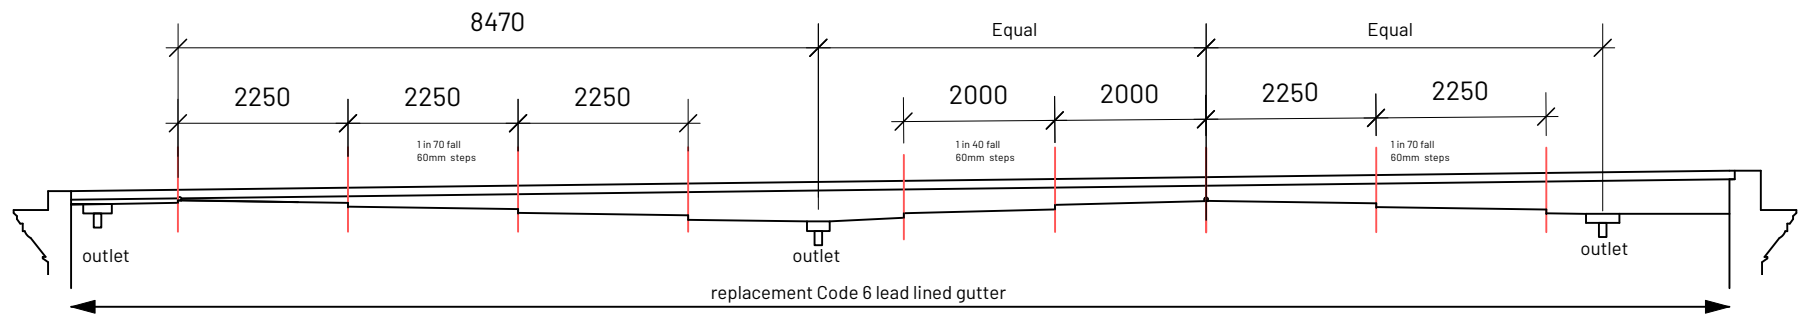

2

#### Ridgefield Gutter Section Looking Outward


Scale: 1:100

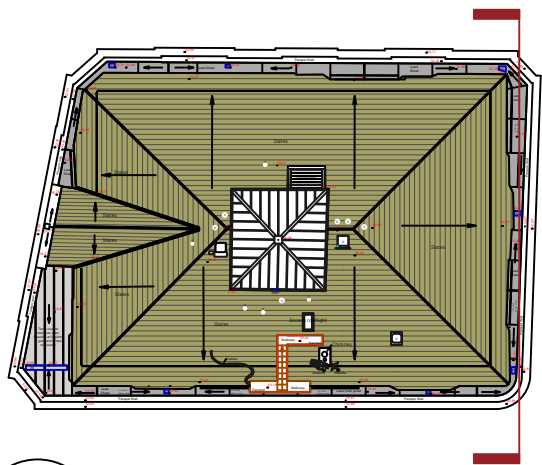

3

#### Key Plan

Scale: 1:500

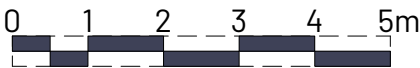

1:100 @A3

REV | NOTE | DRN/CHK

King Street Chambers  
Manchester  
Roof Repairs

#### Gutter Sections 2

PROJECT REF. 2050  
DRWG NO. P(301)  
REVISION  
SCALE 1:100 @ A3  
DATE 1st June 24  
DRAWN PL

SK sketch E existing P proposed T tender C construction FI final issue

+44 161 236 0051  
ARCHITECT@ATELIERMB.CO.UK

**ATELIER.MB**