




GEOSHIELD Verification Report



OVERVIEW PHOTOGRAPHS



Overview photograph of the area verified during installation





GEOSHIELD Verification Report



VERIFICATION ITEM ONE

LOCATION/GRID LINE: Basement slab - Pour 5

NOTES: Tape Lap Joint

Visqueen Standard Gas Barrier has been installed to the area of Pour 5 and lapped up the walls vertically where applicable. Overlaps of 100mm minimum have been created which have been sealed using Visqueen double sided butyl tape, forming a complete




and continuous barrier. The above photos show the application of double sided butyl tape.

Visqueen silver foil tape has been used to complete the detail.

GEOSHIELD Verification Report

VERIFICATION ITEM ONE

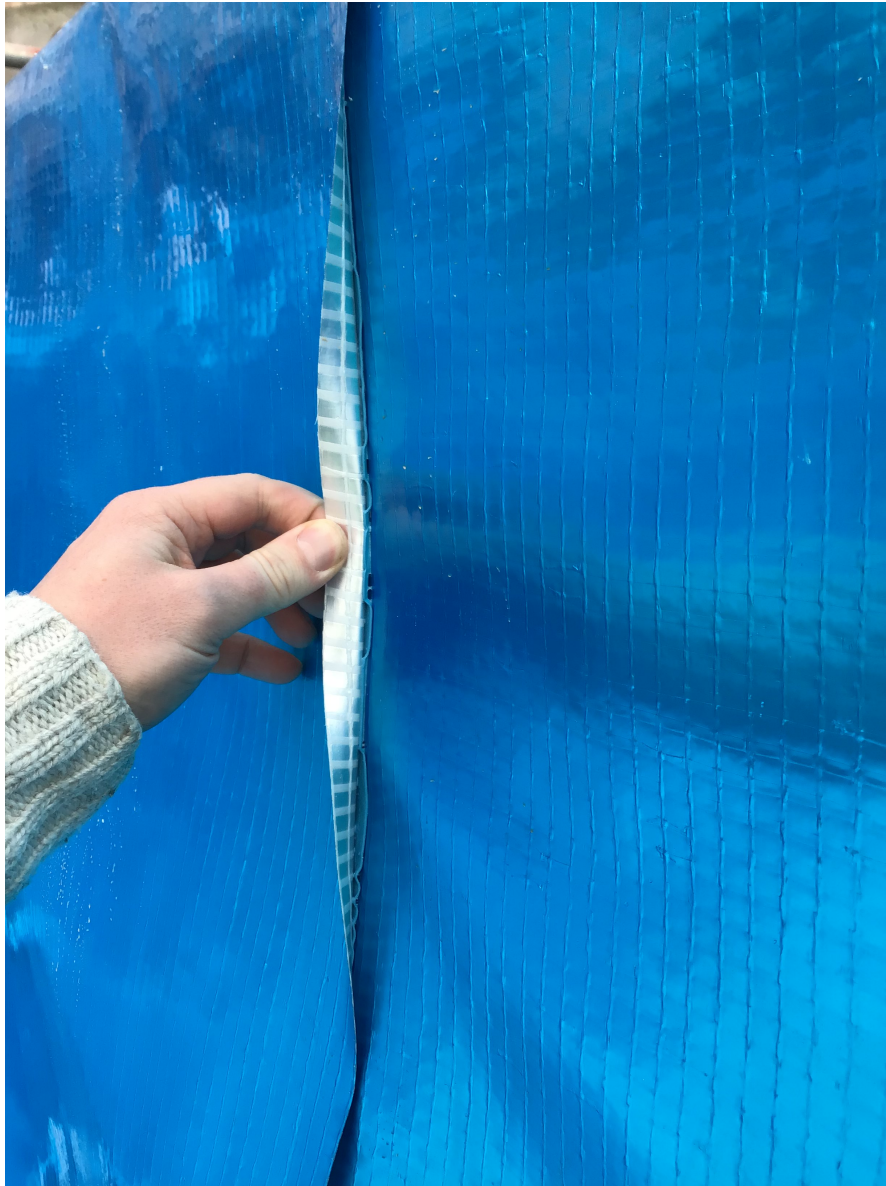

Due to no access air lancing was not conducted however this was replaced by a

thorough pick and probe test. Testing returned no faults with the material installed

to manufacturers specification and an excellent overall standard.



GEOSHIELD Verification Report



VERIFICATION ITEM TWO

LOCATION/GRID LINE: Basement slab - Pour 5

NOTES: Fleece and Spacer Application

Protective Fleece has been installed to the Visqueen Standard Gas Barrier, this is designed to protect the membrane from follow on trade and UV light damage. This has also been overlapped stopping any areas from being exposed.



The left photo shows a roll of Protective Fleece used during the installation.

The right photo shows the fleece installed protecting the membrane from steel mesh and any other follow on trades.

GEOSHIELD Verification Report

VERIFICATION ITEM TWO



Concrete spacers have been applied on top of the protective fleece to help reduce the risk of damage that can be caused to the membrane by sharp edges of steel mesh.