



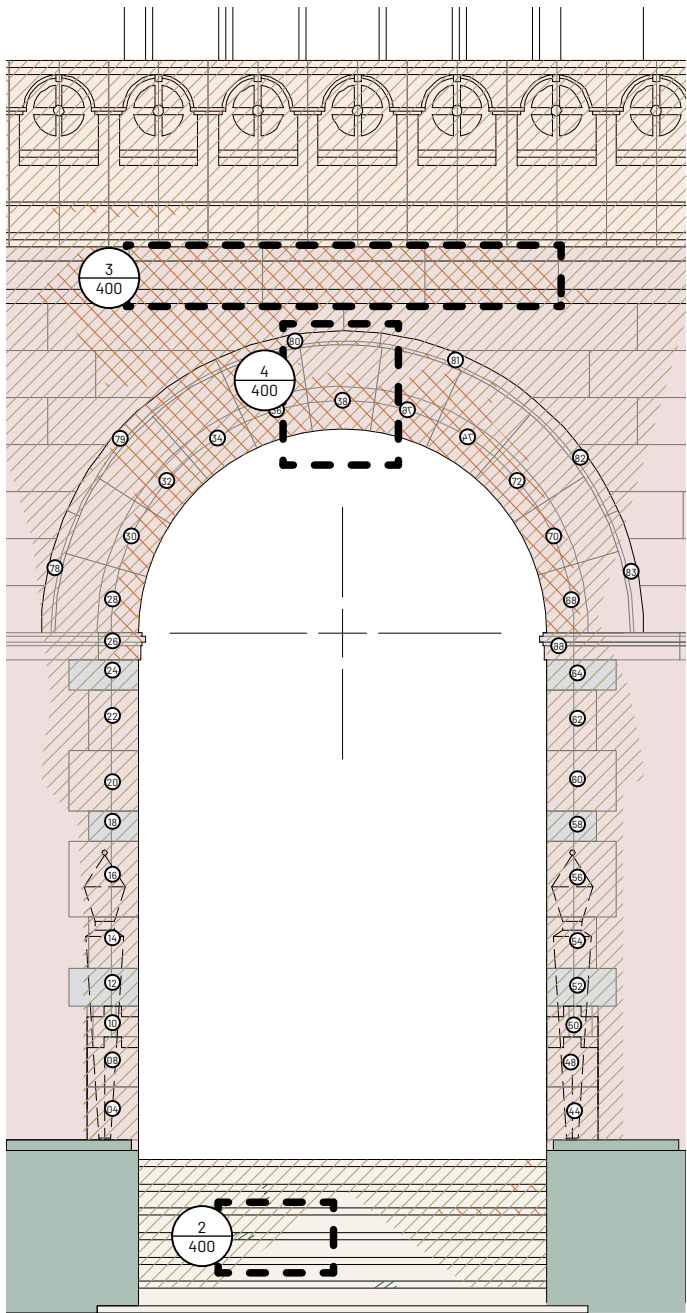

1 Localised Elevation 0150 500 850 mm
Scale: 1:50

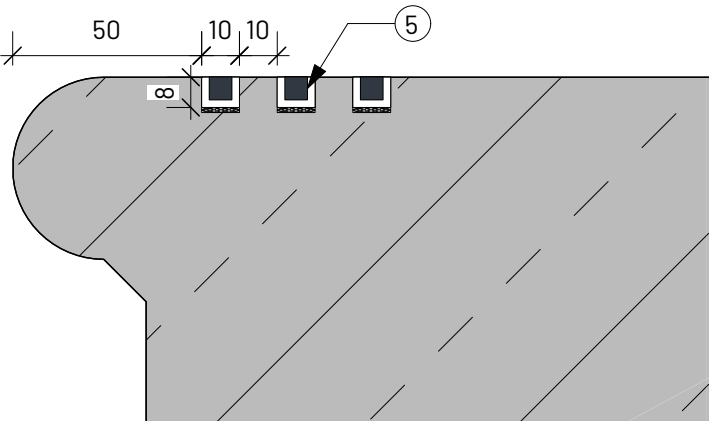

2 Localised Details - Stair Inserts
Scale: Half Actual Size


0 25 50 mm



Cosmetic damage to faience terracotta balcony. Cleaning work only.

The upper and lower orthogonal pieces to have localised indents as per the main facade repair work



Curved surface of cantilevered stone redressed to a new smooth line

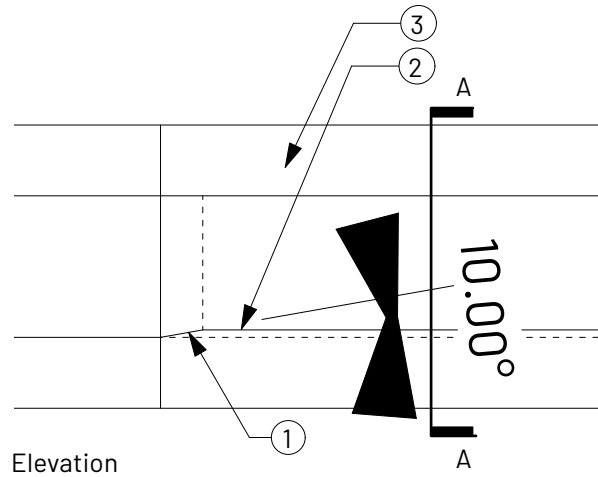

3 Localised Details - Cantilevered Stone
Scale: 1:10

4 Localised Details - Stone Indents
Scale: 1:10

0 100 300 500 mm

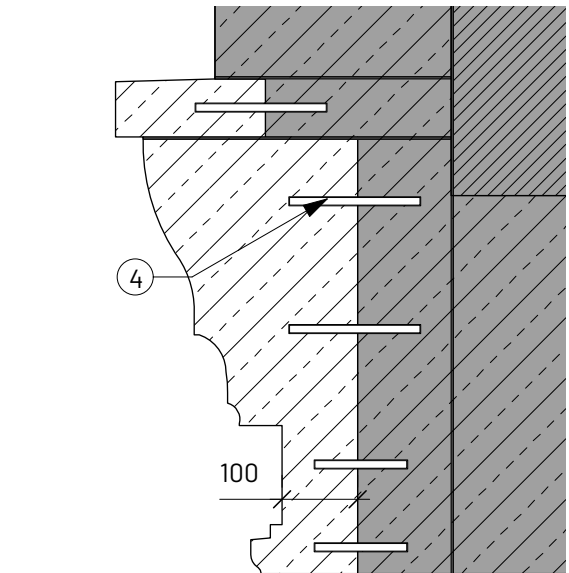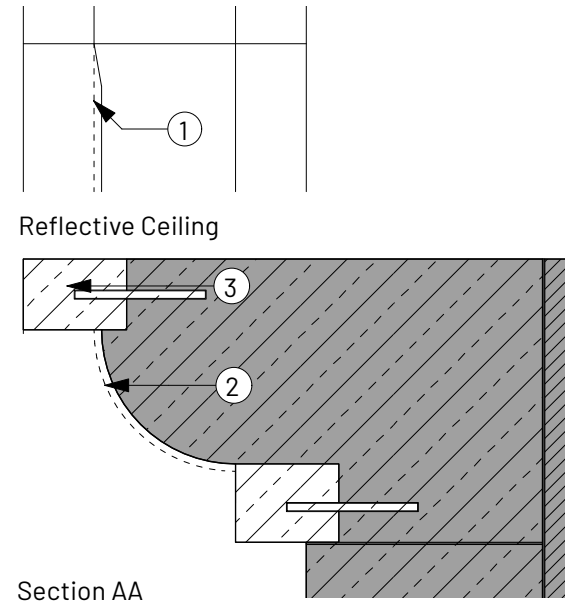

COPYRIGHT OF ATELIER MB LTD
DO NOT SCALE FROM THIS DRAWING
DIMENSIONS TO BE CHECKED ON SITE

KEY Condition Survey

- AtMB-Condition-Cracked Stone
- AtMB-Condition-Smoke surface soiling
- AtMB-Condition-Stone Surface Removed and/or Blistering

NOTES

- Profile the newly redressed face where meets sound adjacent stone/mortar joint.
- Damaged surface to be redressed - nom. 10mm back.
- Stone indents to replace damaged orthogonal details.
- Stone indents to replace damaged faces. Matching stone secured with stainless steel dowels and resin.
- Proprietary ant-slip carborundum insert strips. Adhesive fixed into new grooves.

All details shown are indicative pending final detailed design by stonemason and structural engineer

REV | NOTE | DRN/CHK

Midland Hotel
West Elevation
for Leonardo Hotels

Repair Details

PROJECT REF. 2045
DRWG NO. P(400)
REVISION
SCALE AS NOTED@A3
DATE 1st Feb 24
DRAWN HW

SK sketch E existing P proposed T tender C construction FI final issue

+44 161 236 0051
ARCHITECT@ATELIERMB.CO.UK

ATELIER.MB