

Notes:

LSTA - Lead Sheet Training Academy
<https://leadsheet.co.uk/>
Previously known as the Lead Sheet Association.


Fabric Repair Key

-  Clean off biological growth
-  New stone indent repair
-  Redress loose and friable stone




- Localised redressing of loose and friable stone
- Replace 2 no. side pieces to cartouche plinth - take profile from un-eroded areas to ensure new profile matches the existing.
- New code 6 lead flashing - installed in accordance with LSTA recommendations, and where deviates as agreed with Conservation Officer on site, in accordance with specialist subcontract recommendations.


2 Localised Elevation - Doorway 1
Scale: 1:50

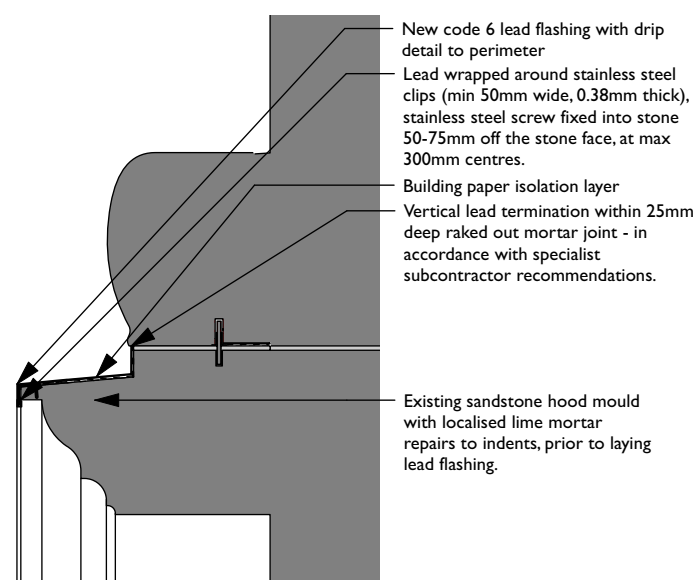

3 Proposed - Section AA
Scale: 1:20

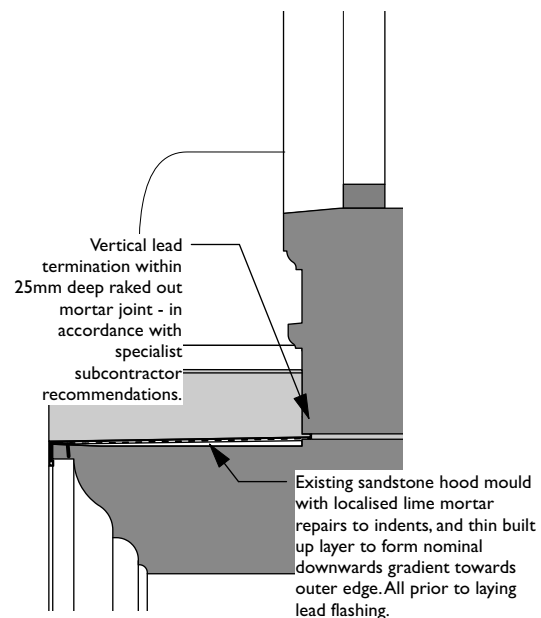

4 Proposed - Section BB
Scale: 1:20

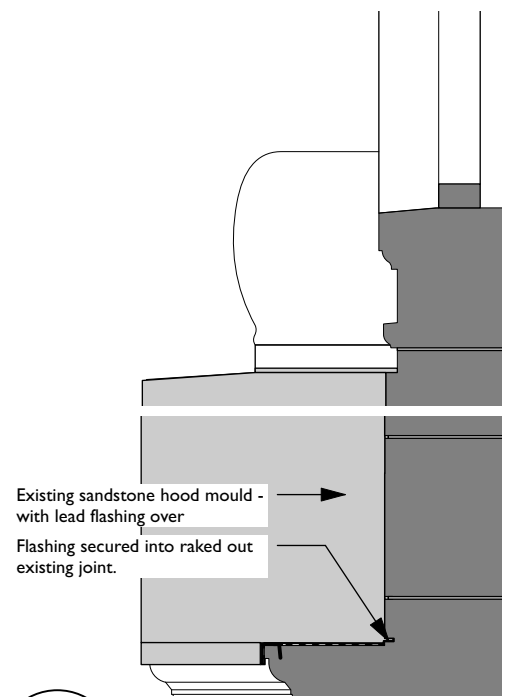

5 Proposed - Section CC
Scale: 1:20

Rev Note DRN CHK

86 Princess St

Water Ingress

Repair Proposals 1 of 2

scheme 1944
drwg no. P(200)
revision

scale 1:20 @ A3
date first drawn Sept 21
drawn HW

SK sketch E existing P proposed T tender C construction F1 final issue

www.ateliermb.co.uk
t 0161 236 0051
e architect@ateliermb.co.uk