


Key Plan 1:500

- 1 Sandstone erosion - close inspection required.
- 2 Holes left by redundant fixings - mortar fill in accordance with specification.
- 3 Gaps in brickwork. Close inspection required to inform replacement with matching material.
- 4 Missing pointing between frieze panels. Reinststate in accordance with specification.
- 5 Redundant plant equipment carefully remove and make good fabric in accordance with specification.
- 6 Eroded sandstone coping. Close inspection required. Replacement matching stone inserts may be required to prevent further deterioration.
- 7 Rusting lintels Clean off and repaint in accordance with specification.
- 8 Biological growth to be removed from roof level.
- 9 Coping water staining. May require repointing. Close inspection required.
- 10 Previous repairs to sandstone. Poorly matched aesthetic and presumed composition, but no evidence repairs are causing damage to surrounding historic fabric. Add to building maintenance plan for regular monitoring.
- 11 Biological growth to stone to be cleaned in accordance with specification.
- 12 Water staining may be caused by missing pointing. Close inspection required to inform repair strategy.
- 13 Signs of cracking. Further inspection required on site.
- 14 Redundant cables/lights/alarm box. Carefully remove
- 15 Residue from former sign to be cleaned off sandstone. Method pending site trials.

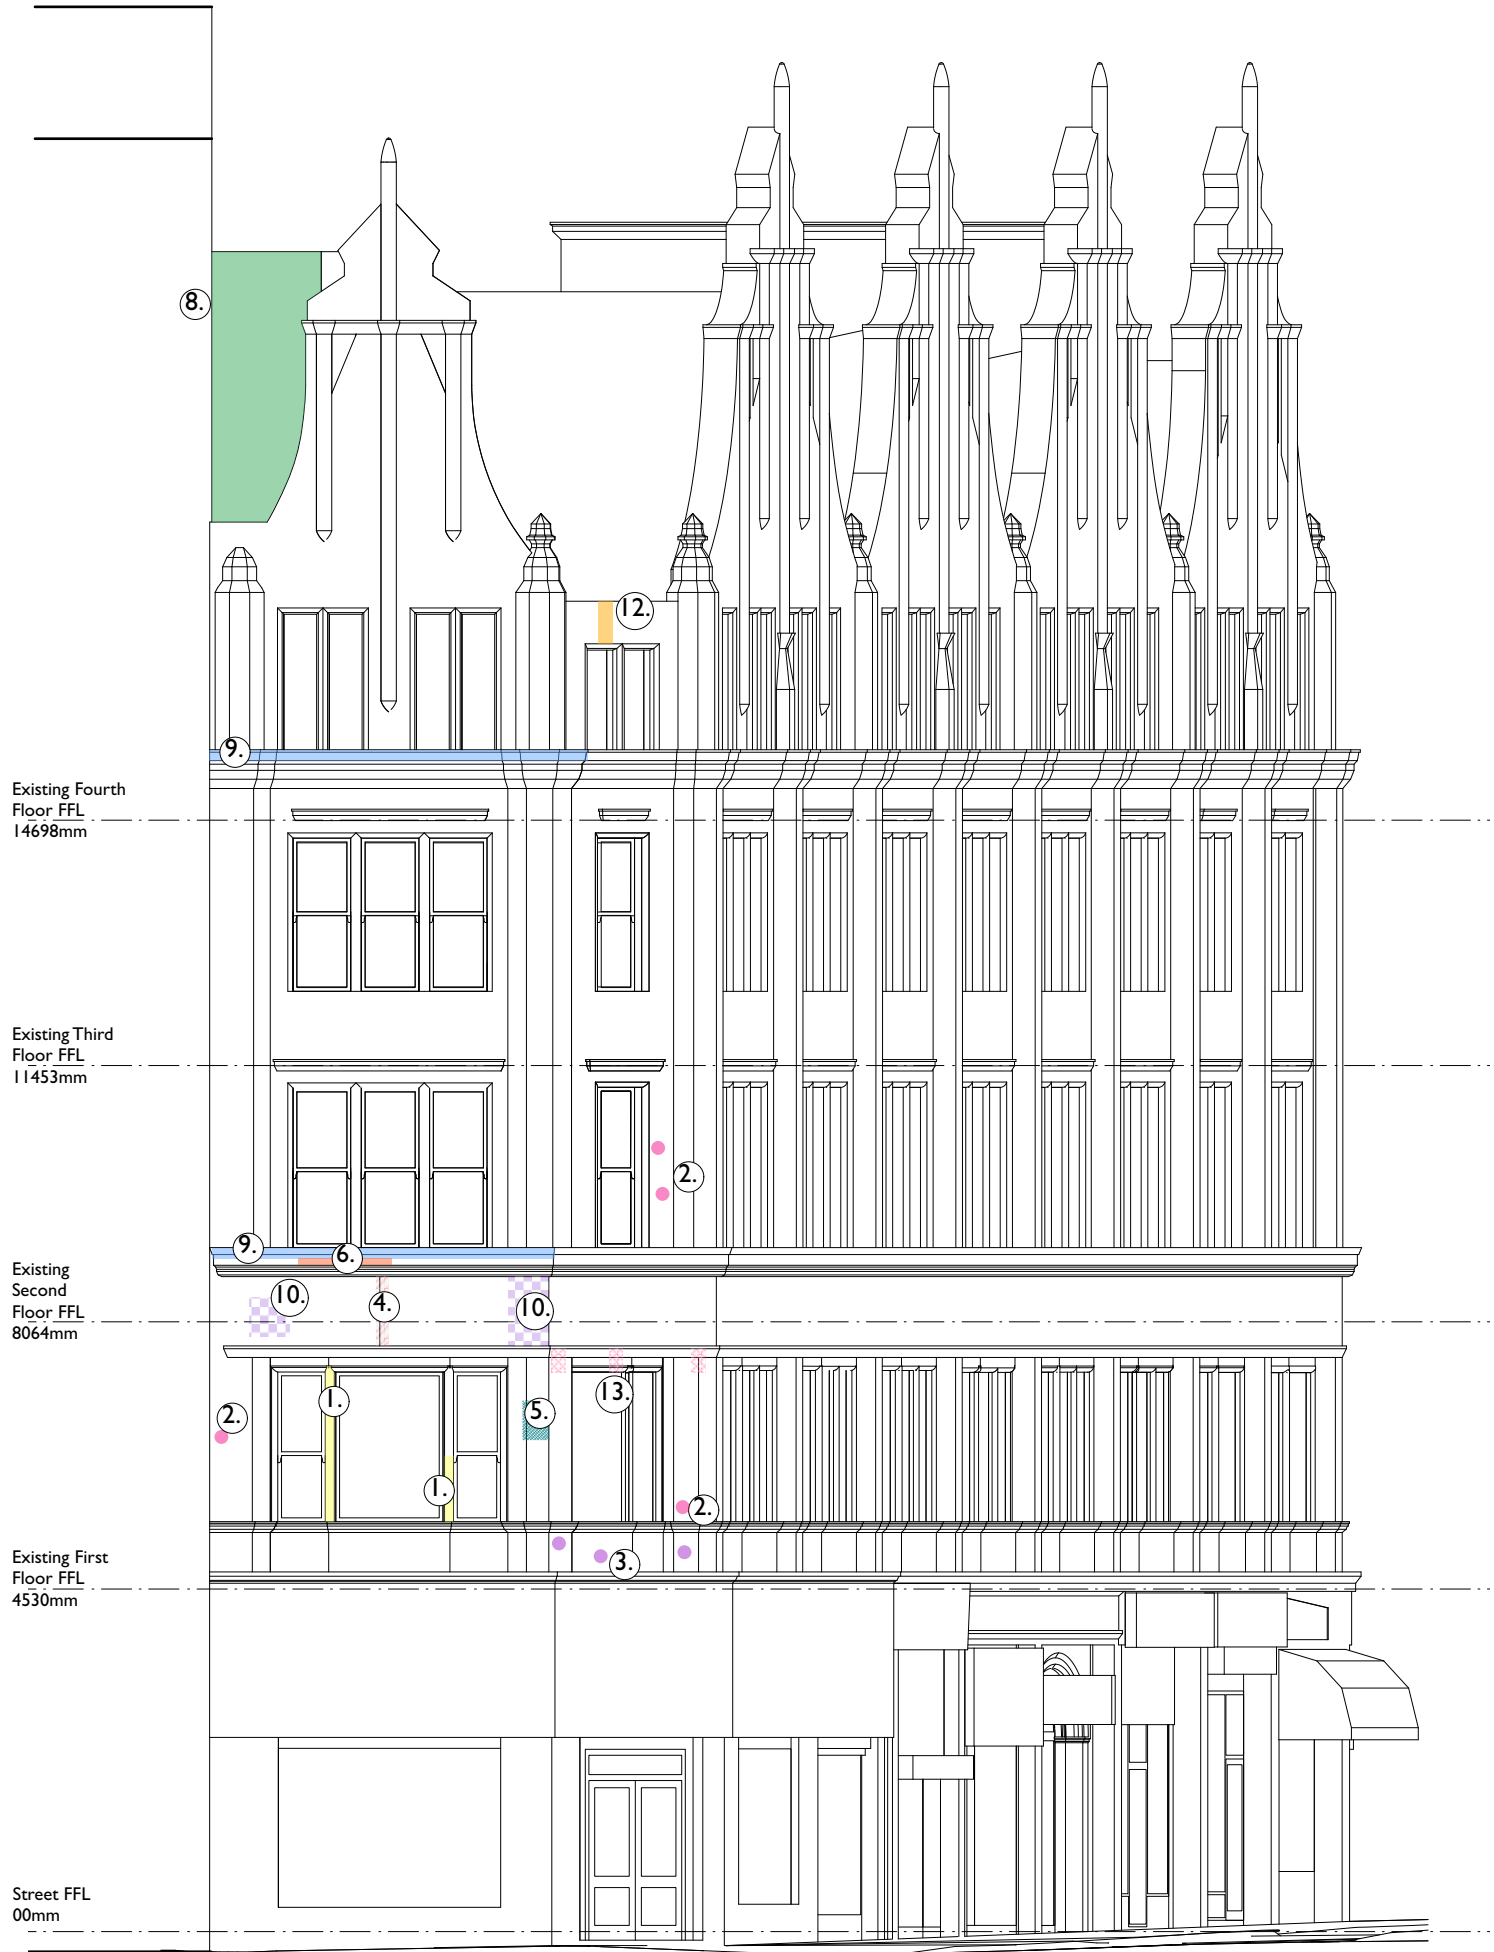

Refer to Drawings 216

COPYRIGHT OF ATELIER MB LTD  
DO NOT SCALE FROM THIS DRAWING  
DIMENSIONS TO BE CHECKED ON SITE

Note: These elevations are indicative and not based on a full measured survey

All notes based on pavement level inspection only. Close inspection required following receipt of Listed Building Consent to inform final scope of repair works package.

General atmospheric dirt to masonry faces. No sign of causing damage to underlying fabric. Propose no action.

Note: Floor Levels are Approximate

Flashings to be renewed as required

Rev Note DRN CHK

**St Margaret's Chambers**  
For Charlotte Street Estates

Piccadilly Elevation -  
Proposed Repairs and  
Conditions

|          |               |
|----------|---------------|
| scheme   | 1907          |
| drwg no. | <b>P(206)</b> |
| revision |               |

|                  |               |
|------------------|---------------|
| scale            | 1:100 @ A3    |
| date first drawn | February 2022 |
| drawn            | RG            |

SK sketch E existing P proposed T tender C construction FI final issue

[www.ateliermb.co.uk](http://www.ateliermb.co.uk)  
t 0161 236 0051  
e architect@ateliermb.co.uk

**Atelier MB**  
Urban Architects