





ROOF REMEDIAL DETAIL
(1:2)

REPAIR NOTES:

1. BREAK OFF ALL CRACKED CONCRETE AND CHASE BACK BEYOND BY 20mm TO EXPOSED STEEL.
2. NEEDLE GUN EXPOSED REINFORCEMENT.
3. PRIME WITH NITOPRIME ZINC-RICH PRIMER OR SIMILAR APPROVED BY ENGINEER.
4. BUILD UP CONCRETE SECTION WITH FIVE STAR NON-SHRINK REPAIR OR SIMILAR APPROVED BY ENGINEER.

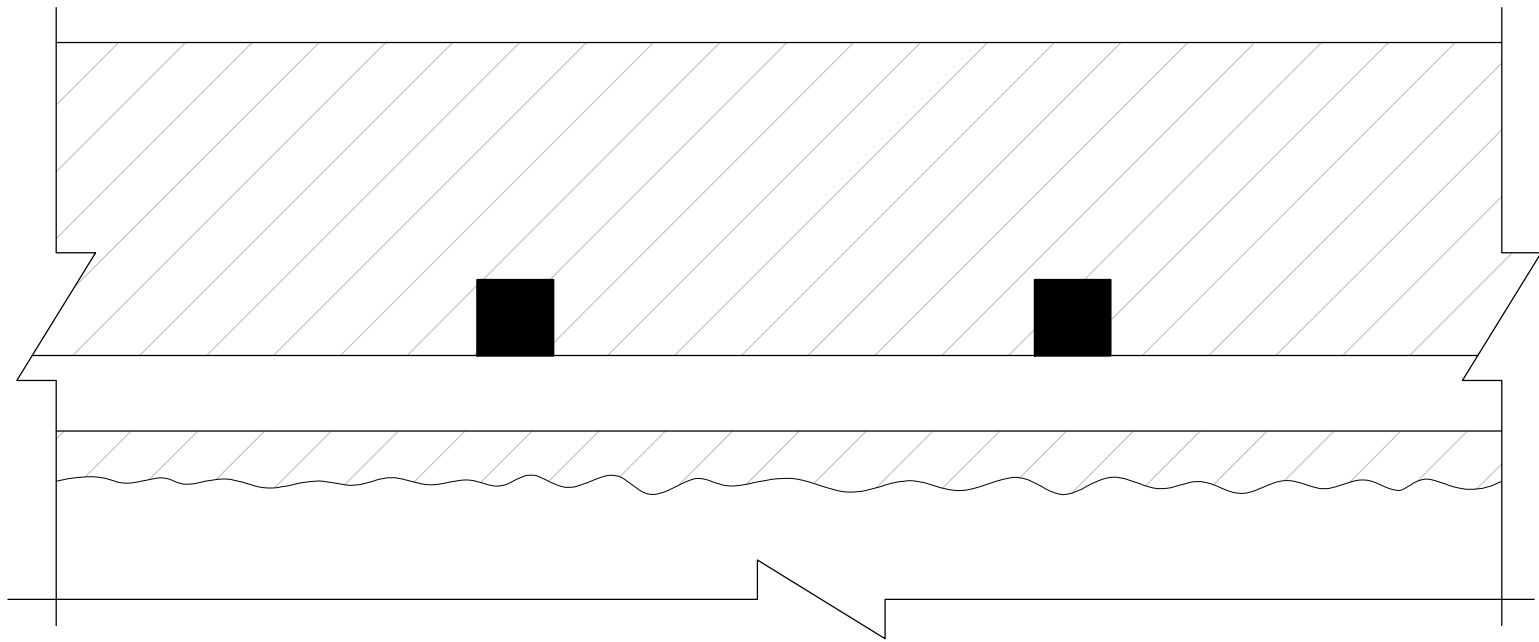

REPOINTING OF BRICKWORK REQUIRED
(NTS)

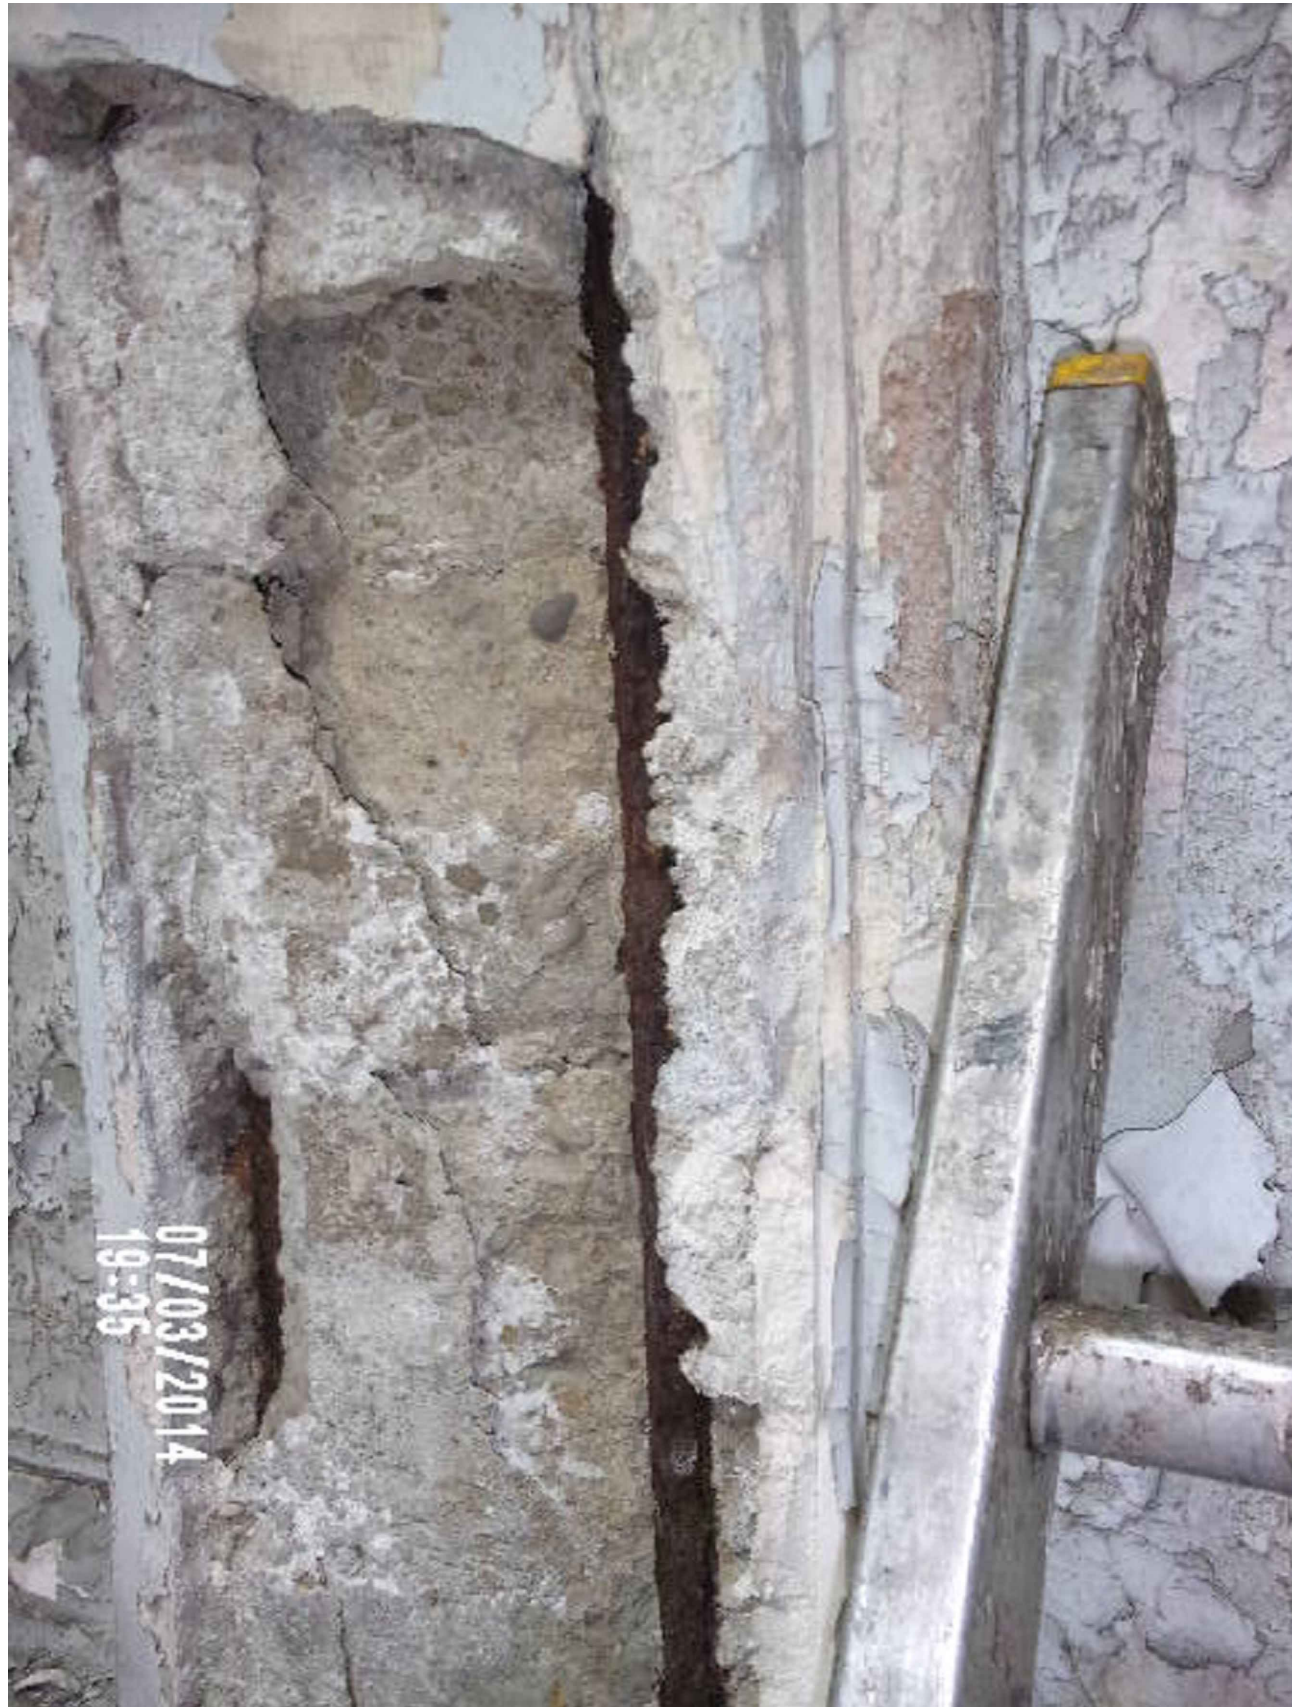

DAMAGED CONCRETE PHOTO
(NTS)



DAMAGED CONCRETE PHOTO
(NTS)

NOTES:

1. ALL DIMENSIONS ARE IN MILLIMETRES UNLESS NOTED OTHERWISE.
2. THIS DRAWING IS TO BE READ IN CONJUNCTION WITH ALL OTHER RELEVANT DRAWINGS AND SPECIFICATIONS.

P1	ISSUED FOR INFORMATION	JKT	PKD	MAY'22
Rev	Description	Drawn	Chkd	Date

Sir Frederick Snow & Partners Ltd
Consulting Engineers



211 - 213 Higher Hillgate
Stockport
Cheshire
SK1 3RB
Tel: 0161 477 3365
Fax: 0161 477 7472
e-mail: northwest@fsnow.co.uk

Client
MANCHESTER CITY COUNCIL

Project Title
CHORLTON LIBRARY

Drawing Title
PROPOSED REMEDIAL WORKS TO
CONCRETE DOME

Scale(s)
1:200
(Do not scale off this drawing
work to figured dimensions)

Scalebar
0 10 50 100mm
Original Drawing Size A1