

Room Ref.	Element	Description / Item	Condition	Action	Photographs			
S02	Walls	Holes to red brick walls. Misc. screws and M&E fixings.	Fair	- Fix salvaged red brick to holes. - Remove all screws and fixings from walls. Proposed works - Existing walls to be stripped back to masonry, and all loose material removed.				010
	Ceiling	Exposed timber roof structure.	Good	- Remove redundant fixings and clean roof truss. Proposed works - All existing ceilings to be removed - Provide new insulated plasterboard ceiling below rafters (to be read in conjunction with roof type drawing 3501) - Prepare and decorate existing trusses (colour tbc by architect).				
	Floor	Red quarry tile, wood block and glazed tile to hearth.	Good / fair	- Clean red quarry tile and protect. - Record quantity of wood block, lift and store on pallet in room. - Carefully remove glazed tile and store in box on pallet in room. - Remove all debris. Proposed works - Floor to be levelled and prepared throughout with latex levelling screed or similar NBS:M10/120.				
	Joinery			N/A				
	Misc.	Failed concrete lintels. Conduit to walls. Misc. fixing and cable to roof truss.		- CURTINS COMMENT: Doorways are proposed to be infilled. We recommend infilling in load bearing masonry to avoid repairs to two suspect lintels. - Remove redundant conduit. - Retain misc. fixing and cable to roof truss. - Clean fire place.				

Room Ref.	Element	Description / Item	Condition	Action	Photographs			
S11	Walls	Holes to red brick walls. Misc. screws and M&E fixings.	Fair	- Fix salvaged red brick to holes. - Remove all screws and fixings from walls. Proposed works - Existing walls to be stripped back to masonry, and all loose material removed.				010
	Ceiling	Exposed timber and steel structure with stone slabs.	Good	- De-rust all beams ready for re-decoration. Proposed works - All existing ceilings to be removed - Steel beams to be de-rusted and treated with intumescent paint NBS:M61/120. - Provide new suspended plasterboard ceiling consisting of MF grid with 2 layers fireboard and skim in preparation for decoration. <i>Provisional to pricing purposes – further inspection required.</i>				
	Floor	Wood block already lifted.	Good / fair	- Record quantity of wood block and store on pallet in room. - Remove all debris and pigeon guano. Proposed works - Floor to be levelled and prepared throughout with latex levelling screed or similar NBS:M10/120.				
	Joinery	Window and pile of joinery piled in room.		Proposed work - Loose window to be set aside for reuse - Misc joinery to be reused where possible, otherwise, scrapped.				
	Misc.	Failed concrete lintels. Conduit to walls. Misc. fixing and cable to roof truss.		- CURTINS COMMENT: Patch repair lintel with patch repair mortar e.g. Sika monotop615. Repoint cracked mortar joints (lintel expansion rust jacking). - Remove redundant conduit (and fill holes) - Retain misc. fixing and cable to roof truss (fill holes).				

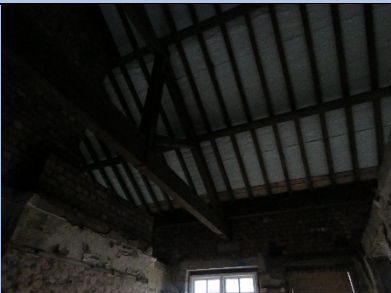
Room Ref.	Element	Description / Item	Condition	Action	Photographs			
313a, 313B, 313G	Walls	Holes to red brick walls. Misc. screws and M&E fixings.	Fair	- Fix salvaged red brick to holes. - Remove all screws and fixings from walls. Proposed works - Strip all walls back to masonry - Provide insulated plasterboard (refer to wall type drawing) and secondary glazing (NBS:L10/580A) to east wall (LR). - Provide stud partitions to form internal bathroom (313B) and Lobby (313g) as per drawing 2418. - Provide acoustic plaster board to north and south party wall of 313a as per drawing 2418. - North (party) wall of Lobby 313g to remain as bare masonry.				001
	Ceiling	Exposed timber roof structure.	Good	- Remove redundant fixings and clean roof truss. Proposed works - All existing ceilings to be removed - Provide new insulated plasterboard ceiling below rafters (to be read in conjunction with roof type drawing 3501) - Prepare and decorate existing trusses (colour tbc by architect)				
	Floor	Red quarry tile, wood block and glazed tile to hearth.	Good / fair	- Clean red quarry tile and protect. - Record quantity of wood block, lift and store on pallet in room. - Remove all debris. Proposed works - Floor to be levelled and prepared throughout with latex levelling screed or similar NBS:M10/120.				
	Joinery			N/A				
	Misc.	Failed concrete lintels. Conduit to walls. Misc. fixing and cable to roof truss.		- CURTINS COMMENT: Walls proposed to be infilled. Partition infill should be load bearing masonry to support wall over. - ALLIED COMMENT: Quadriga to confirm with Curtins if existing lintel is to be removed and replaced with the brickwork or to remain in place. - Remove redundant conduit (and fill holes). - Retain misc. fixing and cable to roof truss (check with Project Manager if this item should instead be removed).				

Room Ref.	Element	Description / Item	Condition	Action	Photographs			
315a, 315b	Walls	Plaster on brickwork with paint and wallpaper finish. Minor no. of nails to walls.	Fair	- Remove redundant fixings. Proposed works - Strip all walls back to masonry - Provide insulated plasterboard (refer to wall type drawing) and secondary glazing (NBS:L10/580A) to east wall (LR). - Provide stud partitions to form internal bathroom (315B) as per drawing 2418. - Provide acoustic plaster board to south party wall of 315a as per drawing 2418. - North (party) wall to remain as bare masonry.				00 1
	Ceiling	Exposed timber roof structure.	Good	- Remove redundant fixings and clean roof truss. Proposed works - All existing ceilings to be removed - Provide new insulated plasterboard ceiling below rafters (to be read in conjunction with roof type drawing 3501) - Prepare and decorate existing trusses (colour tbc by architect)				
	Floor	Red quarry tile, wood block and glazed tile to hearth.	Good / fair	- Clean red quarry tile and protect. - Record quantity of wood block, lift and store on pallet in room. - Remove all debris. Proposed works - Floor to be levelled and prepared throughout with latex levelling screed or similar NBS:M10/120.				
	Joinery	Minor area of skirting in-situ. Window and pile of joinery piled in room.		Proposed works - Reinstate skirting boards to new plastered walls, leave masonry walls bare. - Standalone window to be set aside for reuse - Misc. joinery to be reused where possible, otherwise scrapped.				
	Misc.	Failed concrete lintels. Misc. fixing and cable to roof truss.		- CURTINS COMMENT: Walls proposed to be infilled. Partition infill should be load bearing masonry to support wall over. - ALLIED COMMENT: Quadriga to confirm with Curtins if existing lintel is to be removed and replaced with the brickwork or to remain in place. - Retain misc. fixing and cable to roof truss.				

Room Ref.	Element	Description / Item	Condition	Action	Photographs				
316a, 316b, 316c	Walls	Plaster on brickwork with paint and wallpaper finish. Minor no. of nails to walls.	Fair	- Remove redundant fixings. Proposed works - Strip all walls back to masonry - Provide insulated plasterboard (refer to wall type drawing) and secondary glazing (NBS:L10/580A) to east wall (LR). - Provide stud partitions to form internal bathroom (316B) and lobby 316c as per drawing 2418. - Provide acoustic plaster board to north party wall of 316a as per drawing 2418. - South (party) wall to remain as bare masonry.					001
	Ceiling	Exposed timber roof structure.	Good	- Remove redundant fixings and clean roof truss. Proposed works - All existing ceilings to be removed - Provide new insulated plasterboard ceiling below rafters (to be read in conjunction with roof type drawing 3501) - Prepare and decorate existing trusses					
	Floor	Red quarry tile, wood block and glazed tile to hearth.	Good / fair	- Clean red quarry tile and protect. - Record quantity of wood block, lift and store on pallet in room. - Remove all debris. Proposed works - Floor to be levelled and prepared throughout with latex levelling screed or similar NBS:M10/120.					
	Joinery	Minor area of skirting in-situ. Door frame and pile of joinery piled in room.		Proposed works - Reinstate skirting boards/picture rails to new plastered walls, leave masonry walls bare. - Doors and frames to be set aside for reuse - Misc. joinery to be reused where possible, otherwise scrapped.					
	Misc.	Misc. fixing and cable to roof truss.		Retain misc. fixing and cable to roof truss. (check with Project Manager as to whether these should instead be removed).					

Room Ref.	Element	Description / Item	Condition	Action	Photographs			
318	Walls	Plaster on brickwork with paint and wallpaper finish. Minor no. of nails to walls.	Fair	- Remove redundant fixings. Proposed works - Strip all walls back to masonry - Provide insulated plasterboard (refer to wall type drawing) and secondary glazing (NBS:L10/580A) to east wall (LR). - Provide stud partitions to form internal bathroom as per drawing 2418. - Provide acoustic plaster board to north & west party walls, along with recesses in south party wall, all as per drawing 2418. - South (party) wall chimney breasts to remain as bare masonry.				00 1
	Ceiling	Exposed timber roof structure.	Good	- Remove redundant fixings and clean roof truss. Proposed works - All existing ceilings to be removed - Provide new insulated plasterboard ceiling below rafters (to be read in conjunction with roof type drawing 3501) - Prepare and decorate existing trusses (colour tbc by architect).				
	Floor	Red quarry tile, wood block and glazed tile to hearth.	Good / fair	- Clean red quarry tile and protect. - Record quantity of wood block, lift and store on pallet in room. - Carefully remove glazed tile and store in box on pallet in room. - Remove all debris. Proposed works - Floor to be levelled and prepared throughout with latex levelling screed or similar NBS:M10/120.				
	Joinery	Minor area of skirting and picture rail in-situ. Door frames and pile of joinery piled in room.		Proposed works - Reinstate skirting boards/picture rails to new plastered walls, leave masonry walls bare. - Doors and frames to be set aside for reuse - Misc. joinery to be reused where possible, otherwise scrapped.				
	Misc.	Misc. fixing and cable to roof truss. Lead water tank stored in room.		- Retain misc. fixing and cable to roof truss. (check with Project Manager as to whether these should instead be removed). - Record lead tank and move to heritage store room. - Remove all other waste.				

Room Ref.	Element	Description / Item	Condition	Action	Photographs			
320a, 320b	Walls	Plasterboard to fireplace. Plaster on brickwork with paint and wallpaper finish. Minor no. of nails and embedded timbers to walls.	Fair	- Remove plaster to fireplace. - Remove redundant fixings and embedded timbers. Proposed works - Strip all walls back to masonry - Provide insulated plasterboard (refer to wall type drawing) and secondary glazing (NBS:L10/580A) to east wall (LR). - Provide stud partitions to form internal bathroom (320b) as per drawing 2416. - Provide acoustic plaster board to south party wall & west (corridor) party walls all as per drawing 2416. - North (party) wall to remain as bare masonry.				00 1
	Ceiling	Exposed timber roof structure.	Good	- Remove redundant fixings and timber fixed to truss. - Clean roof truss. Proposed works - All existing ceilings to be removed - Provide new insulated plasterboard ceiling below rafters (to be read in conjunction with roof type drawing 3501) - Prepare and decorate existing trusses (colour tbc by architect).				
	Floor	Red quarry tile, wood block and glazed tile to hearth. Small area of vinyl tile over red quarry tile.	Good / fair	- Remove vinyl and adhesive. - Clean red quarry tile and protect. - Record quantity of wood block, lift and store on pallet in room. - Remove all debris. Proposed works - Floor to be levelled and prepared throughout with latex levelling screed or similar NBS:M10/120.				
	Joinery	Minor area of skirting in-situ.		Proposed works Reinstate skirting boards/picture rails to new plastered walls, leave masonry walls bare.				
	Misc.	Misc. fixing and cable to roof truss. Section of plaster cornice. Pile of waste plasterboard in room.		- Retain misc. fixing and cable to roof truss (check with Project Manager as to whether these should instead be removed). - Retain plaster cornice. - Remove all other waste.				

Room Ref.	Element	Description / Item	Condition	Action	Photographs			
323a, 323b, 323c	Walls	Plasterboard to fireplace. Plaster on brickwork with wallpaper finish. Minor no. of nails and embedded timbers to walls.	Fair	- Remove redundant fixings and embedded timbers (and fill holes) Proposed works - Strip all walls back to masonry - Provide insulated plasterboard (refer to wall type drawing) and secondary glazing (NBS:L10/580A) to east wall of 323a (LR). - Provide stud partitions to form internal bathroom (323b) and lobby (232c) as per drawing 2416. - Provide acoustic plaster board to south party wall (323a) as per drawing 2416. - North (party) wall to remain as bare masonry.				001
	Ceiling	Exposed timber roof structure.	Good	- Remove redundant fixings and timber fixed to truss. - Clean roof truss. Proposed works - All existing ceilings to be removed - Provide new insulated plasterboard ceiling below rafters (to be read in conjunction with roof type drawing 3501) - Prepare and decorate existing trusses (colour tbc by architect).				
	Floor	Red quarry tile and white tile, wood block and glazed tile to hearth. Small area of vinyl tile over red quarry tile.	Good / fair	- Remove debris, vinyl and adhesive. - Clean red quarry tile, white tile and protect. - Record quantity of wood block, lift remaining and store on pallet in room. - Carefully remove glazed tile and store in box on pallet in room. Proposed works - Floor to be levelled and prepared throughout with latex levelling screed or similar NBS:M10/120.				
	Joinery	Minor area of skirting in-situ. Pile of misc. joinery.		Proposed works - Reinstate skirting boards/picture rails to new plastered walls, leave masonry walls bare. - Misc. joinery to be reused where possible, otherwise scrapped.				
	Misc.	Misc. fixing and cable to roof truss. Pile of general building waste in room.		- Retain misc. fixing and cable to roof truss. - Remove all other waste.				

Room Ref.	Element	Description / Item	Condition	Action	Photographs			
325a, 325b	Walls	Plaster on brickwork with wallpaper finish. Minor no. of nails to walls.	Fair	- Remove redundant fixings (and fill holes). Proposed works - Strip all walls back to masonry - Provide insulated plasterboard (refer to wall type drawing) and secondary glazing (NBS:L10/580A) to east wall of 325a (LR). - Provide stud partitions to form internal bathroom (3253b) as per drawing 2416. - Provide acoustic plaster board to north and south party wall of 325a and to west (corridor) party wall (325a) as per drawing 2416. - North (party) wall 325b to remain as bare masonry.				00 1
	Ceiling	Exposed timber roof structure.	Good	- Remove redundant fixings to roof timbers.. - Clean roof truss. Proposed works - All existing ceilings to be removed - Provide new insulated plasterboard ceiling below rafters (to be read in conjunction with roof type drawing 3501 - Prepare and decorate existing trusses (colour tbc by architect).				
	Floor	Red quarry tile, wood block (1no. room already lifted) and glazed tile to hearth.	Good / fair	- Clean red quarry tile and protect. - Record quantity of wood block, lift and store on pallet in room. - Carefully remove glazed tile and store in box on pallet in room. - Remove all debris. Proposed works - Floor to be levelled and prepared throughout with latex levelling screed or similar NBS:M10/120.				
	Joinery	Minor area of skirting, picture rail and door architrave in-situ. 2no. door frames stacked in room.		Proposed works - Reinstate skirting boards/picture rails to new plastered walls, leave masonry walls bare. - Doors and architraves to be set aside for reuse elsewhere - Misc. joinery to be reused where possible, otherwise scrapped.				
	Misc.	Misc. fixing and cable to roof truss. Section of plaster cornice. Pile of waste plasterboard in room.		- Retain misc. fixing and cable to roof truss (check with Project Manager as to whether these should instead be removed). - Retain plaster cornice & clean. - Remove all other waste.				

Room Ref.	Element	Description / Item	Condition	Action	Photographs				
327a, 237b, 237c	Walls	Plaster on brickwork with paint and wallpaper finish. Minor no. of nails to walls.	Fair	- Remove redundant fixings and fill holes) Proposed works - Strip all walls back to masonry - Provide insulated plasterboard (refer to wall type drawing) and secondary glazing (NBS:L10/580A) to east wall of 327a (LR). - Provide stud partitions to form internal bathroom (327b) and lobby (327c) as per drawing 2416. - Provide acoustic plaster board to north and south party walls of 327a where noted on drawing 2416, otherwise leave as bare masonry.					001
	Ceiling	Exposed timber roof structure.	Good	- Remove redundant fixings to roof timbers. - Clean roof truss. - Retain hanging bracket and cable to roof trusses. Proposed works - All existing ceilings to be removed - Provide new insulated plasterboard ceiling below rafters (to be read in conjunction with roof type drawing 3501 - Prepare and decorate existing trusses (colour tbc by architect).					
	Floor	Red quarry tile, white tile and wood block,	Good / fair	- Clean red quarry tile, white tile and protect. - Record quantity of wood block, lift and store on pallet in room. - Remove all debris. Proposed works - Floor to be levelled and prepared throughout with latex levelling screed or similar NBS:M10/120.					
	Joinery	Minor area of skirting, and door architrave in-situ. Misc. joinery stacked in room.		Proposed works - Reinstate skirting boards/picture rails to new plastered walls, leave masonry walls bare. - Doors and architraves to be set aside for reuse elsewhere - Misc. joinery to be reused where possible, otherwise scrapped.					
	Misc.			N/A					

Room Ref.	Element	Description / Item	Condition	Action	Photographs			
329a, 329b	Walls	Plaster on brickwork with paint and wallpaper finish. Minor no. of nails and embedded timber to walls. Small holes to brickwork.	Fair	- Remove redundant fixings and embedded timber (and fill holes). - Fill holes to brickwork with salvaged red brick. Proposed works - Strip all walls back to masonry - Provide insulated plasterboard (refer to wall type drawing) and secondary glazing (NBS:L10/580A) to east wall of 329a (LR). - Provide stud partitions to form internal bathroom (329b) as per drawing 2416. - Provide acoustic plaster board to north and south party walls of 329a where noted on drawing 2416, otherwise leave as bare masonry.				00 1
	Ceiling	Exposed timber roof structure.	Good	- Remove redundant fixings to roof timbers. - Clean roof truss. - Retain hanging bracket and cable to roof trusses (check fixings and replace with new if required) Proposed works - All existing ceilings to be removed - Provide new insulated plasterboard ceiling below rafters (to be read in conjunction with roof type drawing 3501) - Prepare and decorate existing trusses (colour tbc by architect).				
	Floor	Minor area of vinyl tile over red quarry tile. Red quarry tile, white tile and wood block,	Good / fair	- Remove vinyl and adhesive. - Clean red quarry tile, white tile and protect. - Record quantity of wood block, lift and store on pallet in room. - Remove all debris. Proposed works - Floor to be levelled and prepared throughout with latex levelling screed or similar NBS:M10/120.				
	Joinery	Minor area of skirting, and door architrave in-situ. Misc. joinery stacked in room.		Proposed works - Reinstate skirting boards/picture rails to new plastered walls, leave masonry walls bare. - Doors and architraves to be set aside for reuse elsewhere - Misc. joinery to be reused where possible, otherwise scrapped.				
	Misc.			N/A				

Room Ref.	Element	Description / Item	Condition	Action	Photographs			
330, 330a, 330b	Walls	Plaster on brickwork with paint and wallpaper finish. Minor no. of nails to walls. Small holes to brickwork.	Fair	- Remove redundant fixings (and fill holes). - Fill holes to brickwork with salvaged red brick. Proposed works - Strip all walls back to masonry - Provide insulated plasterboard (refer to wall type drawing) and secondary glazing (NBS:L10/580A) to east wall of 330a (LR). - Provide stud partitions to form internal bathroom (330b) and lobby (330) as per drawing 2404. - Provide acoustic plaster board to west (corridor) party wall of 330, otherwise leave as bare masonry.				00 1
	Ceiling	Exposed timber ceiling structure. Steel beams with stone slabs.	Good	- Remove redundant fixings to roof timbers. - Clean timbers. - De-rust beams ready for decoration. Proposed works - All existing ceilings to be removed - Provide new insulated plasterboard ceiling below rafters (to be read in conjunction with roof type drawing 3501) - Prepare and decorate existing trusses (colour tbc by architect).				
	Floor	Red quarry tile, glazed tile to hearths and wood block,	Good / fair	- Clean red quarry tile and protect. - Record quantity of wood block, lift and store on pallet in room. - Remove all debris. Proposed works - Floor to be levelled and prepared throughout with latex levelling screed or similar NBS:M10/120.				
	Joinery	Minor area of skirting, and picture rail in-situ. Misc. joinery and window stacked in room.		Proposed works - Reinstate skirting boards/picture rails to new plastered walls, leave masonry walls bare. - Standalone window to be set aside for reuse elsewhere - Misc. joinery to be reused where possible, otherwise scrapped.				
	Misc.	Misc. building waste and fire insert.		- Remove mortar and brick from fireplace and clean area. Proposed works - Overboard fireplace				

Room Ref.	Element	Description / Item	Condition	Action	Photographs			
331e (Lobby rotunda)	Walls	Plaster on brickwork with wallpaper finish. Minor no. of nails and embedded timber to walls. Area of heavily eroded brickwork.	Fair	- Remove redundant fixings and embedded timber. - Make repairs/replacements to eroded brickwork Proposed works - Strip all walls back to masonry - Provide insulated plasterboard (refer to wall type drawing) and secondary glazing (NBS:L10/580A) to rotunda room (LR/FFS). - Provide stud partitions to form internal lobby as per drawing 2404. - Provide acoustic plaster board to west (corridor) party wall backing onto riser, otherwise leave as bare masonry.				00 1
	Ceiling	Exposed timber ceiling structure. Steel beams with stone slabs.	Good	- Remove nails and redundant M&E fixings only (and fill holes). - Clean timbers. - De-rust beams ready for decoration. Proposed works - All existing ceilings to be removed - Provide new insulated plasterboard ceiling below rafters (to be read in conjunction with roof type drawing 3501) - Prepare and decorate existing trusses (colour tbc by architect).				
	Floor	Red quarry tile.	Good / fair	- Clean red quarry tile and protect. - Remove all debris. Proposed works - Floor to be levelled and prepared throughout with latex levelling screed or similar NBS:M10/120.				
	Joinery	Door architrave in-situ.		Proposed works Door and architrave to be set aside for reuse elsewhere.				
	Misc.	Pile of building waste.		Remove building waste.				

Room Ref.	Element	Description / Item	Condition	Action	Photographs			
331c, 331d	Walls	Plaster on brickwork with wallpaper finish. Minor no. of nails to walls.	Fair	- Remove redundant fixings (and fill holes). Proposed works - Strip all walls back to masonry - Provide insulated plasterboard (refer to wall type drawing) and secondary glazing (NBS:L10/580A) to east wall (LR). - Provide stud partitions to form bedroom, bathroom, lobby as per drawing 2404. - North and south walls to remain as bare masonry.				00 1
	Ceiling	Exposed timber ceiling structure.	Good	- Remove nails only (and fill holes). - Clean timbers. Proposed works - All existing ceilings to be removed - Provide new insulated plasterboard ceiling below rafters (to be read in conjunction with roof type drawing 3501) - Prepare and decorate existing trusses (colour tbc by architect).				
	Floor	Red quarry tile, wood block (already lifted) and tiled hearth.	Good / fair	- Clean red quarry tile and protect. - Remove all debris. - Quantity wood block and stack on pallet in room. Proposed works - Floor to be levelled and prepared throughout with latex levelling screed or similar NBS:M10/120.				
	Joinery	Picture rail in-situ.		Proposed works Reinstate skirting boards/picture rails to new plastered walls, leave masonry walls bare.				
	Misc.	3no lead water tanks. General building waste.		- Record tanks and retain in heritage store room. - Remove all other waste.				

Room Ref.	Element	Description / Item	Condition	Action	Photographs			
331, 331a	Walls	Plaster on brickwork with wallpaper finish. Minor no. of nails to walls.	Fair	- Remove redundant fixings (and fill holes) Proposed works - Strip all walls back to masonry - Provide insulated plasterboard (refer to wall type drawing) and secondary glazing (NBS:L10/580A) to south wall of 331 (FFS). - Provide stud partitions to form internal bathroom (331a) as per drawing 2404. - Provide acoustic plaster board to west party wall of 331, otherwise leave as bare masonry.				001
	Ceiling	Lath and Plaster ceiling with paint finish. Exposed timber roof structure.	Good	- Remove redundant fixings and clean roof timbers. Proposed works - All existing ceilings to be removed - Provide new insulated plasterboard ceiling below rafters (to be read in conjunction with roof type drawing 3501) - Prepare and decorate existing trusses (colour tbc by architect).				
	Floor	Wood block	Good / fair	- Quantity wood block, lift and stack on pallet in room. Proposed works - Floor to be levelled and prepared throughout with latex levelling screed or similar NBS:M10/120.				
	Joinery	Skirting board in-situ 100%. Misc. door frames and joinery stacked in room.		Proposed works - Reinstate skirting boards/picture rails to new plastered walls, leave masonry walls bare. - Doors, frames, architraves to be removed and set aside for reuse elsewhere				
	Misc.	1no. radiator. Miscellaneous waste. Ceiling hatch. Glazed screen.		- Record radiator and store in heritage storeroom. - Remove all other waste. - Remove glazed screen.				