




North Elevation 01



South Elevation 02

- notes:
1. DO NOT SCALE FROM THIS DRAWING - USE FIGURED DIMENSIONS ONLY.
 2. TO BE READ IN CONJUNCTION WITH ALL OTHER CONSULTANTS / SPECIALISTS DRAWINGS. REPORT ANY DISCREPANCIES BEFORE AFFECTED WORK COMMENCES.
 3. ALL SETTING OUT DIMENSIONS TO BE CHECKED ON SITE BY CONTRACTOR BEFORE WORK COMMENCES.

KEY PLAN

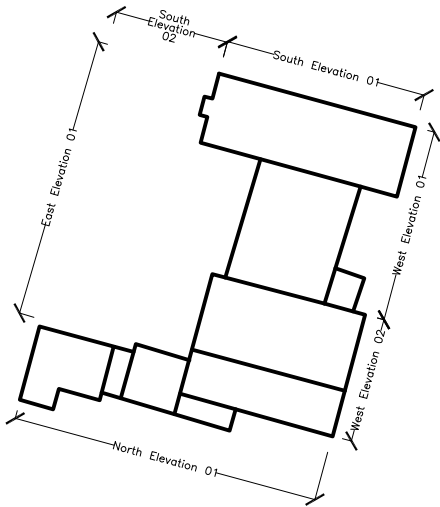

FABRIC REPAIRS KEY

- Refix approximately 6no slipped slates with copper pegs.
- Replace existing plywood with plywood painted white on the inside with an image of the window externally.
- Repointing at low level. Allow for 3 courses around the perimeter of the building.
- Carefully cut out brickwork and replace with reclaimed brick as per specification. Repoint in a Hot Lime mix to match existing mortar colour and texture.
- Replace lead flashing.
- Renew rainwater goods throughout and increase sizes to 6inch.
- Replace valley gutter as per detail...

REVISIONS	P01	ISSUED_FOR_COSTING	11/08/22	SGI	LM
DATE; DRAWN; CHECK					

CLIENT	Historic England
PROJECT	Baguley Hall
TITLE	Fabric Repairs Elevations 3 of 3
NUMBER	BGH-SEV-XX-ZZ-DR-A-3002
REVISION	P01
STATUS	PLANNING
SCALE	1:100 @A3
DATE	12/08/22
DRAWN BY	SGI
CHECKED BY	LM

seven.
SEVENARCHITECTURE.CO.UK

Studios at :

Unit 1.3, Waulk Mill, 51 Bengal Street
MANCHESTER, M4 6LN
t : 0161 236 5655
Clarendon House, Victoria Avenue,
HARROGATE, HG1 1DY
t : 01423 709 807
24 Greville Street, **LONDON**,
EC1N 8SS
t : 0203 036 0691