

NOTES

- Drawings to approximate scale, for reference only.
- Architect and contractor to survey following cleaning to agree areas of repointing.
- Method of protection TBA with Conservation Architect.
- No fixings permitted into Historic Building. Consult Conservation Architect.

Outline specification for mortar mix for repointing:

1:1:1:1/4 - 1/4

'Ionic': NHL2: moist pink silica sand:

Waddington fell grit: clinker based ash: PFA


NOTE: Particular specification TBA with Conservation Architect following completion of samples.



Area to be cleaned using method agreed between architect and contractor.



Areas for proposed indent stone repairs.

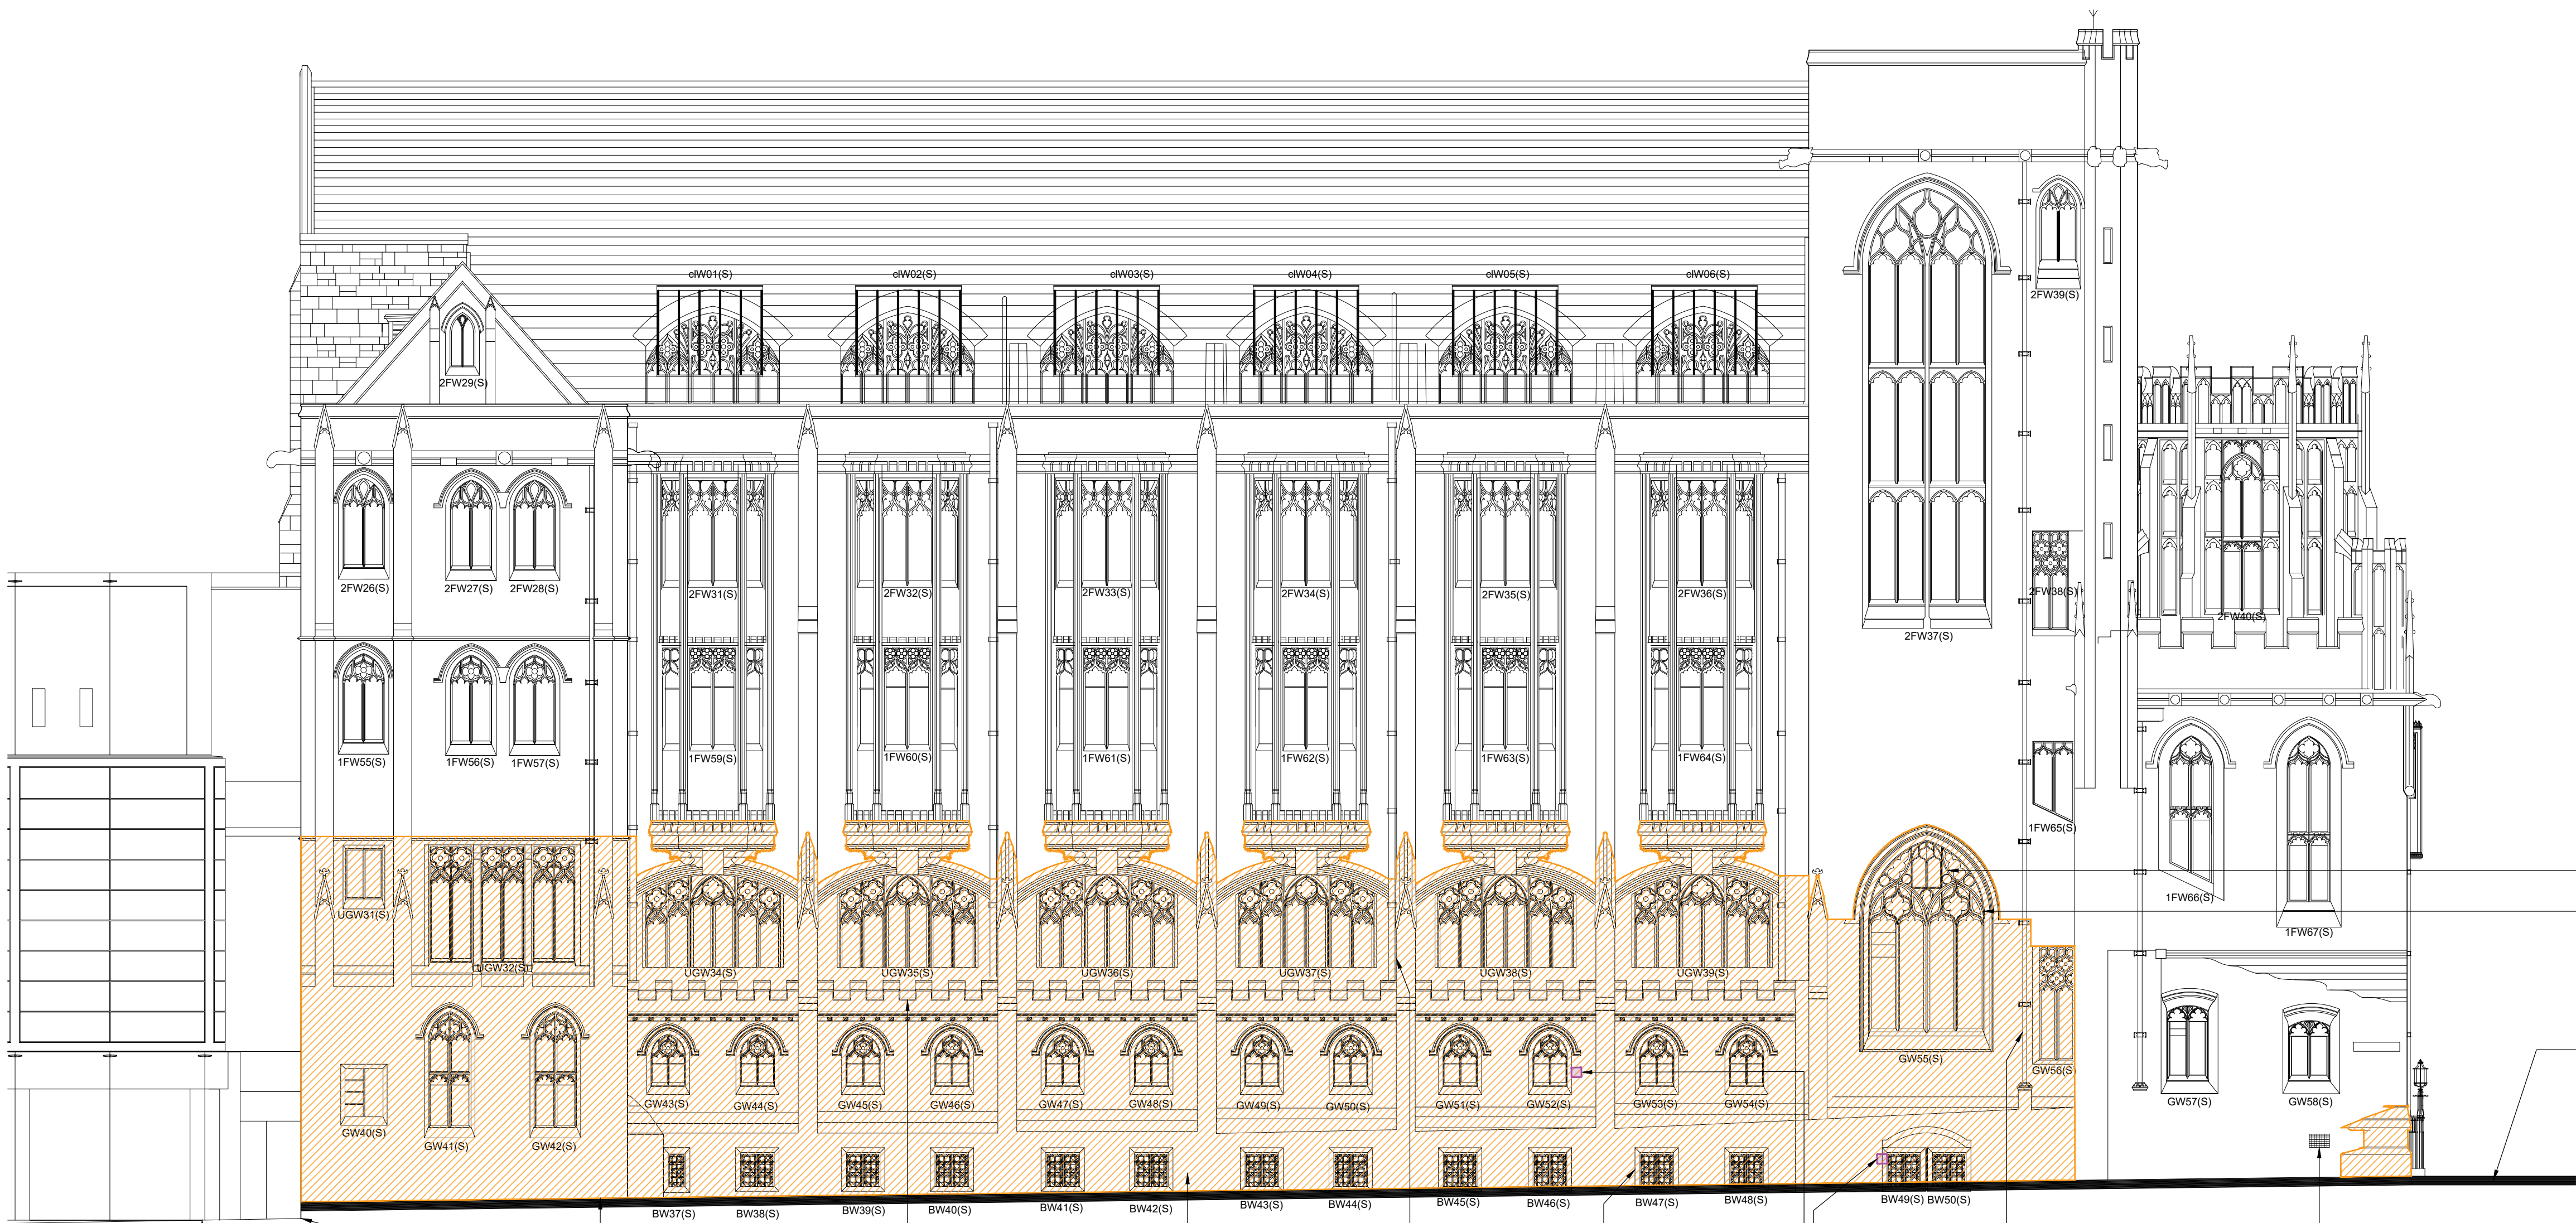

Provide protections to windows.

Provide method statement for scaffolding and high level access.

Site Restriction: Weight bearing capacity of Spinningfields hardscaping tbc.

Site Restriction: Fire Exit cannot be blocked.

Site Restriction: Public using busy entrance to John Rylands Library. Queues form on regular basis.

Site Restriction: Public using space adjacent to building.

Provide protections to lead roofs. Provide method statement for access over lead roofs.

Repointing to isolated areas in lime extent TBA on site with Conservation Architect.

Allow to clean return elevations of buttresses.

Stone indent repairs, stone selection to be agreed with conservation architect.

Provide protection to lead downpipes.

Provide protections to vent grilles.

Site Restriction: Foot level windows risk being damaged from scaffold.

0 1 2 5
Scale 1:100 m

Notes

1. Any dwg format drawing is to be read in conjunction with and at the scale of the accompanying pdf.
2. Where colours other than black or grey are used, the drawing must be plotted in colour.
3. For status 'C' (Construction) drawings all dimensions are to be checked on site by the contractor, scaling is for Local Authority purposes only.
4. Unless otherwise indicated, all dimensions are in millimeters.
5. All information on this drawing is to be read in conjunction with the relevant Donald Insall Associates specification and trade contractors' drawings and information by specialists.
6. In the event of any discrepancy, please contact us immediately.
7. This drawing may contain survey information by others and is to be used solely for the purposes for which it was issued.
8. These are uncontrolled documents issued for information purposes only. If you have any queries regarding the drawings, please contact DIA immediately.
9. Please note DIA cannot be held responsible for any errors arising from changes made to an uncontrolled dwg file.

© 2019 DONALD INSALL ASSOCIATES LTD

Drawing Status

- F Feasibility
- S Sketch Design
- P Planning
- B Building Control
- D Developed Design
- M Measurement
- T Tender
- C Construction
- R Record

Rev	Date	Dwn	Auth	Revision

Rev	Date	Dwn	Auth	Revision
1	08-09-22	JXW	RZM	Additional annotation - LBC
0	10-08-22	JXW	RZM	Initial Issue

Donald Insall Associates
Chartered Architects and Historic Building Consultants

Bridgegate House, 5 Bridge Place
Chester CH1 1SA
(+44) 01244 350 063
chester@insall-architects.co.uk

John Rylands Library and Beyer Building, Manchester

John Rylands Library - Cleaning
Spinningfields Elevation

Project	No	Status	Revision
MAN.JRL.02	2101	P	1
Scale (A1)	1:100		