

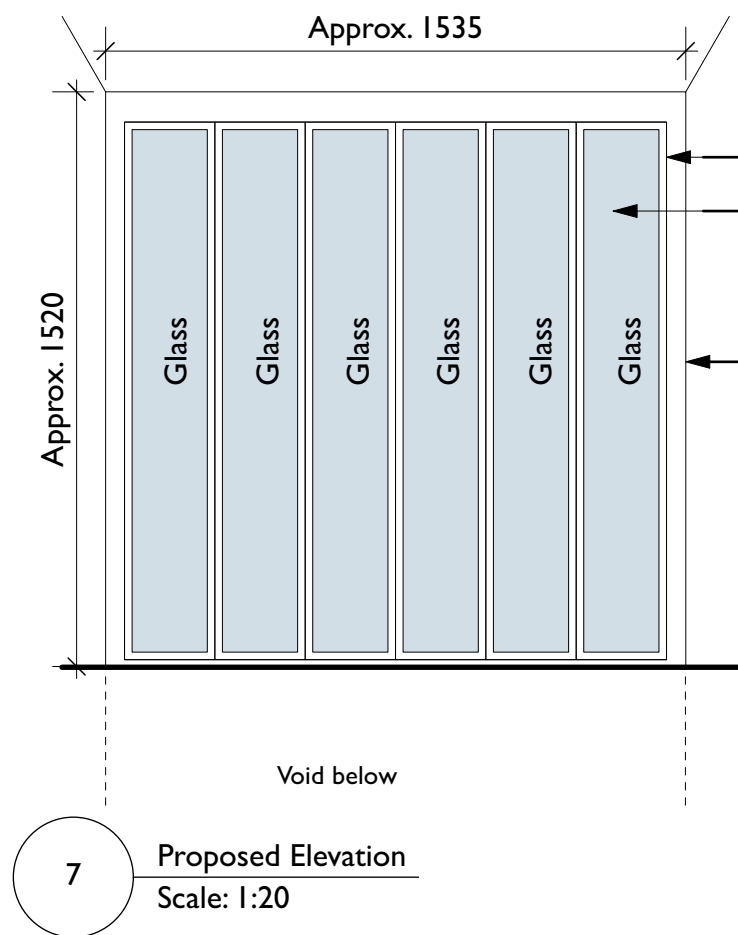
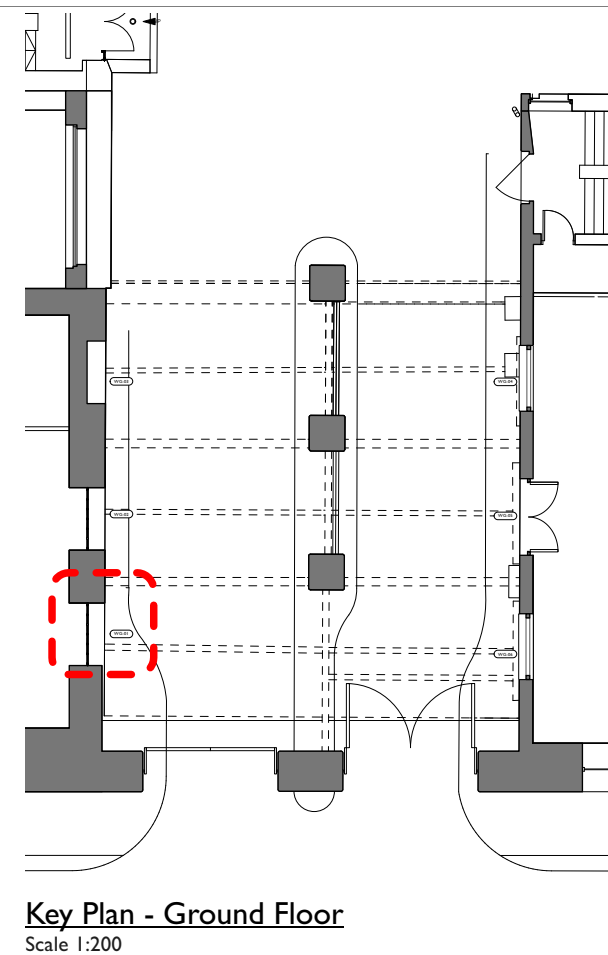
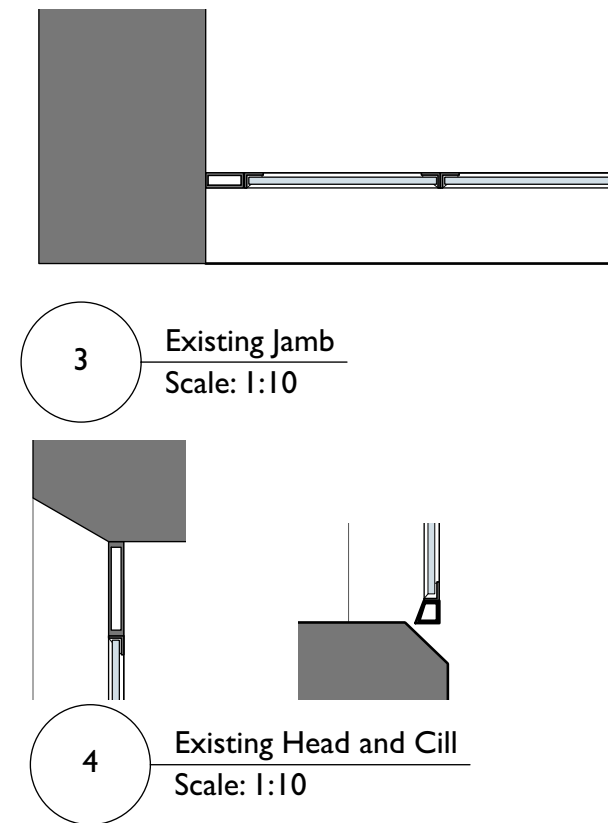
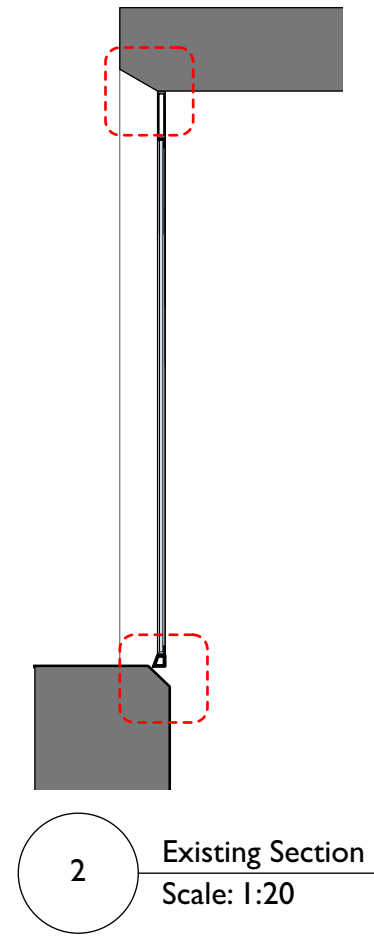
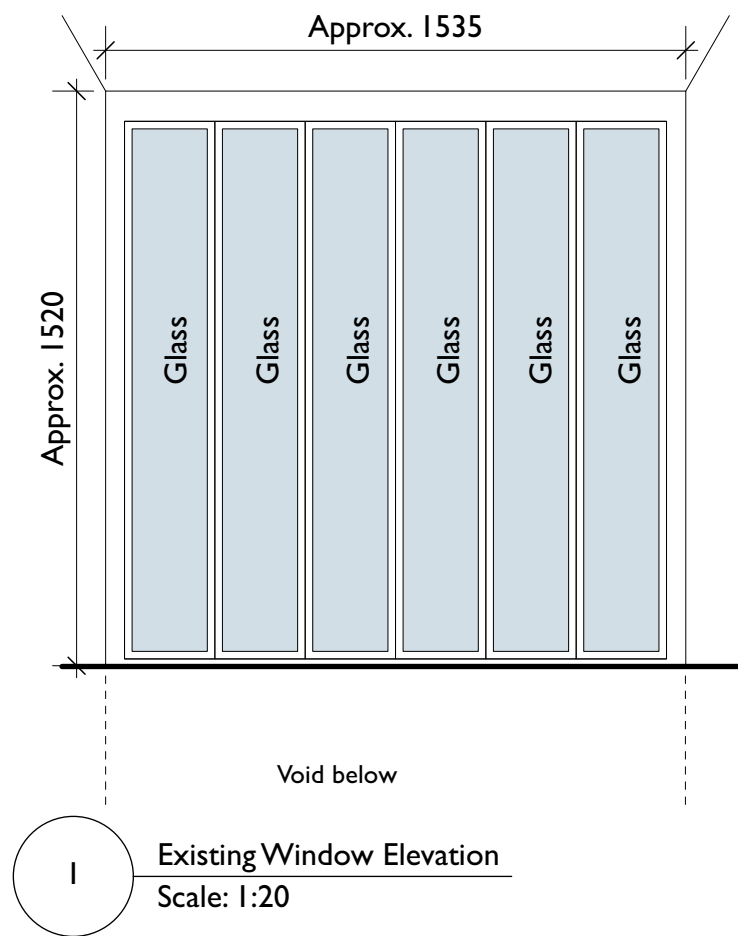


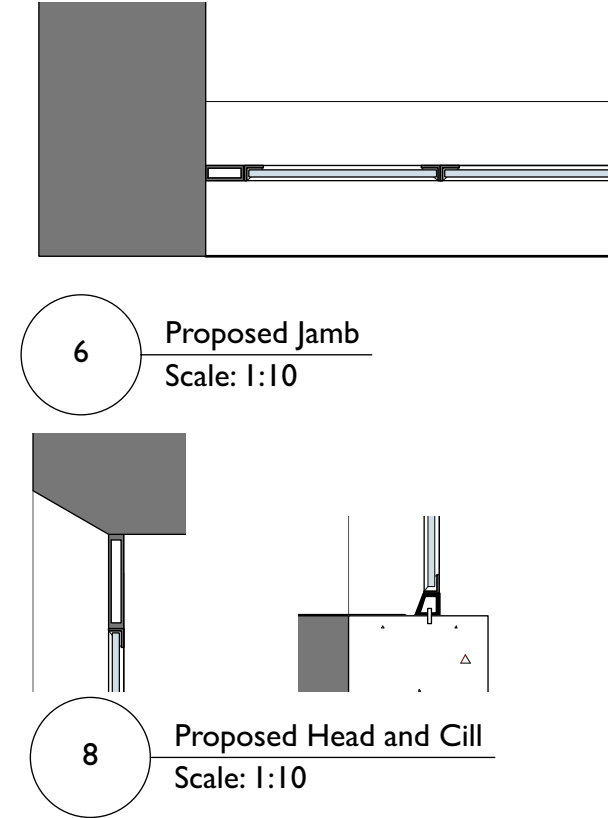

Existing metal frame
cleaned and repainted

Cracked pieces of glass
to be replaced with
new laminated pieces
composed to achieve
10mm thickness of
existing.

Mortar cleaned off
brickwork reveals, and
any damaged
bricks/pointing
repaired/reinstated on
a like for like basis. Final
mix to be agreed
following sampling of
existing mortar. For
pricing purposes only -
1:3 quicklime:sand as
NBS CI C41.

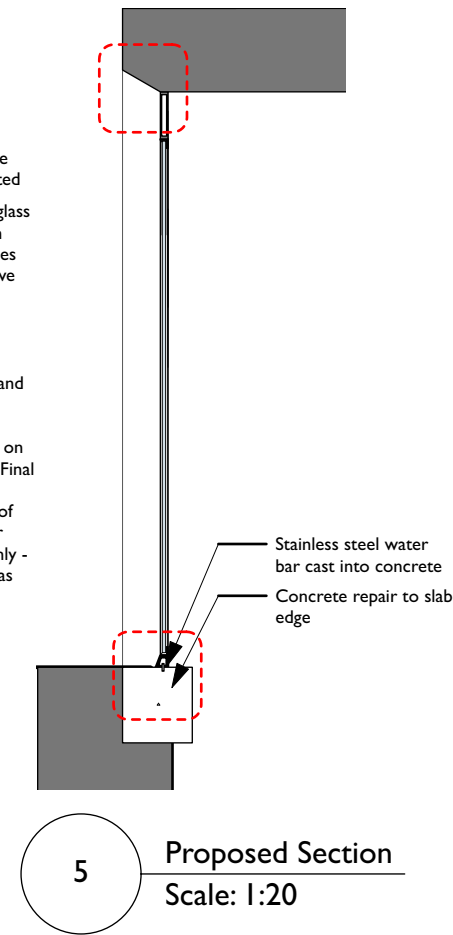

Photograph of existing opening
10/03/22

COPYRIGHT OF ATELIER MB LTD
DO NOT SCALE FROM THIS DRAWING
DIMENSIONS TO BE CHECKED ON SITE

All dimensions are
approximate

KEY
Existing
Proposed

A Minor corrections HW HW
08/06/2022
Rev Note DRN CHK

Tootal Courtyard Windows
for
XLB Property

Existing and Proposed -
Window WG_01

scheme 1963
dwg no. P(401)
revision A

scale 1:20 @ A3
date first drawn March 22
drawn RJD

SK sketch E existing P proposed T tender C construction FI final issue

www.ateliermb.co.uk
t 0161 236 0051
e architect@ateliermb.co.uk

Atelier MB
Urban Architects