




Part RCP layout: Level 02

- KEY:**
- CEILING TYPES**
- Original floor/mill boards to be cleaned, repaired, linewash finish applied
 - Original lath and plaster ceiling to be retained, repaired and decorated
 - Cast iron beams located above lath and plaster ceiling, to be fully exposed (ceiling opened up) and intumescent painted/fire protected. Lath and plaster ceiling to be made good.
 - Decorative coving to be retained, repaired, or locally replaced if necessary (gap between indicates former partition or screen, now removed)
 - Unstable/ damaged decorative coving to be replaced to match original (gap between indicates former partition or screen, now removed)
 - Cementitious board providing 60 minute fire protection underdrawing new timber floor infill to former stair opening
 - Plasterboard ceiling on MF system (acoustic) to window bays, behind decorative coving
- PARTITION REPAIRS**
- Original lath and plaster partition to be retained loose and friable material to be carefully removed and locally repaired to match original.

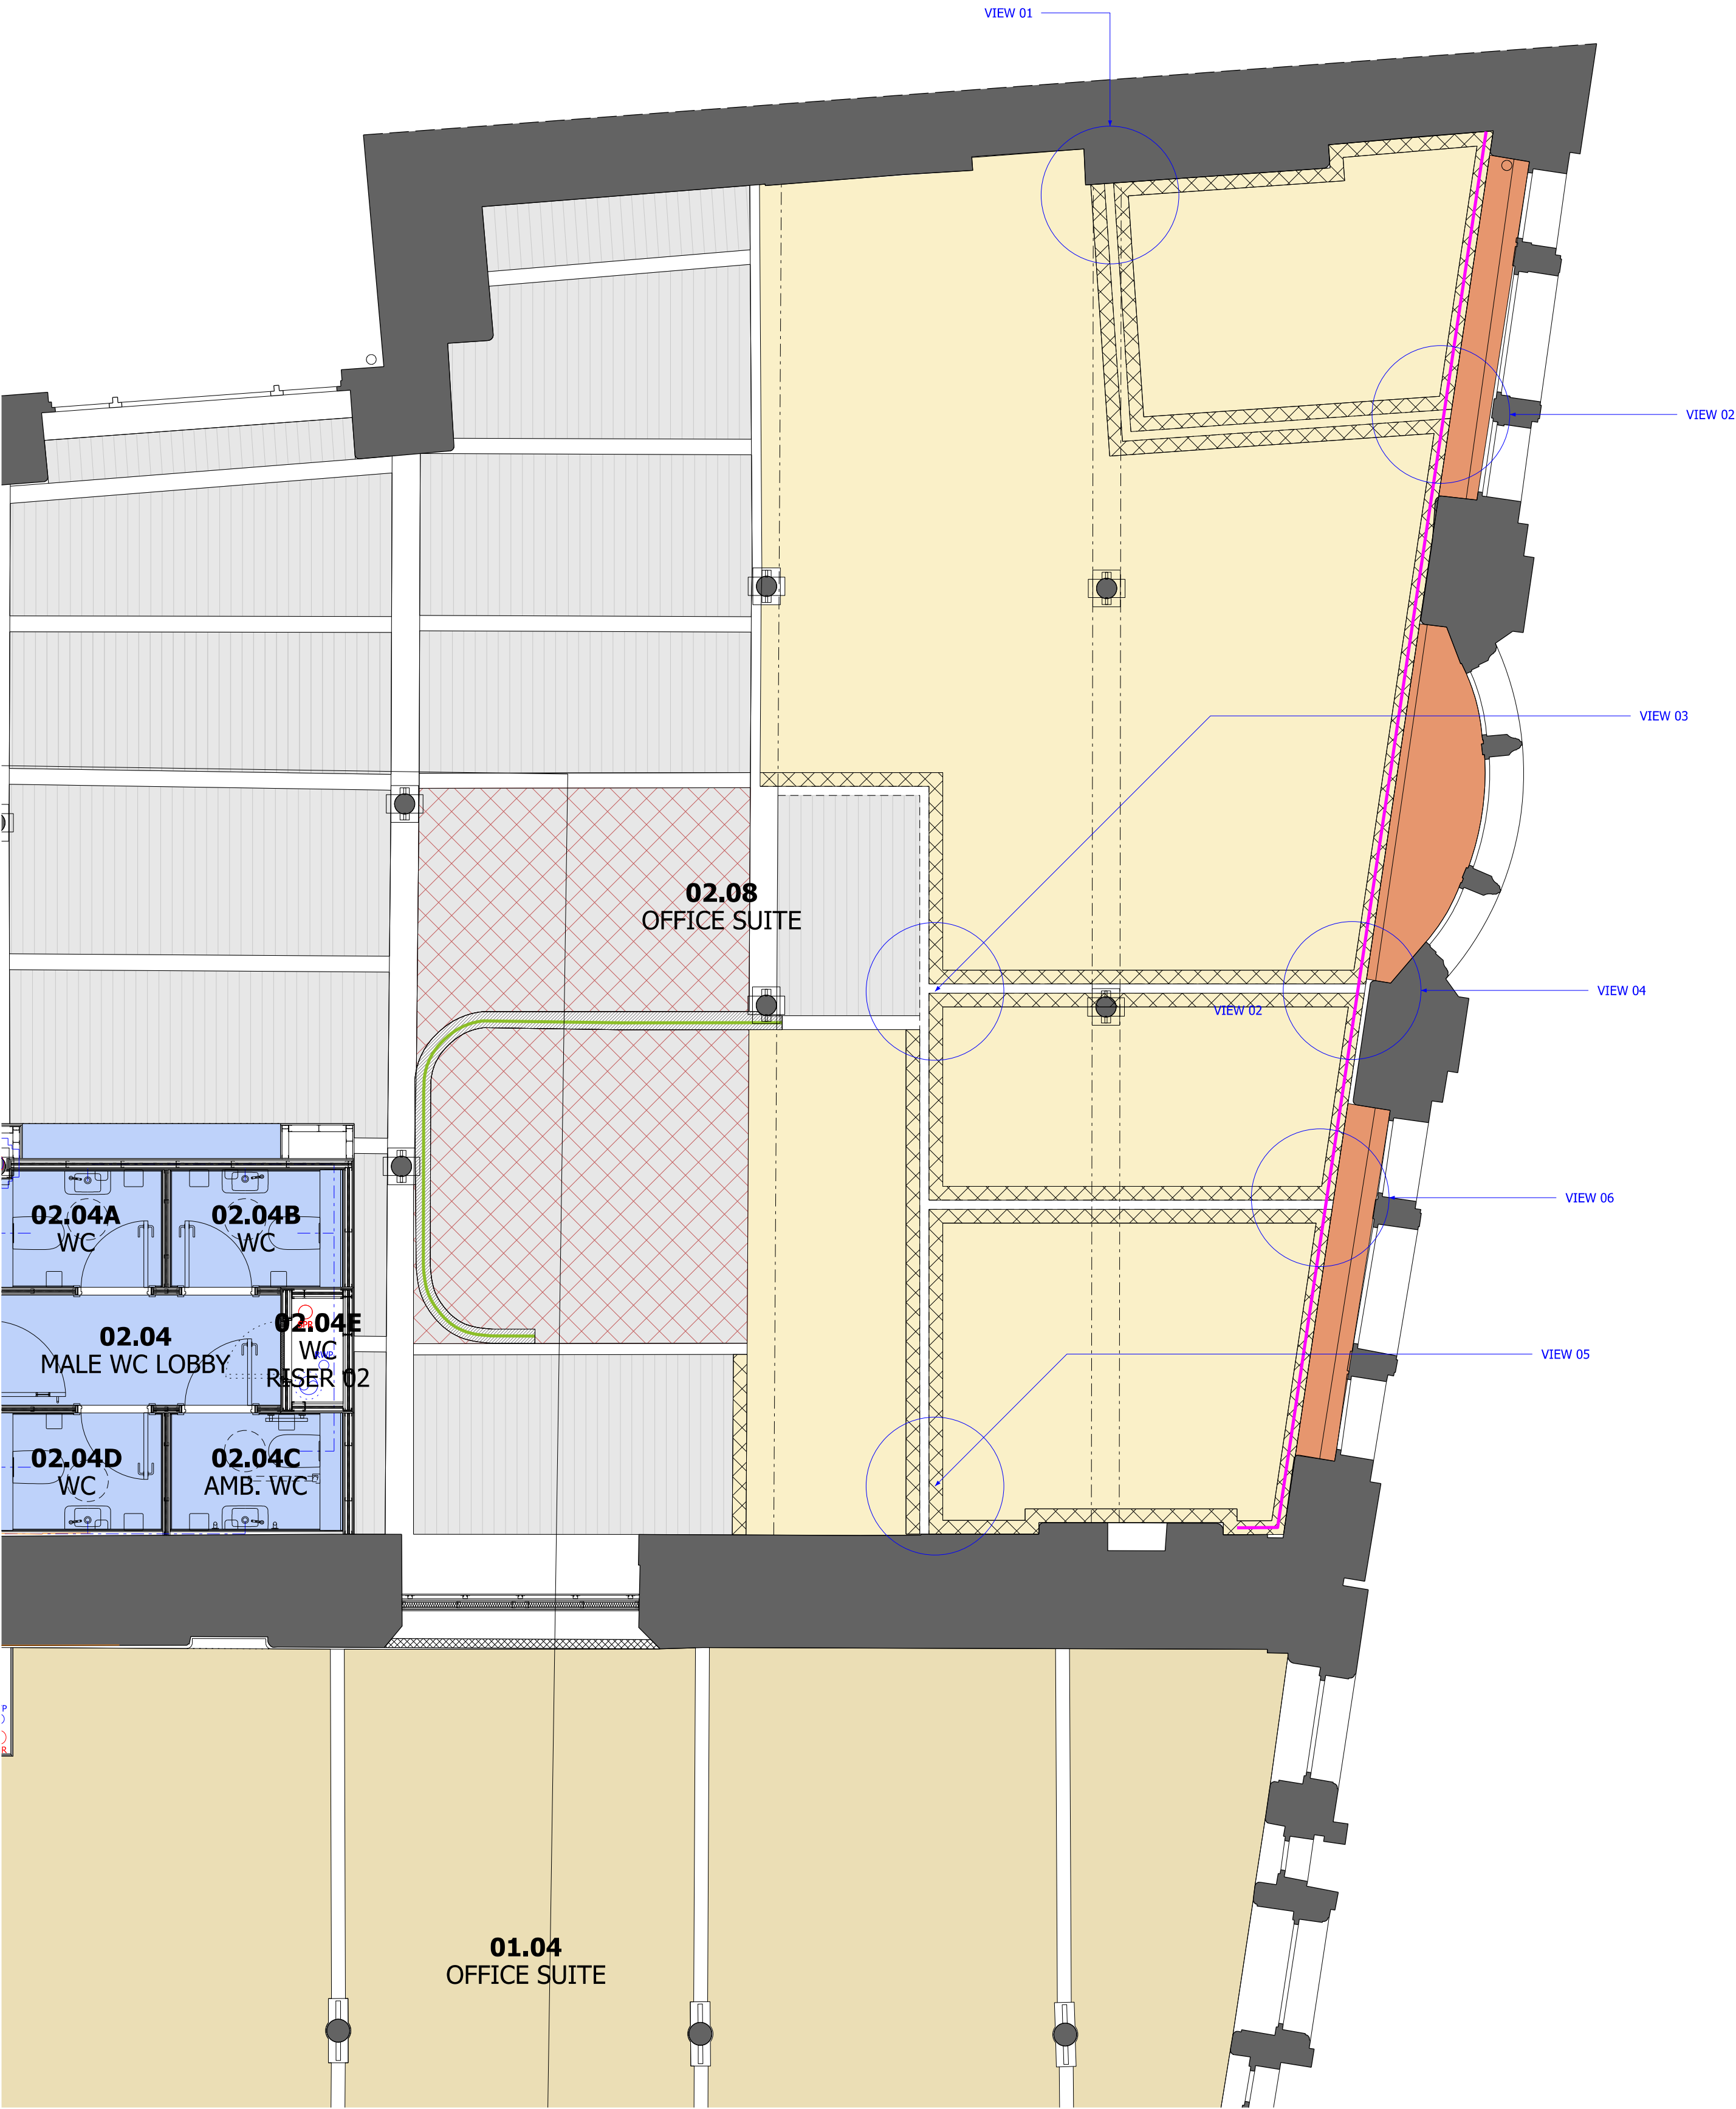

VIEW 01



VIEW 02



VIEW 03



VIEW 04



VIEW 05



VIEW 06