A
L(20) 1041


AOV OPENINGS
L(20) 10611

B
L(20) 1042

AOV OPENINGS
L(20) 10622

C
L(20) 1043

AOV OPENINGS
L(20) 10633

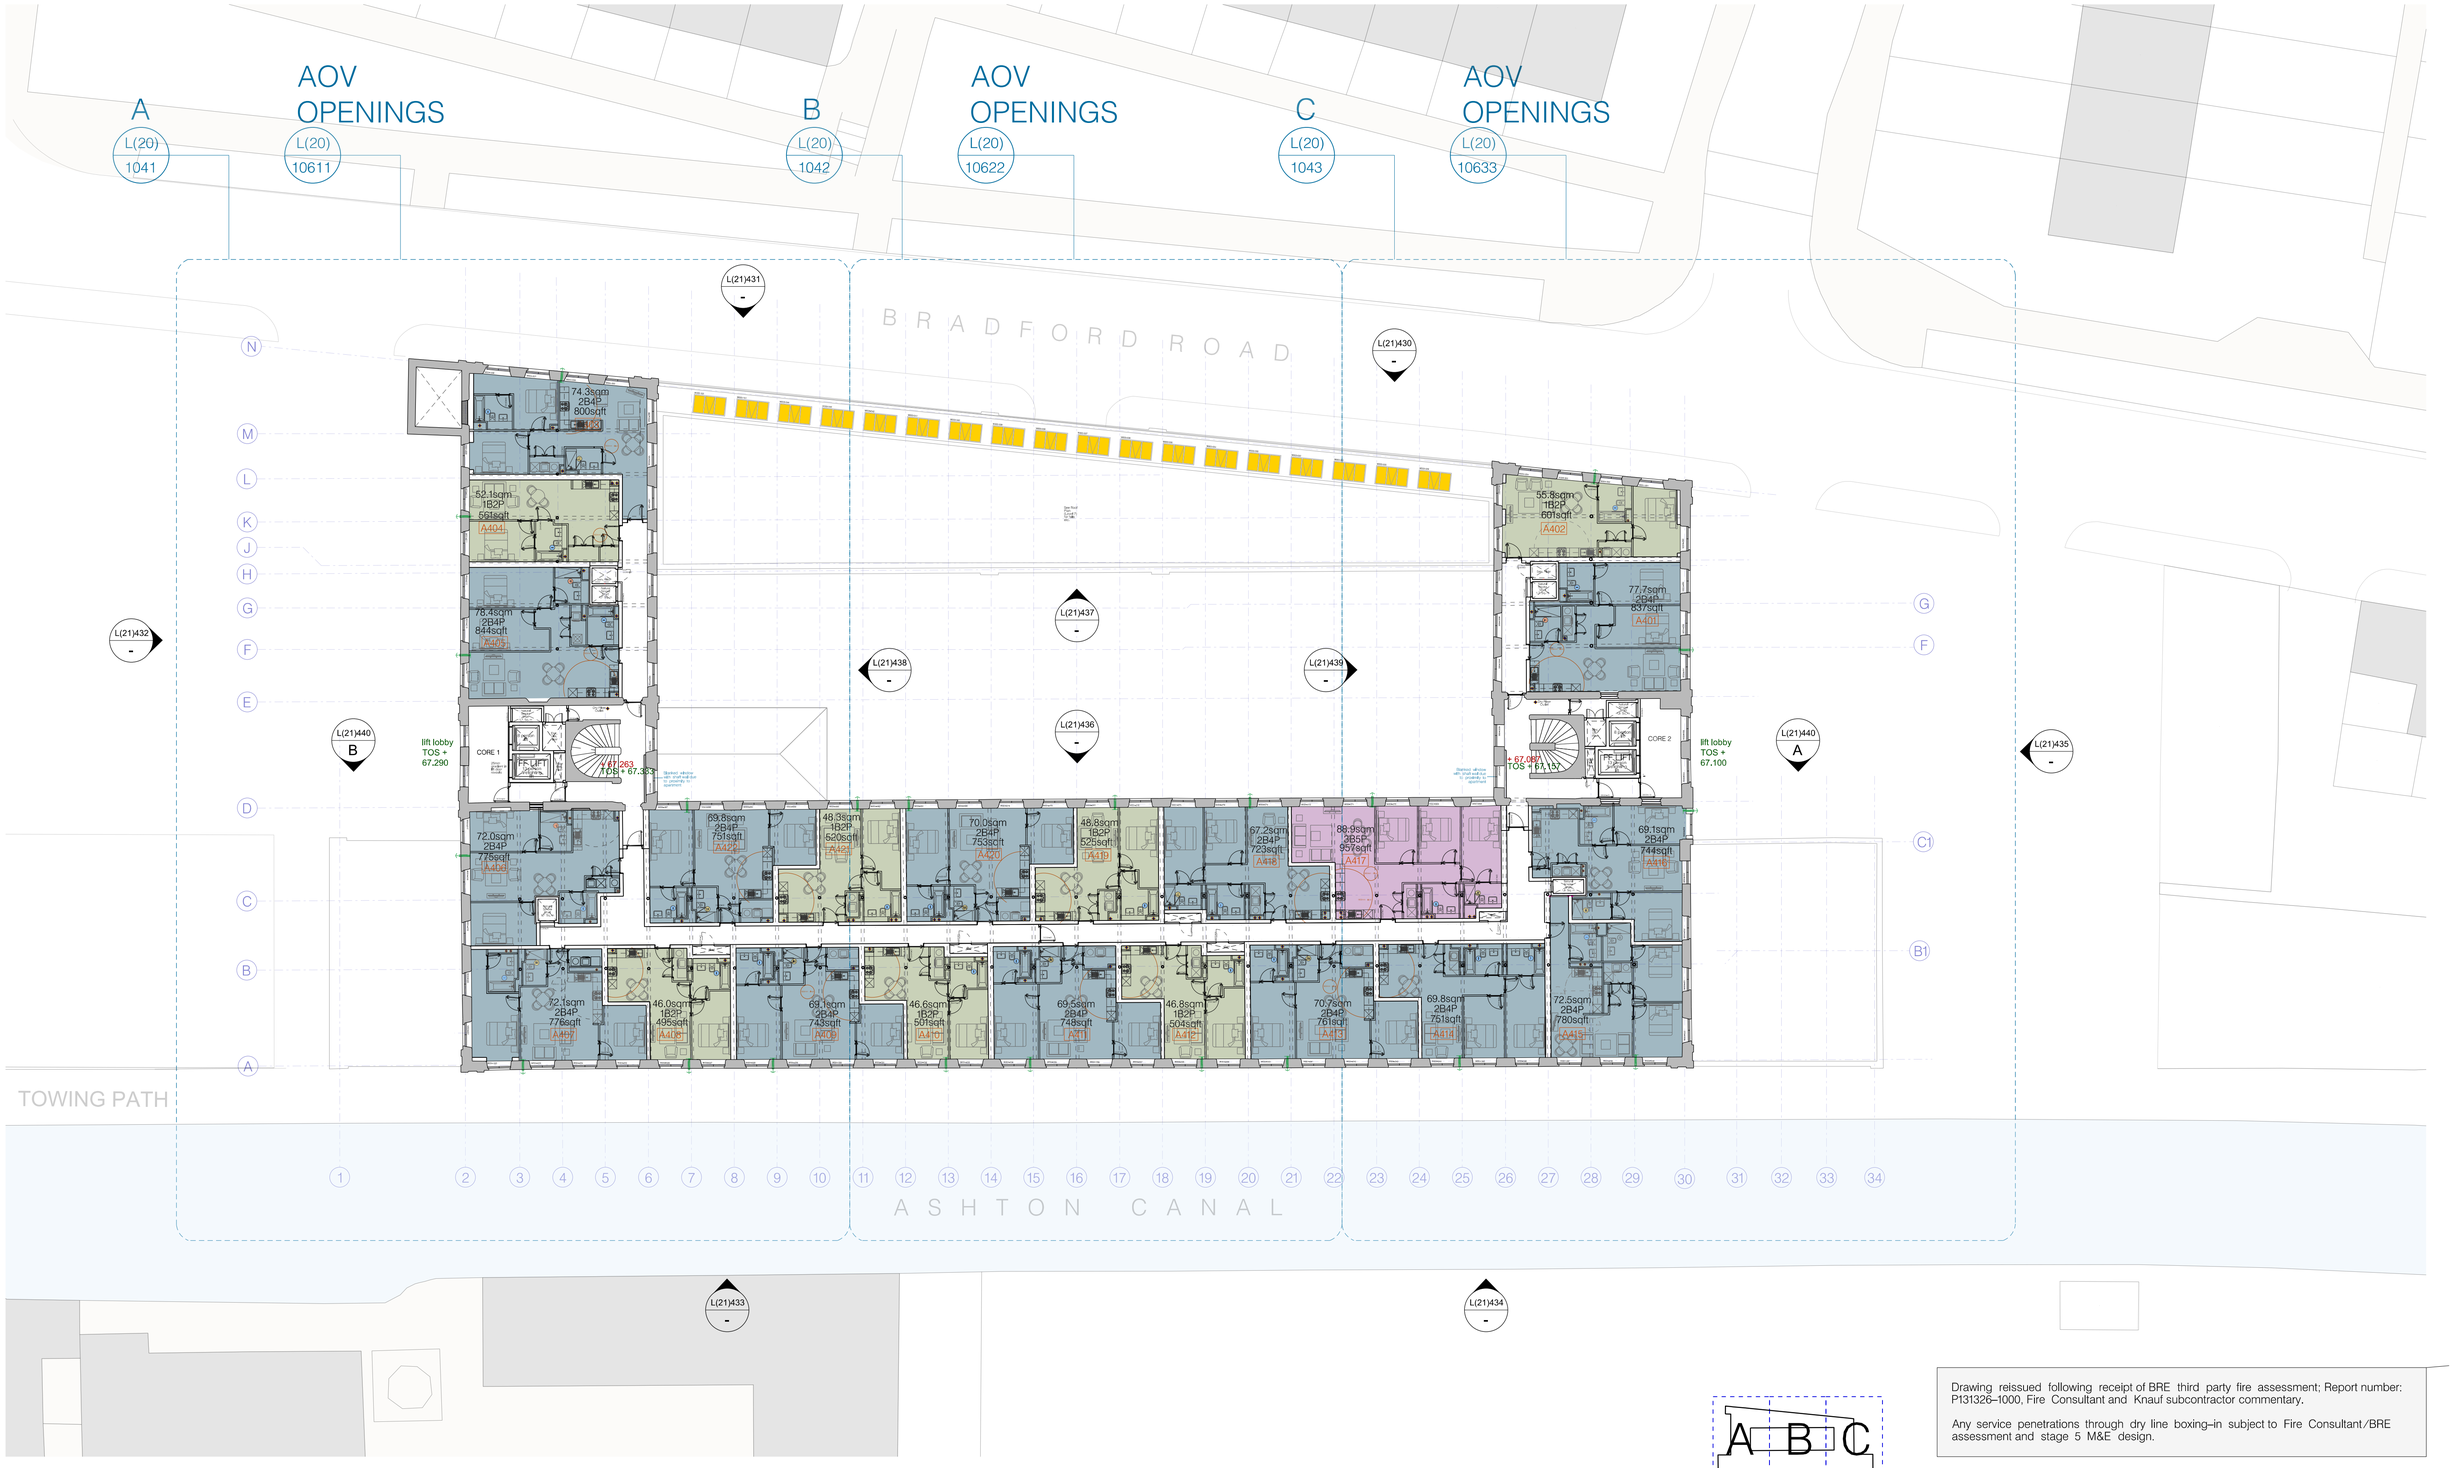

Drawing reissued following receipt of BRE third party fire assessment; Report number: P131326–1000, Fire Consultant and Knauf subcontractor commentary.

Any service penetrations through dry line boxing–in subject to Fire Consultant/BRE assessment and stage 5 M&E design.

hodder+partners

SGI Studios
1 Kelso Place
Manchester M15 4LE

t: +44(0)161 832 9842
e: mail@hodderandpartners.com
w: www.hodderandpartners.com

DO NOT SCALE
Work to annotated dimensions only.
Read drawing in conjunction with relevant specification, Structural Engineers' and Services Engineers' drawings.
Confirm all dimensions before commencement of any work on site or fabrication.

revisions + notes:


P1	30/08/2023	FIRST ISSUE
P2	26/10/2023	Accommodation removed from flue chimney. Vent positions added. General amendments
P3	17/11/2023	Lift positions altered for risers. Imperial areas added. Smoke shaft amended.
P4	18/12/2023	Various apartment layouts rearranged. Colours adjusted.
P5	07/05/2024	Lift handing changed. Risers removed pending confirmation from MEP Consultant. Hob proximities amended, some layout changes as a result.
P6	01/11/2024	North East smoke shaft moved following FE comments. A415, A416, A417 layouts adjusted.
P7	05/02/2025	Team Issue
P8	26/02/2025	Team Issue
P9	20/03/2025	Team Issue
P10	03/04/2025	TEAM ISSUE FOR CO-ORDINATION
P11	14/05/2025	Lift core extent and doors adjusted to LF comment. Areas update, Sheets ref annotated
C1	23.06.25	PRELIMINARY CONSTRUCTION ISSUE
C2	07.10.25	MISC DOOR HANDING POSITION /UPDATES. SHAFT UPDATES TO SE /M&E COORDINATION. 2 NO. ADDITIONAL ROOFLIGHTS (W003–151, 152). TOS LEVELS TO SURVEY SOLUTIONS SURVEY
C3	04.12.25	WALL AND DOOR SETTING OUT TO ALLOW FOR SVP AND DRY LINING POST BRE REPORTING. MINOR SMOKE AND SERVICE CORE UPDATE FURTHER TO STRUCTURAL COORDINATION. MEV POSITION UPDATE

NOTE — APARTMENT VENTILATION

MEV vent extract based upon acoustic trickle vent being adopted over windows. Trickle vent and MEV location in elevation subject to LA approval. Design and location of MEV subject to M&E and SE input. Refer to typical apartment dwg. L(31)002. L(31)003 and elevations.

NOTE — LEVELS
– approx existing level + 00.000
– Proposed Top of screed TOS + 00.000

Lift lobby to be flat level across full width to ensure consistent dimension for lift thresholds. All lift thresholds to be 25mm above FFL. Client to confirm floor finish. All levels subject to site check

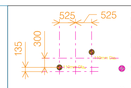

SVP SET OUT
Dimension indicates setting out of SVPs.
Dimensions set from centre of existing structural steelwork. Dimensions to the centre of the pipework.
Dimensions to be checked on site to ensure stacking of pipework. Diameter of pipework to M&E information. Acoustic lagging and boxing in to acoustic recommendations.

1 Substack position (typical dryline boxing out to extend to allow for substack)

Ground Floor
2 SVP shown in green identifies vertical drop adjacent to column. Pipe to be offset in soffit as identified.

3 Ground floor sub level pop up positions subject to site check to ensure avoidance of clash with existing foundations. SVP Pipe to be offset under new floor level for sub ground drainage, above the existing baseplate.
All SVP pop up locations subject to M&E stage 4/5 design coordination. Slab buildups and waterproofing strategy subject to Waterproofing specialist design. FR access panels to be added to corridors. Internal access where corridor access is not possible

CONSOLUX TO REVIEW ALL SVP SET OUT - SPACE BEHIND SHOWER SPACE. SPACING INBETWEEN SVPS FOR STRUCTURAL CORING. & N/E UNIT KITCHEN CHANGE. CONSOLUX TO UPDATE DWGS TO ALLOW FOR REFERENCE INTO ARCHITECTURAL DWGS



client: ARROWSMITH BRUNSWICK SQUARE LTD.
date: JUNE 2025

project: BRUNSWICK MILL DEVELOPMENT PHASE 1
scale: 1:200 @A1
drawn by: TC

title: LEVEL 4 PROPOSED
drawing number: L(20)204

status: STAGE 5 – CONSTRUCTION
job number: 0586
revision: C3

hodder+partners