


RWP 97

**Cooper Street courtyard
Repairs behind rainwater
pipes at mosaic locations**

Lift 5 overview

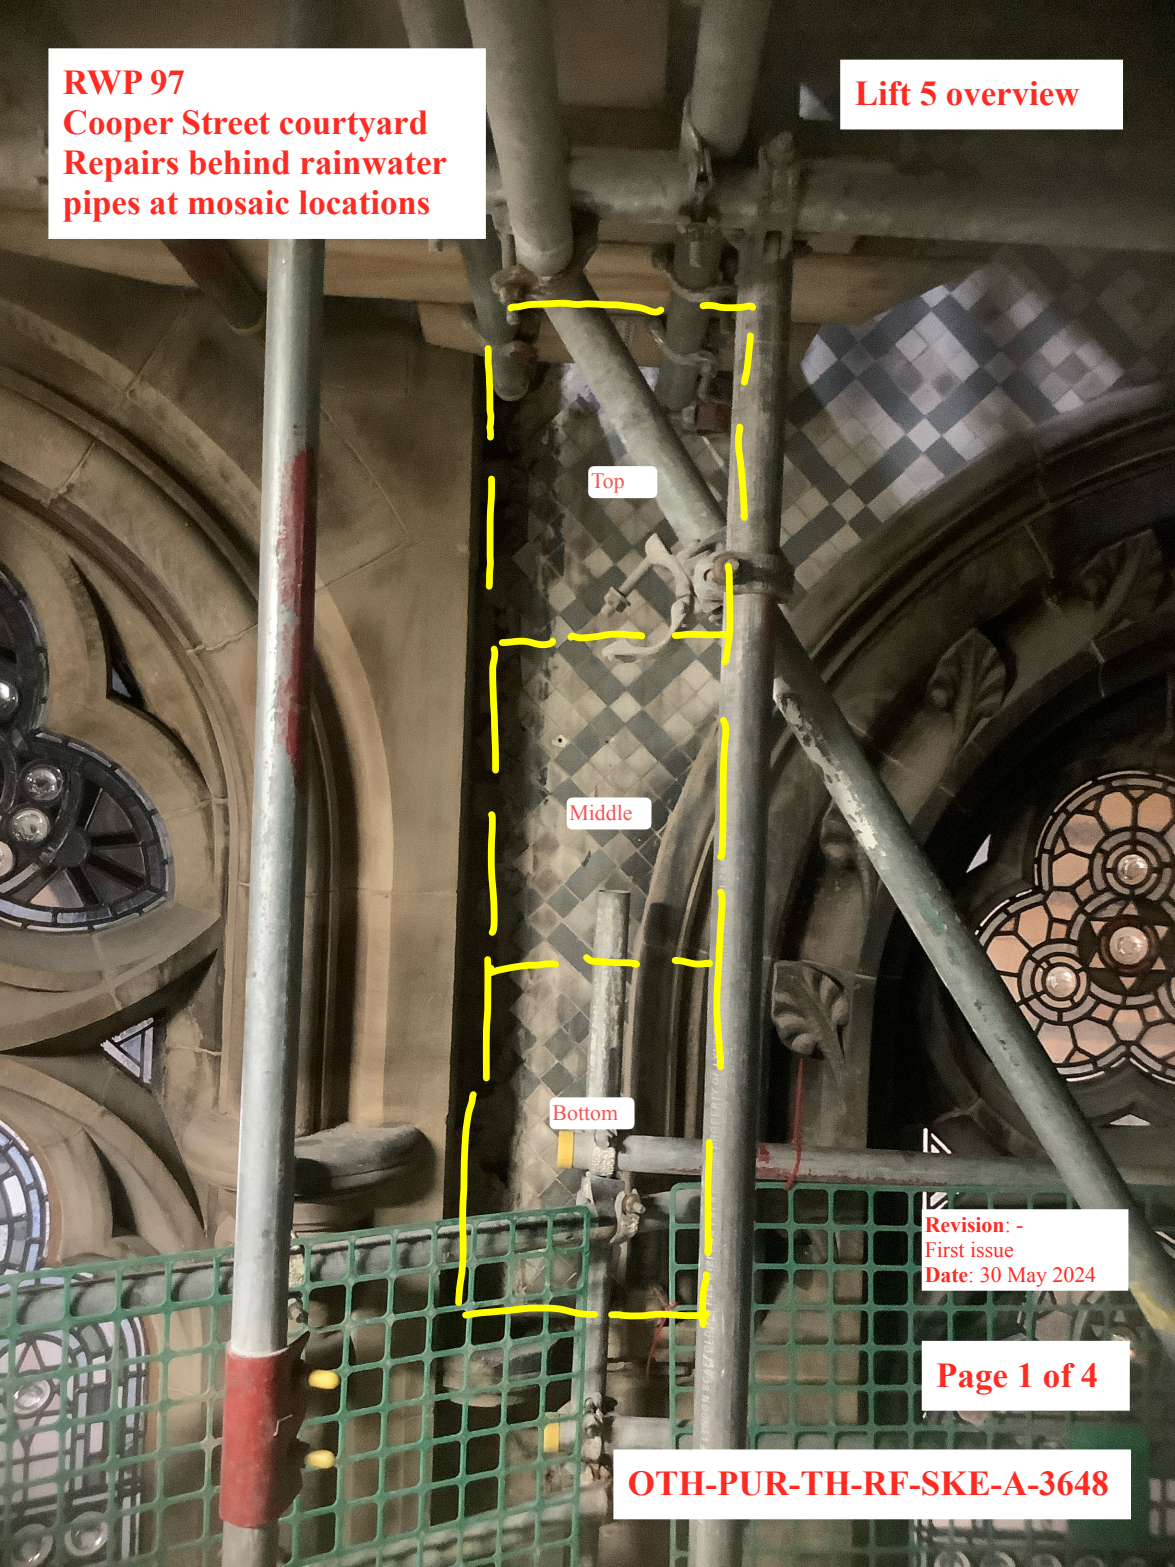

Top

Middle

Bottom

**Revision: -
First issue
Date: 30 May 2024**

Page 1 of 4

OTH-PUR-TH-RF-SKE-A-3648

RWP 97

**Cooper Street courtyard
Repairs behind rainwater
pipes at mosaic locations**

Lift 5 bottom

Replace missing render

Mix: 1 part NHL lime : 2 parts aggregate

Lime: St Astier NHL 3.5

Aggregate: Washed Sharp sand

Reinforcement: Bellmix flock polypropylene
fibres 18mm - 500g to 2 kg per tonne

Revision: -
First issue

Date: 30 May 2024

Page 2 of 4

OTH-PUR-TH-RF-SKE-A-3648

RWP 97

**Cooper Street courtyard
Repairs behind rainwater
pipes at mosaic locations**

Lift 5 middle

Mosaic to be re-fixed and
grouted using Sencil Tek
Adhere Cal NHL fixing
mortar

Carefully remove loose
mosaic tiles and store
safely for re-use. Area to
be reviewed when all
loose tiles have been
removed

Missing tiles to be replaced
with loose tiles removed from
mosaic panel at scaffolding
lift 3 rainwater pipe RWP 101

Replace missing render

Mix: 1 part NHL lime : 2 parts aggregate

Lime: St Astier NHL 3.5

Aggregate: Washed Sharp sand

Reinforcement: Bellmix flock polypropylene
fibres 18mm - 500g to 2 kg per tonne

Revision: -
First issue
Date: 30 May 2024

Page 3 of 4

OTH-PUR-TH-RF-SKE-A-3648

RWP 97

**Cooper Street courtyard
Repairs behind rainwater
pipes at mosaic locations**

Lift 5 top

Missing tiles to be replaced
with loose tiles removed from
mosaic panel at scaffolding
lift 3 rainwater pipe RWP 101

Mosaic to be re-fixed and
grouted using Sencil Tek
Adhere Cal NHL fixing
mortar

Carefully remove loose
mosaic tiles and store
safely for re-use. Area to
be reviewed when all
loose tiles have been
removed

Replace missing render

Mix: 1 part NHL lime : 2 parts aggregate

Lime: St Astier NHL 3.5

Aggregate: Washed Sharp sand

Reinforcement: Bellmix flock polypropylene
fibres 18mm - 500g to 2 kg per tonne

Revision: -

First issue

Date: 30 May 2024

Page 4 of 4

OTH-PUR-TH-RF-SKE-A-3650