


RWP 96

**Cooper Street courtyard
Repairs behind rainwater
pipe at mosaic locations**

Lift 3 overview

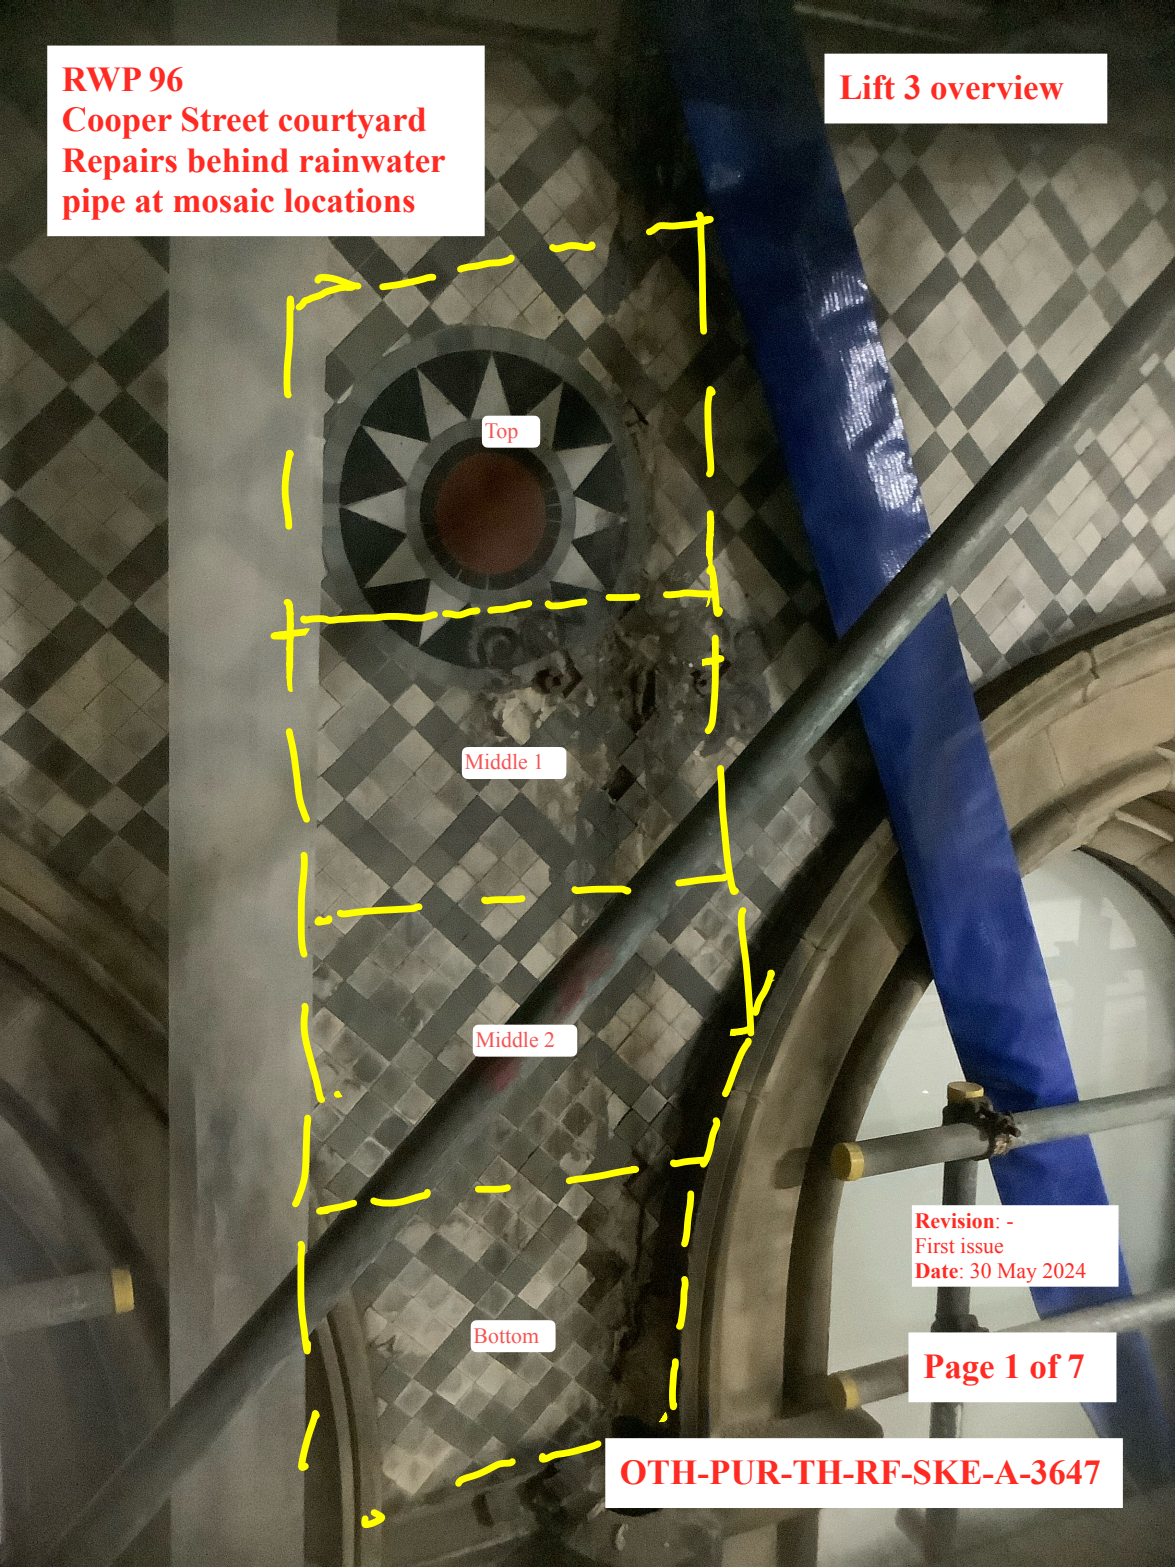

Top

Middle 1

Middle 2

Bottom

**Revision: -
First issue
Date: 30 May 2024**

Page 1 of 7

OTH-PUR-TH-RF-SKE-A-3647

RWP 96

**Cooper Street courtyard
Repairs behind rainwater
pipe at mosaic locations**

Lift 3 top

Carefully remove loose mosaic tiles
and store safely for re-use. Area to
be reviewed when all loose tiles
have been removed

Mosaic to be re-fixed and
grouted using Sencil Tek
Adhere Cal NHL fixing
mortar C

Missing tiles to be replaced
with loose tiles removed from
mosaic panel at scaffolding
lift 3 rainwater pipe RWP 101

Carefully remove oak
plug, remove loose or
de-bonded mosaic and
fit new plug before
replacing missing tiles

Revision: -
First issue
Date: 30 May 2024

Page 2 of 7

OTH-PUR-TH-RF-SKE-A-3647

RWP 96

**Cooper Street courtyard
Repairs behind rainwater
pipe at mosaic locations**

Lift 3 middle

Carefully remove oak
plug, remove loose or
de-bonded mosaic and
fit new plug before
replacing missing tiles

Carefully remove oak
plug, remove loose or
de-bonded mosaic and
fit new plug before
replacing missing tiles

Mosaic to be re-fixed and
grouted using Sencil Tek
Adhere Cal NHL fixing
mortar C

Carefully remove loose mosaic tiles
and store safely for re-use. Area to
be reviewed when all loose tiles
have been removed

Missing tiles to be replaced
with loose tiles removed from
mosaic panel at scaffolding
lift 3 rainwater pipe RWP 101

Revision: -
First issue
Date: 30 May 2024

Page 3 of 7

OTH-PUR-TH-RF-SKE-A-3647

RWP 96

**Cooper Street courtyard
Repairs behind rainwater
pipe at mosaic locations**

Lift 3 middle 2

Fill gaps and recesses in render

Mix: 1 part NHL lime : 2 parts aggregate

Lime: St Astier NHL 3.5

Aggregate: Washed Sharp sand

Reinforcement: Bellmix flock polypropylene
fibres 18mm - 500g to 2 kg per tonne

Mosaic to be re-fixed and
grouted using Sencil Tek
Adhere Cal NHL fixing
mortar C

Carefully remove loose mosaic tiles
and store safely for re-use. Area to
be reviewed when all loose tiles
have been removed

Missing tiles to be replaced
with loose tiles removed from
mosaic panel at scaffolding
lift 3 rainwater pipe RWP 101

Revision: -

First issue

Date: 30 May 2024

Page 4 of 7

OTH-PUR-TH-RF-SKE-A-3647

RWP 96

**Cooper Street courtyard
Repairs behind rainwater
pipe at mosaic locations**

Lift 3 bottom

Missing tiles to be replaced with loose tiles removed from mosaic panel at scaffolding lift 3 rainwater pipe RWP 101

Carefully remove loose mosaic tiles and store safely for re-use. Area to be reviewed when all loose tiles have been removed

Mosaic to be re-fixed and grouted using Sencil Tek Adhere Cal NHL fixing mortar C

Fill gaps and recesses in render

Mix: 1 part NHL lime : 2 parts aggregate

Lime: St Astier NHL 3.5

Aggregate: Washed Sharp sand

Reinforcement: Bellmix flock polypropylene fibres 18mm - 500g to 2 kg per tonne

Revision: -

First issue

Date: 30 May 2024


Page 5 of 7

OTH-PUR-TH-RF-SKE-A-3647

RWP 96

**Cooper Street courtyard
Repairs behind rainwater
pipe at mosaic locations**

Lift 5 overview

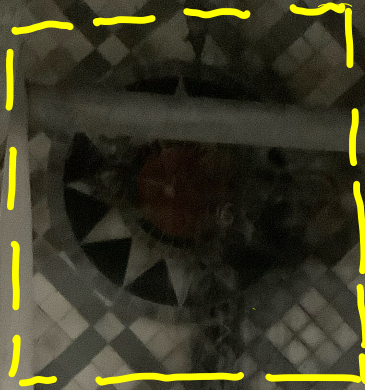

**Revision: -
First issue
Date: 30 May 2024**

Page 6 of 7

OTH-PUR-TH-RF-SKE-A-3647

RWP 96

**Cooper Street courtyard
Repairs behind rainwater
pipe at mosaic locations**

Lift 5 top

Mosaic to be re-fixed and
grouted using Sencil Tek
Adhere Cal NHL fixing
mortar C

Carefully remove oak
plug, remove loose or
de-bonded mosaic and
fit new plug before
replacing missing tiles

Carefully remove loose mosaic tiles
and store safely for re-use. Area to
be reviewed when all loose tiles
have been removed

Carefully remove oak
plug, remove loose or
de-bonded mosaic and
fit new plug before
replacing missing tiles

Revision: -
First issue
Date: 30 May 2024

Page 7 of 7

OTH-PUR-TH-RF-SKE-A-3647