

RWP 95

**Cooper Street courtyard
Repairs behind rainwater
pipe at mosaic locations**

Lift 3 overview



Top

Middle

Bottom

Revision: -
First issue
Date: 30 May 2024

Page 1 of 6

OTH-PUR-TH-RF-SKE-A-3646

RWP 95

**Cooper Street courtyard
Repairs behind rainwater
pipe at mosaic locations**

Lift 3 top

Missing tiles to be replaced
with loose tiles removed from
mosaic panel at scaffolding
lift 3 rainwater pipe RWP 101

Carefully remove
oak plug, remove
loose or de-bonded
mosaic and fit new
plug before
replacing missing
tiles

Carefully remove
oak plug, remove
loose or de-
bonded mosaic
and fit new plug
before replacing
missing tiles

Mosaic to be re-fixed and
grouted using Sencil Tek
Adhere Cal NHL fixing
mortar C

Carefully remove loose mosaic tiles
and store safely for re-use. Area to
be reviewed when all loose tiles
have been removed

Missing tiles to be replaced
with loose tiles removed from
mosaic panel at scaffolding
lift 3 rainwater pipe RWP 101

Revision: -
First issue
Date: 30 May 2024

Page 2 of 6

OTH-PUR-TH-RF-SKE-A-3646

RWP 95
Cooper Street courtyard
Repairs behind rainwater
pipe at mosaic locations

Lift 3 middle

Carefully remove loose mosaic tiles and store safely for re-use. Area to be reviewed when all loose tiles have been removed

Missing tiles to be replaced with loose tiles removed from mosaic panel at scaffolding lift 3 rainwater pipe RWP 101

Mosaic to be re-fixed and grouted using Sencil Tek Adhere Cal NHL fixing mortar

Carefully remove loose mosaic tiles and store safely for re-use. Area to be reviewed when all loose tiles have been removed

Revision: -
First issue
Date: 30 May 2024

Page 3 of 6

OTH-PUR-TH-RF-SKE-A-3646

RWP 95

**Cooper Street courtyard
Repairs behind rainwater
pipe at mosaic locations**

Lift 3 bottom

Missing tiles to be replaced with loose tiles removed from mosaic panel at scaffolding lift 3 rainwater pipe RWP 101

Mosaic to be re-fixed and grouted using Sencil Tek Adhere Cal NHL fixing mortar

Carefully remove loose mosaic tiles and store safely for re-use. Area to be reviewed when all loose tiles have been removed

Revision: -
First issue
Date: 30 May 2024


Page 4 of 6

OTH-PUR-TH-RF-SKE-A-3646

RWP 95

**Cooper Street courtyard
Repairs behind rainwater
pipe at mosaic locations**

Lift 5 overview

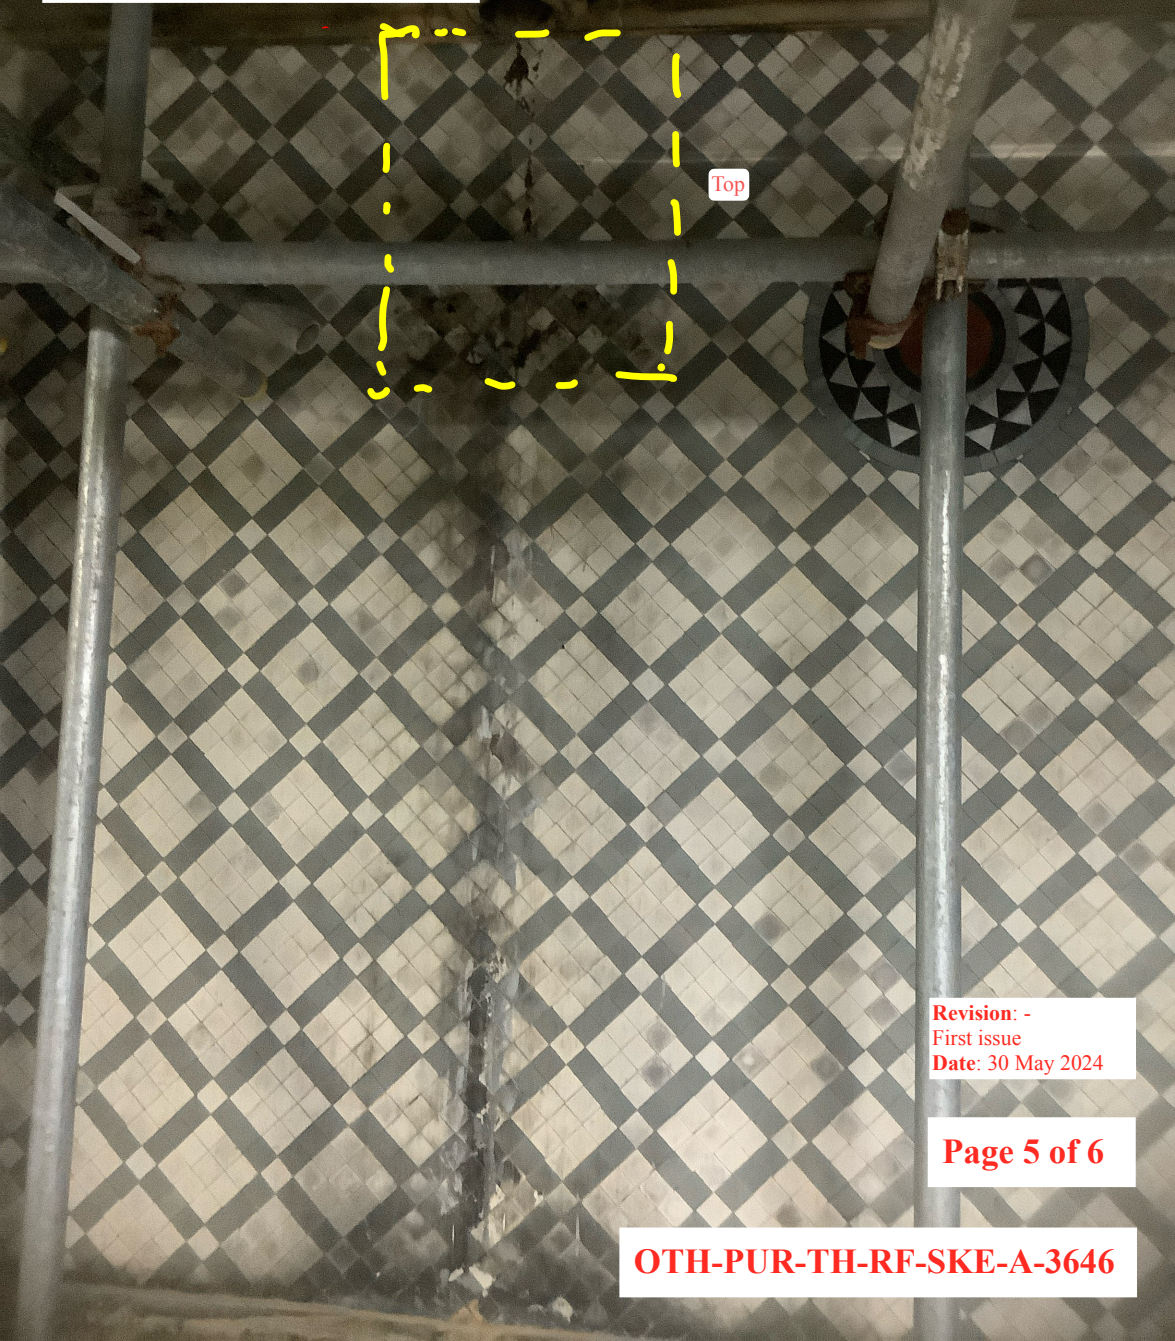

Revision: -
First issue
Date: 30 May 2024

Page 5 of 6

OTH-PUR-TH-RF-SKE-A-3646

RWP 95

**Cooper Street courtyard
Repairs behind rainwater
pipe at mosaic locations**

Lift 5 top

Carefully remove
oak plug, remove
loose or de-
bonded mosaic
and fit new plug
before replacing
missing tiles

Missing tiles to be replaced
with loose tiles removed from
mosaic panel at scaffolding
lift 3 rainwater pipe RWP 101

Mosaic to be re-fixed and
grouted using Sencil Tek
Adhere Cal NHL fixing
mortar

Carefully remove
oak plug, remove
loose or de-
bonded mosaic
and fit new plug
before replacing
missing tiles

Revision: -
First issue
Date: 30 May 2024

Page 6 of 6

OTH-PUR-TH-RF-SKE-A-3646