

Chute and rainwater pipe 28.1 Roof slope NR03 Repointing and mortar repairs

Fix Expamet stainless steel mesh using stainless steel screws and washers in nylon plugs and render with lime : sand mortar as NBS reference C41.293 document reference OTH-PUR-TH-EX-SPE-0014 to form flush face at back of drop shaft


Remove all dust and debris rake out loose and friable mortar to all brickwork within recess to minimum 25mm deep and repoint using lime :sand mortar

Revision: -
First issue
Date: 15 July 2024

Page 1 of 4 - rainwater pipe recess

OTH-PUR-TH-RF-SKE-A-3732

Chute and rainwater pipe 28.1 Roof slope NR03 Repointing and mortar repairs

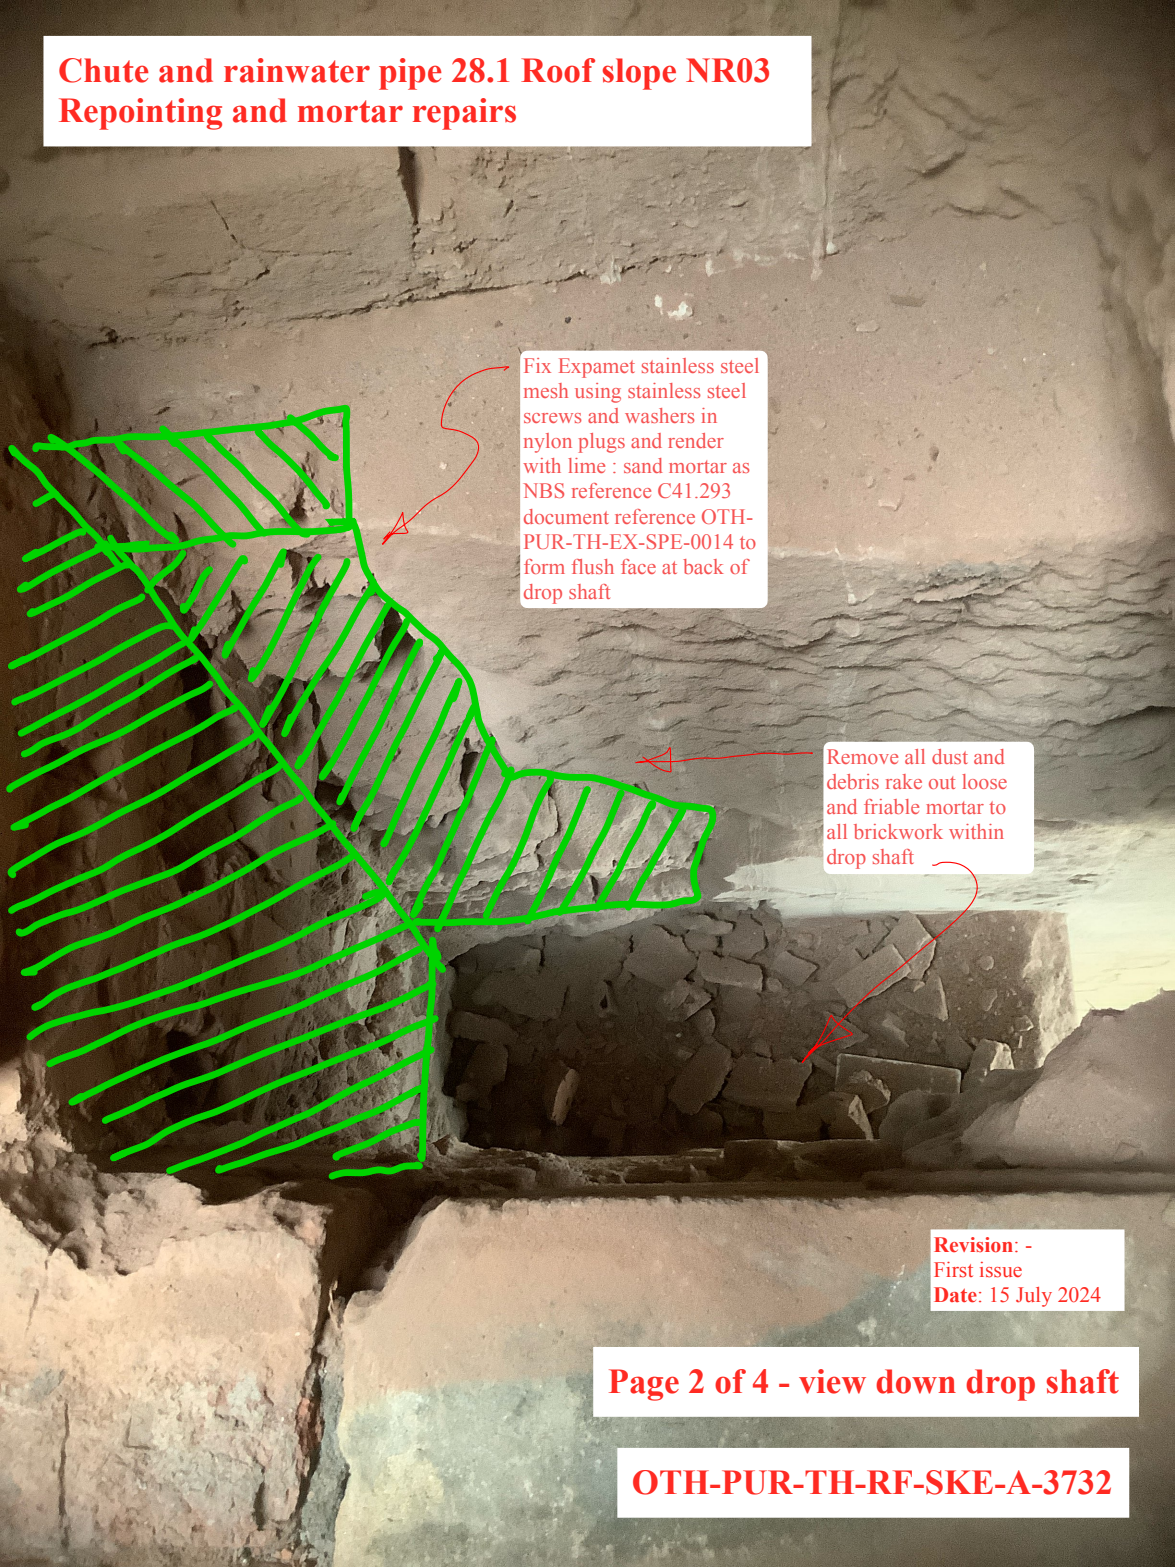

Fix Expamet stainless steel mesh using stainless steel screws and washers in nylon plugs and render with lime : sand mortar as NBS reference C41.293 document reference OTH-PUR-TH-EX-SPE-0014 to form flush face at back of drop shaft


Remove all dust and debris rake out loose and friable mortar to all brickwork within drop shaft

Revision: -
First issue
Date: 15 July 2024

Page 2 of 4 - view down drop shaft

OTH-PUR-TH-RF-SKE-A-3732

Chute and rainwater pipe 28.1 Roof slope NR03
Repointing and mortar repairs

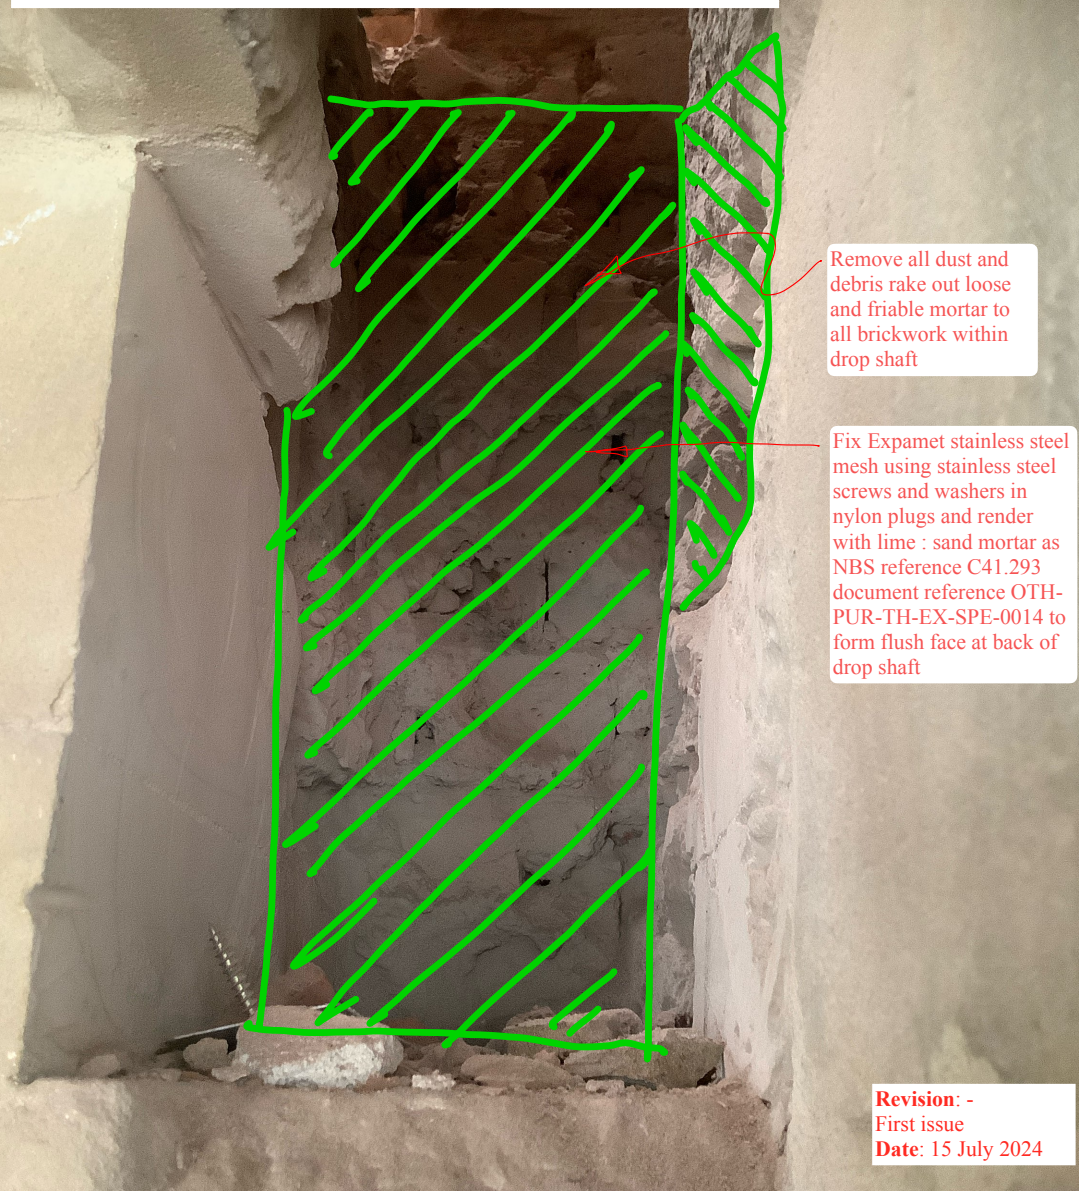

Page 3 of 4 - view through chute opening

OTH-PUR-TH-RF-SKE-A-3732

Chute and rainwater pipe 28.1 Roof slope NR03
Pipe outlet adjustment

Square off rainwater pipe
outlet opening

Back flush with face
of brick below

Revision: -
First issue
Date: 15 July 2024

Page 4 of 4 - chute in gutter

OTH-PUR-TH-RF-SKE-A-3732