

**RWP 70**

**Princess Street courtyard  
Repairs behind rainwater  
pipes at mosaic locations**

**Lift 6**

Replace missing render immediately behind  
rainwater pipe

**Mix:** 1 part NHL lime : 2 parts aggregate

**Lime:** St Astier NHL 3.5

**Aggregate:** Washed Sharp sand

**Reinforcement:** Bellmix flock polypropylene  
fibres 18mm - 500g to 2 kg per tonne


**Page 1 of 7**

**Revision:** -

**First issue**

**Date:** 24.07.2024

**OTH-PUR-TH-RF-SKE-A- 3748**

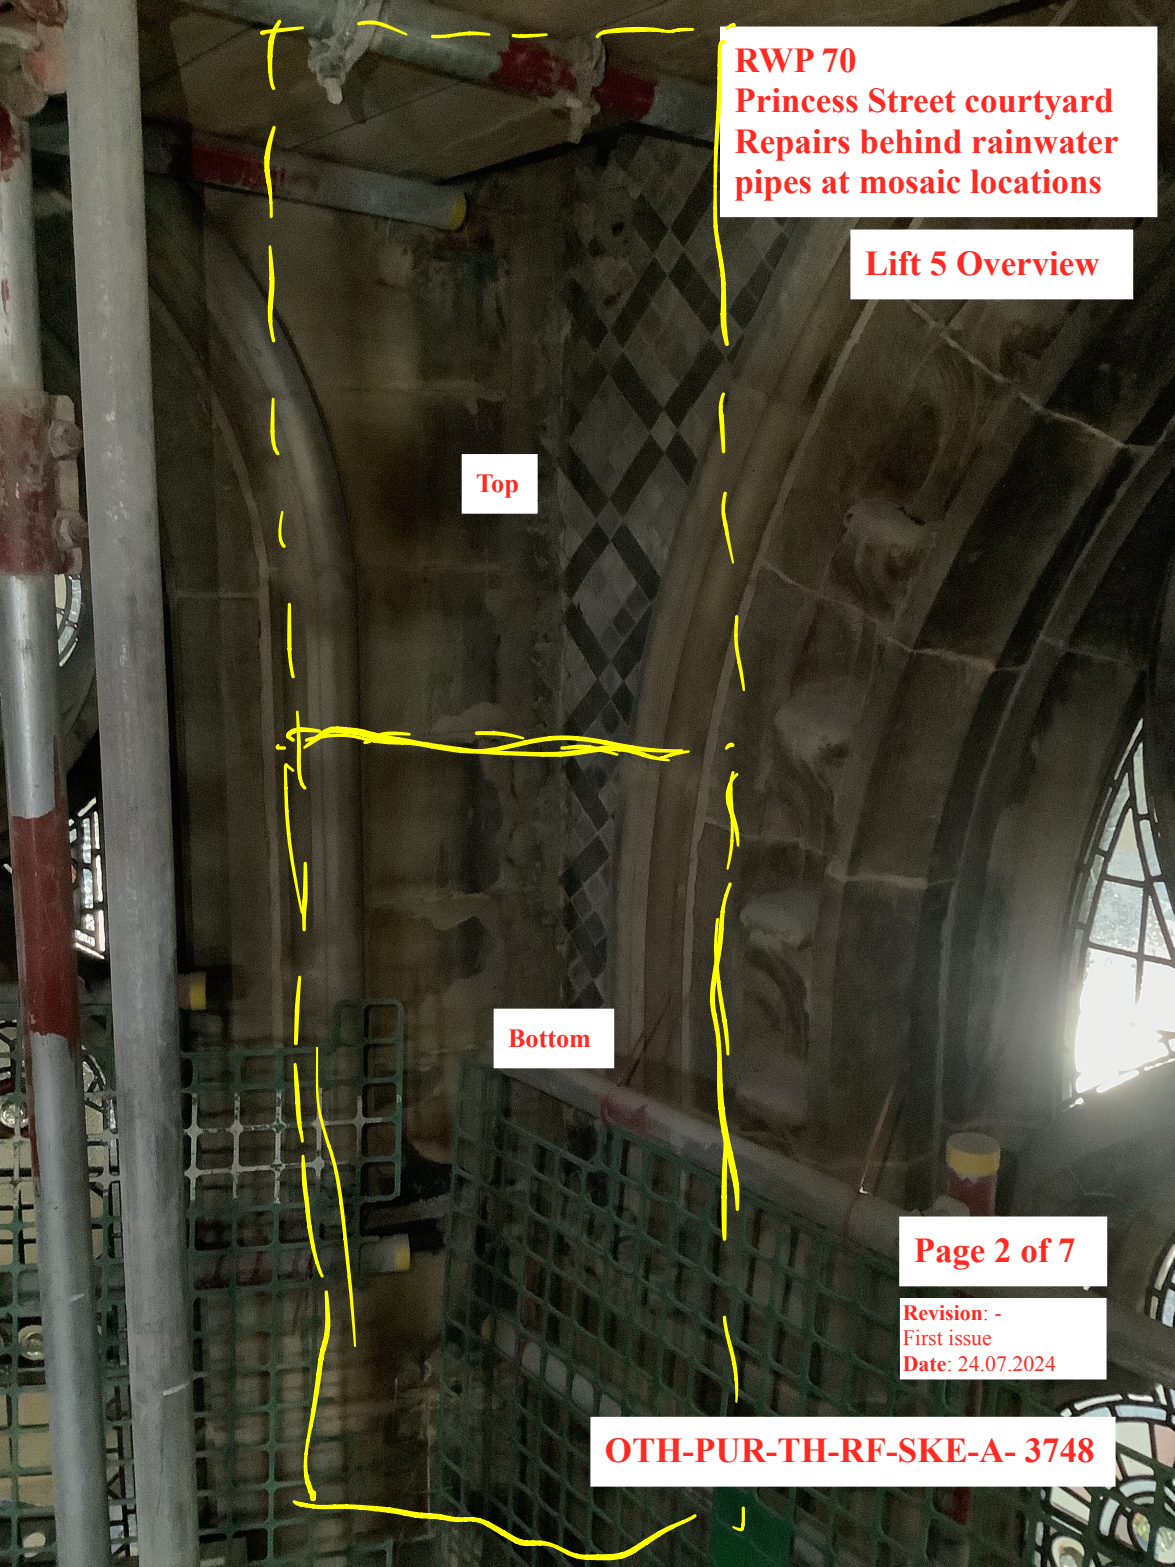

**RWP 70**  
**Princess Street courtyard**  
**Repairs behind rainwater**  
**pipes at mosaic locations**

**Lift 5 Overview**

**Top**

**Bottom**

**Page 2 of 7**

**Revision: -**  
**First issue**  
**Date: 24.07.2024**

**OTH-PUR-TH-RF-SKE-A- 3748**

## RWP 70

### Princess Street courtyard Repairs behind rainwater pipes at mosaic locations

## Lift 5 Top

Replacement tiles to be re-fixed  
and grouted using Sencil Tek  
Adhere Cal NHL fixing mortar

Replace missing render immediately behind  
rainwater pipe

**Mix:** 1 part NHL lime : 2 parts aggregate

**Lime:** St Astier NHL 3.5

**Aggregate:** Washed Sharp sand

**Reinforcement:** Bellmix flock polypropylene  
fibres 18mm - 500g to 2 kg per tonne

Carefully remove oak plug,  
remove loose or de-bonded  
mosaic and fit new plug before  
replacing missing tiles

Replacement mosaic tiles  
matching original as NBS  
specification reference C41.278

## Page 3 of 7

**Revision:** -

**First issue**

**Date:** 24.07.2024

OTH-PUR-TH-RF-SKE-A- 3748

**RWP 70**

**Princess Street courtyard  
Repairs behind rainwater  
pipes at mosaic locations**

**Lift 5 Bottom**

Replace missing render immediately behind  
rainwater pipe

**Mix:** 1 part NHL lime : 2 parts aggregate

**Lime:** St Astier NHL 3.5

**Aggregate:** Washed Sharp sand

**Reinforcement:** Bellmix flock polypropylene  
fibres 18mm - 500g to 2 kg per tonne

**Page 4 of 7**

**Revision:** -

First issue

**Date:** 24.07.2024

**OTH-PUR-TH-RF-SKE-A- 3748**



**RWP 70**  
**Princess Street courtyard**  
**Repairs behind rainwater**  
**pipes at mosaic locations**

**Top**

**Lift 3 Overview**

**Bottom**

**Page 5 of 7**

**Revision: -**  
**First issue**  
**Date: 24.07.2024**

**OTH-PUR-TH-RF-SKE-A- 3748**

**RWP 70**  
**Princess Street courtyard**  
**Repairs behind rainwater**  
**pipes at mosaic locations**

**Lift 3 Top**

Replace missing render immediately behind rainwater pipe  
**Mix:** 1 part NHL lime : 2 parts aggregate  
**Lime:** St Astier NHL 3.5  
**Aggregate:** Washed Sharp sand  
**Reinforcement:** Bellmix flock polypropylene fibres 18mm - 500g to 2 kg per tonne

Replacement tiles to be re-fixed and grouted using Sencil Tek Adhere Cal NHL fixing mortar

Carefully remove oak plug, remove loose or de-bonded mosaic and fit new plug before replacing missing tiles

Replacement mosaic tiles matching original as NBS specification reference C41.278

Replacement mosaic tiles matching original as NBS specification reference C41.278

Carefully remove oak plug, remove loose or de-bonded mosaic and fit new plug before replacing missing tiles

**OTH-PUR-TH-RF-SKE-A- 3748**

**Page 6 of 7**

**Revision:** -  
First issue  
**Date:** 24.07.2024

Replacement tiles to be re-fixed and grouted using Sencil Tek Adhere Cal NHL fixing mortar

**RWP 70**

**Princess Street courtyard  
Repairs behind rainwater  
pipes at mosaic locations**

**Lift 3 Bottom**

Carefully fit new plug before  
replacing missing tiles

Replacement tiles to be re-fixed  
and grouted using Sencil Tek  
Adhere Cal NHL fixing mortar

Replacement mosaic tiles  
matching original as NBS  
specification reference C41.278

Replace missing render immediately behind  
rainwater pipe  
**Mix:** 1 part NHL lime : 2 parts aggregate  
**Lime:** St Astier NHL 3.5  
**Aggregate:** Washed Sharp sand  
**Reinforcement:** Bellmix flock polypropylene  
fibres 18mm - 500g to 2 kg per tonne

**Page 7 of 7**

**Revision:** -  
**First issue**  
**Date:** 24.07.2024

**OTH-PUR-TH-RF-SKE-A- 3748**