

RWP 84

**Lloyd Street courtyard
Repairs behind rainwater
pipes at mosaic locations**

Lift 6

Fill hole

Mix: 1 part NHL lime : 2 parts aggregate

Lime: St Astier NHL 3.5

Aggregate: Washed Sharp sand

Reinforcement: Bellmix flock
polypropylene fibres 18mm - 500g to 2 kg
per tonne

Replacement mosaic tiles
matching original as NBS
specification reference C41.278

Replace missing render

Mix: 1 part NHL lime : 2 parts aggregate

Lime: St Astier NHL 3.5

Aggregate: Washed Sharp sand

Reinforcement: Bellmix flock polypropylene
fibres 18mm - 500g to 2 kg per tonne

Carefully remove oak plug,
remove loose or de-bonded
mosaic and fit new plug before
replacing missing tiles

Replacement tiles to be re-fixed
and grouted using Sencil Tek
Adhere Cal NHL fixing mortar

Carefully remove damaged
mosaic tile. Area to be reviewed
when all loose tiles have been
removed

Revision: -
First issue
Date: 24.07.2024

Page 1 of 7

OTH-PUR-TH-RF-SKE-A- 3751

RWP 84
Lloyd Street courtyard
Repairs behind rainwater
pipes at mosaic locations

Lift 5 overview

Top

Bottom

Page 2 of 7

Revision: -
First issue
Date: 24.07.2024

OTH-PUR-TH-RF-SKE-A- 3751

RWP 84

**Lloyd Street courtyard
Repairs behind rainwater
pipes at mosaic locations**

Lift 5 Top

Carefully remove damaged mosaic tile. Area to be reviewed when all loose tiles have been removed

Replacement mosaic tiles matching original as NBS specification reference C41.278

Replacement tiles to be re-fixed and grouted using Sencil Tek Adhere Cal NHL fixing mortar

Replace missing render immediately behind rainwater pipe

Mix: 1 part NHL lime : 2 parts aggregate

Lime: St Astier NHL 3.5

Aggregate: Washed Sharp sand

Reinforcement: Bellmix flock polypropylene fibres 18mm - 500g to 2 kg per tonne

Page 3 of 7

Revision: -
First issue

Date: 24.07.2024

OTH-PUR-TH-RF-SKE-A- 3751

Lift 5 Bottom

Replace missing render immediately behind rainwater pipe

Mix: 1 part NHL lime : 2 parts aggregate

Lime: St Astier NHL 3.5

Aggregate: Washed Sharp sand

Reinforcement: Bellmix flock polypropylene fibres 18mm - 500g to 2 kg per tonne

Replacement tiles to be re-fixed and grouted using Sencil Tek Adhere Cal NHL fixing mortar

Replacement mosaic tiles matching original as NBS specification reference C41.278

RWP 84
Lloyd Street courtyard
Repairs behind rainwater pipes at mosaic locations

Page 4 of 7

Revision: -
First issue
Date: 24.07.2024

Carefully remove damaged mosaic tile. Area to be reviewed when all loose tiles have been removed

OTH-PUR-TH-RF-SKE-A- 3751

RWP 84
Lloyd Street courtyard
Repairs behind rainwater
pipes at mosaic locations

Top

Lift 3 overview

Revision: -
First issue
Date: 24.07.2024

Page 5 of 7

Bottom

OTH-PUR-TH-RF-SKE-A- 3751

Lift 3 Top

RWP 84
Lloyd Street courtyard
Repairs behind rainwater
pipes at mosaic locations

Revision: -
First issue
Date: 24.07.2024


Page 6 of 7

Replacement mosaic tiles
matching original as NBS
specification reference C41.278

Carefully remove oak plug,
remove loose or de-bonded
mosaic and fit new plug before
replacing missing tiles

Replacement tiles to be re-fixed
and grouted using Sencil Tek
Adhere Cal NHL fixing mortar

Replace missing render immediately behind
rainwater pipe
Mix: 1 part NHL lime : 2 parts aggregate
Lime: St Astier NHL 3.5
Aggregate: Washed Sharp sand
Reinforcement: Bellmix flock polypropylene
fibres 18mm - 500g to 2 kg per tonne

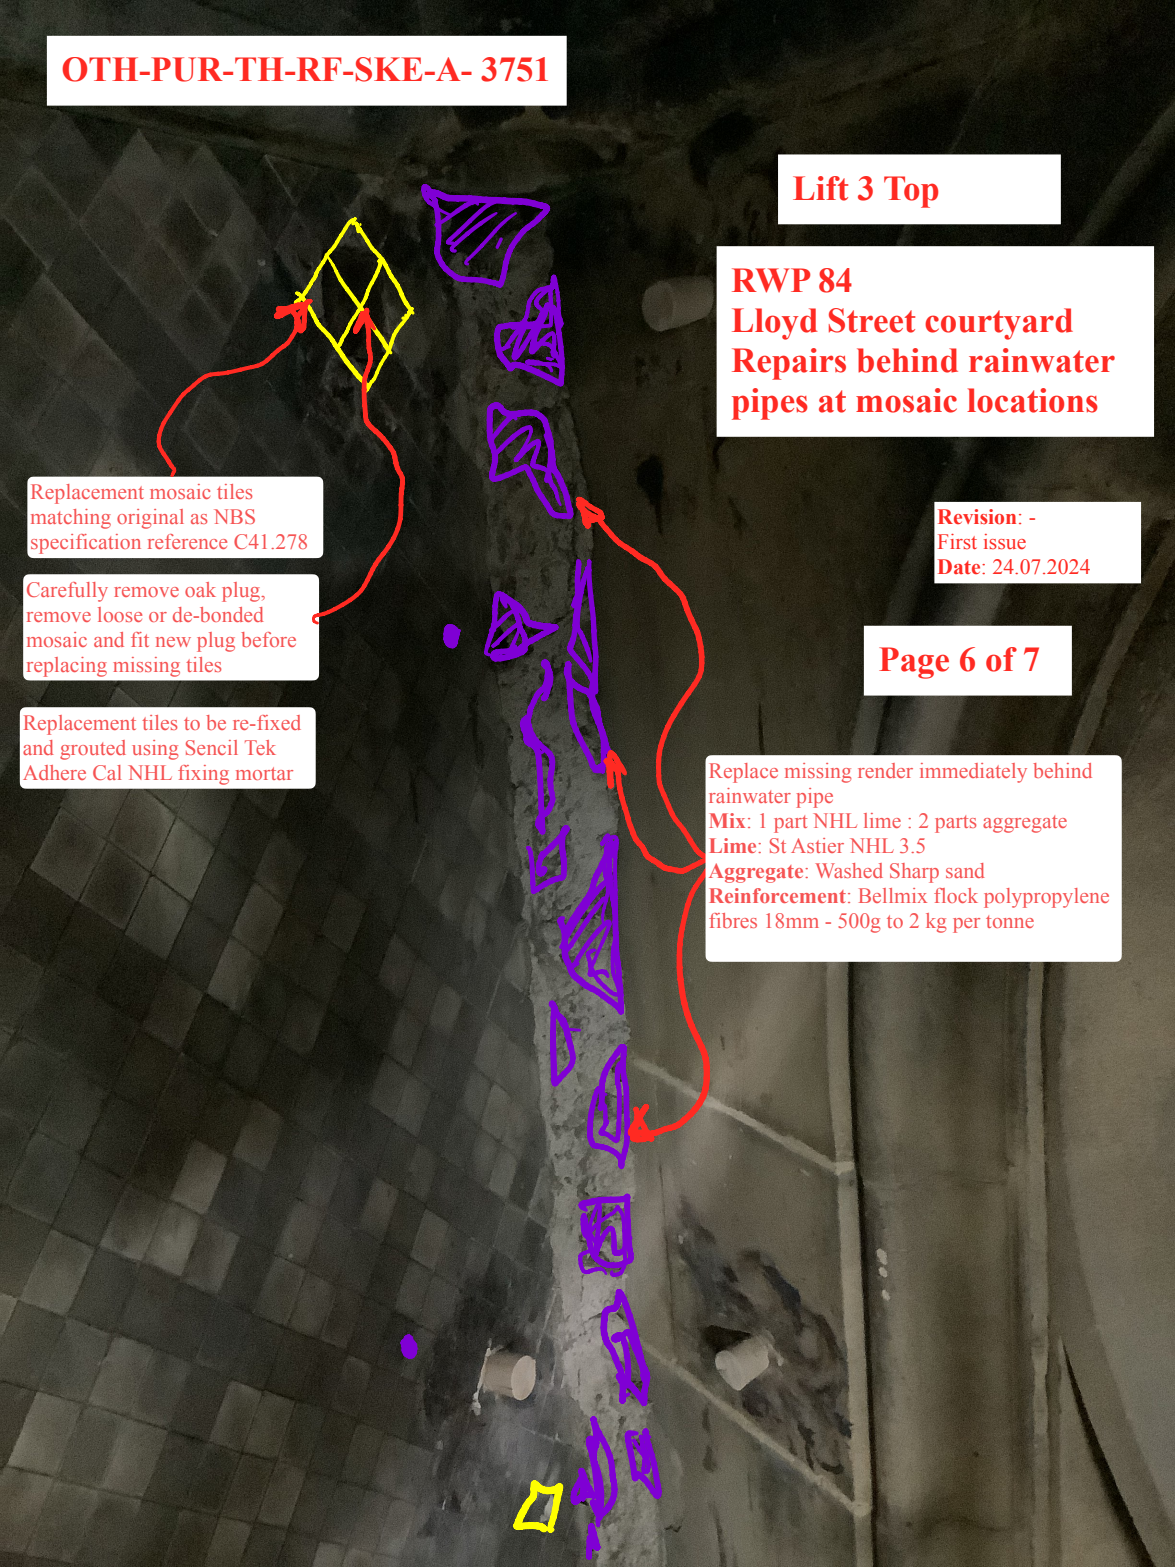

Fill hole
Mix: 1 part NHL lime : 2 parts aggregate
Lime: St Astier NHL 3.5
Aggregate: Washed Sharp sand
Reinforcement: Bellmix flock polypropylene fibres 18mm - 500g to 2 kg per tonne

RWP 84
Lloyd Street courtyard
Repairs behind rainwater
pipes at mosaic locations

Lift 3 Bottom

Replace missing render immediately behind rainwater pipe
Mix: 1 part NHL lime : 2 parts aggregate
Lime: St Astier NHL 3.5
Aggregate: Washed Sharp sand
Reinforcement: Bellmix flock polypropylene fibres 18mm - 500g to 2 kg per tonne

Replacement tiles to be re-fixed and grouted using Sencil Tek Adhere Cal NHL fixing mortar

Replacement mosaic tiles matching original as NBS specification reference C41.278