

RWP 87
Lloyd Street courtyard
Repairs behind rainwater
pipes at mosaic locations

Lift 5

Replacement tiles to be re-fixed
and grouted using Sencil Tek
Adhere Cal NHL fixing mortar


Replacement mosaic tiles
matching original as NBS
specification reference C41.278



Page 1 of 4

Revision: -
First issue
Date: 24.07.2024

OTH-PUR-TH-RF-SKE-A- 3754

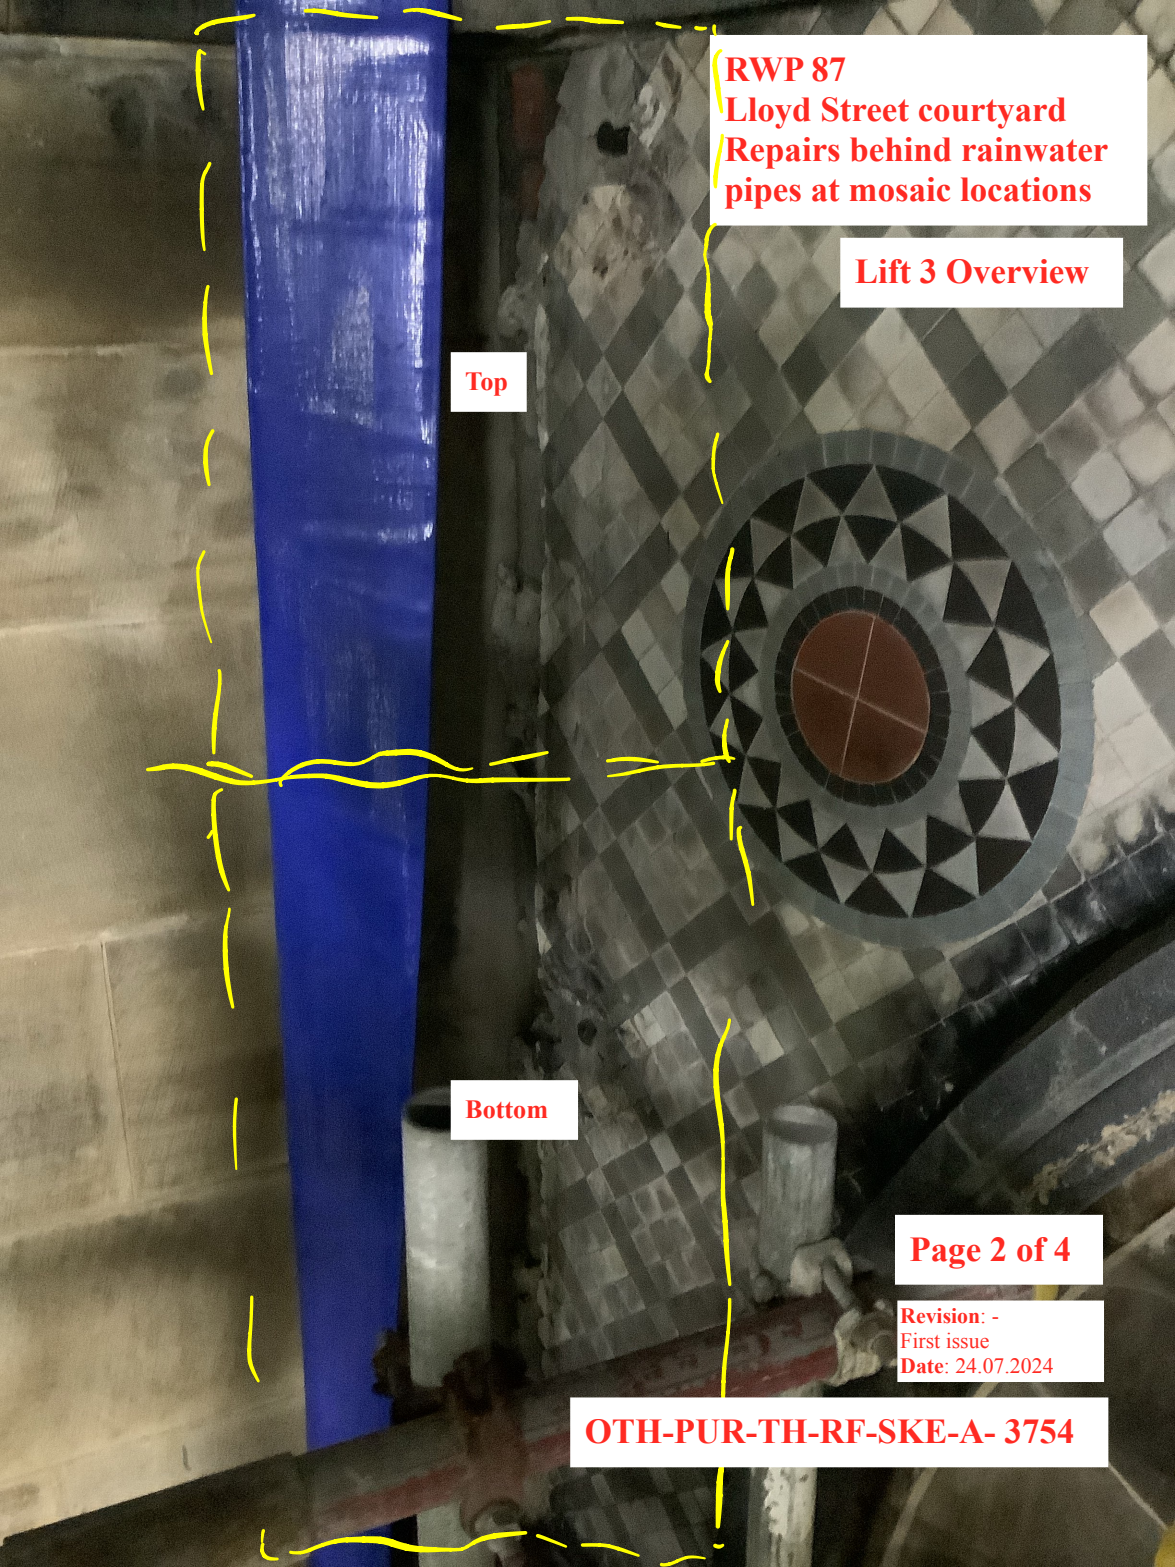

RWP 87
Lloyd Street courtyard
Repairs behind rainwater
pipes at mosaic locations

Lift 3 Overview

Top

Bottom

Page 2 of 4

Revision: -
First issue
Date: 24.07.2024

OTH-PUR-TH-RF-SKE-A- 3754

RWP 87
Lloyd Street courtyard
Repairs behind rainwater
pipes at mosaic locations

Lift 3 Top

Carefully fit new plug before
replacing missing tiles

Replacement mosaic tiles
matching original as NBS
specification reference C41.278

Replacement tiles to be re-fixed
and grouted using Sencil Tek
Adhere Cal NHL fixing mortar

Replace missing render immediately behind
rainwater pipe

Mix: 1 part NHL lime : 2 parts aggregate

Lime: St Astier NHL 3.5

Aggregate: Washed Sharp sand

Reinforcement: Bellmix flock polypropylene
fibres 18mm - 500g to 2 kg per tonne

Page 3 of 4

Revision: -
First issue
Date: 24.07.2024

OTH-PUR-TH-RF-SKE-A- 3754

RWP 87

**Lloyd Street courtyard
Repairs behind rainwater
pipes at mosaic locations**

Lift 3 Bottom

Carefully remove oak plug,
remove loose or de-bonded
mosaic and fit new plug before
replacing missing tiles

Replacement mosaic tiles
matching original as NBS
specification reference C41.278

Replacement tiles to be
and grouted using Senci
Adhere Cal NHL fixing

Replace missing render immediately behind
rainwater pipe

Mix: 1 part NHL lime : 2 parts aggregate

Lime: St Astier NHL 3.5

Aggregate: Washed Sharp sand

Reinforcement: Bellmix flock polypropylene
fibres 18mm - 500g to 2 kg per tonne

Page 4 of 4

Revision: -

First issue

Date: 24.07.2024

OTH-PUR-TH-RF-SKE-A- 3754