TV RECEPTION SURVEY REPORT

THIS POST CONSTRUCTION TV RECEPTION SURVEY WAS CONDUCTED BY:

SCS Technologies Ltd
Unit 4, centre 21 business park
Bridge Lane
Woolston
Warrington
WA1 4AW
0800 3777 485
www.SCStechnologies.co.uk

DATE OF SURVEY: 16th January 2026
Tower A and midrise A (section 2).

The contents of this document are confidential and for the addressee only, not for duplication nor amendments.
Unless under a controlled document referenced by SCS Technologies Ltd

Contents

EXECUTIVE SUMMARY 3
INTRODUCTION 4
SCOPE 4
DISCUSSIONS 4
SIGNAL BLOCKING 5
FIELD SURVEY METHOD 6
FIELD SURVEY EQUIPMENT 6
SERVICES LIKELY TO BE AFFECTED 7
THE DEVELOPMENT: 8
OVERVIEW OF DEVELOPMENT 8
COORDINATES 9
TECHNICAL BACKGROUND – WINTER HILL 10
PLAN 1: THE DEVELOPMENT'S LOCATION 11
PLAN 1: THE DEVELOPMENT'S LOCATION 12
PHOTO A: TOWER A AND MIDRISE A 13
TERRESTRIAL TELEVISION SERVICES 14
SATELLITE TELEVISION SERVICES 14
FIELD SURVEY TEST RESULTS AND INFORMATION 15
POTENTIAL IMPACT ZONE – MAP 1 24
REFERENCE OF TERMS 25

The contents of this document are confidential and for the addressee only, not for duplication nor amendments.
Unless under a controlled document referenced by SCS Technologies Ltd

SCS Technologies Terms & conditions apply (available from www.SCStechnologies.co.uk

EXECUTIVE SUMMARY

The Tower A and midrise A on Dantzic Street, Manchester are now complete. Subsequently this Post Construction TV Reception Survey has been conducted to ascertain whether the introduction of the development has caused an impact to existing viewers' television reception in the surrounding area.

Since the Pre- Construction TV Reception Survey, which was undertaken in June 2019, the Winter Hill television transmitter has undergone certain changes (please refer to the Transmitter Technical Background section of this report). Although these changes have taken place, we are still able to conduct the comparison of the Pre and Post Construction Survey results, as the Winter Hill broadcast powers have remained constant.

There has been a slight reduction in aerial signal to the southeast of the proposed development covering test points 2 and 4. This is as largely as predicted in the initial pre-construction report, however as this area has predominantly car park areas and only a small amount of commercial properties we expect minor impact.

If there are any properties that have been affected by the introduction of the new development, we expect these issues would have already been reported and highlighted during the build.

A comparison of the pre and post construction test results shows that there has not been any wide scale impact to television reception caused by the new development and that the pre-existing signal levels have been generally maintained.

The contents of this document are confidential and for the addressee only, not for duplication nor amendments.
Unless under a controlled document referenced by SCS Technologies Ltd

SCS Technologies Terms & conditions apply (available from www.SCStechnologies.co.uk

INTRODUCTION

Theory predicts, and practical evaluation has confirmed, that the introduction of new structures into an area can cause interference to television reception.

This Post-Construction TV Reception Survey has been undertaken to record the new television reception baseline conditions and assess if the introduction of the development has impacted upon existing viewers' television reception in the surrounding area.

To enable us to make an assessment, an initial desktop study is conducted, followed by a comprehensive field survey.

The desktop study is conducted using plans of the development for example the buildings' location and elevations, along with maps of the surrounding area and details of local television transmitter broadcast information.

The field survey is then conducted at several test point locations surrounding the development. Television signal test results and relevant information are recorded at each of the test point locations.

This report includes the information collated during the desk top study and field survey along with an assessment of where, or if, the introduction of the development has the caused interference to existing viewers' television reception and determine if mitigation is required.

SCOPE

To conduct a desktop study and comprehensive field survey to record existing baseline television reception conditions in the surrounding area to the development. To provide details of any impact zone and methods of mitigation if required, to conform to Local Planning Authority requirements. The results and information recorded during this field survey assist in assessing if, or where, the introduction of the proposed development has the potential to impact upon existing viewers' television reception.

DISCUSSIONS


The introduction of a new building or structure into an area has the potential to cause interference to existing viewers' television reception.

The contents of this document are confidential and for the addressee only, not for duplication nor amendments.
Unless under a controlled document referenced by SCS Technologies Ltd

SCS Technologies Terms & conditions apply (available from www.SCStechnologies.co.uk

SIGNAL BLOCKING

Wireless signals, especially those using relatively high frequencies such as television, behave much like light. Therefore, it is desirable to have a clear line of sight path between the transmitter and a receiving aerial to achieve the most reliable reception. The presence of a tall structure between the transmitter and receiver will cause a 'shadow' to be cast behind the structure on the side opposite the transmitter. This effect is like the way that an obstruction between a lamp and an observer's eye blocks out the light.

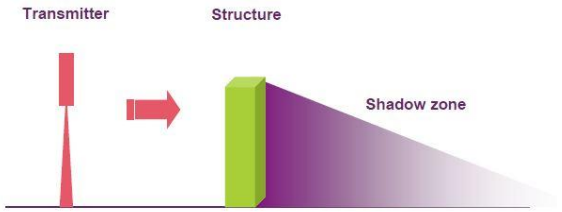


The shadow cast by a structure does not have hard edges though and does not usually extend indefinitely. While there would be a large reduction in signal levels immediately behind the structure, the blocking effect of the structure diminishes with distance because of diffraction. Diffraction is a process where signals appear to bend behind the structure and partially fill in the shadow.

Zone A - close behind the structure (typically a few tens of metres) there may be a large reduction in signal level with a possible complete loss of reception.

Zone B - further away (typically a few hundred metres) the signal reduction is less severe, and the shadow will be smaller as diffraction effects partially fill in the shadow. Depending on the size of the structure, some locations could still lose reception completely.

Zone C - some distance away (1-5km) the shadow will effectively have disappeared.
The resulting shadow is therefore a triangular shape as shown in Figure 2.

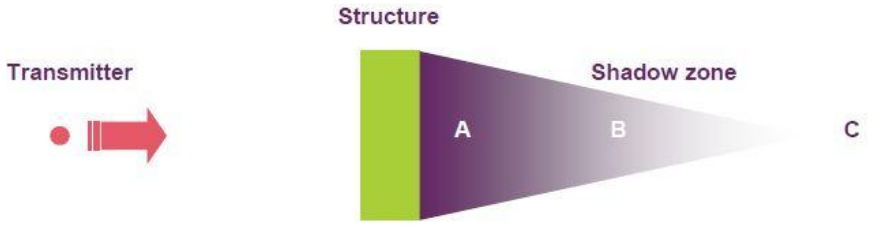

It should be noted that the severity of the reduction and the actual size of the shadow will depend upon many factors including the construction of the structure and its height – the distances given above are for guidance only.

The contents of this document are confidential and for the addressee only, not for duplication nor amendments.
Unless under a controlled document referenced by SCS Technologies Ltd

SCS Technologies Terms & conditions apply (available from www.SCStechnologies.co.uk

FIELD SURVEY METHOD

Tests are conducted at a selection of locations in the area surrounding the proposed development.

Test results are recorded regarding television signal strength and quality: -
Strength is recorded in: dBµv.
Quality is recorded in: VBER (Standard definition SD)
LBER (High-definition HD)

Due to the rollout of the 4G Networks all results are recorded with a CAI approved benchmarked aerial with a balun and LTE filter.

An alternative transmitter is tested for and where receivable, results are recorded.

All tests are conducted at a 10m height above ground level.

The direction and type of existing viewers' television aerials is noted.

A bearing and distance to the proposed development is recorded at each test point location, for comparison with the bearing and distance to the television transmitter serving the area.

Existing obstructions to television reception are noted.

FIELD SURVEY EQUIPMENT

The field survey is conducted using the following equipment: -

- Specialist vehicle complete with telescopic mast
- 360º Antenna rotator
- 14 Element CAI approved wideband UHF antenna with balun and LTE filter, one vertical and one horizontal polarisation.
- 20m x WF100 twin screened CAI approved coaxial cable.
- Televes spectrum analyser/field strength meter
- Ordnance survey maps
- Garmin GPS receiver
- Compass
- Digital camera
- Digital terrestrial television decoder

The contents of this document are confidential and for the addressee only, not for duplication nor amendments.
Unless under a controlled document referenced by SCS Technologies Ltd

SCS Technologies Terms & conditions apply (available from www.SCStechnologies.co.uk

SERVICES LIKELY TO BE AFFECTED

TERRESTRIAL TELEVISION RECEPTION

There are two potential ways that the introduction of a new building can cause interference to terrestrial television reception; these are obstruction and reflection.

Obstruction occurs when existing viewers are in an area where their television aerial beam path (direction) to the television transmitter is either through, or within proximity to, the new building or structure. This can result in a reduction of television signal strength and quality and in some cases (if existing viewers are located within proximity to the new building or structure); receiving terrestrial television signals can become problematic and may not be achievable.

Reflection occurs when the new building reflects terrestrial television signals. These unwanted reflected signals are received on the existing viewer's television aerial along with the direct signals from the television transmitter, resulting in irregularities of television signal strength and quality. However, digital terrestrial television broadcasts are less prone to reflections than the previous analogue television broadcasts, but this must still be taken into account when assessing any potential impact.

SATELLITE TELEVISION RECEPTION

Satellite television reception requires a clear line of sight between the satellite antenna and the satellite it is aligned to. In most cases the angle of the satellite antenna to the satellite orbiting the earth is between 20- and 30-degrees elevation.

This elevation must be taken into account when assessing if the introduction of the new building or structure has the potential to obstruct existing viewers' satellite antenna beam path to the satellite.

Satellite reception is very rarely affected on a large scale and is mostly only relevant to existing viewers within proximity to the new building or structure.

The contents of this document are confidential and for the addressee only, not for duplication nor amendments.
Unless under a controlled document referenced by SCS Technologies Ltd

THE DEVELOPMENT:

VICTORIA RIVERSIDE, Towers A, and midrise A (section 2)
DANTZIC STREET
MANCHESTER

CONDUCTED ON BEHALF OF:

NORTHERN GATEWAY (FEC) NO. 7 LIMITED
Northern Assurance Building, Second Floor
9-21 Princess Street
Manchester
M2 4DN

OVERVIEW OF DEVELOPMENT

The development is a new build at Dantzic Street.

Tower A	- 37 storeys
Midrise section A	- 6 Storeys

.

The contents of this document are confidential and for the addressee only, not for duplication nor amendments.
Unless under a controlled document referenced by SCS Technologies Ltd

COORDINATES

Prior to commencement of the survey, coordinates at the development's location are entered into a GPS receiver, along with the coordinates for the television transmitter serving the area. This enables us to record a bearing and distance from each test point location to the development, for comparison with the bearing and distance to the television transmitter. The coordinates used throughout the survey are listed below and shown on Plan A.

LOCATION	NATIONAL GRID REFERENCE
Winter Hill Transmitter	SD 66000 14400
Towers A and midrise A	SJ 84485 99346

The contents of this document are confidential and for the addressee only, not for duplication nor amendments.
Unless under a controlled document referenced by SCS Technologies Ltd

SCS Technologies Terms & conditions apply (available from www.SCStechnologies.co.uk

TECHNICAL BACKGROUND – WINTER HILL

TRANSMITTER No: 103.00

NGR: SD 6600 14400

APPROXIMATE BEARING FROM THE DEVELOPMENT: 306°

APPROXIMATE DISTANCE FROM THE DEVELOPMENT: 24.0 km

Television Broadcasts from the Winter Hill Transmitter at the time of the Pre Construction Television Reception Survey (June 2019):

UHF Channel	Frequency	Multiplexer	Format	Broadcast Power
31	554.0	COM7	HD	25,700W
37	602.0	COM8	HD	14,000W
49	698.0	ARQA	SD	100,000W
50	706.0	BBCA	SD	100,000W
54	737.8	BBCB	HD	100,000W
55	746.0	ARQB	SD	100,000W
56	754.0	LM	SD	1,000W
58	770.0	SDN	SD	100,000W
59	778.0	D3+4	SD	100,000W

Television Broadcasts from the Winter Hill Transmitter at the present time (January 2026):

UHF Channel	Frequency	Multiplexer	Format	Broadcast Power
37	602.0	ARQB	SD	14,000W
31	554.0	ARQA	SD	100,000W
32	562.0	BBCA	SD	100,000W
35	585.8	BBCB	HD	100,000W
29	538.0	SDN	SD	100,000W
34	578.0	D3+4	SD	100,000W

The contents of this document are confidential and for the addressee only, not for duplication nor amendments.
Unless under a controlled document referenced by SCS Technologies Ltd

SCS Technologies Terms & conditions apply (available from www.SCStechnologies.co.uk

PLAN 1: THE DEVELOPMENT'S LOCATION



The contents of this document are confidential and for the addressee only, not for duplication nor amendments.
Unless under a controlled document referenced by SCS Technologies Ltd

PLAN 1: THE DEVELOPMENT'S LOCATION



The contents of this document are confidential and for the addressee only, not for duplication nor amendments.
Unless under a controlled document referenced by SCS Technologies Ltd

PHOTO A: Tower A and midrise A



The contents of this document are confidential and for the addressee only, not for duplication nor amendments.
Unless under a controlled document referenced by SCS Technologies Ltd

SCS Technologies Terms & conditions apply (available from www.SCStechnologies.co.uk

TERRESTRIAL TELEVISION SERVICES

Viewers in the surrounding area to the development are receiving their terrestrial television services from the Winter Hill transmitter, located to the northwest.

The Winter Hill transmitter broadcasts 6 digital multiplexers providing the full range of standard definition and high-definition digital terrestrial television services available on Freeview, with regional programming for the northwest. Please refer to the transmitter details for further information about the Winter Hill Transmitter.

The test results recorded during the survey show that terrestrial television reception from the Winter Hill transmitter has good signal strengths and at the majority of test points the quality is good. Please note that the results are recorded at a 10m aerial height, in accordance with TV reception survey specifications and that for existing television aerials sited at multi-storey height reception could be much improved.

During the survey, tests were conducted to receive an alternative transmitter to the Winter Hill transmitter. The result of these tests was that no alternative transmitter could be received at an acceptable quality or strength.

SATELLITE TELEVISION SERVICES

Both Sky TV and Freesat are broadcast from the same fleet of satellites located at an orbital position of 28.2º east of south, with a required satellite dish elevation of approximately 23º.

Sky TV is primarily a subscription-based service offering several packages of various television services at monthly subscription costs.

Freesat is a non-subscription-based service and offers a similar television service line up to Freeview and selectable regional programming.

The contents of this document are confidential and for the addressee only, not for duplication nor amendments.
Unless under a controlled document referenced by SCS Technologies Ltd

SCS Technologies Terms & conditions apply (available from www.SCStechnologies.co.uk

FIELD SURVEY TEST RESULTS AND INFORMATION

TEST POINT 1

Location Dantzic Street
NGR: SJ 84502 99403
Alt: 33 m
Mast Height: 10 m

LOCATION	BEARING	DISTANCE
Winter Hill Transmitter	306°	23.8 km
Proposed Development	152°	0.05 m

Visible Existing Aerial Arrays: none

Visible Existing Obstructions: Various multi-storey buildings/Trees in the general direction of the Winter Hill Transmitter

WINTER HILL TRANSMITTER - REPORT

Channel	Frequency	MUX	Format	Level (dBµv)	CN dB	MER	VBER	LBER	Quality
31	554.0	COM8	HD	51	34	23		-4	Pass
37	602.0	ARQB	SD	56	37	23	-8		Pass
49	698.0	ARQA	SD	56	34	21	-8		Pass
50	706.0	BBCA	SD	56	32	28	-8		Pass
54	737.8	BBCB	HD	51	32	22		-5	Pass
55	746.0	COM8	HD	48	31	25		-6	Pass
56	754.0	LM	SD	48	26	25	-7		Pass
58	770.0	SDN	SD	51	32	21	-8		Pass
59	778.0	D3+4	SD	48	32	21	-8		Pass

Post Construction signal levels.

Channel	Frequency	MUX	Format	Level (dBµv)	CN dB	MER	VBER	LBER	Quality
37	602.0	ARQB	SD	58	36	25	-8		Pass
31	554.0	ARQA	SD	56	32	30	-8		Pass
32	562.0	BBCA	SD	60	34	32	-8		Pass
35	585.0	BBCB	HD	61	36	32		-8	Pass
29	538.0	SDN	SD	55	32	26	-8		Pass
34	578.0	D3+4	SD	50	30	30	-8		Pass

Television reception is of an acceptable quality and strength.

The contents of this document are confidential and for the addressee only, not for duplication nor amendments.
Unless under a controlled document referenced by SCS Technologies Ltd

SCS Technologies Terms & conditions apply (available from www.SCStechnologies.co.uk

TEST POINT 2

Location Bilbrook Street
NGR: SJ 84757 99278
Alt: 46 m
Mast Height: 10 m

LOCATION	BEARING	DISTANCE
Winter Hill Transmitter	306°	24 km
Proposed Development	308°	200m

Visible Existing Aerial Arrays: none

Visible Existing Obstructions: Various multi-storey buildings/Trees in the general direction of the Winter Hill Transmitter

WINTER HILL TRANSMITTER - REPORT

Channel	Frequency	MUX	Format	Level (dBµv)	CN dB	MER	VBER	LBER	Quality
31	554.0	COM8	HD	66	36	34		-6	Pass
37	602.0	ARQB	SD	65	39	30	-8		Pass
49	698.0	ARQA	SD	72	32	32	-8		Pass
50	706.0	BBCA	SD	71	38	33	-8		Pass
54	737.8	BBCB	HD	72	32	30		-4	Pass
55	746.0	COM8	HD	72	31	32		-4	Pass
56	754.0	LM	SD	51	12	20	-3		Pass
58	770.0	SDN	SD	71	32	32	-8		Pass
59	778.0	D3+4	SD	70	33	33	-8		Pass

Post Construction signal levels.

Channel	Frequency	MUX	Format	Level (dBµv)	CN dB	MER	VBER	LBER	Quality
37	602.0	ARQB	SD	62	32	32	-8		Pass
31	554.0	ARQA	SD	65	36	33	-8		Pass
32	562.0	BBCA	SD	68	40	38	-8		Pass
35	585.0	BBCB	HD	65	38	32		-8	Pass
29	538.0	SDN	SD	68	32	30	-8		Pass
34	578.0	D3+4	SD	67	32	32	-8		Pass

Television reception is of a good quality and strength.

The contents of this document are confidential and for the addressee only, not for duplication nor amendments.
Unless under a controlled document referenced by SCS Technologies Ltd

SCS Technologies Terms & conditions apply (available from www.SCStechnologies.co.uk

TEST POINT 3

Location Peary Street
NGR: SJ 84843 99274
Alt: 52 m
Mast Height: 10 m

LOCATION	BEARING	DISTANCE
Winter Hill Transmitter	306°	24.1 km
Proposed Development	306°	270 m

Visible Existing Aerial Arrays: none

Visible Existing Obstructions: Various multi-storey buildings/Trees in the general direction of the Winter Hill Transmitter

WINTER HILL TRANSMITTER - REPORT

Channel	Frequency	MUX	Format	Level (dBµv)	CN dB	MER	VBER	LBER	Quality
31	554.0	COM8	HD	69	36	33		-6	Pass
37	602.0	ARQB	SD	69	38	31	-8		Pass
49	698.0	ARQA	SD	78	34	33	-8		Pass
50	706.0	BBCA	SD	78	40	33	-8		Pass
54	737.8	BBCB	HD	77	35	29		-4	Pass
55	746.0	COM8	HD	77	34	32		-4	Pass
56	754.0	LM	SD	57	13	21	-5		Pass
58	770.0	SDN	SD	75	35	33	-8		Pass
59	778.0	D3+4	SD	74	34	33	-8		Pass

Post Construction signal levels.

Channel	Frequency	MUX	Format	Level (dBµv)	CN dB	MER	VBER	LBER	Quality
37	602.0	ARQB	SD	72	40	36	-8		Pass
31	554.0	ARQA	SD	77	40	32	-8		Pass
32	562.0	BBCA	SD	79	42	38	-8		Pass
35	585.0	BBCB	HD	78	38	36		-8	Pass
29	538.0	SDN	SD	76	35	32	-8		Pass
34	578.0	D3+4	SD	75	40	30	-8		Pass

Television reception is of a good quality and strength.

The contents of this document are confidential and for the addressee only, not for duplication nor amendments.
Unless under a controlled document referenced by SCS Technologies Ltd

SCS Technologies Terms & conditions apply (available from www.SCStechnologies.co.uk

TEST POINT 4

Location Sudell Street
NGR: SJ 84876 99148
Alt: 52 m
Mast Height: 10 m

LOCATION	BEARING	DISTANCE
Winter Hill Transmitter	306°	24.2 km
Proposed Development	320°	320 m

Visible Existing Aerial Arrays: none

Visible Existing Obstructions: Various multi-storey buildings/Trees/Land in the general direction of the Winter Hill Transmitter

WINTER HILL TRANSMITTER - REPORT

Channel	Frequency	MUX	Format	Level (dBµv)	CN dB	MER	VBER	LBER	Quality
31	554.0	COM8	HD	68	37	32		-6	Pass
37	602.0	ARQB	SD	67	39	32	-8		Pass
49	698.0	ARQA	SD	70	29	31	-8		Pass
50	706.0	BBCA	SD	72	38	28	-8		Pass
54	737.8	BBCB	HD	73	33	28		-4	Pass
55	746.0	COM8	HD	73	31	31		-4	Pass
56	754.0	LM	SD	57	17	22	-5		Pass
58	770.0	SDN	SD	70	33	25	-8		Pass
59	778.0	D3+4	SD	68	18	22	-8		Pass

Post Construction signal levels.

Channel	Frequency	MUX	Format	Level (dBµv)	CN dB	MER	VBER	LBER	Quality
37	602.0	ARQB	SD	70	42	32	-8		Pass
31	554.0	ARQA	SD	78	42	33	-8		Pass
32	562.0	BBCA	SD	74	42	37	-8		Pass
35	585.0	BBCB	HD	76	35	33		-8	Pass
29	538.0	SDN	SD	80	33	30	-8		Pass
34	578.0	D3+4	SD	78	42	32	-8		Pass

Television reception is of a good quality and strength.

The contents of this document are confidential and for the addressee only, not for duplication nor amendments.
Unless under a controlled document referenced by SCS Technologies Ltd

SCS Technologies Terms & conditions apply (available from www.SCStechnologies.co.uk

TEST POINT 5

Location Shilford Drive
NGR: SJ 85013 99232
Alt: 53 m
Mast Height: 10 m

LOCATION	BEARING	DISTANCE
Winter Hill Transmitter	306°	24.2 km
Proposed Development	295°	400 m

Visible Existing Aerial Arrays: 10 element aerials on 1 and 2m masts, mounted at rooftop height on 2 storey properties, directed towards the Winter Hill Transmitter

Visible Existing Obstructions: Various multi-storey buildings/Trees in the general direction of the Winter Hill Transmitter

WINTER HILL TRANSMITTER - REPORT

Channel	Frequency	MUX	Format	Level (dBµv)	CN dB	MER	VBER	LBER	Quality
31	554.0	COM8	HD	69	37	31		-6	Pass
37	602.0	ARQB	SD	67	39	29	-8		Pass
49	698.0	ARQA	SD	76	34	30	-8		Pass
50	706.0	BBCA	SD	78	40	33	-8		Pass
54	737.8	BBCB	HD	79	34	30		-4	Pass
55	746.0	COM8	HD	78	33	32		-4	Pass
56	754.0	LM	SD	61	17	22	-5		Pass
58	770.0	SDN	SD	76	34	33	-8		Pass
59	778.0	D3+4	SD	75	34	33	-8		Pass

Post Construction signal levels.

Channel	Frequency	MUX	Format	Level (dBµv)	CN dB	MER	VBER	LBER	Quality
37	602.0	ARQB	SD	72	42	32	-8		Pass
31	554.0	ARQA	SD	78	42	33	-8		Pass
32	562.0	BBCA	SD	79	40	36	-8		Pass
35	585.0	BBCB	HD	75	34	32		-8	Pass
29	538.0	SDN	SD	78	34	32	-8		Pass
34	578.0	D3+4	SD	76	40	32	-8		Pass

Television reception is of a good quality and strength.

The contents of this document are confidential and for the addressee only, not for duplication nor amendments.
Unless under a controlled document referenced by SCS Technologies Ltd

SCS Technologies Terms & conditions apply (available from www.SCStechnologies.co.uk

TEST POINT 6
Location Oldham Road
NGR: SJ 85139 99046
Alt: 52 m
Mast Height: 10 m

LOCATION	BEARING	DISTANCE
Winter Hill Transmitter	307°	24.5 km
Proposed Development	310°	0.6 km

Visible Existing Aerial Arrays: High gain aerials on 1m masts, mounted at rooftop height on 2 storey properties, directed towards the Winter Hill Transmitter

Visible Existing Obstructions: Various multi-storey buildings/Trees/Land in the general direction of the Winter Hill Transmitter

WINTER HILL TRANSMITTER - REPORT

Channel	Frequency	MUX	Format	Level (dBµv)	CN dB	MER	VBER	LBER	Quality
31	554.0	COM8	HD	70	38	33		-6	Pass
37	602.0	ARQB	SD	69	39	30	-8		Pass
49	698.0	ARQA	SD	70	29	31	-8		Pass
50	706.0	BBCA	SD	71	38	28	-8		Pass
54	737.8	BBCB	HD	75	35	26		-4	Pass
55	746.0	COM8	HD	73	31	31		-4	Pass
56	754.0	LM	SD	55	17	22	-6		Pass
58	770.0	SDN	SD	72	33	25	-8		Pass
59	778.0	D3+4	SD	69	22	22	-8		Pass

Post Construction signal levels.

Channel	Frequency	MUX	Format	Level (dBµv)	CN dB	MER	VBER	LBER	Quality
37	602.0	ARQB	SD	65	38	36	-8		Pass
31	554.0	ARQA	SD	66	44	36	-8		Pass
32	562.0	BBCA	SD	68	32	32	-8		Pass
35	585.0	BBCB	HD	70	35	32		-8	Pass
29	538.0	SDN	SD	70	31	30	-8		Pass
34	578.0	D3+4	SD	66	40	32	-8		Pass

Television reception is of a good quality and strength.

The contents of this document are confidential and for the addressee only, not for duplication nor amendments.
Unless under a controlled document referenced by SCS Technologies Ltd

SCS Technologies Terms & conditions apply (available from www.SCStechnologies.co.uk

TEST POINT 7

Location Clive Street
NGR: SJ 84739 99160
Alt: 54 m
Mast Height: 10 m

LOCATION	BEARING	DISTANCE
Winter Hill Transmitter	309°	24.3 km
Proposed Development	311°	0.3 m

Visible Existing Aerial Arrays: 10 elements on small mast, mounted at rooftop height on 2 storey properties, directed towards the Winter Hill Transmitter

Visible Existing Obstructions: Various multi-storey buildings/Trees/Land in the general direction of the Winter Hill Transmitter

WINTER HILL TRANSMITTER - REPORT

Channel	Frequency	MUX	Format	Level (dBµv)	CN dB	MER	VBER	LBER	Quality
31	554.0	COM8	HD	57	37	32		-6	Pass
37	602.0	ARQB	SD	59	34	32	-8		Pass
49	698.0	ARQA	SD	65	32	31	-8		Pass
50	706.0	BBCA	SD	65	36	32	-8		Pass
54	737.8	BBCB	HD	66	31	28		-4	Pass
55	746.0	COM8	HD	66	31	32		-4	Pass
56	754.0	LM	SD	51	17	22	-7		Pass
58	770.0	SDN	SD	64	33	32	-8		Pass
59	778.0	D3+4	SD	62	32	31	-8		Pass

Post Construction signal levels.

Channel	Frequency	MUX	Format	Level (dBµv)	CN dB	MER	VBER	LBER	Quality
37	602.0	ARQB	SD	69	38	30	-8		Pass
31	554.0	ARQA	SD	65	34	30	-8		Pass
32	562.0	BBCA	SD	66	36	32	-8		Pass
35	585.0	BBCB	HD	69	36	32		-8	Pass
29	538.0	SDN	SD	68	40	34	-8		Pass
34	578.0	D3+4	SD	69	42	32	-8		Pass

Television reception is of a good quality and strength.

The contents of this document are confidential and for the addressee only, not for duplication nor amendments.
Unless under a controlled document referenced by SCS Technologies Ltd

SCS Technologies Terms & conditions apply (available from www.SCStechnologies.co.uk

TEST POINT 8

Location Clarion Street
NGR: SJ 85093 99095
Alt: 52 m
Mast Height: 10 m

LOCATION	BEARING	DISTANCE
Winter Hill Transmitter	306°	24.5 km
Proposed Development	300°	560 m

Visible Existing Aerial Arrays: 10 element aerials on 1m 1 mast, mounted at rooftop height on 2 storey commercial building, directed towards the Winter Hill Transmitter

Visible Existing Obstructions: Various multi-storey buildings/Trees/Land in the general direction of the Winter Hill Transmitter

WINTER HILL TRANSMITTER - REPORT

Channel	Frequency	MUX	Format	Level (dBµv)	CN dB	MER	VBER	LBER	Quality
31	554.0	COM8	HD	70	36	30		-6	Pass
37	602.0	ARQB	SD	69	39	29	-8		Pass
49	698.0	ARQA	SD	76	34	30	-8		Pass
50	706.0	BBCA	SD	78	40	33	-8		Pass
54	737.8	BBCB	HD	79	34	30		-4	Pass
55	746.0	COM8	HD	78	33	32		-4	Pass
56	754.0	LM	SD	62	18	22	-7		Pass
58	770.0	SDN	SD	72	34	33	-8		Pass
59	778.0	D3+4	SD	71	34	303	-8		Pass

Post Construction signal levels.

Channel	Frequency	MUX	Format	Level (dBµv)	CN dB	MER	VBER	LBER	Quality
37	602.0	ARQB	SD	70	34	32	-8		Pass
31	554.0	ARQA	SD	75	40	36	-8		Pass
32	562.0	BBCA	SD	76	40	36	-8		Pass
35	585.0	BBCB	HD	76	34	34		-8	Pass
29	538.0	SDN	SD	72	34	32	-8		Pass
34	578.0	D3+4	SD	70	34	30	-8		Pass

Television reception is of a good quality and strength.

The contents of this document are confidential and for the addressee only, not for duplication nor amendments.
Unless under a controlled document referenced by SCS Technologies Ltd

SCS Technologies Terms & conditions apply (available from www.SCStechnologies.co.uk

TEST POINT 9

Location Mozart Close
NGR: SJ 85352 98847
Alt: 51 m
Mast Height: 10 m

LOCATION	BEARING	DISTANCE
Winter Hill Transmitter	306°	24.7 km
Proposed Development	308°	890 m

Visible Existing Aerial Arrays: 10 element aerials on 1m and 2m masts, mounted at rooftop height on 2 storey properties, directed towards the Winter Hill Transmitter

Visible Existing Obstructions: Various multi-storey buildings/Trees/Land in the general direction of the Winter Hill Transmitter

WINTER HILL TRANSMITTER - REPORT

Channel	Frequency	MUX	Format	Level (dBµv)	CN dB	MER	VBER	LBER	Quality
31	554.0	COM8	HD	62	36	30		-6	Pass
37	602.0	ARQB	SD	59	38	29	-8		Pass
49	698.0	ARQA	SD	61	29	29	-8		Pass
50	706.0	BBCA	SD	57	31	28	-8		Pass
54	737.8	BBCB	HD	56	31	22		-4	Pass
55	746.0	COM8	HD	56	25	20		-4	Pass
56	754.0	LM	SD	38	13	19	-5		Marginal
58	770.0	SDN	SD	55	33	22	-8		Pass
59	778.0	D3+4	SD	55	29	28	-8		Pass

Post Construction signal levels.


Channel	Frequency	MUX	Format	Level (dBµv)	CN dB	MER	VBER	LBER	Quality
37	602.0	ARQB	SD	60	32	32	-8		Pass
31	554.0	ARQA	SD	62	32	32	-8		Pass
32	562.0	BBCA	SD	60	32	32	-8		Pass
35	585.0	BBCB	HD	58	32	32		-8	Pass
29	538.0	SDN	SD	60	32	30	-8		Pass
34	578.0	D3+4	SD	59	30	28	-8		Pass

Television reception is of a good quality and strength.

The contents of this document are confidential and for the addressee only, not for duplication nor amendments.
Unless under a controlled document referenced by SCS Technologies Ltd

SCS Technologies Terms & conditions apply (available from www.SCStechnologies.co.uk

POTENTIAL IMPACT ZONE – MAP 1

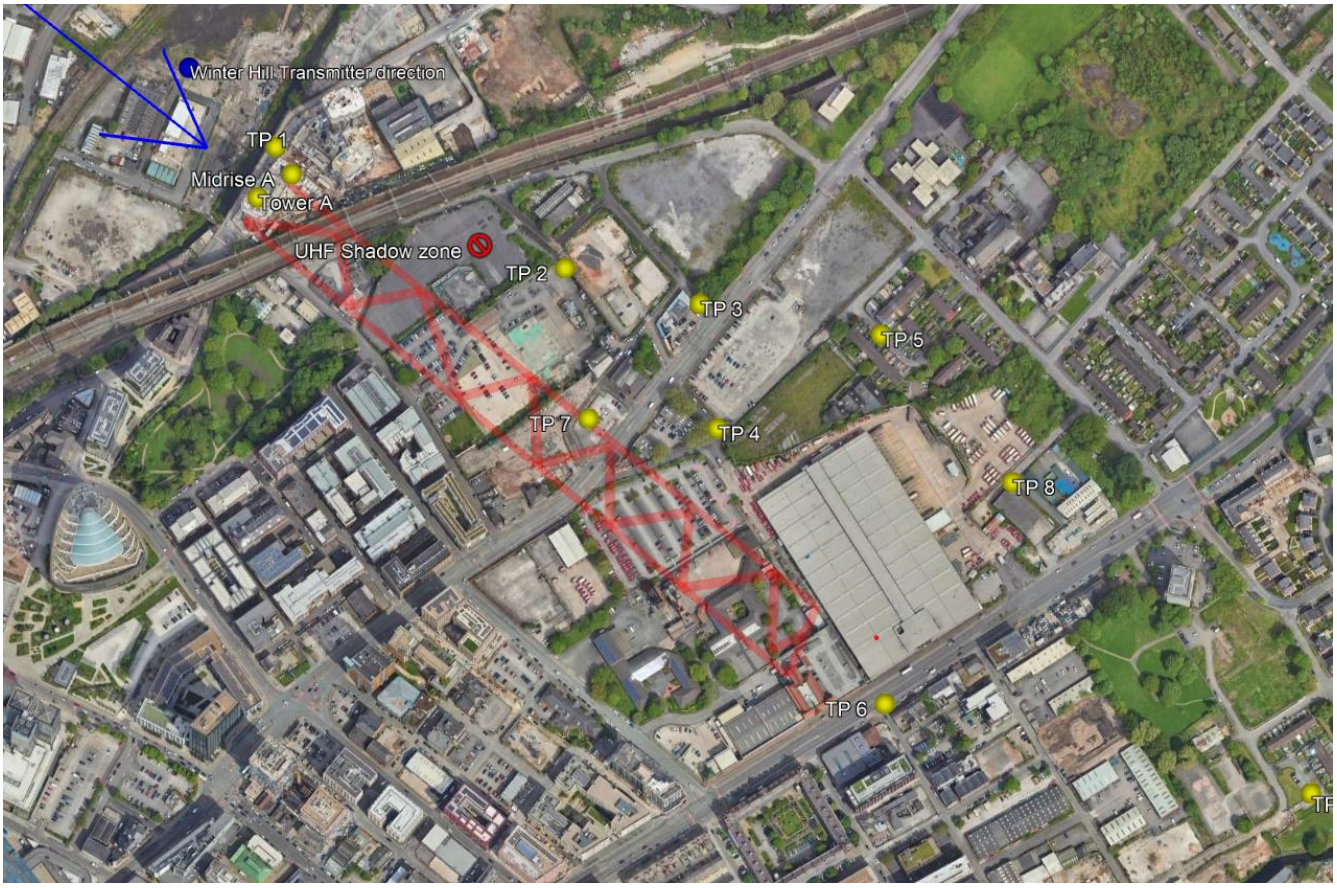

The contents of this document are confidential and for the addressee only, not for duplication nor amendments.
Unless under a controlled document referenced by SCS Technologies Ltd

SCS Technologies Terms & conditions apply (available from www.SCStechnologies.co.uk

REFERENCE OF TERMS

c.	Circa
CH	The UHF Channel allocation from the transmitter.
MUX	The digital multiplexer allocation/operator.
TX	Transmitter.
dBµv	Carrier strength reading (decibel microvolt).
C/N	Carrier /Noise Ratio
VBER	Measurement for digital signal after error correction (BER after VITERBi)
LBER	BER after been applied the LDPC (low density parity check) error correction.
SD	SD Standard Definition
HD	HD High Definition
NGR	National Grid Reference
ALT	Altitude above sea level at the location.
BRG	Bearing from North.
GPS	Global Positioning System.

The contents of this document are confidential and for the addressee only, not for duplication nor amendments.
Unless under a controlled document referenced by SCS Technologies Ltd