

|                                                                                   |                            |                                  |                                    |                                                   |  |
|-----------------------------------------------------------------------------------|----------------------------|----------------------------------|------------------------------------|---------------------------------------------------|--|
|  |                            | <h1>Inspection Report</h1>       |                                    | 40 Francis Road<br>Irlam<br>Manchester<br>M44 6AY |  |
| Section:<br><b>MH 01 LEG1</b>                                                     | Date:<br><b>2021-11-25</b> | Job Number:<br><b>32 M21 9LA</b> | Weather:<br><b>No rain or snow</b> | PLR:                                              |  |
| Operator:<br><b>A JONES</b>                                                       |                            |                                  | Cleaned:                           |                                                   |  |


|                                                        |                                                                                  |                                                           |                                                                   |                                                      |                        |
|--------------------------------------------------------|----------------------------------------------------------------------------------|-----------------------------------------------------------|-------------------------------------------------------------------|------------------------------------------------------|------------------------|
| Place:<br>Road:<br>Location:                           | <b>HAPMTON ROAD<br/>Gardens</b>                                                  | Direction:<br>Catchment:<br>Total Length:<br>Pipe Length: | <b>Upstream</b>                                                   | Start ref:<br>Start depth:<br>End ref:<br>End depth: | <b>MH 01<br/>GULLY</b> |
| Use:<br>Year Laid:<br>Purpose:<br>Lining:<br>Comments: | <b>Combined<br/>Sample survey to determine asset condition of a sewer system</b> |                                                           | Pipe Shape:<br>Width / Height:<br>Flow Control:<br>Pipe Material: | <b>circular<br/>? / 100mm<br/>vitrified clay</b>     |                        |

0.00m (MH 01)


|                                                                                    | Meterage | CD | Code | Observation                                                 | Video    | Pic. |
|------------------------------------------------------------------------------------|----------|----|------|-------------------------------------------------------------|----------|------|
|  | 0.00m    |    | IC   | Start node type, inspection chamber reference number: MH 01 | 00:00:00 | (1)  |
|                                                                                    | 2.69m    |    | RFJ  | Roots, fine at joint                                        | 00:00:13 | (2)  |
|                                                                                    | 2.69m    |    | FSJ  | Fracture, spiral at joint from 10 O'Clock to 6 O'Clock      | 00:00:15 | (3)  |
|                                                                                    | 2.69m    |    | JDM  | Joint displaced, medium                                     | 00:00:19 | (4)  |
|                                                                                    | 3.63m    |    | RMJ  | Roots, mass at joint 20%                                    | 00:00:31 | (5)  |
|                                                                                    | 4.78m    |    | JDL  | Joint displaced, large                                      | 00:00:38 | (6)  |
|                                                                                    | 5.53m    |    | GP   | General photograph taken at this point WASTE PIPE INRUDING  | 00:00:46 | (7)  |
|                                                                                    | 5.53m    |    | SA   | Survey abandoned UNABLE TO PUSH                             | 00:00:50 | (8)  |

5.53m (GULLY)

|                                                                                   |                            |                                  |                                    |                                                   |  |
|-----------------------------------------------------------------------------------|----------------------------|----------------------------------|------------------------------------|---------------------------------------------------|--|
|  |                            | <h1>Inspection Report</h1>       |                                    | 40 Francis Road<br>Irlam<br>Manchester<br>M44 6AY |  |
| Section:<br><b>MH 01 LEG1</b>                                                     | Date:<br><b>2021-11-25</b> | Job Number:<br><b>32 M21 9LA</b> | Weather:<br><b>No rain or snow</b> | PLR:                                              |  |
| Operator:<br><b>A JONES</b>                                                       |                            |                                  | Cleaned:                           |                                                   |  |

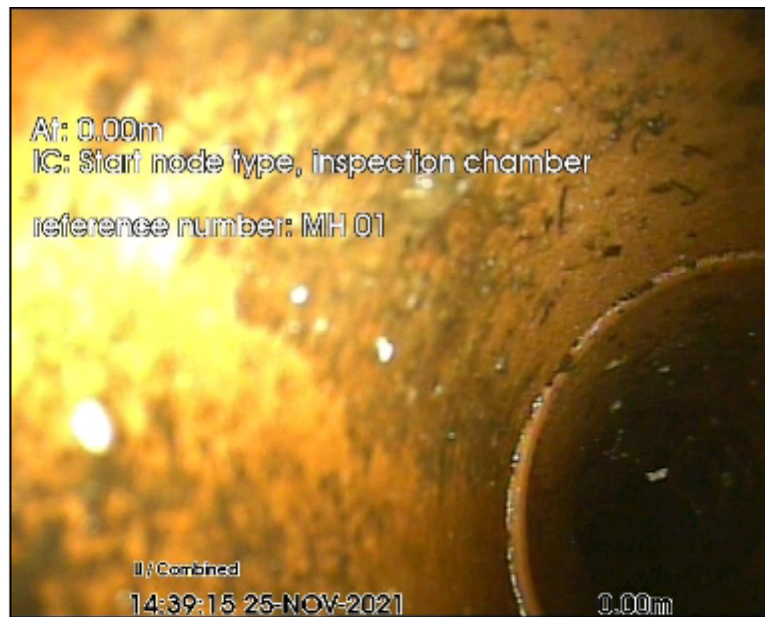

(1)

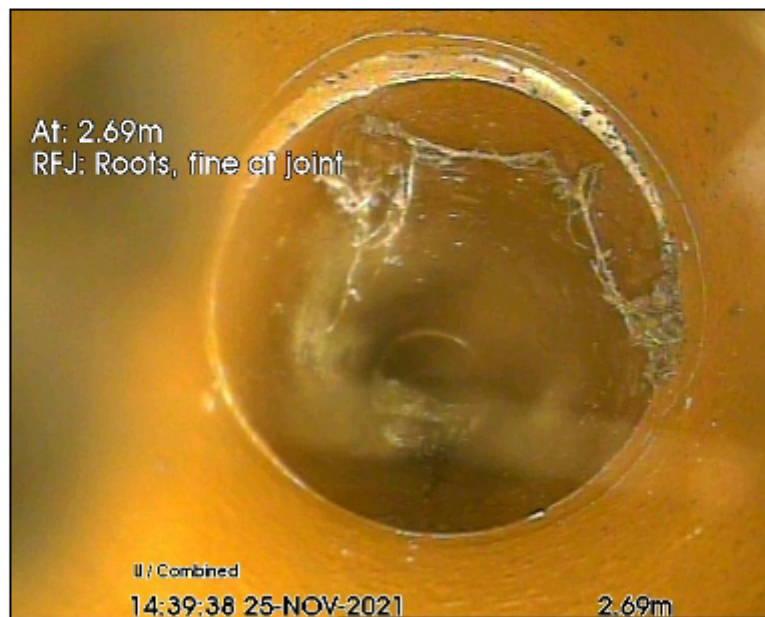

(2)

|                                                                                   |                            |                                  |                                    |                                                   |  |
|-----------------------------------------------------------------------------------|----------------------------|----------------------------------|------------------------------------|---------------------------------------------------|--|
|  |                            | <h1>Inspection Report</h1>       |                                    | 40 Francis Road<br>Irlam<br>Manchester<br>M44 6AY |  |
| Section:<br><b>MH 01 LEG1</b>                                                     | Date:<br><b>2021-11-25</b> | Job Number:<br><b>32 M21 9LA</b> | Weather:<br><b>No rain or snow</b> | PLR:                                              |  |
| Operator:<br><b>A JONES</b>                                                       |                            |                                  | Cleaned:                           |                                                   |  |



(3)



(4)

|                                                                                   |                            |                                  |                                    |                                                   |  |
|-----------------------------------------------------------------------------------|----------------------------|----------------------------------|------------------------------------|---------------------------------------------------|--|
|  |                            | <h1>Inspection Report</h1>       |                                    | 40 Francis Road<br>Irlam<br>Manchester<br>M44 6AY |  |
| Section:<br><b>MH 01 LEG1</b>                                                     | Date:<br><b>2021-11-25</b> | Job Number:<br><b>32 M21 9LA</b> | Weather:<br><b>No rain or snow</b> | PLR:                                              |  |
| Operator:<br><b>A JONES</b>                                                       |                            |                                  | Cleaned:                           |                                                   |  |



(5)



(6)

|                                                                                   |                            |                                  |                                    |                                                   |  |
|-----------------------------------------------------------------------------------|----------------------------|----------------------------------|------------------------------------|---------------------------------------------------|--|
|  |                            | <h1>Inspection Report</h1>       |                                    | 40 Francis Road<br>Irlam<br>Manchester<br>M44 6AY |  |
| Section:<br><b>MH 01 LEG1</b>                                                     | Date:<br><b>2021-11-25</b> | Job Number:<br><b>32 M21 9LA</b> | Weather:<br><b>No rain or snow</b> | PLR:                                              |  |
| Operator:<br><b>A JONES</b>                                                       |                            |                                  | Cleaned:                           |                                                   |  |



(7)



(8)